side (+x) (axes in mm from the view origin)

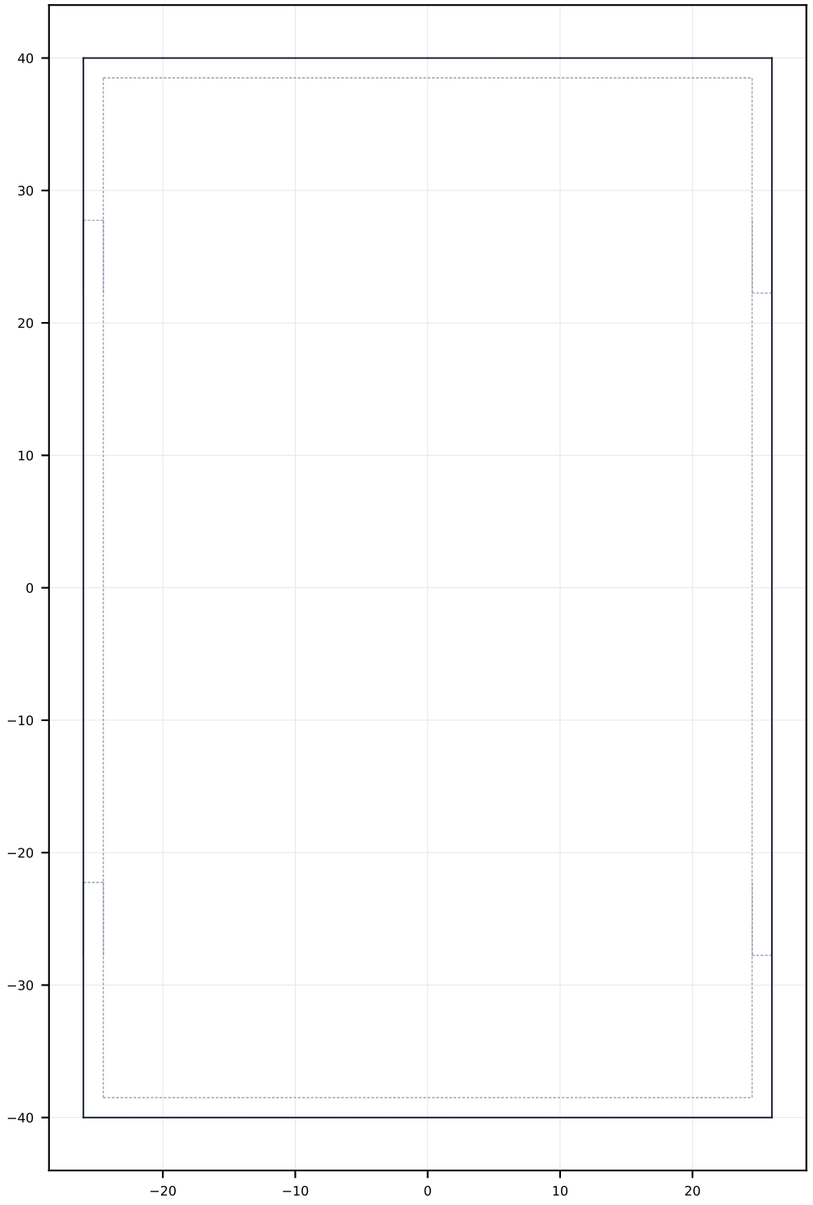

front (-y) (axes in mm from the view origin)

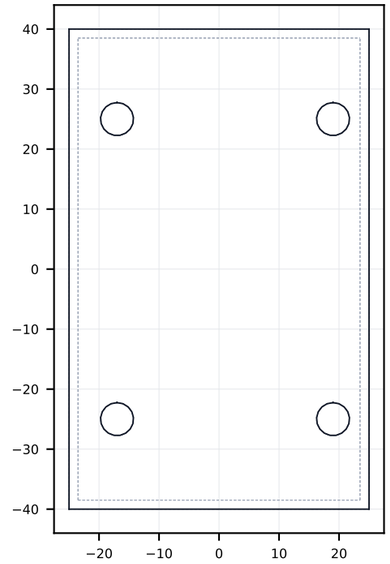

top (+z) (axes in mm from the view origin)

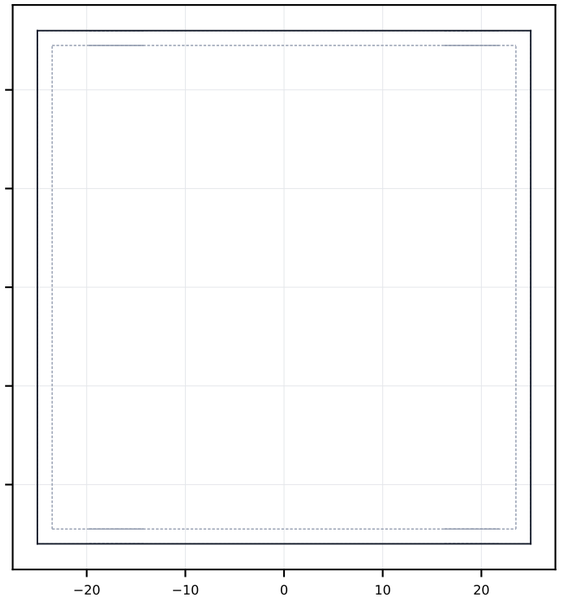

iso

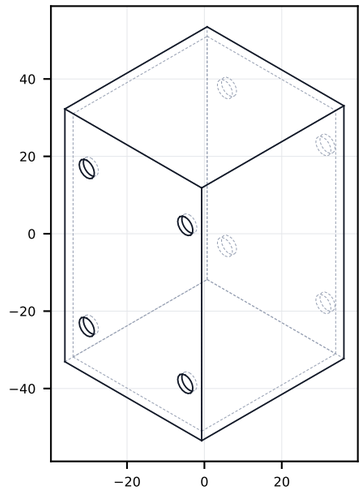

DRAWING power_box
qty per robot: 1
material: 5052-H32 1.5 mm
process: laser cut + bent, PEM nuts
finish:
mass: 82.0 g overall: 50.0 x 52.0 x 80.0 mm (x, y, z)
note: 12S BMS (<= 74 x 44 x 15, on edge), 40 A MIDI fuse, XT90-S anti-spark, CAN hub, e-stop relay
general tolerances ISO 2768-mK, edges broken 0.3 x 45, units mm
geometry master: parts/power_box.step
view origin = bounding-box centre = robot (-20.00, 0.00, -165.00)

HOLE TABLE (view coords of the screw seat, mm)

feature	x	y	z	axis
d5.5 for M4 PEM nut	-17.00	-35.00	-25.00	+y
d5.5 for M4 PEM nut	-17.00	-35.00	25.00	+y
d5.5 for M4 PEM nut	-17.00	35.00	-25.00	-y
d5.5 for M4 PEM nut	-17.00	35.00	25.00	-y
d5.5 for M4 PEM nut	19.00	-35.00	-25.00	+y
d5.5 for M4 PEM nut	19.00	-35.00	25.00	+y
d5.5 for M4 PEM nut	19.00	35.00	-25.00	-y
d5.5 for M4 PEM nut	19.00	35.00	25.00	-y