RISC-V External Debug Support Version 0.13 f7f3277d78d5b72dbba7d718d40892c469ca22ba

Tim Newsome <tim@sifive.com>

Tue Nov 28 07:54:42 2017 -0800

Preface

Warning! This draft specification will change before being accepted as standard, so implementations made to this draft specification will likely not conform to the future standard.

Acknowledgments

I would like to thank the following people for their time, feedback, and ideas: Bruce Ableidinger, Krste Asanovic, Mark Beal, Alex Bradbury, Zhong-Ho Chen, Monte Dalrymple, Vyacheslav Dyanchenco, Peter Egold, Richard Herveille, Po-wei Huang, Scott Johnson, Aram Nahidipour, Rishiyur Nikhil, Gajinder Panesar, Klaus Kruse Pedersen, Antony Pavlov, Ken Pettit, Wesley Terpstra, Megan Wachs, Stefan Wallentowitz, Ray Van De Walker, Andrew Waterman, and Andy Wright.

Contents

| P | refac | ee | i |
|---|-------|---|----|
| 1 | Intr | roduction | 1 |
| | 1.1 | Terminology | 1 |
| | | 1.1.1 Context | 1 |
| | 1.2 | About This Document | 2 |
| | | 1.2.1 Structure | 2 |
| | | 1.2.2 Register Definition Format | 2 |
| | | 1.2.2.1 Long Name (shortname, at 0x123) | 2 |
| | 1.3 | Background | 3 |
| | 1.4 | Supported Features | 3 |
| 2 | Sys | tem Overview | 5 |
| 3 | Deb | bug Module (DM) | 7 |
| | 3.1 | Debug Module Interface (DMI) | 7 |
| | 3.2 | Reset Control | 8 |
| | 3.3 | Selecting Harts | 8 |
| | | 3.3.1 Selecting a Single Hart | 9 |
| | | 3.3.2 Selecting Multiple Harts | 9 |
| | 3.4 | Run Control | 9 |
| | 3.5 | Abstract Commands | 10 |

| | 3.5.1 | Abstract Command Listing | 1(|
|------|---------|--|----|
| | | 3.5.1.1 Access Register | 10 |
| | | 3.5.1.2 Quick Access | 12 |
| 3.6 | Progra | am Buffer | 12 |
| 3.7 | Overvi | iew of States | 13 |
| 3.8 | System | Bus Access | 13 |
| 3.9 | Quick | Access | 15 |
| 3.10 | Securit | ty | 15 |
| 3.11 | Debug | Module DMI Registers | 15 |
| | 3.11.1 | Debug Module Status (dmstatus, at 0x11) | 15 |
| | 3.11.2 | Debug Module Control (dmcontrol, at 0x10) | 19 |
| | 3.11.3 | Hart Info (hartinfo, at 0x12) | 21 |
| | 3.11.4 | Halt Summary (haltsum, at 0x13) | 22 |
| | 3.11.5 | Hart Array Window Select (hawindowsel, at 0x14) | 22 |
| | 3.11.6 | Hart Array Window (hawindow, at 0x15) | 23 |
| | 3.11.7 | Abstract Control and Status (abstractcs, at 0x16) | 23 |
| | 3.11.8 | Abstract Command (command, at 0x17) | 24 |
| | 3.11.9 | Abstract Command Autoexec (abstractauto, at 0x18) | 26 |
| | 3.11.10 | Device Tree Addr 0 (devtreeaddr0, at 0x19) | 26 |
| | 3.11.11 | Abstract Data 0 (data0, at 0x04) | 27 |
| | 3.11.12 | 2 Program Buffer 0 (progbuf0, at 0x20) | 27 |
| | 3.11.13 | 3 Authentication Data (authdata, at 0x30) | 27 |
| | 3.11.14 | 4 System Bus Access Control and Status (sbcs, at 0x38) | 27 |
| | 3.11.15 | System Bus Address 31:0 (sbaddress0, at 0x39) | 29 |
| | 3.11.16 | System Bus Address 63:32 (sbaddress1, at 0x3a) | 29 |
| | 3.11.17 | 7 System Bus Address 95:64 (sbaddress2, at 0x3b) | 29 |
| | 3.11.18 | 8 System Bus Data 31:0 (sbdata0, at 0x3c) | 30 |
| | 3.11.19 | 9 System Bus Data 63:32 (sbdata1, at 0x3d) | 31 |

| RISC- V | External | Debug | Support | Version | 0.13 |
|-----------|----------|-------|---------|---------|------|
|-----------|----------|-------|---------|---------|------|

| RI | SC-V | External Debug Support Version 0.13 | V |
|----|------|--|----|
| | | 3.11.20 System Bus Data 95:64 (sbdata2, at 0x3e) | 31 |
| | | 3.11.21 System Bus Data 127:96 (sbdata3, at 0x3f) | 31 |
| 4 | RIS | SC-V Debug | 33 |
| | 4.1 | Debug Mode | 33 |
| | 4.2 | Load-Reserved/Store-Conditional Instructions | 34 |
| | 4.3 | Single Step | 34 |
| | 4.4 | Reset | 34 |
| | | 4.4.1 dret Instruction | 34 |
| | 4.5 | Core Debug Registers | 35 |
| | | 4.5.1 Debug Control and Status (dcsr, at 0x7b0) | 35 |
| | | 4.5.2 Debug PC (dpc, at 0x7b1) | 37 |
| | | 4.5.3 Debug Scratch Register 0 (dscratch0, at 0x7b2) | 38 |
| | | 4.5.4 Debug Scratch Register 1 (dscratch1, at 0x7b3) | 38 |
| | 4.6 | Virtual Debug Registers | 38 |
| | | 4.6.1 Privilege Level (priv, at virtual) | 38 |
| 5 | Trig | gger Module | 41 |
| | 5.1 | Trigger Registers | 41 |
| | | 5.1.1 Trigger Select (tselect, at 0x7a0) | 42 |
| | | 5.1.2 Trigger Data 1 (tdata1, at 0x7a1) | 42 |
| | | 5.1.3 Trigger Data 2 (tdata2, at 0x7a2) | 43 |
| | | 5.1.4 Trigger Data 3 (tdata3, at 0x7a3) | 43 |
| | | 5.1.5 Match Control (mcontrol, at 0x7a1) | 43 |
| | | 5.1.6 Instruction Count (icount, at 0x7a1) | 47 |
| 6 | Deb | oug Transport Module (DTM) | 49 |
| | 6.1 | JTAG Debug Transport Module | 49 |

| | | 6.1.2 JTAG DTM Registers | 50 |
|---|------|--|----|
| | | 6.1.3 IDCODE (at 0x01) | 50 |
| | | 6.1.4 DTM Control and Status (dtmcs, at 0x10) | 51 |
| | | 6.1.5 Debug Module Interface Access (dmi, at 0x11) | 52 |
| | | 6.1.6 BYPASS (at 0x1f) | 54 |
| | | 6.1.7 Recommended JTAG Connector | 54 |
| • | | | |
| A | Har | dware Implementations | 57 |
| | A.1 | Abstract Command Based | 57 |
| | A.2 | Execution Based | 57 |
| В | Deb | bugger Implementation | 59 |
| | | | |
| | B.1 | Debug Module Interface Access | 59 |
| | B.2 | Main Loop | 60 |
| | B.3 | Halting | 60 |
| | B.4 | Running | 60 |
| | B.5 | Single Step | 60 |
| | B.6 | Accessing Registers | 60 |
| | | B.6.1 Using Abstract Command | 60 |
| | | B.6.2 Using Program Buffer | 61 |
| | B.7 | Reading Memory | 61 |
| | | B.7.1 Using System Bus Access | 61 |
| | | B.7.2 Using Program Buffer | 62 |
| | B.8 | Writing Memory | 63 |
| | | B.8.1 Using System Bus Access | 63 |
| | | B.8.2 Using Program Buffer | 63 |
| | B.9 | Handling Exceptions | 64 |
| | D 10 | Quiels Accord | 64 |

| ISC-V External Debug Support Version 0.13 | vii |
|--|------------|
| Future Ideas | 67 |
| C.1 Serial Ports | 68 |
| C.1.1 Serial Control and Status (sercs, at 0x34) | 68 |
| C.1.2 Serial TX Data (sertx, at 0x35) | 69 |
| C.1.3 Serial RX Data (serrx, at 0x36) | 69 |
| ndex | 7 0 |
| Change Log | 73 |

List of Figures

| 2.1 | RISC-V Debug System Overview | • | • | | • | | | | | • | • | | | • | • | 6 |
|-----|-------------------------------|---|-------|---|-------|--|------|---|--|---|---|--|--|---|---|----|
| 3.1 | Run/Halt Debug State Machine. | | | _ | | | | _ | | | | | | | | 14 |

List of Tables

| 1.1 | Register Access Abbreviations | 2 |
|-----|--|----|
| 3.1 | Debug Module Interface Address Space | 8 |
| 3.2 | Use of Data Registers | 10 |
| 3.3 | Meaning of cmdtype | 10 |
| 3.4 | Abstract Register Numbers | 12 |
| 3.5 | Debug Module Debug Bus Registers | 16 |
| 4.1 | Core Debug Registers | 35 |
| 4.2 | Virtual address in DPC upon Debug Mode Entry | 37 |
| 4.3 | Virtual Core Debug Registers | 38 |
| 4.4 | Privilege Level Encoding | 38 |
| 5.1 | Trigger Registers | 42 |
| 5.2 | Suggested Breakpoint Timings | 44 |
| 6.1 | JTAG DTM TAP Registers | 50 |
| 6.2 | JTAG Connector Diagram | 54 |
| 6.3 | JTAG Connector Pinout | 55 |
| B.1 | Memory Read Timeline | 63 |
| C 1 | Debug Module Debug Bus Registers | 68 |

Chapter 1

Introduction

When a design progresses from simulation to hardware implementation, a user's control and understanding of the system's current state drops dramatically. To help bring up and debug low level software and hardware, it is critical to have good debugging support built into the hardware. When a robust OS is running on a core, software can handle many debugging tasks. However, in many scenarios, hardware support is essential.

This document outlines a standard architecture for external debug support on RISC-V platforms. This architecture allows a variety of implementations and tradeoffs, which is complementary to the wide range of RISC-V implementations. At the same time, this specification defines common interfaces to allow debugging tools and components to target a variety of platforms based on the RISC-V ISA.

System designers may choose to add additional hardware debug support, but this specification defines a standard interface for common functionality.

1.1 Terminology

A platform is a single integrated circuit consisting of one or more components. Some components may be RISC-V cores, while others may have a different function. Typically they will all be connected to a single system bus. A single RISC-V core contains one or more hardware threads, called harts.

1.1.1 Context

This document is written to work with:

- 1. The RISC-V Instruction Set Manual, Volume I: User-Level ISA, Document Version 2.2
- 2. The RISC-V Instruction Set Manual, Volume II: Privileged Architecture, Version 1.10

1.2 About This Document

1.2.1 Structure

This document contains two parts. The main part of the document is the specification, which is given in the numbered sections. The second part of the document is a set of appendices. The information in the appendix is intended to clarify and provide examples, but is not part of the actual specification.

1.2.2 Register Definition Format

All register definitions in this document follow the format shown below. A simple graphic shows which fields are in the register. The upper and lower bit indices are shown to the top left and top right of each field. The total number of bits in the field are shown below it.

After the graphic follows a table which for each field lists its name, description, allowed accesses, and reset value. The allowed accesses are listed in Table 1.1.

| | Table 1.1. Register Access Abbreviations | | | | | | |
|-------|---|--|--|--|--|--|--|
| R | Read-only. | | | | | | |
| R/W | Read/Write. | | | | | | |
| R/W0 | Read/Write. Only writing 0 has an effect. | | | | | | |
| R/W1 | Read/Write. Only writing 1 has an effect. | | | | | | |
| R/W1C | Read/Write. For each bit in the field, writing 1 clears | | | | | | |
| | that bit. Writing 0 has no effect. | | | | | | |
| W | Write-only. When read this field returns 0. | | | | | | |
| W1 | Write-only. Only writing 1 has an effect. | | | | | | |

Table 1.1: Register Access Abbreviations

Names of registers and their bits are hyperlinks to their definition. If you're reading this on paper, there's an index with all their names on page 70.

1.2.2.1 Long Name (shortname, at 0x123)

| 31 | | 8 | 7 | 0 |
|----|----|---|-----|-----|
| | 0 | | fie | eld |
| | 24 | | | 8 |

| Field | Description | Access | Reset |
|-------|---|--------|-------|
| field | Description of what this field is used for. | R/W | 15 |

1.3 Background

There are several use cases for dedicated debugging hardware, both internal to a CPU core and with an external connection. This specification addresses the use cases listed below. Implementations can choose not to implement every feature, which means some use cases might not be supported.

- Debugging low-level software in the absence of an OS or other software.
- Debugging issues in the OS itself.
- Bootstrapping a system to test, configure, and program components before there is any executable code path in the system.
- Accessing hardware on a system without a working CPU.

In addition, even without a hardware debugging interface, architectural support in a RISC-V CPU can aid software debugging and performance analysis by allowing hardware triggers and breakpoints. This specification aims to define common resources which can be used for different cases.

When debugging software, this specification distinguishes between two forms of external debugging. The first is *halt mode* debugging, where an external debugger halts some or all components of a platform and inspects their state while they are in stasis. The debugger can read and/or modify state, then direct the hardware to execute a single instruction, or continue to run freely.

The second is run mode debugging. In this mode a software debug agent runs on a component (eg. triggered by a timer interrupt or breakpoint on a RISC-V core) which transfers data to or from the debugger without halting the component, only briefly interrupting its program flow. This functionality is essential if the component is controlling some real-time system (like a hard drive) where long timing delays could lead to physical damage. This requires additional software support (both on the system as well as on the debugger), and efficient communication channels between the component and the debugger.

1.4 Supported Features

The debug interface described in this specification supports the following features:

- 1. RV32, RV64, and future RV128 are all supported.
- 2. Any hart in the platform can be independently debugged.
- 3. A debugger can discover almost 1 everything it needs to know itself, without user configuration.
- 4. Each hart can be debugged from the very first instruction executed.

¹Notable exceptions include information about the memory map and peripherals.

- 5. A RISC-V hart can be halted when a software breakpoint instruction is executed.
- 6. Hardware single-step can execute one instruction at a time.
- 7. Debug functionality is independent of the debug transport used.
- 8. The debugger does not need to know anything about the microarchitecture of the cores it is debugging.
- 9. Arbitrary subsets of harts can be halted and resumed simultaneously. (Optional)
- 10. Arbitrary instructions can be executed on a halted hart. That means no new debug functionality is needed when a core has additional or custom instructions or state, as long as there exist programs that can move that state into GPRs. (Optional)
- 11. Registers can be accessed without halting. (Optional)
- 12. A running hart can be directed to execute a short sequence of instructions, with little overhead. (Optional)
- 13. A system bus master allows memory access without involving any hart. (Optional)
- 14. A RISC-V hart can be halted when a trigger matches the PC, read/write address/data, or an instruction opcode. (Optional)

While both the mechanism to execute arbitrary instructions and the system bus master are optional, at least one of them must be implemented. Otherwise there is no mechanism to access memory.

This document does not suggest a strategy or implementation for hardware test, debugging or error detection techniqes. Scan, BIST, etc. are out of scope of this specification, but this specification does not intend to limit their use in RISC-V systems.

Chapter 2

System Overview

Figure 2.1 shows the main components of External Debug Support. Blocks shown in dotted lines are optional.

The user interacts with the Debug Host (eg. laptop), which is running a debugger (eg. gdb). The debugger communicates with a Debug Translator (eg. OpenOCD, which may include a hardware driver) to communicate with Debug Transport Hardware (eg. Olimex USB-JTAG adapter). The Debug Transport Hardware connects the Debug Host to the Platform's Debug Transport Module (DTM). The DTM provides access to the Debug Module (DM) using the Debug Module Interface (DMI).

The DM allows the debugger to halt any hart in the platform. Abstract commands provide access to GPRs. Additional registers are accessible through abstract commands or by writing programs to the optional Program Buffer.

The Program Buffer allows the debugger to execute arbitrary instructions on a hart. This mechanism can be used to access memory. An optional system bus access block allows memory accesses without using a RISC-V hart to perform the access.

Each RISC-V hart may implement a Trigger Module. When trigger conditions are met, harts will halt and inform the debug module that they have halted.



Figure 2.1: RISC-V Debug System Overview

Chapter 3

Debug Module (DM)

The Debug Module implements a translation interface between abstract debug operations and their specific implementation. It might support the following operations:

- 1. Give the debugger necessary information about the implementation. (Required)
- 2. Allow any individual hart to be halted and resumed. (Required)
- 3. Provide status on which harts are halted. (Required)
- 4. Provide read and write access to a halted hart's GPRs. (Required)
- 5. Provide access to a reset signal that allows debugging from the very first instruction after reset. (Required)
- 6. Provide access to other hart registers. (Optional)
- 7. Provide a Program Buffer to force the hart to execute arbitrary instructions. (Optional)
- 8. Allow multiple harts to be halted, resumed, and/or reset at the same time. (Optional)
- 9. Allow direct System Bus Access. (Optional)

In order to implement memory access, a target must implement either the Program Buffer or System Bus Access.

A single DM can debug up to 1024 harts.

3.1 Debug Module Interface (DMI)

The Debug Module is a slave to a bus called the Debug Module Interface (DMI). The master of the bus is the Debug Transport Module(s). The Debug Module Interface can be a trivial bus with one master and one slave, or use a more full-featured bus like TileLink or the AMBA Advanced Peripheral Bus. The details are left to the system designer.

The DMI uses between 7 and 32 address bits. It supports read and write operations. The bottom of the address space is used for the DM. Extra space can be used for custom debug devices, other cores, additional DMs, etc.

The Debug Module is controlled via register accesses to its DMI address space.

| Tau | one 5.1: Debug Wodule Interface Address Space |
|-------------|--|
| 0x00 - 0x3f | Registers described in Section 3.11. |
| 0x40 - 0x5f | This is called the 'halt region'. These 32 addresses for |
| | 32-bit words provide access to the halt bit for up to |
| | 1024 harts. If the hart is halted, the bit is 1. |
| | Otherwise the bit is 0. The bit for hart 0 is the LSB |
| | in the 32-bit word at 0x40. The bit for hart 1023 is |
| | the MSB in the 32-bit word at 0x5f. |

Table 3.1: Debug Module Interface Address Space

3.2 Reset Control

The Debug Module controls a global reset signal, ndmreset (non-debug module reset), which can reset, or hold in reset, every component in the platform, except for the Debug Module and Debug Transport Modules. Exactly what is affected by this reset is implementation dependent, as long as it is possible to debug programs from the first instruction executed. The Debug Module's own state and registers should only be reset at power-up and while dmactive in dmcontrol is 0. The halt state of harts should be maintained across system reset provided that dmactive is 1, although trigger CSRs may be cleared.

Due to clock and power domain crossing issues, it may not be possible to perform arbitrary DMI accesses across system reset. While ndmreset or any external reset is asserted, the only supported DM operation is accessing dmcontrol. The behavior of other accesses is undefined.

There is no requirement on the duration of the assertion of ndmreset. The implementation must ensure that a write of ndmreset to 1 followed by a write of ndmreset to 0 triggers system reset. The system may take an arbitrarily long time to come out of reset, as reported by allunavail, anyunavail, or other implementation specific indicators.

When harts have been reset, they must set a sticky havereset state bit. The conceptual havereset state bits can be read for selected harts in anyhavereset and allhavereset in dmstatus. These bits must be set regardless of the cause of the reset. The havereset bits for the selected harts can be cleared by writing 1 to ackhavereset in dmcontrol. The havereset bits may or may not be cleared when dmactive is low.

3.3 Selecting Harts

Up to 1024 harts can be connected to a single DM. The debugger selects a hart, and then subsequent halt, resume, reset, and debugging commands are specific to that hart.

A debugger can enumerate all the harts attached to the DM by selecting each hart starting from 0 until anynonexistent in dmstatus is 1.

The debugger can discover the mapping between hart indices and mhartid by using the interface to read mhartid, or by reading the system's Device Tree.

3.3.1 Selecting a Single Hart

All debug modules must support selecting a single hart. The debugger can select a hart by writing its index to hartsel. Hart indexes start at 0 and are contiguous until the final index.

3.3.2 Selecting Multiple Harts

Debug Modules may optionally implement a Hart Array Mask register to allow selecting multiple harts at once. The debugger can set bits in the hart array mask register using hawindowsel and hawindow, then apply actions to all selected harts by setting hasel. If this feature is supported, multiple harts can be halted, resumed, and reset simultaneously.

Only the actions initiated by dmcontrol can apply to multiple harts at once, Abstract Commands apply only to the hart selected by hartsel.

3.4 Run Control

For every hart, the Debug Module contains 3 conceptual bits of state: halt request, resume request, and hart reset. (The hart reset bit is optional.) These bits all reset to 0. A debugger can write them for the currently selected harts through haltreq, resumereq, and hartreset in dmcontrol. In addition the DM receives halted, running, and resume ack signals from each hart.

When a running hart receives a halt request, it responds by halting and asserting its halted signal. The halted signals of all selected harts are reflected in the allhalted and anyhalted bits. haltreq is ignored by halted harts.

When a halted hart receives a resume request, it responds by resuming, clearing its halted signal, and asserting its running signal and resume ack signals. The resume ack signal is lowered when the resume request is deasserted. These status signals of all selected harts are reflected in allresumeack, anyresumeack, allrunning, and anyrunning, resumered is ignored by running harts.

When halt or resume is requested, a hart must respond in less than one second, unless it is unavailable. (How this is implemented is not further specified. A few clock cycles will be a more typical latency).

3.5 Abstract Commands

The DM supports a set of abstract commands, most of which are optional. Depending on the implementation, the debugger may be able to perform some abstract commands even when the selected hart is not halted. Debuggers can only determine which abstract commands are supported by a given hart in a given state by attempting them and then looking at cmderr in abstractcs to see if they were successful.

Debuggers execute abstract commands by writing them to command. Debuggers can determine whether an abstract command is complete by reading busy in abstracts. If the command takes arguments, the debugger must write them to the data registers before writing to command. If a command returns results, the Debug Module must ensure they are placed in the data registers before busy is cleared. Which data registers are used for the arguments is described in Table 3.2. In all cases the least-significant word is placed in the lowest-numbered data register.

| Table 9.2. Obe of Bata Hogisters | | | | | | | | | |
|----------------------------------|-------------------|---------------|----------------|--|--|--|--|--|--|
| XLEN | arg0/return value | arg1 | arg2 | | | | | | |
| 32 | data0 | data1 | data2 | | | | | | |
| 64 | data0, data1 | data2 , data3 | data4, data5 | | | | | | |
| 128 | data0- data3 | data4 — data7 | data8 - data11 | | | | | | |

Table 3.2: Use of Data Registers

3.5.1 Abstract Command Listing

This section describes each of the different abstract commands and how their fields should be interpreted when they are written to command.

Each abstract command is a 32-bit value. The top 8 bits contain cmdtype which determines the kind of command. Table 3.3 lists all commands.

| Tab | ole | 3.3: | Meaning | ot | cmd | type |
|-----|-----|------|---------|----|-----|------|
| | | | | | | |

| cmdtype | Command | Page |
|---------|-------------------------|------|
| 0 | Access Register Command | 10 |
| 1 | Quick Access | 12 |

3.5.1.1 Access Register

This command gives the debugger access to CPU registers and program buffer. It performs the following sequence of operations:

- 1. Copy data from the register specified by regno into the arg0 region of data, if write is clear and transfer is set.
- 2. Copy data from the arg0 region of data into the register specified by regno, if write is set and transfer is set.

3. Execute the Program Buffer, if postexec is set.

If any of these operations fail, cmderr is set and none of the remaining steps are executed. An implementation may detect an upcoming failure early, and fail the overall command before it reaches the step that would cause failure.

Debug Modules must implement this command and must support read and write access to all GPRs when the selected hart is halted. Debug Modules may optionally support accessing other registers, or accessing registers when the hart is running. If this command is supported for a register while the hart is running, it must also be supported for a register while the hart is halted. Each individual register (aside from GPRs) may be supported differently across read, write, and halt status.

The encoding of size was chosen to match sbaccess in sbcs.

| 31 | 24 | 23 | 22 | 20 | 19 | 18 | 17 | 16 | 15 | 0 |
|-----|------|----|-----|----|----|----------|----------|-------|-------|---|
| cmd | type | 0 | siz | ze | 0 | postexec | transfer | write | regno | |
| 8 | | 1 | 5 | 3 | 1 | 1 | 1 | 1 | 16 | |

| Field | Description | | | | |
|----------|---|--|--|--|--|
| cmdtype | This is 0 to indicate Access Register Command. | | | | |
| size | 2: Access the lowest 32 bits of the register. | | | | |
| | 3: Access the lowest 64 bits of the register. | | | | |
| | 4: Access the lowest 128 bits of the register. | | | | |
| | If size specifies a size larger than the register's | | | | |
| | actual size, then the access must fail. If a register | | | | |
| | is accessible, then reads of size less than or equal | | | | |
| | to the register's actual size must be supported. | | | | |
| postexec | When 1, execute the program in the Program | | | | |
| | Buffer exactly once after performing the transfer, | | | | |
| | if any. | | | | |
| transfer | 0: Don't do the operation specified by write. | | | | |
| | 1: Do the operation specified by write. | | | | |
| | This bit can be used to just execute the Pro- | | | | |
| | gram Buffer without having to worry about plac- | | | | |
| | ing valid values into size or regno. | | | | |
| write | When transfer is set: 0: Copy data from the spec- | | | | |
| | ified register into arg0 portion of data. | | | | |
| | 1: Copy data from arg0 portion of data into the | | | | |
| | specified register. | | | | |
| | Continued on next page | | | | |

| regno | Number of the register to access, as described in |
|-------|---|
| | Table 3.4. dpc may be used as an alias for PC if |
| | this command is supported on a non-halted hart. |

3.5.1.2 Quick Access

Perform the following sequence of operations:

- 1. If the hart is halted, the command sets cmderr to halt/resume and does not continue.
- 2. Halt the hart. If the hart halts for some other reason (e.g. breakpoint), the command sets cmderr to halt/resume and does not continue.
- 3. Execute the Program Buffer. If an exception occurs, cmderr is set to exception and the program buffer execution ends, but the quick access command continues.
- 4. Resume the hart.

Implementing this command is optional.



| Field | Description | | |
|---------|---|--|--|
| cmdtype | This is 1 to indicate Quick Access command. | | |

Table 3.4: Abstract Register Numbers

| 0x0000 - 0x0fff | CSRs. The "PC" can be accessed here through dpc. |
|-----------------|--|
| 0x1000 - 0x101f | GPRs |
| 0x1020 - 0x103f | Floating point registers |
| 0xc000 - 0xffff | Reserved for non-standard extensions and internal use. |

3.6 Program Buffer

To support executing arbitrary instructions on a halted hart, a Debug Module can include a Program Buffer that a debugger can write small programs to. Systems that support all necessary functionality using abstract commands only may choose to omit the Program Buffer.

A debugger can write a small program to the Program Buffer, and then execute it exactly once with the Access Register Abstract Command, setting the postexec bit in command. The debugger can write whatever program it likes (including jumps out of the Program Buffer), but the program

must end with ebreak or c.ebreak. To save hardware, an implementation may support an implied ebreak that is executed when a hart runs off the end of the Program Buffer. This is indicated in impebreak. With this feature, a Program Buffer of just 2 32-bit words can offer efficient debugging.

If progbufsize is 1, the Program Buffer may only hold a single instruction, and impebreak must be 1. This instruction can be a 32-bit instruction, or a compressed instruction in the lower 16 bits accompanied by a compressed nop in the upper 16 bits.

If the debugger executes a program that does not terminate with an ebreak instruction, the hart will remain in Debug Mode until it is reset.

While these programs are executed, the hart does not leave Debug Mode (see Section 4.1). If an exception is encountered during execution of the Program Buffer, no more instructions are executed, the hart remains in Debug Mode, and cmderr is set to 3 (exception error). If the debugger executes a program that doesn't terminate, then it loses control of the hart.

Executing the Program Buffer may clobber dpc. If that is the case, it must be possible to read/write dpc using an abstract command with postexec not set. The debugger must attempt to save dpc between halting and executing a Program Buffer, and then restore dpc before leaving Debug Mode.

Allowing Program Buffer execution to clobber \mathtt{dpc} allows for direct implementations that don't have a separate PC register, and do need to use the PC when executing the Program Buffer.

The Program Buffer may be implemented as RAM which is accessible to the hart as RAM memory. A debugger can determine if this is the case by executing small programs that attempt to write and read back relative to pc while executing from the Program Buffer. If so, the debugger has more flexibility in what it can do with the program buffer.

3.7 Overview of States

Figure 3.1 shows a conceptual view of the states passed through by a hart during run/halt debugging as influenced by the different fields of dmcontrol, abstractcs, abstractauto, and command.

3.8 System Bus Access

When a Program Buffer is present, a debugger can access the system bus by having a RISC-V hart perform the accesses it requires. A Debug Module may also include a System Bus Access block to provide memory access without involving a hart, regardless of whether Program Buffer is implemented. The System Bus Access block uses physical addresses.

Depending on the microarchitecture, data accessed through System Bus Access may not always be coherent with that observed by each hart. (For instance, a hart may have caches that don't snoop or aren't write-through.) It is up to the debugger to enforce coherency if the implementation does not. This specification does not define a standard way to do this, as it is implementation/platform specific. Possibilities may include using the System Bus Interface and/or Program Buffer to write to special memory-mapped locations, or executing special instructions via the Program Buffer.



Figure 3.1: Run/Halt Debug State Machine. As only a small amount of state is visibile to the debugger, the states and transitions are conceptual.

Implementing a System Bus Access block has several benefits even when a Debug Module also implements a Program Buffer. First, it is possible to access memory in a running system with minimal impact. Second, it may improve performance when accessing memory. Third, it may provide access to devices that a hart does not have access to.

3.9 Quick Access

Depending on the task it is performing, some harts can only be halted very briefly. There are several mechanisms that allow accessing resources in such a running system with a minimal impact on the running hart.

First, an implementation may allow some abstract commands to execute without halting the hart.

Second, the Quick Access abstract command can be used to halt a hart, quickly execute the contents of the Program Buffer, and let the hart run again. Combined with instructions that allow Program Buffer code to access the data registers, as described in 3.11.3, this can be used to quickly perform a memory or register access. For some systems this will be too intrusive, but many systems that can't be halted can bear an occasional hiccup of a hundred or less cycles.

Third, if the System Bus Access block is implemented, it can be used while a hart is running to access system memory.

3.10 Security

To protect intellectual property it may be desirable to lock access to the Debug Module. To allow access during a manufacturing process and not afterwards, a reasonable solution could be to add a fuse bit to the Debug Module that can be used to be permanently disable it. Since this is technology specific, it is not further addressed in this spec.

Another option is to allow the DM to be unlocked only by users who have an access key. A few bits in dmstatus and authdata can support an arbitrarily complex authentication mechanism. When authenticated is clear, the DM must not interact with the rest of the platform in any way.

3.11 Debug Module DMI Registers

When read, unimplemented Debug Module DMI Registers return 0. Writing them has no effect.

3.11.1 Debug Module Status (dmstatus, at 0x11)

The address of this register will not change in the future, because it contains version. It has changed from version 0.11 of this spec.


Table 3.5: Debug Module Debug Bus Registers

| Address | Name | Page |
|---------|--------------------------------------|------|
| 0x04 | Abstract Data 0 | 27 |
| | | 21 |
| 0x0f | Abstract Data 11 | 10 |
| 0x10 | Debug Module Control | 19 |
| 0x11 | Debug Module Status | 15 |
| 0x12 | Hart Info | 21 |
| 0x13 | Halt Summary | 22 |
| 0x14 | Hart Array Window Select | 22 |
| 0x15 | Hart Array Window | 23 |
| 0x16 | Abstract Control and Status | 23 |
| 0x17 | Abstract Command | 24 |
| 0x18 | Abstract Command Autoexec | 26 |
| 0x19 | Device Tree Addr 0 | 26 |
| 0x1a | Device Tree Addr 1 | |
| 0x1b | Device Tree Addr 2 | |
| 0x1c | Device Tree Addr 3 | |
| 0x20 | Program Buffer 0 | 27 |
| 0x2f | Program Buffer 15 | |
| 0x30 | Authentication Data | 27 |
| 0x38 | System Bus Access Control and Status | 27 |
| 0x39 | System Bus Address 31:0 | 29 |
| 0x3a | System Bus Address 63:32 | 29 |
| 0x3b | System Bus Address 95:64 | 29 |
| 0x3c | System Bus Data 31:0 | 30 |
| 0x3d | System Bus Data 63:32 | 31 |
| 0x3e | System Bus Data 95:64 | 31 |
| 0x3f | System Bus Data 127:96 | 31 |
| | V | _ |

This register reports status for the overall debug module as well as the currently selected harts, as defined in hasel.

Harts are nonexistent if they will never be part of this system, no matter how long a user waits. Eg. in a simple single-hart system only one hart exists, and all others are nonexistent.

Harts are unavailable if they might exist/become available at a later time. Eg. in a multi-hart system some might temporarily be powered down, or a system might support hot-swapping harts.

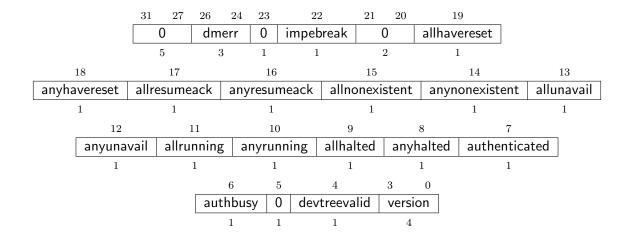

| Field | Description | Access | Reset |
|--------------|--|------------|---------|
| dmerr | Gets set if the Debug Module was accessed incor- | R/W1C | 0 |
| | rectly. | | |
| | 0 (none): No error. | | |
| | 1 (badaddr): There was an access to an unimple- | | |
| | mented Debug Module address. | | |
| | 7 (other): An access failed for another reason. | | |
| impebreak | If 1, then there is an implicit ebreak instruction | R | Preset |
| | at the non-existent word immediately after the | | |
| | Program Buffer. This saves the debugger from | | |
| | having to write the ebreak itself, and allows the | | |
| | Program Buffer to be one word smaller. | | |
| | This must be 1 when progbufsize is 1. | | |
| allhavereset | This field is 1 when all currently selected harts | R | - |
| | have been reset but the reset has not been ac- | | |
| | knowledged. | | |
| anyhavereset | This field is 1 when any currently selected hart | R | - |
| | has been reset but the reset has not been acknowl- | | |
| | edged. | | |
| | Conti | nued on ne | xt page |

| allresumeack | This field is 1 when all currently selected harts have acknowledged the previous resume request. | R | - |
|----------------|---|---|--------|
| anyresumeack | This field is 1 when any currently selected hart has acknowledged the previous resume request. | R | - |
| allnonexistent | This field is 1 when all currently selected harts do not exist in this system. | R | - |
| anynonexistent | This field is 1 when any currently selected hart does not exist in this system. | R | - |
| allunavail | This field is 1 when all currently selected harts are unavailable. | R | - |
| anyunavail | This field is 1 when any currently selected hart is unavailable. | R | - |
| allrunning | This field is 1 when all currently selected harts are running. | R | - |
| anyrunning | This field is 1 when any currently selected hart is running. | R | - |
| allhalted | This field is 1 when all currently selected harts are halted. | R | - |
| anyhalted | This field is 1 when any currently selected hart is halted. | R | - |
| authenticated | 0 when authentication is required before using the DM. 1 when the authentication check has passed. On components that don't implement authentication, this bit must be preset as 1. | R | Preset |
| authbusy | 0: The authentication module is ready to process the next read/write to authdata. 1: The authentication module is busy. Accessing authdata results in unspecified behavior. authbusy only becomes set in immediate response to an access to authdata. | R | 0 |
| devtreevalid | 0: devtreeaddr0-devtreeaddr3 hold information which is not relevant to the Device Tree. 1: devtreeaddr0-devtreeaddr3 registers hold the address of the Device Tree. | R | Preset |
| version | There is no Debug Module present. There is a Debug Module and it conforms to version 0.11 of this specification. There is a Debug Module and it conforms to version 0.13 of this specification. There is a Debug Module but it does not conform to any available version of this spec. | R | 2 |

3.11.2 Debug Module Control (dmcontrol, at 0x10)

This register controls the overall debug module as well as the currently selected harts, as defined in hasel.

| | 31 haltreq 1 26 25 | | 31 30 | | : | 29 | 28 | 27 | | |
|---|-----------------------------|-------------|-------------------|----|-----|-------|-----------|--------|---|---|
| | | | haltreq resumereq | | | reset | ackhavere | 0 | | |
| | | | 1 1 | | | 1 | 1 | | 1 | |
| | | | 16 | 15 | 2 1 | | | 0 | | |
| h | asel | asel hartse | | | 0 | | ndmreset | dmacti | | е |
| | 1 | | 10 | | 14 | | 1 | | 1 | |

| Field | Description | Access | Reset | | | | | | |
|------------------------|---|--------|-------|--|--|--|--|--|--|
| haltreq | Writes the halt request bit for all currently se- | W | - | | | | | | |
| • | lected harts. When set to 1, each selected hart | | | | | | | | |
| | will halt if it is not currently halted. | | | | | | | | |
| | Writing 1 or 0 has no effect on a hart which is | | | | | | | | |
| | already halted, but the bit must be cleared to 0 | | | | | | | | |
| | before the hart is resumed. | | | | | | | | |
| | Writes apply to the new value of hartsel and hasel. | | | | | | | | |
| resumereq | Writes the resume request bit for all currently se- | W | - | | | | | | |
| · | lected harts. When set to 1, each selected hart | | | | | | | | |
| | will resume if it is currently halted. | | | | | | | | |
| | The resume request bit is ignored while the halt | | | | | | | | |
| | request bit is set. | | | | | | | | |
| | Writes apply to the new value of hartsel and hasel. | | | | | | | | |
| hartreset | This optional field writes the reset bit for all the | R/W | 0 | | | | | | |
| | currently selected harts. To perform a reset the | | | | | | | | |
| | debugger writes 1, and then writes 0 to deassert | | | | | | | | |
| | the reset signal. | | | | | | | | |
| | If this feature is not implemented, the bit always | | | | | | | | |
| | stays 0, so after writing 1 the debugger can read | | | | | | | | |
| | the register back to see if the feature is supported. | | | | | | | | |
| | Writes apply to the new value of hartsel and hasel. | | | | | | | | |
| ackhavereset | Writing 1 to this bit clears the havereset bits for | W | - | | | | | | |
| | any selected harts. | | | | | | | | |
| | Writes apply to the new value of hartsel and hasel. | | | | | | | | |
| hasel | Selects the definition of currently selected harts. | R/W | 0 | | | | | | |
| | 0: There is a single currently selected hart, that | | | | | | | | |
| | selected by hartsel. | | | | | | | | |
| | 1: There may be multiple currently selected harts | | | | | | | | |
| | - that selected by hartsel, plus those selected by | | | | | | | | |
| | the hart array mask register. | | | | | | | | |
| | An implementation which does not implement the | | | | | | | | |
| | hart array mask register should tie this field to 0. | | | | | | | | |
| | A debugger which wishes to use the hart array | | | | | | | | |
| | mask register feature should set this bit and read | | | | | | | | |
| | back to see if the functionality is supported. | | | | | | | | |
| Continued on next page | | | | | | | | | |

| hartsel | The DM-specific index of the hart to select. This | R/W | 0 |
|----------|--|-----|---|
| | hart is always part of the currently selected harts. | | |
| ndmreset | This bit controls the reset signal from the DM to | R/W | 0 |
| | the rest of the system. The signal should reset | | |
| | every part of the system, including every hart, | | |
| | except for the DM and any logic required to access | | |
| | the DM. To perform a system reset the debugger | | |
| | writes 1, and then writes 0 to deassert the reset. | | |
| dmactive | This bit serves as a reset signal for the Debug | R/W | 0 |
| | Module itself. | | |
| | 0: The module's state, including authentication | | |
| | mechanism, takes its reset values (the dmactive bit | | |
| | is the only bit which can be written to something | | |
| | other than its reset value). | | |
| | 1: The module functions normally. | | |
| | No other mechanism should exist that may result | | |
| | in resetting the Debug Module after power up, | | |
| | including the platform's system reset or Debug | | |
| | Transport reset signals. | | |
| | A debugger may pulse this bit low to get the de- | | |
| | bug module into a known state. | | |
| | Implementations may use this bit to aid debug- | | |
| | ging, for example by preventing the Debug Mod- | | |
| | ule from being power gated while debugging is | | |
| | active. | | |

3.11.3 Hart Info (hartinfo, at 0x12)

This register gives information about the hart currently selected by hartsel.

This register is optional. If it is not present it should read all-zero.

If this register is included, the debugger can do more with the Program Buffer by writing programs which explicitly access the data and/or dscratch registers.

This entire register is read-only.

| | 31 | 24 | 23 | 20 | 19 | 17 | 16 | 15 | 12 | 11 | 0 |
|---|----|----|----------|----|----|----|------------|----------|----|----------|---|
| | 0 | | nscratch | | 0 | | dataaccess | datasize | | dataaddr | |
| 8 | | 4 | 1 | : | 3 | 1 | 4 | 1 | 1 | 2 | |

| Field | Description | Access | Reset |
|------------|--|--------|--------|
| nscratch | Number of dscratch registers available for the | R | Preset |
| | debugger to use during program buffer execution, | | |
| | starting from dscratch0. The debugger can make | | |
| | no assumptions about the contents of these regis- | | |
| | ters between commands. | | |
| dataaccess | 0: The data registers are shadowed in the hart by | R | Preset |
| | CSR registers. Each CSR register is XLEN bits | | |
| | in size, and corresponds to a single argument, per | | |
| | Table 3.2. | | |
| | 1: The data registers are shadowed in the hart's | | |
| | memory map. Each register takes up 4 bytes in | | |
| | the memory map. | | |
| datasize | If dataaccess is 0: Number of CSR registers dedi- | R | Preset |
| | cated to shadowing the data registers. | | |
| | If dataaccess is 1: Number of 32-bit words in the | | |
| | memory map dedicated to shadowing the data | | |
| | registers. | | |
| dataaddr | If dataaccess is 0: The number of the first CSR | R | Preset |
| | dedicated to shadowing the data registers. | | |
| | If dataaccess is 1: Signed address of RAM where | | |
| | the data registers are shadowed, to be used to | | |
| | access relative to zero. | | |


3.11.4 Halt Summary (haltsum, at 0x13)

This register contains a summary of which harts are halted.

Each bit contains the logical OR of 32 halt bits. When there are a large number of harts in the system, the debugger can first read this register, and then read from the halt region (0x40-0x5f) to determine which hart is the one that is halted.

This entire register is read-only.


| 31 | 30 | 29 | 28 | 27 | 26 |
|--------------|-------------|-------------|-------------|-------------|-------------|
| halt1023:992 | halt991:960 | halt959:928 | halt927:896 | halt895:864 | halt863:832 |
| 1 | 1 | 1 | 1 | 1 | 1 |
| 25 | 24 | 23 | 22 | 21 | 20 |
| halt831:800 | halt799:768 | halt767:736 | halt735:704 | halt703:672 | halt671:640 |
| 1 | 1 | 1 | 1 | 1 | 1 |
| 19 | 18 | 17 | 16 | 15 | 14 |
| halt639:608 | halt607:576 | halt575:544 | halt543:512 | halt511:480 | halt479:448 |
| 1 | 1 | 1 | 1 | 1 | 1 |
| 13 | 12 11 | | 10 | 9 | 8 |
| halt447:416 | halt415:384 | halt383:352 | halt351:320 | halt319:288 | halt287:256 |
| 1 | 1 | 1 | 1 | 1 | 1 |

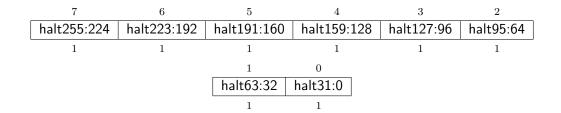

3.11.5 Hart Array Window Select (hawindowsel, at 0x14)

This register selects which of the 32-bit portion of the hart array mask register is accessible in hawindow.

The hart array mask register provides a mask of all harts controlled by the debug module. A hart is part of the currently selected harts if the corresponding bit is set in the hart array mask register and hasel in dmcontrol is 1, or if the hart is selected by hartsel.

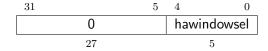

3.11.6 Hart Array Window (hawindow, at 0x15)

This register provides R/W access to a 32-bit portion of the hart array mask register. The position of the window is determined by hawindowsel. I.e. bit 0 refers to hart hawindowsel *32, while bit 31 refers to hart hawindowsel *32 + 31.



3.11.7 Abstract Control and Status (abstractcs, at 0x16)

| | 31 | 29 | 28 | 24 | 23 | | 13 | 12 | 11 | 10 | 8 | 7 | 5 | 4 | 0 |
|---|----|----|-------------|----|-----------|--|----|------|----|--------|---|---|---|-----------|---|
| | 0 | | progbufsize | | bufsize 0 | | | busy | 0 | cmderr | | 0 | | datacount | |
| 3 | | 5 | | | 11 | | 1 | 1 | 3 | | 3 | 3 | | 5 | |

| Field | Description | Access | Reset |
|-------------|--|--------|--------|
| progbufsize | Size of the Program Buffer, in 32-bit words. Valid | R | Preset |
| | sizes are 0 - 16. | | |
| busy | 1: An abstract command is currently being exe- | R | 0 |
| | cuted. | | |
| | This bit is set as soon as command is written, and | | |
| | is not cleared until that command has completed. | | |
| cmderr | Gets set if an abstract command fails. The bits in | R/W1C | 0 |
| | this field remain set until they are cleared by writ- | | |
| | ing 1 to them. No abstract command is started | | |
| | until the value is reset to 0. | | |
| | 0 (none): No error. | | |
| | 1 (busy): An abstract command was executing | | |
| | while command, abstractcs, abstractauto was | | |
| | written, or when one of the data or progbuf registers was read or written. | | |
| | 2 (not supported): The requested command is | | |
| | not supported. A command that is not supported | | |
| | while the hart is running may be supported when | | |
| | it is halted. | | |
| | 3 (exception): An exception occurred while ex- | | |
| | ecuting the command (eg. while executing the | | |
| | Program Buffer). | | |
| | 4 (halt/resume): An abstract command couldn't | | |
| | execute because the hart wasn't in the expected | | |
| | state (running/halted). | | |
| | 7 (other): The command failed for another rea- | | |
| | son. | | |
| datacount | Number of data registers that are implemented | R | Preset |
| | as part of the abstract command interface. Valid | | |
| | sizes are 0 - 12. | | |

3.11.8 Abstract Command (command, at 0x17)

Writes to this register cause the corresponding abstract command to be executed.

Writing while an abstract command is executing causes cmderr to be set.

If cmderr is non-zero, writes to this register are ignored.

cmderr inhibits starting a new command to accommodate debuggers that, for performance reasons, send several commands to be executed in a row without checking cmderr in between. They can safely do so and check cmderr at the end without worrying that one command failed but then a later command (which might have depended on the previous one succeeding) passed.

| 31 | 24 | 23 | | 0 |
|---------|----|----|---------|---|
| cmdtype | | | control | |
| | 3 | | 24 | |

| Field | Description | Access | Reset |
|---------|--|--------|-------|
| cmdtype | The type determines the overall functionality of | W | 0 |
| | this abstract command. | | |
| control | This field is interpreted in a command-specific | W | 0 |
| | manner, described for each abstract command. | | |

3.11.9 Abstract Command Autoexec (abstractauto, at 0x18)

This register is optional. Including it allows more efficient burst accesses. Debugger can attempt to set bits and read them back to determine if the functionality is supported.

| 31 | 16 | 15 | 12 | 11 | 0 |
|---------------|----|----|----|-----------|----|
| autoexecprogb | uf | 0 | |) autoexe | |
| 16 | | 4 | L | - | 12 |

| Field | Description | Access | Reset |
|-----------------|---|--------|-------|
| autoexecprogbuf | When a bit in this field is 1, read or write ac- | R/W | 0 |
| | cesses the corresponding progbuf word cause the | | |
| | command in command to be executed again. | | |
| autoexecdata | When a bit in this field is 1, read or write accesses | R/W | 0 |
| | the corresponding data word cause the command | | |
| | in command to be executed again. | | |

3.11.10 Device Tree Addr 0 (devtreeaddr0, at 0x19)

When devtreevalid is set, reading this register returns bits 31:0 of the Device Tree address. Reading the other devtreeaddr registers returns the upper bits of the address.

When system bus mastering is implemented, this must be an address that can be used with the System Bus Access module. Otherwise, this must be an address that can be used to access the Device Tree from the hart with ID 0.

If devtreevalid is 0, then the devtreeaddr registers hold identifier information which is not further specified in this document.

The Device Tree itself is described in the RISC-V Privileged Specification.

This entire register is read-only.

| 31 | | 0 |
|----|------|---|
| | addr | |
| • | 39 | |

3.11.11 Abstract Data 0 (data0, at 0x04)

Basic read/write registers that may be read or changed by abstract commands.

Accessing them while an abstract command is executing causes cmderr to be set.

Attempts to write them while busy is set does not change their value.

The values in these registers may not be preserved after an abstract command is executed. The only guarantees on their contents are the ones offered by the command in question. If the command fails, no assumptions can be made about the contents of these registers.



3.11.12 Program Buffer 0 (progbuf0, at 0x20)

The progbuf registers provide read/write access to the optional program buffer.

Accessing them while an abstract command is executing causes cmderr to be set.

Attempts to write them while busy is set does not change their value.



3.11.13 Authentication Data (authdata, at 0x30)

This register serves as a 32-bit serial port to the authentication module.

When authbusy is clear, the debugger can communicate with the authentication module by reading or writing this register. There is no separate mechanism to signal overflow/underflow.



3.11.14 System Bus Access Control and Status (sbcs, at 0x38)

| 31 | 21 | 20 | 19 | 17 | 16 | 15 | 14 | 12 |
|----|----|--------------|------|------|-----------------|------------|------|------|
| C | | sbsingleread | sbac | cess | sbautoincrement | sbautoread | sbei | rror |
| 1 | 1 | 1 | ; | 3 | 1 | 1 | 3 | 3 |

| 11 | 5 | 4 | 3 | 2 | 1 | 0 |
|------|-----|-------------|------------|------------|------------|-----------|
| sbas | ize | sbaccess128 | sbaccess64 | sbaccess32 | sbaccess16 | sbaccess8 |
| 7 | | 1 | 1 | 1 | 1 | 1 |

| Field | Description | Access | Reset | | | | |
|-----------------|---|--------|-------|--|--|--|--|
| sbsingleread | When a 1 is written here, triggers a read at the | W1 | 0 | | | | |
| | address in sbaddress using the access size set by | | | | | | |
| | sbaccess. | | | | | | |
| sbaccess | Select the access size to use for system bus ac- | R/W | 2 | | | | |
| | cesses triggered by writes to the sbaddress reg- | | | | | | |
| | isters or sbdata0. | | | | | | |
| | 0: 8-bit | | | | | | |
| | 1: 16-bit | | | | | | |
| | 2: 32-bit | | | | | | |
| | 3: 64-bit | | | | | | |
| | 4: 128-bit | | | | | | |
| | If an unsupported system bus access size is writ- | | | | | | |
| | ten here, the DM does not perform the access and | | | | | | |
| | sberror is set to 3. | | | | | | |
| sbautoincrement | When 1, sbaddress is incremented by the access | R/W | 0 | | | | |
| | size (in bytes) selected in sbaccess after every sys- | | | | | | |
| | tem bus access. | | | | | | |
| sbautoread | When 1, every read from sbdata0 automatically | R/W | 0 | | | | |
| | triggers a system bus read at the (possibly auto- | | | | | | |
| | incremented) address. | | | | | | |
| sberror | When the debug module's system bus master | R/W1C | 0 | | | | |
| | causes a bus error, this field gets set. The bits | | | | | | |
| | in this field remain set until they are cleared by | | | | | | |
| | writing 1 to them. While this field is non-zero, no | | | | | | |
| | more system bus accesses can be initiated by the | | | | | | |
| | debug module. | | | | | | |
| | 0: There was no bus error. | | | | | | |
| | 1: There was a timeout. | | | | | | |
| | 2: A bad address was accessed. | | | | | | |
| | 3: There was some other error (eg. alignment). | | | | | | |
| | 4: The system bus master was busy when one of | | | | | | |
| | the sbaddress or sbdata registers was written, | | | | | | |
| | or sbdata0 was read when it had stale data. | | | | | | |
| | Continued on next page | | | | | | |

| sbasize | Width of system bus addresses in bits. (0 indi- | R | Preset |
|-------------|---|---|--------|
| | cates there is no bus access support.) | | |
| sbaccess128 | 1 when 128-bit system bus accesses are supported. | R | Preset |
| sbaccess64 | 1 when 64-bit system bus accesses are supported. | R | Preset |
| sbaccess32 | 1 when 32-bit system bus accesses are supported. | R | Preset |
| sbaccess16 | 1 when 16-bit system bus accesses are supported. | R | Preset |
| sbaccess8 | 1 when 8-bit system bus accesses are supported. | R | Preset |

3.11.15 System Bus Address 31:0 (sbaddress0, at 0x39)

If sbasize is 0, then this register is not present.

When the system bus master is busy, writes to this register will set sberror.

If sberror is 0 and sbautoread is set then the system bus master will start to read after updating the address from address. The access size is controlled by sbaccess in sbcs.

If sbsingleread is set, the bit is cleared.



| Field | Description | Access | Reset |
|---------|---|--------|-------|
| address | Accesses bits 31:0 of the physical address in | R/W | 0 |
| | sbaddress. | | |

3.11.16 System Bus Address 63:32 (sbaddress1, at 0x3a)



| Field | Description | Access | Reset |
|---------|---|--------|-------|
| address | Accesses bits 63:32 of the physical address in | R/W | 0 |
| | sbaddress (if the system address bus is that wide). | | |

3.11.17 System Bus Address 95:64 (sbaddress2, at 0x3b)

If sbasize is less than 65, then this register is not present.



| Field I | Description | Access | Reset |
|-----------|---|--------|-------|
| address A | Accesses bits 95:64 of the physical address in | R/W | 0 |
| | sbaddress (if the system address bus is that wide). | | |

3.11.18 System Bus Data 31:0 (sbdata0, at 0x3c)

If all of the sbaccess bits in sbcs are 0, then this register is not present.

Any successful system bus read updates the data in this register, and marks it no longer stale.

If sberror isn't 0 then accesses do nothing.


Writes to this register:

- 1. If the bus master is busy then accesses set sberror, and don't do anything else.
- 2. Start a bus write of sbdata to sbaddress.
- 3. If sbautoincrement is set, increment sbaddress.

Reads from this register:

- 1. If the register is marked stale, then set sberror and don't do anything else.
- 2. "Return" the data.
- 3. Mark the register stale.
- 4. If sbautoincrement is set, increment sbaddress.
- 5. If sbautoread is set, start another system bus read.


Only sbdata0 has this behavior. The other sbdata registers have no side effects. On systems that have buses wider than 32 bits, a debugger should access sbdata0 after accessing the other sbdata registers.

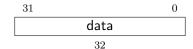

| Field | Description | Access | Reset |
|-------|-------------------------------|--------|-------|
| data | Accesses bits 31:0 of sbdata. | R/W | 0 |

3.11.19 System Bus Data 63:32 (sbdata1, at 0x3d)


If sbaccess64 and sbaccess128 are 0, then this register is not present.

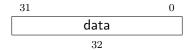

| Field | Description | Access | Reset |
|-------|--|--------|-------|
| data | Accesses bits 63:32 of sbdata (if the system bus | R/W | 0 |
| | is that wide). | | |

3.11.20 System Bus Data 95:64 (sbdata2, at 0x3e)

This register only exists if sbaccess128 is 1.

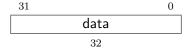

| Field | Description | Access | Reset |
|-------|--|--------|-------|
| data | Accesses bits 95:64 of sbdata (if the system bus | R/W | 0 |
| | is that wide). | | |

3.11.21 System Bus Data 127:96 (sbdata3, at 0x3f)

This register only exists if sbaccess128 is 1.



| Field | Description | Access | Reset |
|-------|---|--------|-------|
| data | Accesses bits 127:96 of sbdata (if the system bus | R/W | 0 |
| | is that wide). | | |

Chapter 4

RISC-V Debug

Modifications to the RISC-V core to support debug are kept to a minimum. There is a special execution mode (Debug Mode) and a few extra CSRs. The DM takes care of the rest.

4.1 Debug Mode

Debug Mode is a special processor mode used only when the core is halted for external debugging. How Debug Mode is implemented is not specified here.

When executing code from the Program Buffer, the processor stays in Debug Mode and the following apply:

- 1. All operations are executed at machine mode privilege level, except that mprv in mstatus is ignored.
- 2. All interrupts are masked.
- 3. Exceptions don't update any registers. That includes cause, epc, tval, dpc, and mstatus. They do end execution of the Program Buffer.
- 4. No action is taken if a trigger matches.
- 5. Trace is disabled.
- 6. Counters may be stopped, depending on stopcount in dcsr.
- 7. Timers may be stopped, depending on stoptime in dcsr.
- 8. The wfi instruction acts as a nop.
- 9. Almost all instructions that change the privilege level have undefined behavior. This includes ecall, mret, hret, sret, and uret. (To change the privilege level, the debugger can write prv in dcsr). The only exception is ebreak. When that is executed in Debug Mode, it halts the processor again but without updating dpc or dcsr.

4.2 Load-Reserved/Store-Conditional Instructions

The reservation registered by an lr instruction on a memory address may be lost when entering Debug Mode or while in Debug Mode. This means that there may be no forward progress if Debug Mode is entered between lr and sc pairs.

4.3 Single Step

A debugger can cause a halted hart to execute a single instruction and then re-enter Debug Mode by setting step before setting resumereq.

If executing or fetching that instruction causes an exception, Debug Mode is re-entered immediately after the PC is changed to the exception handler and the appropriate tval and cause registers are updated.

If executing or fetching the instruction causes a trigger to fire, Debug Mode is re-entered immediately after that trigger has fired. In that case cause is set to 2 (trigger) instead of 4 (single step). Whether the instruction is executed or not depends on the specific configuration of the trigger.

If the instruction that is executed causes the PC to change to an address where an instruction fetch causes an exception, that exception does not occurr until the next time the hart is resumed. Similarly, a trigger at the new address does not fire until the hart actually attempts to execute that instruction.

4.4 Reset

If the halt signal (driven by the hart's halt request bit in the Debug Module) is asserted when a hart comes out of reset, the hart must enter Debug Mode before executing any instructions, but after performing any initialization that would usually happen before the first instruction is executed.

4.4.1 dret Instruction

To return from Debug Mode, a new instruction is defined: dret. It has an encoding of 0x7b200073. On harts which support this instruction, executing dret in Debug Mode changes pc to the value stored in dpc. The current privilege level is changed to that specified by prv in dcsr. The hart is no longer in debug mode.

It is not necessary for the debugger to know whether an implementation supports dret, as the Debug Module will ensure that it is executed if necessary. It is defined in this specification only to reserve the opcode and allow for reusable Debug Module implementations.

4.5 Core Debug Registers

The supported Core Debug Registers must be implemented for each hart that can be debugged.

These registers are only accessible from Debug Mode.

Table 4.1: Core Debug Registers

| Address | Name | Page |
|---------|--------------------------|------|
| 0x7b0 | Debug Control and Status | 35 |
| 0x7b1 | Debug PC | 37 |
| 0x7b2 | Debug Scratch Register 0 | |
| 0x7b3 | Debug Scratch Register 1 | |

4.5.1 Debug Control and Status (dcsr, at 0x7b0)

| 31 | 28 | 27 | 16 | 1 | .5 | 14 | | 13 | | | 12 | | 11 |
|-------|------|-------|------|------|-----|----|----|------|-----|----|------|----|--------|
| xdebu | gver | (|) | ebre | akm | 0 | eł | orea | ks | eb | reak | (u | stepie |
| 4 | | 1 | 2 | : | 1 | 1 | | 1 | | | 1 | | 1 |
| | | 10 | , | 9 | 8 | 6 | 5 | 3 | 2 | | 1 | 0 | |
| | stop | count | stop | time | cau | se | C |) | ste | p | pr | ٧ |] |
| | | 1 | | 1 | 3 | | 3 | 3 | 1 | | 2 | 2 | = |

| Field | Description | Access | Reset | | | |
|-----------|---|-----------|----------|--|--|--|
| xdebugver | 0: There is no external debug support. | R | Preset | | | |
| | 4: External debug support exists as it is described | | | | | |
| | in this document. | | | | | |
| | 15: There is external debug support, but it does | | | | | |
| | not conform to any available version of this spec. | | | | | |
| ebreakm | When 1, ebreak instructions in Machine Mode | R/W | 0 | | | |
| | enter Debug Mode. | | | | | |
| ebreaks | When 1, ebreak instructions in Supervisor Mode | R/W | 0 | | | |
| | enter Debug Mode. | | | | | |
| ebreaku | When 1, ebreak instructions in User/Application | R/W | 0 | | | |
| | Mode enter Debug Mode. | | | | | |
| stepie | 0: Interrupts are disabled during single stepping. | R/W | 0 | | | |
| | 1: Interrupts are enabled during single stepping. | | | | | |
| | Implementations may hard wire this bit to 0. The | | | | | |
| | debugger must read back the value it writes to | | | | | |
| | check whether the feature is supported. If not | | | | | |
| | supported, interrupt behavior can be emulated by | | | | | |
| | the debugger. | | | | | |
| | Continu | ued on ne | ext page | | | |

| ohom server! | O. In anomant countage of1 | D /117 | Dnc 4 |
|--------------|---|----------|----------|
| stopcount | 0: Increment counters as usual. | R/W | Preset |
| | 1: Don't increment any counters while in Debug | | |
| | Mode or on ebreak instructions that cause en- | | |
| | try into Debug Mode. These counters include the | | |
| | cycle and instret CSRs. This is preferred for | | |
| | most debugging scenarios. | | |
| | An implementation may choose not to support | | |
| | writing to this bit. The debugger must read back | | |
| | the value it writes to check whether the feature is | | |
| | supported. | | |
| stoptime | 0: Increment timers as usual. | R/W | Preset |
| | 1: Don't increment any hart-local timers while in | | |
| | Debug Mode. | | |
| | An implementation may choose not to support | | |
| | writing to this bit. The debugger must read back | | |
| | the value it writes to check whether the feature is | | |
| | supported. | | |
| cause | Explains why Debug Mode was entered. | R | 0 |
| | When there are multiple reasons to enter Debug | | |
| | Mode in a single cycle, the cause with the highest | | |
| | priority is the one written. | | |
| | 1: An ebreak instruction was executed. (priority | | |
| | (3) | | |
| | 2: The Trigger Module caused a breakpoint ex- | | |
| | ception. (priority 4) | | |
| | 3: The debugger requested entry to Debug Mode. | | |
| | (priority 2) | | |
| | 4: The hart single stepped because step was set. | | |
| | (priority 1) | | |
| | Other values are reserved for future use. | | |
| | | d on ma | rrt name |
| | Continue | ea on ne | xı page |

| step | When set and not in Debug Mode, the hart will | R/W | 0 |
|------|--|-----|---|
| | only execute a single instruction and then enter | | |
| | Debug Mode. If the instruction does not com- | | |
| | plete due to an exception, the hart will immedi- | | |
| | ately enter Debug Mode before executing the trap | | |
| | handler, with appropriate exception registers set. | | |
| prv | Contains the privilege level the hart was operating | R/W | 0 |
| | in when Debug Mode was entered. The encoding | | |
| | is described in Table 4.4. A debugger can change | | |
| | this value to change the hart's privilege level when | | |
| | exiting Debug Mode. | | |
| | Not all privilege levels are supported on all harts. | | |
| | If the encoding written is not supported or the | | |
| | debugger is not allowed to change to it, the hart | | |
| | may change to any supported privilege level. | | |


4.5.2 Debug PC (dpc, at 0x7b1)

Upon entry to debug mode, dpc is updated with the virtual address of the next instruction to be executed. The behavior is described in more detail in Table 4.2.

Table 4.2: Virtual address in DPC upon Debug Mode Entry

| 1 0 |
|--|
| Virtual Address in DPC |
| Address of the ebreak instruction |
| Address of the instruction that would be executed |
| next if no debugging was going on. Ie. $pc + 4$ for |
| 32-bit instructions that don't change program flow, |
| the destination PC on taken jumps/branches, etc. |
| If timing is 0, the address of the instruction which |
| caused the trigger to fire. If timing is 1, the address of |
| the next instruction to be executed at the time that |
| debug mode was entered. |
| Address of the next instruction to be executed at the |
| time that debug mode was entered |
| |

When resuming, the hart's PC is updated to the virtual address stored in dpc. A debugger may write dpc to change where the hart resumes.

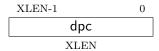

4.5.3 Debug Scratch Register 0 (dscratch0, at 0x7b2)

Optional scratch register that can be used by implementations that need it. A debugger must not write to this register unless hartinfo explicitly mentions it (the Debug Module may use this register internally).

4.5.4 Debug Scratch Register 1 (dscratch1, at 0x7b3)

Optional scratch register that can be used by implementations that need it. A debugger must not write to this register unless hartinfo explicitly mentions it (the Debug Module may use this register internally).

4.6 Virtual Debug Registers

Virtual debug registers are a requirement on the debugger SW/interface, not on the Core designer.

Users of the debugger shouldn't need to know about the core debug registers, but may want to change things affected by them. A virtual register is one that doesn't exist directly in the hardware, but that the debugger exposes as if it does.

Table 4.3: Virtual Core Debug Registers

| Address | Name | Page |
|---------|-----------------|------|
| virtual | Privilege Level | 38 |

4.6.1 Privilege Level (priv, at virtual)

User can read this register to inspect the privilege level that the hart was running in when the hart halted. User can write this register to change the privilege level that the hart will run in when it resumes.

This register contains prv from dcsr, but in a place that the user is expected to access. The user should not access dcsr directly, because doing so might interfere with the debugger.

Table 4.4: Privilege Level Encoding

| Encoding | Privilege Level |
|----------|------------------|
| 0 | User/Application |
| 1 | Supervisor |
| 3 | Machine |

| Field | Description | Access | Reset |
|-------|---|--------|-------|
| prv | Contains the privilege level the hart was operating | R/W | 0 |
| | in when Debug Mode was entered. The encoding | | |
| | is described in Table 4.4, and matches the priv- | | |
| | ilege level encoding from the RISC-V Privileged | | |
| | ISA Specification. A user can write this value to | | |
| | change the hart's privilege level when exiting De- | | |
| | bug Mode. | | |

Chapter 5

Trigger Module

Triggers can cause a breakpoint exception, entry into Debug Mode, or a trace action without having to execute a special instruction. This makes them invaluable when debugging code from ROM. They can trigger on execution of instructions at a given memory address, or on the address/data in loads/stores. These are all features that can be useful without having the Debug Module present, so the Trigger Module is broken out as a separate piece that can be implemented separately.

Each trigger may support a variety of features. A debugger can build a list of all triggers and their features as follows:

- 1. Write 0 to tselect.
- 2. Read back tselect to confirm this trigger exists. If not, exit.
- 3. Read tdata1, and possible tdata2 and tdata3 depending on the trigger type.
- 4. If type is 0, this trigger doesn't exist. Exit the loop.
- 5. Repeat, incrementing the value in tselect.

There are two ways to check whether a given trigger is the last one to support these implementations:

- 1. When no hardware triggers are implemented at all, all related registers return 0. The algorithm above terminates when checking type.
- 2. When 2 triggers are implemented, tselect is just a single bit that selects one of the two. When the debugger writes 2, it reads back as 0 which terminates the enumeration.

5.1 Trigger Registers

The trigger registers are only accessible in machine and Debug Mode to prevent untrusted user code from causing entry into Debug Mode without the OS's permission.

| 14510 5.11 1118801 1408154015 | | | | | | | | | |
|-------------------------------|-------------------|------|--|--|--|--|--|--|--|
| Address | Name | Page | | | | | | | |
| 0x7a0 | Trigger Select | 42 | | | | | | | |
| 0x7a1 | Trigger Data 1 | 42 | | | | | | | |
| 0x7a1 | Match Control | 43 | | | | | | | |
| 0x7a1 | Instruction Count | 47 | | | | | | | |
| 0x7a2 | Trigger Data 2 | 43 | | | | | | | |
| 0x7a3 | Trigger Data 3 | 43 | | | | | | | |

Table 5.1: Trigger Registers

5.1.1 Trigger Select (tselect, at 0x7a0)

This register determines which trigger is accessible through the other trigger registers. The set of accessible triggers must start at 0, and be contiguous.

Writes of values greater than or equal to the number of supported triggers may result in a different value in this register than what was written. Debuggers should read back the value to confirm that what they wrote was a valid index.

Since triggers can be used both by Debug Mode and M Mode, the debugger must restore this register if it modifies it.



5.1.2 Trigger Data 1 (tdata1, at 0x7a1)

| XLEN-1 | XLEN-4 | XLEN-5 | XLEN-6 | 0 |
|--------|--------|--------|----------|---|
| ty | pe | dmode | data | |
| | 4 | 1 | XLEN - 5 | |

| Field | Description | Access | Reset |
|-------|---|--------|--------|
| type | 0: There is no trigger at this tselect. | R | Preset |
| | 1: The trigger is a legacy SiFive address match | | |
| | trigger. These should not be implemented and | | |
| | aren't further documented here. | | |
| | 2: The trigger is an address/data match trig- | | |
| | ger. The remaining bits in this register act as | | |
| | described in mcontrol. | | |
| | 3: The trigger is an instruction count trigger. The | | |
| | remaining bits in this register act as described in | | |
| | icount. | | |
| | 15: This trigger exists (so enumeration shouldn't | | |
| | terminate), but is not currently available. | | |
| | Other values are reserved for future use. | | |
| dmode | 0: Both Debug and M Mode can write the tdata | R/W | 0 |
| | registers at the selected tselect. | | |
| | 1: Only Debug Mode can write the tdata regis- | | |
| | ters at the selected tselect. Writes from other | | |
| | modes are ignored. | | |
| | This bit is only writable from Debug Mode. | | |
| data | Trigger-specific data. | R/W | Preset |

5.1.3 Trigger Data 2 (tdata2, at 0x7a2)

Trigger-specific data.



5.1.4 Trigger Data 3 (tdata3, at 0x7a3)

Trigger-specific data.



5.1.5 Match Control (mcontrol, at 0x7a1)

This register is accessible as tdata1 when type is 2.

Writing unsupported values to any field in this register results in the reset value being written

instead. When a debugger wants to use a feature, it must write the appropriate value and then read back the register to determine whether it is supported.

Address and data trigger implementation are heavily dependent on how the processor core is implemented. To accommodate various implementations, execute, load, and store address/data triggers may fire at whatever point in time is most convenient for the implementation. The debugger may request specific timings as described in timing. Table 5.2 suggests timings for the best user experience.

Table 5.2: Suggested Breakpoint Timings

| Match Type | Suggested Trigger Timing |
|-----------------------------|--------------------------|
| Execute Address | Before |
| Execute Instruction | Before |
| Execute Address+Instruction | Before |
| Load Address | Before |
| Load Data | After |
| Load Address+Data | After |
| Store Address | Before |
| Store Data | Before |
| Store Address+Data | Before |
| | |

| XLEN-1 | XLE | N-4 | XLEN-5 | XLI | EN-6 | XL | EN- | 11 | XLEI | N-12 | 20 | 19 | 18 |
|--------|--------|-----|--------|-----|------|------|-----|----|------|-----------|-------|--------|--------|
| type | | | dmode | | mas | skma | X | | | 0 | | select | timing |
| 4 | | | 1 | | | 6 | | | | XLEN - 31 | | 1 | 1 |
| | 17 | 12 | 11 | 10 | 7 | 6 | 5 | 4 | 3 | 2 | 1 | 0 | |
| | action | | chain | ma | tch | m | h | S | u | execute | store | load | |
| 6 | | 1 | | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | | |

| Field | Description | Access | Reset | | | | | |
|---------|--|--------|--------|--|--|--|--|--|
| maskmax | Specifies the largest naturally aligned powers-of- | R | Preset | | | | | |
| | two (NAPOT) range supported by the hardware. | | | | | | | |
| | The value is the logarithm base 2 of the number | | | | | | | |
| | of bytes in that range. A value of 0 indicates | | | | | | | |
| | that only exact value matches are supported (one | | | | | | | |
| | byte range). A value of 63 corresponds to the | | | | | | | |
| | maximum NAPOT range, which is 2^{63} bytes in | | | | | | | |
| | size. | | | | | | | |
| | Continued on next page | | | | | | | |

| select | 0: Perform a match on the virtual address. | R/W | 0 |
|--------|---|---------|-----|
| | 1: Perform a match on the data value loaded/s- | , | |
| | tored, or the instruction executed. | | |
| timing | 0: The action for this trigger will be taken just be- | R/W | 0 |
| | fore the instruction that triggered it is executed, | , | |
| | but after all preceding instructions are are com- | | |
| | mitted. | | |
| | 1: The action for this trigger will be taken af- | | |
| | ter the instruction that triggered it is executed. | | |
| | It should be taken before the next instruction is | | |
| | executed, but it is better to implement triggers | | |
| | and not implement that suggestion than to not | | |
| | implement them at all. | | |
| | Most hardware will only implement one timing or | | |
| | the other, possibly dependent on select, execute, | | |
| | load, and store. This bit primarily exists for the | | |
| | hardware to communicate to the debugger what | | |
| | will happen. Hardware may implement the bit | | |
| | fully writable, in which case the debugger has a | | |
| | little more control. | | |
| | Data load triggers with timing of 0 will result in | | |
| | the same load happening again when the debugger | | |
| | lets the core run. For data load triggers, debug- | | |
| | gers must first attempt to set the breakpoint with | | |
| | timing of 1. | | |
| | A chain of triggers that don't all have the same | | |
| | timing value will never fire (unless consecutive in- | | |
| | structions match the appropriate triggers). | | |
| | Continued on | next pa | age |

| action | Determines what happens when this trigger | R/W | 0 |
|--------|--|---------|----|
| | matches. | | |
| | 0: Raise a breakpoint exception. (Used when soft- | | |
| | ware wants to use the trigger module without an | | |
| | external debugger attached.) | | |
| | 1: Enter Debug Mode. (Only supported when | | |
| | dmode is 1.) | | |
| | 2: Start tracing. | | |
| | 3: Stop tracing. | | |
| | 4: Emit trace data for this match. If it is a data | | |
| | access match, emit appropriate Load/Store Ad- | | |
| | dress/Data. If it is an instruction execution, emit | | |
| | its PC. | | |
| chain | Other values are reserved for future use. | D/W | 0 |
| cnain | 0: When this trigger matches, the configured ac- | R/W | U |
| | tion is taken. | | |
| | 1: While this trigger does not match, it prevents | | |
| | the trigger with the next index from matching. | D/W | 0 |
| match | 0: Matches when the value equals tdata2. | R/W | 0 |
| | 1: Matches when the top M bits of the value | | |
| | match the top M bits of tdata2. M is XLEN-1 | | |
| | minus the index of the least-significant bit containing 0 in tdata2. | | |
| | 2: Matches when the value is greater than (un- | | |
| | signed) or equal to tdata2. | | |
| | 3: Matches when the value is less than (unsigned) | | |
| | tdata2. | | |
| | 4: Matches when the lower half of the value equals | | |
| | the lower half of tdata2 after the lower half of the | | |
| | value is ANDed with the upper half of tdata2. | | |
| | 5: Matches when the upper half of the value | | |
| | equals the lower half of tdata2 after the upper | | |
| | half of the value is ANDed with the upper half of | | |
| | tdata2. | | |
| | Other values are reserved for future use. | | |
| | Continued on | next pa | ge |

| m | When set, enable this trigger in M mode. | R/W | 0 |
|---------|--|-----|---|
| h | When set, enable this trigger in H mode. | R/W | 0 |
| S | When set, enable this trigger in S mode. | R/W | 0 |
| u | When set, enable this trigger in U mode. | R/W | 0 |
| execute | When set, the trigger fires on the virtual address | R/W | 0 |
| | or opcode of an instruction that is executed. | | |
| store | When set, the trigger fires on the virtual address | R/W | 0 |
| | or data of a store. | | |
| load | When set, the trigger fires on the virtual address | R/W | 0 |
| | or data of a load. | | |

5.1.6 Instruction Count (icount, at 0x7a1)

This register is accessible as tdata1 when type is 3.

Writing unsupported values to any field in this register results in the reset value being written instead. When a debugger wants to use a feature, it must write the appropriate value and then read back the register to determine whether it is supported.

This trigger type is intended to be used as a single step that's useful both for external debuggers and for software monitor programs. For that case it is not necessary to support count greater than 1. The only two combinations of the mode bits that are useful in those scenarios are u by itself, or m, h, s, and u all set.

If the hardware limits count to 1, and changes mode bits instead of decrementing count, this register can be implemented with just 2 bits. One for u, and one for m, h, and s tied together. If only the external debugger or only a software monitor needs to be supported, a single bit is enough.

| | XLEN-1 | XLEN-4 | XLEN-5 | XLEN-6 | 24 | 23 | 10 | 9 | 8 | 7 | 6 | 5 | 0 |
|---|--------|--------|-----------|--------|----|------|----|---|---|---|---|-------|----|
| | type | | dmode | 0 | | cour | nt | m | h | S | u | actio | on |
| 4 | | 1 | XLEN - 29 | | 14 | | 1 | 1 | 1 | 1 | 6 | | |

| Field | Description | Access | Reset | | |
|-------|--|--------|-------|--|--|
| count | When count is decremented to 0, the trigger fires. | R/W | 1 | | |
| | Instead of changing count from 1 to 0, it is also | | | | |
| | acceptable for hardware to clear m , h , s , and u . | | | | |
| | This allows count to be hard-wired to 1 if this | | | | |
| | register just exists for single step. | | | | |
| | Continued on next page | | | | |

| m | When set, every instruction completed or excep- | R/W | 0 | | | | | | |
|--------|---|-----|---|--|--|--|--|--|--|
| | tion taken in M mode decrements count by 1. | | | | | | | | |
| h | When set, every instruction completed or excep- | R/W | 0 | | | | | | |
| | tion taken in H mode decrements count by 1. | | | | | | | | |
| S | When set, every instruction completed or excep- | R/W | 0 | | | | | | |
| | tion taken in S mode decrements count by 1. | · | | | | | | | |
| u | When set, every instruction completed or excep- | R/W | 0 | | | | | | |
| | tion taken in U mode decrements count by 1. | · | | | | | | | |
| action | Determines what happens when this trigger | R/W | 0 | | | | | | |
| | matches. | | | | | | | | |
| | 0: Raise a breakpoint exception. (Used when soft- | | | | | | | | |
| | ware wants to use the trigger module without an | | | | | | | | |
| | external debugger attached.) | | | | | | | | |
| | 1: Enter Debug Mode. (Only supported when | | | | | | | | |
| | dmode is 1.) | | | | | | | | |
| | 2: Start tracing. | | | | | | | | |
| | 3: Stop tracing. | | | | | | | | |
| | 4: Emit trace data for this match. If it is a data | | | | | | | | |
| | access match, emit appropriate Load/Store Ad- | | | | | | | | |
| | dress/Data. If it is an instruction execution, emit | | | | | | | | |
| | its PC. | | | | | | | | |
| | Other values are reserved for future use. | | | | | | | | |

Chapter 6

Debug Transport Module (DTM)

Debug Transport Modules provide access to the DM over one or more transports (eg. JTAG or USB).

There may be multiple DTMs in a single platform. Ideally every component that communicates with the outside world includes a DTM, allowing a platform to be debugged through every transport it supports. For instance a USB component could include a DTM. This would trivially allow any platform to be debugged over USB. All that is required is that the USB module already in use also has access to the Debug Module Interface.

Using multiple DTMs at the same time is not supported. It is left to the user to ensure this does not happen.

This specification defines a JTAG DTM in Section 6.1. Additional DTMs may be added in future versions of this specification.

6.1 JTAG Debug Transport Module

This Debug Transport Module is based around a normal JTAG Test Access Port (TAP). The JTAG TAP allows access to arbitrary JTAG registers by first selecting one using the JTAG instruction register (IR), and then accessing it through the JTAG data register (DR).

6.1.1 JTAG Background

JTAG refers to IEEE Std 1149.1-2013. It is a standard that defines test logic that can be included in an integrated circuit to test the interconnections between integrated circuits, test the integrated circuit itself, and observe or modify circuit activity during the components normal operation. This specification uses the latter functionality. The JTAG standard defines a Test Access Port (TAP) that can be used to read and write a few custom registers, which can be used to communicate with debug hardware in a component.

6.1.2 JTAG DTM Registers

JTAG TAPs used as a DTM must have an IR of at least 5 bits. When the TAP is reset, IR must default to 00001, selecting the IDCODE instruction. A full list of JTAG registers along with their encoding is in Table 6.1. If the IR actually has more than 5 bits, then the encodings in Table 6.1 should be extended with 0's in their most significant bits. The only regular JTAG registers a debugger might use are BYPASS and IDCODE, but this specification leaves IR space for many other standard JTAG instructions. Unimplemented instructions must select the BYPASS register.

Table 6.1: JTAG DTM TAP Registers

| Address | Name | Description | Page |
|---------|-------------------------------|--------------------------------------|------|
| 0x00 | BYPASS | JTAG recommends this encoding | |
| 0x01 | IDCODE | JTAG recommends this encoding | |
| 0x10 | DTM Control and Status | For Debugging | 51 |
| 0x11 | Debug Module Interface Access | For Debugging | 52 |
| 0x12 | Reserved (BYPASS) | Reserved for future RISC-V debugging | |
| 0x13 | Reserved (BYPASS) | Reserved for future RISC-V debugging | |
| 0x14 | Reserved (BYPASS) | Reserved for future RISC-V debugging | |
| 0x15 | Reserved (BYPASS) | Reserved for future RISC-V standards | |
| 0x16 | Reserved (BYPASS) | Reserved for future RISC-V standards | |
| 0x17 | Reserved (BYPASS) | Reserved for future RISC-V standards | |
| 0x1f | BYPASS | JTAG requires this encoding | |

6.1.3 IDCODE (at 0x01)

This register is selected (in IR) when the TAP state machine is reset. Its definition is exactly as defined in IEEE Std 1149.1-2013.

This entire register is read-only.

| 31 28 | 27 	 12 | 11 1 | 0 |
|---------|------------|---------|---|
| Version | PartNumber | Manufld | 1 |
| 4 | 16 | 11 | 1 |

| Field | Description | Access | Reset |
|------------|---|--------|--------|
| Version | Identifies the release version of this part. | R | Preset |
| PartNumber | Identifies the designer's part number of this part. | R | Preset |
| Manufld | Identifies the designer/manufacturer of this part. | R | Preset |
| | Bits 6:0 must be bits 6:0 of the designer/manufac- | | |
| | turer's Identification Code as assigned by JEDEC | | |
| | Standard JEP106. Bits 10:7 contain the modulo- | | |
| | 16 count of the number of continuation characters | | |
| | (0x7f) in that same Identification Code. | | |

6.1.4 DTM Control and Status (dtmcs, at 0x10)

The size of this register will remain constant in future versions so that a debugger can always determine the version of the DTM.

| 31 | 18 | 17 | 16 | 15 | 14 | 12 | 11 | 10 | 9 | 4 | 3 | 0 |
|----------------|----|----------|----|----|----|------|------|-----|----|------|-----|---|
| 0 dmihardreset | | dmireset | 0 | id | le | dmis | stat | abi | ts | vers | ion | |
| | 14 | 1 | 1 | 1 | | 3 | 2 | ! | 6 | | 4 | |

| Field | Description | Access | Reset |
|--------------|---|-----------|----------|
| dmihardreset | Writing 1 to this bit does a hard reset of the DTM, | W1 | 0 |
| | causing the DTM to forget about any outstand- | | |
| | ing DMI transactions. In general this should only | | |
| | be used when the Debugger has reason to expect | | |
| | that the outstanding DMI transaction will never | | |
| | complete (e.g. a reset condition caused an inflight | | |
| | DMI transaction to be cancelled). | | |
| dmireset | Writing 1 to this bit clears the sticky error state | W1 | 0 |
| | and allows the DTM to retry or complete the pre- | | |
| | vious transaction. | | |
| idle | This is a hint to the debugger of the minimum | R | Preset |
| | number of cycles a debugger should spend in Run- | | |
| | Test/Idle after every DMI scan to avoid a 'busy' | | |
| | return code (dmistat of 3). A debugger must still | | |
| | check dmistat when necessary. | | |
| | 0: It is not necessary to enter Run-Test/Idle at | | |
| | all. | | |
| | 1: Enter Run-Test/Idle and leave it immediately. | | |
| | 2: Enter Run-Test/Idle and stay there for 1 cycle | | |
| | before leaving. | | |
| | And so on. | | |
| | Continu | ied on ne | ext page |

| dmistat | 0: No error. | R | 0 |
|---------|--|---|--------|
| | 1: Reserved. Interpret the same as 2. | | |
| | 2: An operation failed (resulted in op of 2). | | |
| | 3: An operation was attempted while a DMI ac- | | |
| | cess was still in progress (resulted in op of 3). | | |
| abits | The size of address in dmi. | R | Preset |
| version | 0: Version described in spec version 0.11. | R | 1 |
| | 1: Version described in spec version 0.13 (and | | |
| | later?), which reduces the DMI data width to 32 | | |
| | bits. | | |
| | 15: Version not described in any available version | | |
| | of this spec. | | |

6.1.5 Debug Module Interface Access (dmi, at 0x11)

This register allows access to the Debug Module Interface (DMI).

In Update-DR, the DTM starts the operation specified in op unless the current status reported in op is sticky.

In Capture-DR, the DTM updates data with the result from that operation, updating op if the current op isn't sticky.

See Section B.1 and Table B.1 for examples of how this is used.

For instance a series of scans may write a Debug Program and execute it. If one of the writes fails but the execution continues, then the Debug Program may hang or have other unexpected side effects.

| abits+33 | 34 | 33 | | 2 | 1 | 0 |
|----------|----|----|------|---|---|---|
| address | | | data | | 0 | р |
| abits | | | 32 | | 2 | 2 |

| Field | Description | Access | Reset | |
|------------------------|--|--------|-------|--|
| address | Address used for DMI access. In Update-DR this | R/W | 0 | |
| | value is used to access the DM over the DMI. | | | |
| data | The data to send to the DM over the DMI during | R/W | 0 | |
| | Update-DR, and the data returned from the DM | | | |
| | as a result of the previous operation. | | | |
| Continued on next page | | | | |

The still-in-progress status is sticky to accommodate debuggers that batch together a number of scans, which must all be executed or stop as soon as there's a problem.

op | When the debugger writes this field, it has the | R/W following meaning:

0: Ignore data and address. (nop)

Don't send anything over the DMI during Update-DR. This operation should never result in a busy or error response. The address and data reported in the following Capture-DR are undefined.

- 1: Read from address. (read)
- 2: Write data to address. (write)
- 3: Reserved.

When the debugger reads this field, it means the following:

- 0: The previous operation completed successfully.
- 1: Reserved.
- 2: A previous operation failed. The data scanned into dmi in this access will be ignored. This status is sticky and can be cleared by writing dmireset in dtmcs.

This indicates that the DM itself responded with an error. Note: there are no specified cases in which the DM would respond with an error, and DMI is not required to support returning errors. 3: An operation was attempted while a DMI request is still in progress. The data scanned into dmi in this access will be ignored. This status is sticky and can be cleared by writing dmireset in dtmcs. If a debugger sees this status, it needs to give the target more TCK edges between Update-DR and Capture-DR. The simplest way to do that is to add extra transitions in Run-Test/Idle. (The DTM, DM, and/or component may be in different clock domains, so synchronization may be required. Some relatively fixed number of TCK ticks may be needed for the request to reach the DM, complete, and for the response to be synchronized back into the TCK domain.)

6.1.6 BYPASS (at 0x1f)

1-bit register that has no effect. It is used when a debugger does not want to communicate with this TAP.

This entire register is read-only.

0

6.1.7 Recommended JTAG Connector

To make it easy to acquire debug hardware, this spec recommends a connector that is compatible with the Atmel AVR JTAG Connector, as described below.

The connector is a .05"-spaced, gold-plated male header with .016" thick hardened copper or beryllium bronze square posts (SAMTEC FTSH-105 or equivalent). Female connectors are compatible $20\mu m$ gold connectors.

Viewing the male header from above (the pins pointing at your eye), a target's connector looks as it does in Table 6.2. The function of each pin is described in Table 6.3.

Table 6.2: JTAG Connector Diagram

| THE COLUMN | | _ | |
|------------|---|----|---------|
| TCK | 1 | 2 | GND |
| TDO | 3 | 4 | VCC |
| TMS | 5 | 6 | (SRSTn) |
| (NC) | 7 | 8 | (TRSTn) |
| TDI | 9 | 10 | GND |

Table 6.3: JTAG Connector Pinout

| 1 | TCK | JTAG TCK signal, driven by the debug adapter. This |
|-------|-------|--|
| | | pin must be clearly marked in both male and female |
| | | headers. |
| 5 | TMS | JTAG TMS signal, driven by debug adapter. |
| 9 | TDI | JTAG TDI signal, driven by the debug adapter. |
| 3 | TDO | JTAG TDO signal, driven by the target. |
| 8 | TRSTn | Test Reset (optional, only used by some devices. Used |
| | | to reset the JTAG TAP Controller). |
| 4 | VCC | Reference voltage for logic high. A debug adapter |
| | | may attempt to draw up to 20mA from this pin to |
| | | power itself, but a target is not obligated to provide |
| | | that power. |
| 2, 10 | GND | Target ground. |
| 6 | SRSTn | Active-low reset signal, driven by the debug adapter. |
| | | Asserting reset should reset any RISC-V cores as well |
| | | as any other peripherals on the PCB. It should not |
| | | reset the debug logic. Although connecting this pin is |
| | | optional, it is recommended as it allows the debugger |
| | | to hold the target device in a reset state, which may |
| | | be essential to debug some scenarios. If not |
| | | implemented in a target, this pin must not be |
| | | connected. |

Target connectors may be shrouded. In that case the key slot should be next to pin 5. Female headers should have a matching key.

Debug adapters should be tagged or marked with their isolation voltage threshold (i.e. unisolated, $250\mathrm{V},\,\mathrm{etc.}$).

All debug adapter pins other than GND should be current-limited to 20mA.

Appendix A

Hardware Implementations

Below are two possible implementations. A designer could choose one, mix and match, or come up with their own design.

A.1 Abstract Command Based

Halting happens by stalling the processor execution pipeline.

Muxes on the register file(s) allow for accessing GPRs and CSRs using the Access Register abstract command.

System Bus Access allows main memory access.

A.2 Execution Based

This implementation only implements the Access Register abstract command for GPRs on a halted hart, and relies on the Program Buffer for all other operations.

This method uses the processor's existing pipeline and ability to execute from arbitrary memory locations to avoid modifications to a processor's datapath. When the halt request bit is set, the Debug Module raises a special interrupt to the selected hart(s). This interrupt causes each hart to enter Debug Mode and jump to a defined memory region that is serviced by the DM. When taking this exception, pc is saved to dpc and cause is updated in dcsr.

The code in the Debug Module causes the hart to execute a "park loop". In the park loop the hart writes its mhartid to a memory location within the Debug Module to indicate that it is halted. To allow the DM to individually control one out of several halted harts, each hart polls for flags in a DM-controlled memory location to determine whether the debugger wants it to execute the Program Buffer or perform a resume.

To execute an abstract command, the DM first populates some internal words of program buffer

according to command. When transfer is set, the debugger populates these words with lw <gpr>, 0x400(zero) or sw 0x400(zero), <gpr>>. 64- and 128-bit accesses use ld/sd and lq/sq respectively. If transfer is not set, these instructions are populated as nops. If execute is set, execution continues to the debugger-controlled Program Buffer, otherwise the debug module causes a ebreak to execute immediately.

When ebreak is executed (indicating the end of the Program Buffer code) the hart returns to its park loop. If an exception is encountered, the hart jumps to a defined debug exception address within the Debug Module. The code at that address causes the hart to write to an address in the Debug Module which indicates exception. Then the hart jumps back to the park loop. The DM infers from the write that there was an exception, and sets cmderr appropriately.

To resume execution, the debug module sets a flag which causes the core to execute a dret. When dret is executed, pc is restored from dpc and normal execution resumes at the privilege set by prv.

data0 etc. are mapped into regular memory at an address relative to zero with only a 12-bit imm. The exact address is an implementation detail that a debugger must not rely on. For example, the data registers might be mapped to 0x400.

For additional flexibility, progbuf0, etc. are mapped into regular memory immediately preceding data0, in order to form a contiguous region of memory which can be used for either program execution or data transfer.

Appendix B

Debugger Implementation

This section details how an external debugger might use the described debug interface to perform some common operations on RISC-V cores using the JTAG DTM described in Appendix ??. All these examples assume a 32-bit core but it should be easy to adapt the examples to 64- or 128-bit cores.

To keep the examples readable, they all assume that everything succeeds, and that they complete faster than the debugger can perform the next access. This will be the case in a typical JTAG setup. However, the debugger must always check the sticky error status bits after performing a sequence of actions. If it sees any that are set, then it should attempt the same actions again, possibly while adding in some delay, or explicit checks for status bits.

B.1 Debug Module Interface Access

To read an arbitrary Debug Module register, select dmi, and scan in a value with op set to 1, and address set to the desired register address. In Update-DR the operation will start, and in Capture-DR its results will be captured into data. If the operation didn't complete in time, op will be 3 and the value in data must be ignored. The busy condition must be cleared by writing dmireset in dtmcs, and then the second scan scan must be performed again. This process must be repeated until op returns 0. In later operations the debugger should allow for more time between Capture-DR and Update-DR.

To write an arbitrary Debug Bus register, select dmi, and scan in a value with op set to 2, and address and data set to the desired register address and data respectively. From then on everything happens exactly as with a read, except that a write is performed instead of the read.

It should almost never be necessary to scan IR, avoiding a big part of the inefficiency in typical JTAG use.

B.2 Main Loop

A debugger continuously monitors haltsum to see if any harts have spontaneously halted.

B.3 Halting

To halt one or more harts, the debugger selects them, sets haltreq, and then waits for allhalted to indicate the harts are halted before clearing haltreq to 0.

B.4 Running

First, the debugger should restore any registers that it has clobbered. Once that's done, it can let the selected harts run by setting resumereq. Once allresumeack is set, the debugger knows the hart has resumed, and it can clear resumereq. Note that harts might halt very quickly after resuming (eg. by hitting a software breakpoint) so the debugger cannot use allhalted/anyhalted to check whether the hart resumed.

B.5 Single Step

Using the hardware single step feature is almost the same as regular running. The debugger just sets step in dcsr before letting the core run. The core behaves exactly as in the running case, except that interrupts may be disabled (depending on stepie) and it only fetches and executes a single instruction before re-entering Debug Mode.

B.6 Accessing Registers

B.6.1 Using Abstract Command

Read s0 using abstract command:

| Op | Address | Value | Comment |
|-------|---------|------------------------------|------------------------------|
| Write | command | size = 2, transfer, $0x1008$ | Read s0 |
| Read | data0 | - | Returns value that was in s0 |

Write mstatus using abstract command:

| Op | Address | Value | Comment |
|-------|---------|------------------------------------|---------------|
| Write | data0 | new value | |
| Write | command | size = 2, transfer, write, $0x300$ | Write mstatus |

B.6.2 Using Program Buffer

Abstract commands are used to exchange data with GPRs. Using this mechanism, other registers can be accessed by moving their value into/out of GPRs.

Write mstatus using program buffer:

| Op | Address | Value | Comment |
|-------|----------|-----------------|---------------------------------------|
| Write | progbuf0 | csrw s0, | |
| | | MSTATUS | |
| Write | progbuf1 | ebreak | |
| Write | data0 | new value | |
| Write | command | size = 2, | Write s0, then execute program buffer |
| | | postexec, | |
| | | transfer, | |
| | | write, $0x1008$ | |

Read f1 using program buffer:

| Op | Address | Value | Comment |
|-------|----------|-------------------|----------------------------------|
| Write | progbuf0 | fmv.x.s s0, f1 | |
| Write | progbuf1 | ebreak | |
| Write | command | postexec | Execute program buffer |
| Write | command | transfer $0x1008$ | read s0 |
| Read | data0 | - | Returns the value that was in f1 |

B.7 Reading Memory

B.7.1 Using System Bus Access

Read a word from memory using system bus access:

| Op | Address | Value | Comment |
|-------|------------|------------------------------|------------------------|
| Write | sbaddress0 | address | |
| Write | sbcs | sbaccess = 2, $sbsingleread$ | Perform a read |
| Read | sbdata0 | - | Value read from memory |

Read block of memory using system bus access:

| Op | Address | Value | Comment |
|-------|------------|----------------|---|
| Write | sbaddress0 | address | |
| Write | sbcs | sbaccess = 2, | Turn on autoread and autoincrement, and perform a |
| | | sbsingleread, | read |
| | | sbautoread, | |
| | | sbautoincremen | t |
| Read | sbdata0 | - | Value read from memory |
| Read | sbdata0 | - | Next value read from memory |
| ••• | | | |
| Write | sbcs | 0 | Clear sbautoread |
| Read | sbdata0 | - | Get last value read from memory. |

B.7.2 Using Program Buffer

Read a word from memory using program buffer:

| Op | Address | Value | Comment |
|-------|----------|-------------------------|---------------------------------------|
| Write | progbuf0 | lw s0, 0(s0) | |
| Write | progbuf1 | ebreak | |
| Write | data0 | address | |
| Write | command | write, postexec, 0x1008 | Write s0, then execute program buffer |
| Write | command | 0x1008 | Read s0 |
| Read | data0 | - | Value read from memory |

Read block of memory using program buffer:

| Op | Address | Value | Comment |
|-------|--------------|-------------------------|--|
| Write | progbuf0 | lw s1, 0(s0) | |
| Write | progbuf1 | addi s0, s0, 4 | |
| Write | progbuf2 | ebreak | |
| Write | data0 | address | |
| Write | command | write, postexec, 0x1008 | Write s0, then execute program buffer |
| Write | command | postexec, 0x1009 | Read s1, then execute program buffer |
| Write | abstractauto | autoexecdata [0] | Set autoexecdata [0] |
| Read | data0 | - | Get value read from memory, then execute program |
| | | | buffer |
| Read | data0 | - | Get next value read from memory, then execute |
| | | | program buffer |
| | | | |
| Write | abstractauto | 0 | Clear autoexecdata [0] |
| Read | data0 | - | Get last value read from memory. |

TODO: Table B.1 shows the scans involved in reading a single word using this method.

Table B.1: Memory Read Timeline

| | JTAG State | Activity |
|------|------------|----------|
| TODO | TODO | TODO |

B.8 Writing Memory

B.8.1 Using System Bus Access

Write a word to memory using system bus access:

| Op | Address | Value | Comment |
|-------|------------|---------|---------|
| Write | sbaddress0 | address | |
| Write | sbdata0 | value | |

Write block of memory using system bus access:

| Op | Address | Value | Comment |
|-------|------------|----------------|-----------------------|
| Write | sbaddress0 | address | |
| Write | sbcs | sbaccess = 2, | Turn on autoincrement |
| | | sbautoincremen | t |
| Write | sbdata0 | value0 | |
| Write | sbdata0 | value1 | |
| ••• | | | |
| Write | sbdata0 | valueN | |

B.8.2 Using Program Buffer

Write a word to memory using program buffer:

| Op | Address | Value | Comment |
|-------|----------|-------------------------|---------------------------------------|
| Write | progbuf0 | sw s1, 0(s0) | |
| Write | progbuf1 | ebreak | |
| Write | data0 | value | |
| Write | command | write, 0x1008 | Write s0 |
| Write | data0 | address | |
| Write | command | write, postexec, 0x1009 | Write s1, then execute program buffer |

Write block of memory using program buffer:

| Op | Address | Value | Comment |
|-------|--------------|-------------------------|---------------------------------------|
| Write | progbuf0 | sw s1, 0(s0) | |
| Write | progbuf1 | addi s0, s0, 4 | |
| Write | progbuf2 | ebreak | |
| Write | data0 | address | |
| Write | command | write, 0x1008 | Write s0 |
| Write | data0 | value0 | |
| Write | command | write, postexec, 0x1009 | Write s1, then execute program buffer |
| Write | abstractauto | autoexecdata [0] | Set autoexecdata [0] |
| Write | data0 | value1 | |
| ••• | | | |
| Write | data0 | valueN | |
| Write | abstractauto | 0 | Clear autoexecdata [0] |

B.9 Handling Exceptions

Generally the debugger can avoid exceptions by being careful with the programs it writes. Sometimes they are unavoidable though, eg. if the user asks to access memory or a CSR that is not implemented. A typical debugger will not know enough about the platform to know what's going to happen, and must attempt the access to determine the outcome.

When an exception occurs while executing the Program Buffer, cmderr becomes set. The debugger can check this field to see whether a program encountered an exception. If there was an exception, it's left to the debugger to know what must have caused it.

B.10 Quick Access

Halt the hart for a minimum amount of time to perform a single memory write.

There are a variety of instructions to transfer data between GPRs and the data registers. They are either loads/stores or CSR reads/writes. The specific addresses also vary. This is all specified in hartinfo. The example here uses the pseudo-op transfer dest, src to represent all these options.

| Op | Address | Value | Comment |
|-------|----------|-------------------|-------------------------------|
| Write | progbuf0 | transfer arg2, s0 | Save s0 |
| Write | progbuf1 | transfer s0, arg0 | Read first argument (address) |
| Write | progbuf2 | transfer arg0, s1 | Save s1 |
| Write | progbuf3 | transfer s1, arg1 | Read second argument (data) |
| Write | progbuf4 | sw s1, 0(s0) | |
| Write | progbuf5 | transfer s1, arg0 | Restore s1 |
| Write | progbuf6 | transfer s0, arg2 | Restore s0 |
| Write | progbuf7 | ebreak | |
| Write | data0 | address | |
| Write | data1 | data | |
| Write | command | 0x10000000 | Perform quick access |

Appendix C

Future Ideas

All items in this section are future ideas and should not be considered part of the specification.

Some future version of this spec may implement some of the following features.

- 1. The spec defines several additions to the Device Tree which enable a debugger to discover hart IDs and supported triggers for all the cores in the system.
- 2. DTMs can function as general bus slaves, so they would look like regular RAM to bus masters.
- 3. Harts can be divided into groups. All the harts in the same group can be halted/run/stepped simultaneously. When a hart hits a breakpoint, all the other harts in the same group also halt within a few clock cycles.
- 4. DTMs are specified for protocols like USB, I2C, SPI, and SWD.
- 5. Core registers can be read without halting the processor.
- 6. The debugger can communicate with the power manager to power cores up or down, and to query their status.
- 7. Serial ports can raise an interrupt when a send/receive queue becomes full/empty.
- 8. The debug interrupt can be masked by running code. If the interrupt is asserted, then deasserted, and then asserted again the debug interrupt happens anyway. This mechanism can be used to eg. read/write memory with minimal interruption, making sure never to interrupt during a critical piece of code.
- 9. The debugger can non-intrusively sample a recent PC value from any running hart.
- 10. The Debug Module can include a serial interface for re-using the DTM interface as a generic communication interface.

C.1 Serial Ports

The Debug Module may implement up to 8 serial ports. They support basic flow control and full duplex data transfer between a component and the debugger, essentially allowing the Debug Transport to be used to communicate with a debug monitor running on a hart, or more generally emulate devices which aren't present. All these uses require software support, and are not further specified here. Only the DMI side of the Debug Module serial registers are defined in this specification as the core side interface should look like a peripheral device.

Table C.1: Debug Module Debug Bus Registers

| Address | Name | Page |
|---------|---------------------------|------|
| 0x34 | Serial Control and Status | 68 |
| 0x35 | Serial TX Data | 69 |
| 0x36 | Serial RX Data | 69 |

C.1.1 Serial Control and Status (sercs, at 0x34)

If serialcount is 0, this register is not present.

| 31 | 28 | 27 | 26 | 24 | 23 | 22 | 21 | 20 | 19 | 18 |
|-----------|----|-------|-------|----|---------|----------|--------|---------|---------|---------|
| serialcou | nt | 0 | seria | I | error 7 | 7 valid7 | full 7 | 7 error | 6 valid | 6 full6 |
| 4 | | 1 | 3 | | 1 | 1 | 1 | 1 | 1 | 1 |
| 17 | | 16 | 15 | | 14 | 13 | 12 | 11 | 10 | 9 |
| error5 | Vā | alid5 | full5 | er | ror4 | valid4 | full4 | error3 | valid3 | full3 |
| 1 | | 1 | 1 | | 1 | 1 | 1 | 1 | 1 | 1 |
| 8 | | 7 | 6 | | 5 | 4 | 3 | 2 | 1 | 0 |
| error2 | Vā | alid2 | full2 | er | ror1 | valid1 | full1 | error0 | valid0 | full0 |
| 1 | | 1 | 1 | | 1 | 1 | 1 | 1 | 1 | 1 |

| Field | Description | Access | Reset | |
|------------------------|--|--------|--------|--|
| serialcount | Number of supported serial ports. | R | Preset | |
| serial | Select which serial port is accessed by serrx and | R/W | 0 | |
| | sertx. | | | |
| error0 | error0 1 when the debugger-to-core queue for serial port | | | |
| | 0 has over or underflowed. This bit will remain | | | |
| | set until it is reset by writing 1 to this bit. | | | |
| valid0 | 1 when the core-to-debugger queue for serial port | R | 0 | |
| | | | | |
| Continued on next page | | | | |

| full0 | 1 when the debugger-to-core queue for serial port | R | 0 |
|-------|---|---|---|
| | 0 is full. | | |

C.1.2 Serial TX Data (sertx, at 0x35)

If serialcount is 0, this register is not present.

This register provides access to the write data queue of the serial port selected by serial in sercs.

If the error bit is not set and the queue is not full, a write to this register adds the written data to the core-to-debugger queue. Otherwise the error bit is set and the write returns error.

A read to this register returns the last data written.



C.1.3 Serial RX Data (serrx, at 0x36)

If serialcount is 0, this register is not present.

This register provides access to the read data queues of the serial port selected by serial in sercs.

If the error bit is not set and the queue is not empty, a read from this register reads the oldest entry in the debugger-to-core queue, and removes that entry from the queue. Otherwise the error bit is set and the read returns error.

This entire register is read-only.



Index

| abits, 52 | datasize, 21 |
|-----------------------------|------------------|
| abstractauto, 26 | dcsr, 35 |
| abstractes, 23 | devtreeaddr0, 26 |
| Access Register, 10 | devtreevalid, 18 |
| ackhavereset, 20 | dmactive, 20 |
| action, 46, 48 | dmcontrol, 19 |
| address, 29, 30, 52 | dmerr, 17 |
| allhalted, 18 | dmi, 52 |
| allhavereset, 17 | dmihardreset, 51 |
| allnonexistent, 18 | dmireset, 51 |
| allresumeack, 18 | dmistat, 52 |
| allrunning, 18 | dmode, 43 |
| allunavail, 18 | dmstatus, 15 |
| anyhalted, 18 | dpc, 37 |
| anyhavereset, 17 | = : |
| anynonexistent, 18 | dscratch0, 38 |
| anyresumeack, 18 | dscratch1, 38 |
| anyrunning, 18 | dtmcs, 51 |
| | ebreakm, 35 |
| anyunavail, 18 authbusy, 18 | ebreaks, 35 |
| • / | ebreaku, 35 |
| authdata, 27 | error0, 68 |
| authenticated, 18 | execute, 47 |
| autoexecdata, 26 | checute, 11 |
| autoexecprogbuf, 26 | field, 2 |
| busy, 24 | full0, 69 |
| BYPASS, 54 | , |
| 211100, 01 | h, 47, 48 |
| cause, 36 | haltreq, 19 |
| chain, 46 | haltsum, 22 |
| cmderr, 24 | hartinfo, 21 |
| cmdtype, 11, 12, 26 | hartreset, 19 |
| command, 24 | hartsel, 20 |
| control, 26 | hasel, 20 |
| count, 47 | hawindow, 23 |
| | hawindowsel, 22 |
| data, 31, 43, 52 | |
| data0, 27 | icount, 47 |
| dataaccess, 21 | IDCODE, 50 |
| dataaddr, 21 | idle, 51 |
| datacount, 24 | impebreak, 17 |

| load, 47 | sertx, 69 |
|---------------------|-----------------|
| 47. 40 | shortname, 2 |
| m, 47, 48 | size, 11 |
| Manufld, 50 | step, 37 |
| maskmax, 44 | stepie, 35 |
| match, 46 | stopcount, 36 |
| mcontrol, 43 | stoptime, 36 |
| 1 | store, 47 |
| ndmreset, 20 | 50510, 11 |
| nscratch, 21 | tdata1, 42 |
| | tdata2, 43 |
| op, 53 | tdata3, 43 |
| Dont Number 50 | timing, 45 |
| PartNumber, 50 | transfer, 11 |
| postexec, 11 | |
| priv, 38 | tselect, 42 |
| progbuf0, 27 | type, 43 |
| progbufsize, 24 | 47 49 |
| prv, 37, 39 | u, 47, 48 |
| | valid0, 68 |
| Quick Access, 12 | |
| 10 | Version, 50 |
| regno, 12 | version, 18, 52 |
| resumereq, 19 | write, 11 |
| 47, 40 | wine, ii |
| s, 47, 48 | xdebugver, 35 |
| sbaccess, 28 | nacous (ci, co |
| sbaccess128, 29 | |
| sbaccess16, 29 | |
| sbaccess32, 29 | |
| sbaccess64, 29 | |
| sbaccess8, 29 | |
| sbaddress0, 29 | |
| sbaddress1, 29 | |
| sbaddress2, 29 | |
| sbasize, 29 | |
| sbautoincrement, 28 | |
| sbautoread, 28 | |
| • | |
| sbcs, 27 | |
| sbdata0, 30 | |
| sbdata1, 31 | |
| sbdata2, 31 | |
| sbdata3, 31 | |
| sberror, 28 | |
| sbsingleread, 28 | |
| select, 45 | |
| sercs, 68 | |
| serial, 68 | |
| serial count, 68 | |
| serrx, 69 | |
| · | |

Appendix D

Change Log

| Revision | Date | Author(s) | Description |
|------------|----------------|-------------|--|
| f7f3277 | 2017-11-28 | Megan Wachs | Merge pull request #183 from riscv/c_ebreak |
| afda8d7 | 2017-11-28 | mwachs5 | update PDF |
| 134d310 | 2017-11-28 | Megan Wachs | Correct compressed version of ebreak |
| 6c7d031 | 2017-11-27 | Megan Wachs | Merge pull request #179 from riscv/step_corners |
| caa1258 | 2017-11-27 | Megan Wachs | badaddr -¿ tval (Priv Spec 1.9 -¿ 1.9.1) |
| 32b0f08 | 2017-11-22 | Tim Newsome | Incorporate feedback. |
| 2 f7 aa 54 | 2017-11-22 | Tim Newsome | Simplify, and explain trigger behavior. |
| 3e5887f | 2017-11-21 | Tim Newsome | Clarify some single step corner cases. |
| f4b9ae2 | 2017-11-21 | Tim Newsome | Make ackhavereset write-only. (#178) |
| efe3dc8 | 2017-11-21 | Tim Newsome | Make hartreset R/W $(#177)$ |
| ce1b359 | 2017-11-17 | Megan Wachs | Reset clarifications (#172) |
| f49bf1d | 2017-11-16 | Tim Newsome | Merge pull request #174 from riscv/context |
| bac9a94 | 2017-11-16 | mwachs5 | Merge remote-tracking branch 'origin/0.13' into con- |
| | | | text |
| 852a70d | 2017-11-16 | Megan Wachs | icount: remove warning (#173) |
| 363348f | 2017-11-16 | Tim Newsome | Explain cache coherency wrt to system bus access |
| | | | (#171) |
| 26ea898 | 2017-11-15 | Tim Newsome | Refer to ISA and priv docs. |
| e803d67 | 2017-11-03 | Tim Newsome | Merge pull request #170 from riscv/index |
| ffc8c62 | 2017-11-03 | Tim Newsome | Mention the index in "about this doc" |
| a4257ef | 2017-11-02 | Tim Newsome | Add an index to the document. |
| f5f45a5 | 2017-10-30 | Megan Wachs | Add 'has reset' status and control (#168) |
| e87fd2d | 2017-10-26 | Tim Newsome | Merge pull request #158 from riscv/bits_not_signals |
| dfe6a49 | 2017 - 10 - 25 | Megan Wachs | Merge branch '0.13' into bits_not_signals |
| 46f3f54 | 2017 - 10 - 25 | Tim Newsome | Incorporate review feedback. |
| 104247 f | 2017-10-24 | Megan Wachs | Update README.md |
| 6dd5c80 | 2017-10-24 | Megan Wachs | Update README.md |
| cb1a847 | 2017-10-24 | Megan Wachs | Add a note to the README about the built PDF |
| 9e1fe79 | 2017-10-19 | Tim Newsome | Merge pull request #167 from riscv/include_pdf |
| e00625f | 2017-10-18 | Tim Newsome | Include pdf. |
| 3ea45f1 | 2017-10-18 | Megan Wachs | Merge branch '0.13' into bits_not_signals |

| c23e729 | 2017-10-18 | Tim Newsome | Clarify more. |
|---------------------|----------------|-------------|---|
| 6 cab 794 | 2017-10-12 | Tim Newsome | Merge pull request #162 from riscv/impebreak |
| ecdaf0a | 2017-10-11 | Megan Wachs | Merge branch '0.13' into impebreak |
| 83f9faf | 2017-10-11 | Tim Newsome | Clarify what impebreak does. |
| $58 \mathrm{fdc0e}$ | 2017-10-11 | Megan Wachs | Merge pull request #164 from riscv/legend_on_fig |
| 5f3933f | 2017-10-11 | Tim Newsome | Merge branch 'impebreak' of github.com:riscv/riscv- |
| | | | debug-spec into impebreak |
| 78082b5 | 2017-10-11 | Tim Newsome | Mention impebreak in Program Buffer description. |
| 0378324 | 2017-10-11 | mwachs5 | Add legend and update some transitions on the Ab- |
| | | | stract Command State Machine diagram |
| a418a25 | 2017-10-11 | Megan Wachs | Merge branch '0.13' into impebreak |
| d1c895a | 2017-10-11 | Megan Wachs | Merge pull request #161 from riscv/no_h_mode_fig |
| f9981e8 | 2017-10-11 | Megan Wachs | Merge branch '0.13' into no_h_mode_fig |
| ae30fc1 | 2017-10-11 | Megan Wachs | Merge pull request #163 from riscv/fix_build |
| fa2b600 | 2017-10-11 | Megan Wachs | add missing period |
| 0610630 | 2017-10-11 | Megan Wachs | Just do simple hmode -¿ dmode replacement |
| 16e11f3 | 2017-10-11 | Tim Newsome | Remove hmode reference, to fix build. |
| 84b 9 a 6 a | 2017-10-11 | Tim Newsome | Add impebreak, to support of implicit ebreak. |
| cc90b77 | 2017-10-11 | mwachs5 | Remove reference to 'H' mode from the figure |
| cc6a9de | 2017-10-11 | Megan Wachs | Change old reference to 'hmode' to 'dmode' |
| 4a9e017 | 2017-10-10 | Tim Newsome | Merge branch 'bits_not_signals' of |
| | | | github.com:riscv/riscv-debug-spec into |
| | | | bits_not_signals |
| ea2877d | 2017-10-10 | Tim Newsome | Move how-to-debug into the relevant section. |
| d7b9f4c | 2017-10-06 | Megan Wachs | Merge branch '0.13' into bits_not_signals |
| 48f437b | 2017-10-06 | Megan Wachs | Merge pull request #159 from riscv/unsup- |
| | | | ported_access_size |
| 24f0494 | 2017-10-06 | Tim Newsome | Merge branch '0.13' into unsupported_access_size |
| 812686d | 2017-10-06 | Tim Newsome | Merge pull request $#157$ from riscv/reset |
| 486ecc 6 | 2017-10-05 | Tim Newsome | Refuse unsupported bus accesses. |
| 6ca221d | 2017-10-05 | Tim Newsome | haltreq, resumereq, hartreset are per-hart bits |
| c9cdf9e | 2017-10-05 | Tim Newsome | Merge branch '0.13' into reset |
| 2be57af | 2017-10-04 | Tim Newsome | Merge pull request #128 from riscv/connector |
| d16b390 | 2017-10-04 | Tim Newsome | Merge branch '0.13' into connector |
| d4118ab | 2017-09-30 | Tim Newsome | ndmreset can't reset logic required to access DM. |
| d569387 | 2017-09-29 | Tim Newsome | Merge pull request #154 from riscv/nikhil |
| 2a47bd1 | 2017-09-29 | Tim Newsome | Merge branch '0.13' into nikhil |
| 6269d9d | 2017-09-29 | Tim Newsome | Merge pull request #132 from riscv/progbufsize |
| c6bd8d1 | 2017-09-29 | Tim Newsome | and -¿ or |
| 58c2441 | 2017-09-29 | Tim Newsome | Mention stepie in Single Step |
| 94c5f78 | 2017-09-29 | Tim Newsome | Clarify ndmreset. |
| 12810b4 | 2017-09-29 | Tim Newsome | Clarify that shaddress is physical. |
| 5862 fdf | 2017-09-29 | Tim Newsome | Unify M mode and mprv comment. |
| aea1bd5 | 2017-09-29 | Tim Newsome | Define behavior when haltreq and resumereq are set |
| fe76d39 | 2017-09-28 | Megan Wachs | Merge branch '0.13' into progbufsize |
| 146b348 | 2017-09-28 | Megan Wachs | remove superflous 'an' |
| a5d16c4 | 2017-09-28 | Megan Wachs | remove superfluous 'a' |
| 052a8ab | 2017 - 09 - 28 | Tim Newsome | Clarify that a debugger can lose hart control. |
| | | | |

| ro-œ | 2017 00 20 | T: N | A 11 decem |
|-----------|----------------|-------------------------|--|
| cc52cff | 2017-09-28 | Tim Newsome | Add dmerr. |
| 25685eb | 2017-09-28 | Tim Newsome | Explain that bus master or progbuf is required. |
| f75ee7d | 2017-09-28 | Tim Newsome | Clarify debugger can discover "almost" everything |
| 71e6788 | 2017-09-27 | Tim Newsome | Remove description of manual stepping. |
| 9aea347 | 2017-09-27 | Tim Newsome | Move Running/Single Step near Halting. |
| 2090d9b | 2017-09-27 | Tim Newsome | data0 should be sbdata0 in this table. |
| 5858cfe | 2017-09-27 | Tim Newsome | Clarify why priv exists. |
| bc3c2aa | 2017 - 09 - 27 | Tim Newsome | Mention where priv encoding comes from. |
| ef77cc4 | 2017 - 09 - 27 | Tim Newsome | One more attempt to clarify DPC after single step. |
| 80a288e | 2017-09-27 | Tim Newsome | Clarify instret not incrementing on ebreak. |
| 4359b78 | 2017 - 09 - 27 | Tim Newsome | Merge pull request #152 from riscv/nikhil |
| c163d22 | 2017-09-20 | Tim Newsome | Remove ebreakh. |
| 9971075 | 2017-09-20 | Tim Newsome | Clarify we're talking about privilege |
| 3 fbe 495 | 2017-09-20 | Tim Newsome | Clarify that we're talking about *implementation* |
| 3684854 | 2017-09-20 | Tim Newsome | Use steps environment in sbdata0. |
| d4eda18 | 2017-09-20 | Tim Newsome | Explain that only sbdata0 has side effects. |
| ae781c6 | 2017-09-20 | Tim Newsome | Don't refer to internal system bus registers. |
| 875922e | 2017-09-20 | Tim Newsome | Explain sbdata0 being stale a bit more. |
| cd44fd5 | 2017-09-20 | Tim Newsome | Clarify autoread |
| 194484b | 2017-09-20 | Tim Newsome | Clarify hawindow. |
| 02f1aac | 2017-09-20 | Tim Newsome | Clarify that dataaddr is relative to zero. |
| 0e9b6ae | 2017-09-20 | Tim Newsome | Clarify nonexistent vs unavailable. |
| b55ff41 | 2017-09-20 | Tim Newsome | Fix devtreevalid. |
| 4325ef8 | 2017-09-20 | Megan Wachs | Merge branch '0.13' into progbufsize |
| 2eccb86 | 2017-09-20 | Tim Newsome | Explicitly state which registers are read-only. |
| 4af505c | 2017-09-20 | Tim Newsome | Show section numbers for registers. |
| cbd5573 | 2017-09-20 | Tim Newsome | Thank Nikhil |
| 19c206f | 2017-09-20 | Tim Newsome | Clarify how to determine whether progbuf is RAM |
| 0651f7d | 2017-09-20 | Tim Newsome | Explain what happens if ebreak is missing. |
| e889dae | 2017-09-20 | Tim Newsome | Move figure of states into its own section. |
| cff7b80 | 2017-09-20 | Tim Newsome Tim Newsome | Explain when transfer might be used. |
| 6b2ee61 | 2017-09-20 | Tim Newsome Tim Newsome | |
| | | | Explain where size encoding came from. |
| 900d8ab | 2017-09-20 | Tim Newsome | Merge pull request #145 from riscv/nikhil |
| c9f3b73 | 2017-09-14 | Tim Newsome | Fix typo. |
| 4b25400 | 2017-09-13 | Tim Newsome | Mention dpc in CSRs abstract register numbers. |
| c3ee426 | 2017-09-13 | Tim Newsome | Move abstract regno table closer to its reference. |
| 111b9a3 | 2017-09-13 | Tim Newsome | cycle -; operation |
| 994afdc | 2017-09-13 | Tim Newsome | Account for multiple selected harts. |
| aa4a297 | 2017-09-13 | Tim Newsome | Halt Control -¿ Run Control |
| e97c821 | 2017-09-13 | Tim Newsome | continuous -¿ contiguous |
| 97f73ff | 2017-09-13 | Tim Newsome | Clarify ndmreset behavior. |
| 6078220 | 2017-09-13 | Tim Newsome | Explain ndmreset |
| a3d4f30 | 2017-09-13 | Tim Newsome | Describe 'halt region' |
| 272b3d9 | 2017-09-13 | Tim Newsome | Clarify accessing unimplemented DM DMI regs |
| 3e91f1b | 2017-09-13 | Tim Newsome | Clarify either Prog Buf or Sys Bus Acc is required |
| e8a6145 | 2017-09-13 | Tim Newsome | Clarify CSR access; remove serial port |
| ce20766 | 2017-09-13 | Tim Newsome | Remove section referencing itself. |
| 1195a61 | 2017-09-18 | Tim Newsome | Generate constants to be unsigned for clang. |

| ba200ab | 2017 00 10 | Magan Washa | Manage hampel 20 122 into programa |
|-----------|------------|----------------------------|--|
| | 2017-08-18 | Megan Washs | Merge branch '0.13' into progbufsize |
| 8967b0a | 2017-08-16 | Megan Wachs Megan Wachs | Compressed instructions are c.foo, not foo.c |
| b5698a9 | 2017-08-16 | O | clarify progbufsize description |
| d221bab | 2017-08-16 | Megan Wachs | Remove progbufsize enums from register description |
| d232d64 | 2017-08-16 | Megan Wachs | Merge pull request #134 from riscv/sw-examples- |
| 0.4001.00 | 2017 00 10 | 3.6 337 1 | cleanup |
| 0498102 | 2017-08-16 | Megan Wachs | appendix: Use standard assembly format for sw |
| 6e20373 | 2017-08-15 | Megan Wachs | Merge pull request #131 from riscv/devtree |
| 50ea40c | 2017-08-15 | Megan Wachs | Merge branch '0.13' into devtree |
| 4e51a25 | 2017-08-10 | Tim Newsome | Merge pull request #130 from riscv/trigsign |
| 4456d99 | 2017-08-09 | Tim Newsome | Rename progsize to progbufsize. |
| 55d5b66 | 2017-08-09 | Tim Newsome | Clarify that trigger comparisons are unsigned. |
| 21e35ef | 2017-08-09 | Tim Newsome | Configuration String -; Device Tree |
| dc52f28 | 2017-08-03 | Megan Wachs | Merge pull request $#127$ from riscv/cmdtype |
| f044f45 | 2017-08-02 | Tim Newsome | Don't require a target to provide 25mA on VCC. |
| c883943 | 2017-08-02 | Tim Newsome | Add table of Abstract Command Types |
| d6b8148 | 2017-08-02 | Tim Newsome | Merge pull request #123 from riscv/lists |
| 71f5cb2 | 2017-08-02 | Tim Newsome | Merge branch '0.13' into lists |
| b83af70 | 2017-08-02 | Megan Wachs | Merge pull request #125 from riscv/no_dmi_error |
| 2a41bd8 | 2017-08-02 | Megan Wachs | Merge branch '0.13' into no_dmi_error |
| 9c73ce8 | 2017-08-02 | Megan Wachs | Merge pull request #111 from riscv/dpc |
| a814400 | 2017-08-02 | Tim Newsome | Merge branch '0.13' into dpc |
| 8bdc5cd | 2017-08-02 | Tim Newsome | Merge pull request #126 from riscv/build |
| 985a3df | 2017-08-02 | Tim Newsome | Fix and speed up build. |
| 95b9108 | 2017-08-02 | mwachs5 | DTM: Clarify that there are no cases when DMI |
| | | | would actually return an error. |
| 9c9e0c0 | 2017-08-02 | mwachs5 | SystemBus: No longer returns error. So DMI has no |
| | | | 'error' return code. |
| ae1e9e4 | 2017-07-28 | Tim Newsome | Merge branch '0.13' into dpc |
| 5ba18f9 | 2017-07-27 | Tim Newsome | Fix more typos. |
| c6fef98 | 2017-07-26 | Tim Newsome | Merge pull request #122 from riscv/version |
| dbc65bf | 2017-07-26 | Tim Newsome | Fix typos. |
| bba0ad9 | 2017-07-26 | Tim Newsome | Tighten up introduction lists. |
| e22d5eb | 2017-07-26 | Tim Newsome | Add version constants for "not compatible". |
| c79038e | 2017-07-26 | Tim Newsome | Small clarification. |
| 9df0411 | 2017-07-20 | Tim Newsome Tim Newsome | Incorporate review feedback. |
| d67419c | 2017-07-21 | Tim Newsome Tim Newsome | Clarify dpc contents. |
| | | | • • |
| c562898 | 2017-07-11 | Tim Newsome | Merge pull request #109 from riscv/ll |
| 498cdf4 | 2017-07-11 | Megan Wachs | Merge branch '0.13' into ll |
| 0e707f1 | 2017-07-11 | Megan Wachs | Merge pull request #105 from |
| 0.10.4665 | 0017 07 11 | T: N | riscv/quick_access_errors |
| 2d34f65 | 2017-07-11 | Tim Newsome | Merge branch '0.13' into ll |
| a56831c | 2017-07-11 | Megan Wachs | Merge branch '0.13' into quick_access_errors |
| 65d596e | 2017-07-11 | Megan Wachs | Merge pull request #106 from riscv/er- |
| 0.00 | | m, 17 | ror_halt_resume |
| 9f50c05 | 2017-07-11 | Tim Newsome | Use LL instead of L for 64-bit constant suffix. |
| 23fd24a | 2017-07-10 | Megan Wachs | Cleaning up whitespaces |
| 102ba67 | 2017-07-10 | Megan Wachs | Merge branch '0.13' into error_halt_resume |
| | | | |

| 1500505 | 2015 05 10 | 3.6 337 1 | 3.f 11 //107.6 · / · 11.11.11. |
|----------------|------------|------------------|--|
| 1720505 | 2017-07-10 | Megan Wachs | Merge pull request #107 from riscv/csr_individuality |
| d67f6ef | 2017-07-10 | Megan Wachs | Merge branch '0.13' into csr_individuality |
| c1e61b0 | 2017-07-10 | Megan Wachs | Merge pull request #108 from riscv/dcsr_causes |
| c5ab04c | 2017-07-10 | Megan Wachs | Update abstract_commands.xml |
| 6e8cdf1 | 2017-07-10 | Megan Wachs | Update abstract_commands.xml |
| cf6e3f2 | 2017-07-10 | Megan Wachs | clarify DCSR.cause |
| 79ffbb9 | 2017-07-10 | Megan Wachs | Clarify implications of CSR read, write, halt |
| 013e191 | 2017-07-10 | Megan Wachs | Clarify when you would get error halt/resume |
| 231e457 | 2017-07-10 | Megan Wachs | Quick Access error clarification |
| 7c760b0 | 2017-07-03 | Megan Wachs | Merge pull request #104 from riscv/se- |
| | | 9 | rial_to_appendix |
| c54c2f2 | 2017-07-03 | mwachs5 | serial: add the XML file, not the TEX file |
| ac77477 | 2017-07-03 | mwachs5 | serial: Fix compile errors after moving serial port to |
| acr1111 | 2011 01 00 | III W GOILD O | appendix |
| 6defcb8 | 2017-07-03 | mwachs5 | serial: Move serial ports out of main spec and into |
| odelebo | 2011 01 00 | III W delibo | Future Work appendix |
| 3541152 | 2017-07-03 | Megan Wachs | Merge pull request #102 from riscv/remove_trace |
| a28f639 | 2017-06-30 | mwachs5 | remove trace dependencies from Makefile |
| 52a122b | 2017-06-30 | mwachs5 | remove trace dependencies from wakeme remove trace section |
| | | | |
| d9e166b | 2017-06-30 | mwachs5 | remove trace registers |
| 7caf 4 e 5 | 2017-06-30 | mwachs5 | remove trace appendix |
| aff0c16 | 2017-06-30 | Megan Wachs | Merge pull request #82 from riscv/intdisable |
| 4688988 | 2017-06-29 | mwachs5 | DCSR: define a 'stepie' bit which may be hard-wired |
| | | | to 0. |
| 443b3fe | 2017-06-29 | mwachs5 | Merge remote-tracking branch 'origin/0.13' into int- |
| | | | disable |
| 497ed95 | 2017-06-29 | Megan Wachs | Merge pull request #96 from riscv/j- |
| | | | $tagdtm_non_appendix$ |
| f1488c4 | 2017-06-29 | Megan Wachs | Merge branch '0.13' into jtagdtm_non_appendix |
| 920ec9a | 2017-06-13 | Megan Wachs | Merge pull request #95 from riscv/re- |
| | | | move_spontaneous |
| 67 fa 7 b 0 | 2017-06-13 | Megan Wachs | Merge branch '0.13' into remove_spontaneous |
| 78eb 65 e | 2017-06-13 | Megan Wachs | Merge pull request #94 from riscv/anynonexistent |
| d97b296 | 2017-06-13 | Megan Wachs | Merge branch '0.13' into anynonexistent |
| 61c6d30 | 2017-06-13 | Megan Wachs | Merge pull request #93 from riscv/define-dret-again |
| 389ee69 | 2017-06-13 | Megan Wachs | Merge branch '0.13' into define-dret-again |
| 421dcf2 | 2017-06-13 | Megan Wachs | Merge pull request #97 from riscv/implementa- |
| 1214012 | 2011 00 10 | 1710Sall Tracile | tion_deets |
| 9a0492c | 2017-06-13 | Megan Wachs | Add missing period and some other small text edits |
| 13ccdbf | 2017-06-13 | Megan Wachs | fix typo in ProgBuf register macro |
| b01f989 | 2017-06-13 | mwachs5 | implementations: be a bit more concrete about the |
| 0011909 | 2017-00-13 | mwacusə | |
| a7h5f02 | 2017 06 12 | myya ahat | one example implementation we have. |
| a7b5f83 | 2017-06-13 | mwachs5 | jtagdtm: Move it out of the appendix as it is really |
| 05 10 | 2017 02 12 | 3.4 337 1 | part of the specification |
| 87aceb0 | 2017-06-13 | Megan Wachs | remove "spontaneous" |
| 50b9950 | 2017-06-13 | Megan Wachs | Forward reference for anynonexistent |
| adea3e2 | 2017-06-13 | Megan Wachs | More clarifications on dret |
| 1b8dd0e | 2017-06-13 | Megan Wachs | Define DRET instruction |
| | | | |

| b4f1f43 2017-06-08 Tim Newsome Merge pull request # | 79 from riscv/cleanups |
|--|------------------------------------|
| | ng branch 'origin/0.13' into |
| cleanups | 6 , |
| 617da4c 2017-06-08 Megan Wachs Update description of | f R/W1C |
| | also not updated on ebreak |
| | eld size to 4 bits. (#92) |
| a0e147a 2017-06-07 Tim Newsome Address some review | *** |
| c1b3e54 2017-06-07 Megan Wachs Merge pull request # | 91 from riscv/ndmreset |
| 5c7c1bb 2017-06-07 Tim Newsome Merge branch '0.13' in | • |
| 72bb874 2017-06-06 Megan Wachs Merge branch '0.13' in | _ |
| | 90 from riscv/dpc_clarifications |
| 89ffe50 2017-06-06 mwachs5 NDMRESET: Clarify | what it may and may not do |
| 1932da0 2017-06-06 mwachs5 DPC: Clarifications of | n its meaning |
| 03bcafe 2017-06-06 Megan Wachs Merge pull request #8 | 89 from riscv/datacount |
| | rect inconsistency on the num- |
| ber of data words. | - |
| 1f4a1fe 2017-06-06 Megan Wachs Merge pull request #8 | 88 from riscv/W0_corrections |
| 3ca82b4 2017-06-06 Megan Wachs More corrections for H | R vs R/W1C on SERCS |
| 9705fb8 2017-06-06 Megan Wachs Correct a bunch of W | 70 registers |
| 1058690 2017-06-05 Megan Wachs Merge branch '0.13' in | nto intdisable |
| 7531c41 2017-06-05 Megan Wachs Merge pull request $\#8$ | 80 from riscv/issue76 |
| 1347371 2017-06-05 Tim Newsome Add intdisable to dcsr | r. |
| 850bd87 2017-06-05 Megan Wachs Merge branch '0.13' in | nto issue76 |
| 43307eb 2017-06-05 Megan Wachs Merge pull request $\#$ 8 | 81 from riscv/issue63 |
| 989c60d 2017-06-05 Tim Newsome Fix language. We can | only halt harts, not cores. |
| 517a08b 2017-06-05 Tim Newsome Incorporate review fee | edback. |
| 802be28 2017-06-05 Tim Newsome Clarify/fix Quick Acc | ess example. |
| dbcaec8 2017-06-02 Tim Newsome Merge branch '0.13' in | nto cleanups |
| b8cc523 2017-06-02 Tim Newsome Add included tex files | s as dependencies. (#78) |
| d0a5959 2017-06-02 Tim Newsome Merge pull request $\#$ | 77 from riscv/pageno |
| 15f864a 2017-06-01 Tim Newsome Language cleanups, co | onsistency and typo fixes. |
| 4ecae86 2017-06-01 Tim Newsome Add page numbers to | list-of-register tables. |
| 59b3e4a 2017-05-19 Megan Wachs Setting up a Travis reg | gression to check for build errors |
| (#72) | |
| 124bf44 2017-05-17 mwachs5 Debug Module: CMI | DERR is Write-1-to clear, not |
| m R/W0 | |
| bb6c7f0 2017-05-17 mwachs5 SW Registers file show | uld be XML, not TEX |
| d360358 2017-05-10 Megan Wachs Remove virtual register | er from core_registers.xml |
| (Temporary | |
| Acct.) | |
| bfc64fb 2017-05-10 Megan Wachs Add missing sw_regist | ters.tex file |
| (Temporary | |
| Acct.) | |
| 0512f5d 2017-05-06 mwachs5 Move virtual 'prv' re | egister to a seperate section to |
| make it more clear it | is not a real register. |
| 6b3c9d7 2017-05-06 mwachs5 Clarify haltreq/resum | nereq/resumack |
| 0a487eb 2017-04-26 mwachs5 jtag: Change specified | d JTAG pinout from Coretex to |
| AVR, to provide for T | TRSTn option. |

| 93cdfaf | 2017-04-26 | mwachs5 | DM : Clarify that DATA/PROGBUF can't be writ- |
|-----------------------------|------------|---------|---|
| | | | ten while busy. |
| ef98f23 | 2017-04-19 | mwachs5 | jtag: Make it clear that a NOP is really a NOP. |
| a6f8efa | 2017-04-17 | mwachs5 | single_step: Exceptions count as the 'step' completion. |
| bf11e9e | 2017-04-17 | mwachs5 | resumeack: fix some LaTeX cross references |
| 4afa081 | 2017-04-11 | mwachs5 | halt/resumereq: Clarify what setting them to 0 or 1 does |
| 297a39b | 2017-04-06 | mwachs5 | fix chisel build |
| 082c499 | 2017-04-06 | mwachs5 | Rename resumed to resumeack, and add more text about what these bits mean. |
| 909d617 | 2017-04-06 | mwachs5 | Correct some cross references after removing all the multiply listed registers |
| dd09914 | 2017-04-06 | mwachs5 | Add 'resumedall' and 'resumedany' bits to avoid race condition on about to resume and just halted |
| feb88fc | 2017-04-05 | mwachs5 | JTAG DTM: Clarify that leading bits are 0 for more than 5-bit IR |
| 75b 96 ea | 2017-04-04 | mwachs5 | use renamed dm_registers file |
| 9f3ec7e | 2017-04-04 | mwachs5 | debugger_implementation: remove some old TODO and commentary. |
| 45dd5b5 | 2017-04-04 | mwachs5 | Don't list out every single DM register for those that are just indexed versions |
| b8b3aa2 | 2017-04-04 | mwachs5 | remove core-side register definitions from Debug Module. Rename dm1 to dm |
| d979a13 | 2017-04-04 | mwachs5 | remove core-side serial port specification, as these should look like implementation-specific devices with appropriate drivers. |
| b56870b | 2017-04-04 | mwachs5 | Remove the wording about 'debug exception', as it is called breakpoint exception in the RISC-V Spec. |
| $1\mathrm{e}9347\mathrm{d}$ | 2017-04-03 | mwachs5 | Add description of hasel |
| 0 dda 84 d | 2017-04-03 | mwachs5 | JTAG DTM: Clean up TAP register descriptions |
| 82ccde5 | 2017-04-03 | mwachs5 | JTAG DTM: Add a hard DMI bit which cancels the outstanding DMI transaction |
| bd2a3d1 | 2017-04-03 | mwachs5 | remove preexec |
| 02c733a | 2017-04-03 | mwachs5 | remove preexec from Abstract State diagram. |
| 1e271d6 | 2017-04-03 | mwachs5 | Update Debugger implementation for DMI register access, and fix tex compile issues. |
| 155dda4 | 2017-04-03 | mwachs5 | Rewrite HW Implementation examples to describe a pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module |
| 556c2be | 2017-04-03 | mwachs5 | minor wording edits about RISC-V core registers |
| 523c64a | 2017-04-03 | mwachs5 | Edits to the Debug Module section. |
| b9a371f | 2017-04-03 | mwachs5 | add missing trace.tex file. |
| 58b2396 | 2017-04-03 | mwachs5 | Re-order the JTAG DTM Sections |
| a8827e2 | 2017-04-03 | mwachs5 | Edits to the System Overview. |
| c5417ce | 2017-04-03 | mwachs5 | add more sections as seperate files. |
| 287d5c6 | 2017-04-03 | mwachs5 | moving more files to seperate tex files. |

| 9e873f4 | 2017-04-03 | mwachs5 | moves this gap into gap crots file |
|--------------------------|-------------|--------------|--|
| $\frac{9687314}{268986}$ | 2017-04-03 | mwachs5 | move trigger info into seperate file. |
| e676491 | | mwachs5 | move risc-v core debug info into seperate file. |
| | 2017-04-03 | | Move System Overview to separate file |
| 03df6ee | 2017-04-03 | mwachs5 | Move Debug Module description to a seperate file. |
| 5faa430 | 2017-04-03 | mwachs5 | add back in JTAG DTM in appendix |
| 7b28b11 | 2017-04-03 | mwachs5 | Move jtag DTM to appendix. Move some text to |
| 1001 | 2017 04 02 | 1 - | commentary. |
| cc183ba | 2017-04-03 | mwachs5 | move introduction to a seperate file. Comment out |
| 2 22222 | 201 = 24.02 | 1 ~ | reading order. |
| 2c83830 | 2017-04-03 | mwachs5 | Merge remote-tracking branch 'origin/0.13' into 0.13 |
| e3cf6ab | 2017-04-03 | Megan Wachs | Merge pull request #18 from riscv/intro_edits |
| 60c5a1c | 2017-04-03 | Megan Wachs | Merge branch '0.13' into intro_edits |
| f727d14 | 2017-04-03 | mwachs5 | Use Chapters vs Sections. Needs reorganization. |
| 815951d | 2017-04-03 | mwachs5 | Formatting updates. Make this look more like the |
| | | | RISC-V specs. Need to use chapter vs. section |
| 69ffaf8 | 2017-03-31 | mwachs5 | Move XML files into a subdirectory. |
| b276384 | 2017-03-31 | mwachs5 | Remove debug_rom.S |
| 112bbac | 2017-03-31 | mwachs5 | figures: reorganize the figures into directories. |
| 2d05746 | 2017-03-31 | Megan Wachs | Merge pull request #50 from riscv/add_license |
| 1e5c068 | 2017-03-27 | Megan Wachs | Add LICENSE |
| 0e2d08a | 2017-03-22 | Megan Wachs | Merge pull request #47 from poweihuang17/0.13 |
| fc17730 | 2017-03-22 | Po-wei Huang | Change some halt mode into debug mode. |
| 8ccf029 | 2017-03-22 | Po-wei Huang | All halt mode changed to debug mode to synchronize |
| a | | | with the priv spec. |
| f143d9e | 2017-03-21 | mwachs5 | Correct duplicated progbuf register names |
| 0797ec1 | 2017-03-17 | mwachs5 | autoexec: make autoexec bits match the number of |
| | | | data words there really are. |
| 8e76d93 | 2017-03-17 | mwachs5 | dm1_registers: move a few more things around. Re- |
| | | | duce abstract data words back to 12. |
| f8bf292 | 2017-03-17 | mwachs5 | dm1_registers: resolve some address conflicts and in- |
| | | | consistencies |
| a74dff9 | 2017-03-17 | mwachs5 | access_register: some small bit changes |
| 2e6b0ca | 2017-03-15 | mwachs5 | config string: Fix LaTeX compile errors. |
| f83260a | 2017-03-10 | mwachs5 | Abstract Commands: clarify that 32-bit reads should |
| 0.600 1 = | 201-02-10 | , ~ | always work. This allows reading MISA. |
| 6f9347a | 2017-03-10 | mwachs5 | Config String: change the Abstract Command to |
| | | | DMI registers. Allow the same registers to be used |
| | | | for unspecified identifier information. |
| 4ea10ff | 2017-03-10 | mwachs5 | abstract: Make autoexec apply to all data and prog- |
| | | | buf words. Make a seperate register which is optional. |
| 5008436 | 2017-03-10 | mwachs5 | abstract: Allow up to 16 progbuf and/or data words. |
| | | | Inform debugger about dscratch registers available |
| | | | for its use. |
| aaa13e5 | 2017-03-06 | mwachs5 | Command: use the name 'cmdtype' not 'type' to al- |
| | | | low easier auto-generation of Scala code. |
| e9bb72c | 2017-03-06 | mwachs5 | Hart Array: Add registers for hart array. |
| 5d17a35 | 2017-03-06 | mwachs5 | DM: Move addresses around for better seperation of |
| | | | functionalities in HW |

| 45ef6c2 | 25ccaa8 | 2017-03-06 | mwachs5 | CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their |
|--|--------------|----------------|-------------|---|
| b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual addresses. 793bb85 2017-03-03 mwachs5 triggers: Add suggested timings for best user experience. 2669866 2017-03-03 mwachs5 stoptime/stopcycle: Make their functionality match their name. Allow any reset value. c85a1cf 2017-03-01 mwachs5 config.string: Simplify the Config String Address abstract command. a303a6b 2017-03-01 Megan Wachs Update README.md 1951ae3 2017-03-01 Megan Wachs Merge pull request #35 from sifive/generate_chisel 262dc28 2017-03-01 mwachs5 Merge pull request #34 from sifive/serial_addrs c087c34 2017-03-01 mwachs5 serial: tweak addresses. 6477837 2017-03-01 mwachs5 serial: tweak addresses. 6477837 2017-02-28 Tim Newsome Clarify stoptime, stopcycle. 7594662 2017-02-27 Tim Newsome Acknowledge Alex. 617c17c 2017-02-27 Tim Newsome Explain tdatal type a bit more. 613c2e0 2017-02-21 Tim Newsome Clarify how to enumerate triggers | 45cf6c2 | 2017-03-06 | mwachs5 | Errors: fix up the bit assignments in SERSTATUS |
| | 38cb5a0 | 2017-03-06 | mwachs5 | Errors: Make errors write-1-to-clear. |
| ence. ence | b436d77 | 2017-03-03 | mwachs5 | |
| c85a1cf 2017-03-01 mwachs5 their name. Allow any reset value. c85a1cf 2017-03-02 mwachs5 config.string: Simplify the Config String Address abstract command. a303a6b 2017-03-01 Megan Wachs Update README.md 1951ac3 2017-03-01 Megan Wachs Merge pull request #35 from sifive/generate.chisel c087c34 2017-03-01 mwachs5 Merge remote-tracking branch 'origin/0.13' into generate.chisel 92a4923 2017-03-01 mwachs5 serial: tweak addresses. 6477837 2017-03-01 mwachs5 serial: tweaks to class names. be83e3e 2017-02-27 mwachs5 Merge remote-tracking branch 'origin/0.13' into generate.chisel c17c17c 2017-02-27 mwachs5 Merge remote-tracking branch 'origin/0.13' into generate.chisel c17c17c 2017-02-27 Tim Newsome Abstract command that returns config string addr. c63e3e2 2017-02-24 Tim Newsome Explain tdata1 type a bit more. c43ac2 2017-02-24 Tim Newsome Clarify how to enumerate triggers again. c663e20 2017-02-23 Tim Newsome Revert previ | 793bb85 | 2017-03-03 | mwachs5 | |
| stract command. | 2669866 | 2017-03-03 | mwachs5 | _ , |
| 1951ae3 2017-03-01 Megan Wachs Merge pull request #35 from sifive/generate_chisel 2e2dc28 2017-03-01 megan Wachs Merge pull request #34 from sifive/serial_addrs c087c34 2017-03-01 mwachs5 Merge remote-tracking branch 'origin/0.13' into generate_chisel 92a4923 2017-03-01 mwachs5 serial: tweak addresses. 6477837 2017-03-01 mwachs5 chisel: tweaks to class names. be83e3e 2017-02-27 Tim Newsome Clarify stoptime, stopcycle. 647682 2017-02-27 Tim Newsome Abstract command that returns config string addr. 096dfbc 2017-02-27 Tim Newsome Explain tdatal type a bit more. c0253ab 2017-02-24 Tim Newsome Explain tdatal type a bit more. c63e20 2017-02-23 Tim Newsome Revert previous commit. ef770bf 2017-02-23 Tim Newsome meontrol and icount mask tdata2, not tdata1. e780f2 2017-02-23 mwachs5 Generate Chisel headers as well for Debug Module. 846798d 2017-02-22 mwachs5 Generate Chisel headers as well for Debug Module. | c85a1cf | 2017-03-01 | mwachs5 | |
| 1951ae3 2017-03-01 Megan Wachs Merge pull request #35 from sifive/generate_chisel 2e2dc28 2017-03-01 megan Wachs Merge pull request #34 from sifive/serial_addrs c087c34 2017-03-01 mwachs5 Merge remote-tracking branch 'origin/0.13' into generate_chisel 92a4923 2017-03-01 mwachs5 serial: tweak addresses. 6477837 2017-03-01 mwachs5 chisel: tweaks to class names. be83e3e 2017-02-27 Tim Newsome Clarify stoptime, stopcycle. 647682 2017-02-27 Tim Newsome Abstract command that returns config string addr. 096dfbc 2017-02-27 Tim Newsome Explain tdatal type a bit more. c0253ab 2017-02-24 Tim Newsome Explain tdatal type a bit more. c63e20 2017-02-23 Tim Newsome Revert previous commit. ef770bf 2017-02-23 Tim Newsome meontrol and icount mask tdata2, not tdata1. e780f2 2017-02-23 mwachs5 Generate Chisel headers as well for Debug Module. 846798d 2017-02-22 mwachs5 Generate Chisel headers as well for Debug Module. | a303a6b | 2017-03-02 | Megan Wachs | Update README.md |
| 2e2dc28 2017-03-01 Megan Wachs Merge pull request #34 from sifive/serial.addrs c087c34 2017-03-01 mwachs5 Merge remote-tracking branch 'origin/0.13' into generate.chisel 92a4923 2017-03-01 mwachs5 serial: tweak addresses. 6477837 2017-03-01 mwachs5 chisel: tweaks to class names. be83e3e 2017-02-28 Tim Newsome Clarify stoptime, stopcycle. 794662 2017-02-27 mwachs5 Merge remote-tracking branch 'origin/0.13' into generate.chisel c17c17c 2017-02-27 Tim Newsome Abstract command that returns config string addr. 096dfbc 2017-02-27 Tim Newsome Explain tdatal type a bit more. c0253ab 2017-02-24 Tim Newsome Explain tdatal type a bit more. c63e20 2017-02-23 Tim Newsome Revert previous commit. ef770bf 2017-02-23 Tim Newsome Revert previous commit. e43ac2e 2017-02-23 mwachs5 Add Abstract Commands to automatic chisel 2780f2 2017-02-23 mwachs5 Add Abstract Commands to automatic chisel 38bb93 <td>1951ae3</td> <td>2017-03-01</td> <td>_</td> <td>-</td> | 1951ae3 | 2017-03-01 | _ | - |
| erate_chise 92a4923 2017-03-01 mwachs5 serial: tweak addresses. b09f460 2017-03-01 mwachs5 serial: tweak addresses. 6477837 2017-03-28 mwachs5 chisel: tweaks to class names. be83e3e 2017-02-28 Tim Newsome Clarify stoptime, stopcycle. rf94662 2017-02-27 mwachs5 Merge remote-tracking branch 'origin/0.13' into generate_chisel c17c17c 2017-02-27 Tim Newsome Abstract command that returns config string addr. 096dfbc 2017-02-27 Tim Newsome Acknowledge Alex. 0253ab 2017-02-24 Tim Newsome Explain tdatal type a bit more. e43ac2e 2017-02-24 Tim Newsome Revert previous commit. e63e20 2017-02-23 Tim Newsome Revert previous commit. e7770bf 2017-02-23 Tim Newsome mcontrol and icount mask tdata2, not tdatal. 27806f2 2017-02-23 mwachs5 rename 'type' to 'emdtype' purely so my autogeneration scripts work. e46798d 2017-02-22 mwachs5 Generate Chisel headers as well for Debug Module. 3d5b6f6 2017-02-22 Tim Newsome Merge pull request #31 from sifive/abstract_command_types c9db98c 2017-02-22 Tim Newsome Merge pull request #30 from sifive/abstract_command_types c9db98c 2017-02-22 Tim Newsome Merge pull request #30 from sifive/abstract_command_types ddde0a2 2017-02-22 Tim Newsome Merge pull request #30 from sifive/more_ibuf_progbuf f83a1ca 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf ddde0a2 2017-02-22 mwachs5 Remove last references to "Instruction Supply" f6ebde9 2017-02-22 Tim Newsome Move authentication to a serial protocol. | 2e2dc28 | 2017-03-01 | Megan Wachs | |
| b09f460 2017-03-01 mwachs5 serial: tweak addresses. 6477837 2017-03-01 mwachs5 chisel: tweaks to class names. be83e3e 2017-02-28 Tim Newsome Clarify stoptime, stopcycle. 7f94662 2017-02-27 mwachs5 Merge remote-tracking branch 'origin/0.13' into generate-chisel c17c17c 2017-02-27 Tim Newsome Abstract command that returns config string addr. 096dfbc 2017-02-27 Tim Newsome Explain tdatal type a bit more. c43ac2e 2017-02-24 Tim Newsome Clarify how to enumerate triggers again. c6e3e20 2017-02-23 Tim Newsome Revert previous commit. ef770bf 2017-02-23 Tim Newsome mcontrol and icount mask tdata2, not tdata1. 27806f2 2017-02-23 mwachs5 rename 'type' to 'cmdtype' purely so my autogeneration scripts work. e46798d 2017-02-22 mwachs5 Generate Chisel headers as well for Debug Module. 3d5b6f6 2017-02-22 Tim Newsome Merge pull request #31 from sifive/abstract_command_types e9db98c 2017-02-22 Tim Newsome Merge pull request #30 from | c087c34 | 2017-03-01 | mwachs5 | = |
| 6477837 2017-03-01 mwachs5 chisel: tweaks to class names. be83e3e 2017-02-28 Tim Newsome Clarify stoptime, stopcycle. 7f94662 2017-02-27 mwachs5 Merge remote-tracking branch 'origin/0.13' into generate chisel c17c17c 2017-02-27 Tim Newsome Abstract command that returns config string addr. 096dfbc 2017-02-27 Tim Newsome Explain tdata1 type a bit more. c43ac2e 2017-02-24 Tim Newsome Clarify how to enumerate triggers again. c6e3e20 2017-02-23 Tim Newsome Revert previous commit. ef770bf 2017-02-23 Tim Newsome mcontrol and icount mask tdata2, not tdata1. 27806f2 2017-02-23 mwachs5 Add Abstract Commands to automatic chisel b3bb939 2017-02-22 mwachs5 Add Abstract Commands to automatic chisel b3bb6f6 2017-02-22 Tim Newsome Merge pull request #31 from sifive/abstract.command.types c9db98c 2017-02-22 Tim Newsome Simplify description of op statuses. bda39c 2017-02-22 Tim Newsome Merge pull request #30 from sifive/more.ibuf.pr | 92a4923 | 2017-03-01 | mwachs5 | serial: tweak addresses. |
| be83e3e 2017-02-28 Tim Newsome Clarify stoptime, stopcycle. 7f94662 2017-02-27 mwachs5 Merge remote-tracking branch 'origin/0.13' into generate_chisel c17c17c 2017-02-27 Tim Newsome Abstract command that returns config string addr. 096dfbc 2017-02-24 Tim Newsome Explain tdatal type a bit more. c43ac2e 2017-02-24 Tim Newsome Explain tdatal type a bit more. c63e20 2017-02-23 Tim Newsome Revert previous commit. ef770bf 2017-02-23 Tim Newsome mcontrol and icount mask tdata2, not tdata1. 27806f2 2017-02-23 mwachs5 rename 'type' to 'cmdtype' purely so my autogeneration scripts work. e46798d 2017-02-22 mwachs5 Generate Chisel headers as well for Debug Module. 3d5b6f6 2017-02-22 Tim Newsome Merge pull request #31 from sifive/abstract_command_types c9db98c 2017-02-22 Tim Newsome Simplify description of op statuses. bda39c 2017-02-22 mwachs5 Add explicit type field to Abstract Command. 34ff1d8 2017-02-22 mwachs5 Finish up r | b09f460 | 2017-03-01 | mwachs5 | serial: tweak addresses. |
| 7f94662 2017-02-27 mwachs5 Merge remote-tracking branch 'origin/0.13' into generate_chisel c17c17c 2017-02-27 Tim Newsome Abstract command that returns config string addr. 096dfbc 2017-02-27 Tim Newsome Acknowledge Alex. c0253ab 2017-02-24 Tim Newsome Explain tdata1 type a bit more. c43ac2e 2017-02-23 Tim Newsome Revert previous commit. c63e20 2017-02-23 Tim Newsome mcontrol and icount mask tdata2, not tdata1. c9770bf 2017-02-23 mwachs5 rename 'type' to 'cmdtype' purely so my autogeneration scripts work. e46798d 2017-02-22 mwachs5 Generate Chisel headers as well for Debug Module. 3d5b6f6 2017-02-22 Tim Newsome Merge pull request #31 from sifive/abstract_command_types c9db98c 2017-02-22 Tim Newsome Simplify description of op statuses. bda39c 2017-02-22 mwachs5 Add explicit type field to Abstract Command. 34ff1d8 2017-02-22 mwachs5 Finish up replacement of ibuf-¿progbuf fddde0a2 2017-02-22 Tim Newsome Merge pull requ | 6477837 | 2017-03-01 | mwachs5 | chisel: tweaks to class names. |
| c17c17c 2017-02-27 Tim Newsome Abstract command that returns config string addr. | be83e3e | 2017-02-28 | Tim Newsome | Clarify stoptime, stopcycle. |
| c17c17c 2017-02-27 Tim Newsome Abstract command that returns config string addr. 096dfbc 2017-02-27 Tim Newsome Acknowledge Alex. c0253ab 2017-02-24 Tim Newsome Explain tdata1 type a bit more. e43ac2e 2017-02-23 Tim Newsome Clarify how to enumerate triggers again. c663e20 2017-02-23 Tim Newsome Revert previous commit. ef770bf 2017-02-23 Tim Newsome mcontrol and icount mask tdata2, not tdata1. 27806f2 2017-02-23 mwachs5 rename 'type' to 'cmdtype' purely so my autogeneration scripts work. e46798d 2017-02-22 mwachs5 Add Abstract Commands to automatic chisel b3bb939 2017-02-21 mwachs5 Generate Chisel headers as well for Debug Module. 3d5b6f6 2017-02-22 Tim Newsome Merge pull request #31 from sifive/abstract_command_types c9db98c 2017-02-22 Tim Newsome Simplify description of op statuses. bda39c 2017-02-22 Tim Newsome Merge pull request #30 from sifive/more ibuf_progbuf f83a1ca 2017-02-22 mwachs5 Finish up replacement o | 7f94662 | 2017-02-27 | mwachs5 | Merge remote-tracking branch 'origin/0.13' into gen- |
| 096dfbc 2017-02-27 Tim Newsome Acknowledge Alex. c0253ab 2017-02-24 Tim Newsome Explain tdata1 type a bit more. e43ac2e 2017-02-24 Tim Newsome Clarify how to enumerate triggers again. c663e20 2017-02-23 Tim Newsome Revert previous commit. ef770bf 2017-02-23 Tim Newsome mcontrol and icount mask tdata2, not tdata1. 27806f2 2017-02-23 mwachs5 rename 'type' to 'cmdtype' purely so my autogeneration scripts work. e46798d 2017-02-22 mwachs5 Add Abstract Commands to automatic chisel b3bb939 2017-02-21 mwachs5 Generate Chisel headers as well for Debug Module. 3d5b6f6 2017-02-22 Tim Newsome Merge pull request #31 from sifive/abstract_command_types c9db98c 2017-02-22 Tim Newsome Simplify description of op statuses. bda39cc 2017-02-22 Tim Newsome Merge pull request #30 from sifive/more ibuf_progbuf f83a1ca 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf ddde0a2 2017-02-22 Tim Newsome Merge pull | | | | erate_chisel |
| c0253ab 2017-02-24 Tim Newsome Explain tdatal type a bit more. e43ac2e 2017-02-24 Tim Newsome Clarify how to enumerate triggers again. c6e3e20 2017-02-23 Tim Newsome Revert previous commit. ef770bf 2017-02-23 Tim Newsome mcontrol and icount mask tdata2, not tdata1. 27806f2 2017-02-23 mwachs5 rename 'type' to 'cmdtype' purely so my autogeneration scripts work. e46798d 2017-02-22 mwachs5 Add Abstract Commands to automatic chisel b3bb939 2017-02-21 mwachs5 Generate Chisel headers as well for Debug Module. 3d5b6f6 2017-02-22 Tim Newsome Merge pull request #31 from sifive/abstract_command_types c9db98c 2017-02-22 Tim Newsome Simplify description of op statuses. bda39cc 2017-02-22 Tim Newsome Merge pull request #30 from sifive/-more_ibuf_progbuf f83a1ca 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf ddde0a2 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf f6ebde9 2017-02-22 <t< td=""><td>c17c17c</td><td>2017-02-27</td><td>Tim Newsome</td><td>Abstract command that returns config string addr.</td></t<> | c17c17c | 2017-02-27 | Tim Newsome | Abstract command that returns config string addr. |
| c6a3c2 2017-02-24 Tim Newsome Clarify how to enumerate triggers again. c6a3c2 2017-02-23 Tim Newsome Revert previous commit. ef770bf 2017-02-23 Tim Newsome mcontrol and icount mask tdata2, not tdata1. 27806f2 2017-02-23 mwachs5 rename 'type' to 'cmdtype' purely so my autogeneration scripts work. e46798d 2017-02-22 mwachs5 Add Abstract Commands to automatic chisel b3bb939 2017-02-21 mwachs5 Generate Chisel headers as well for Debug Module. 3d5b6f6 2017-02-22 Tim Newsome Merge pull request #31 from sifive/abstract_command_types c9db98c 2017-02-22 Tim Newsome Simplify description of op statuses. bda39cc 2017-02-22 mwachs5 Add explicit type field to Abstract Command. 34ff1d8 2017-02-22 Tim Newsome Merge pull request #30 from sifive/more_ibuf_progbuf f83a1ca 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf ddde0a2 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf 9666e51 2017-02-22 mwachs5 Remove last references to "Instruction Supply" f6ebde9 2017-02-22 Tim Newsome Move authentication to a serial protocol. | 096 dfbc | 2017 - 02 - 27 | Tim Newsome | Acknowledge Alex. |
| c6e3e20 2017-02-23 Tim Newsome Revert previous commit. ef770bf 2017-02-23 Tim Newsome mcontrol and icount mask tdata2, not tdata1. 27806f2 2017-02-23 mwachs5 rename 'type' to 'cmdtype' purely so my autogeneration scripts work. e46798d 2017-02-22 mwachs5 Add Abstract Commands to automatic chisel b3bb939 2017-02-21 mwachs5 Generate Chisel headers as well for Debug Module. 3d5b6f6 2017-02-22 Tim Newsome Merge pull request #31 from sifive/abstract_command_types c9db98c 2017-02-22 Tim Newsome Simplify description of op statuses. bda39cc 2017-02-22 Tim Newsome Merge pull request #30 from sifive/nore.ibuf_progbuf f83a1ca 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf ddde0a2 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf 9666e51 2017-02-22 mwachs5 Remove last references to "Instruction Supply" Move authentication to a serial protocol. | c0253ab | 2017-02-24 | Tim Newsome | Explain tdata1 type a bit more. |
| ef770bf 2017-02-23 Tim Newsome mcontrol and icount mask tdata2, not tdata1. 27806f2 2017-02-23 mwachs5 rename 'type' to 'cmdtype' purely so my autogeneration scripts work. e46798d 2017-02-22 mwachs5 Add Abstract Commands to automatic chisel b3bb939 2017-02-21 mwachs5 Generate Chisel headers as well for Debug Module. 3d5b6f6 2017-02-22 Tim Newsome Merge pull request #31 from sifive/abstract_command_types c9db98c 2017-02-22 Tim Newsome Simplify description of op statuses. bda39cc 2017-02-22 mwachs5 Add explicit type field to Abstract Command. 34ff1d8 2017-02-22 Tim Newsome Merge pull request #30 from sifive/more_ibuf_progbuf f83a1ca 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf g666e51 2017-02-22 mwachs5 IBUF-¿PROGBUF 5308ecd 2017-02-22 mwachs5 Remove last references to "Instruction Supply" f6ebde9 2017-02-22 Tim Newsome Move authentication to a serial protocol. | e43ac2e | 2017-02-24 | Tim Newsome | Clarify how to enumerate triggers again. |
| rename 'type' to 'cmdtype' purely so my autogeneration scripts work. e46798d 2017-02-22 mwachs5 Add Abstract Commands to automatic chisel b3bb939 2017-02-21 mwachs5 Generate Chisel headers as well for Debug Module. 3d5b6f6 2017-02-22 Tim Newsome Merge pull request #31 from sifive/abstract_command_types c9db98c 2017-02-22 Tim Newsome Simplify description of op statuses. bda39cc 2017-02-22 mwachs5 Add explicit type field to Abstract Command. 34ff1d8 2017-02-22 Tim Newsome Merge pull request #30 from sifive/-more_ibuf_progbuf f83a1ca 2017-02-22 mwachs5 Finish up replacement of ibuf-¿progbuf ddde0a2 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf 9666e51 2017-02-22 mwachs5 IBUF-¿PROGBUF 5308ecd 2017-02-22 Tim Newsome Move authentication to a serial protocol. | c6e3e20 | 2017 - 02 - 23 | Tim Newsome | Revert previous commit. |
| generation scripts work. e46798d 2017-02-22 mwachs5 Add Abstract Commands to automatic chisel b3bb939 2017-02-21 mwachs5 Generate Chisel headers as well for Debug Module. 3d5b6f6 2017-02-22 Tim Newsome Merge pull request #31 from sifive/abstract_command_types c9db98c 2017-02-22 Tim Newsome Simplify description of op statuses. bda39cc 2017-02-22 mwachs5 Add explicit type field to Abstract Command. 34ff1d8 2017-02-22 Tim Newsome Merge pull request #30 from sifive/more_ibuf_progbuf f83a1ca 2017-02-22 mwachs5 Finish up replacement of ibuf-¿progbuf ddde0a2 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf 9666e51 2017-02-22 mwachs5 IBUF-¿PROGBUF 5308ecd 2017-02-22 mwachs5 Remove last references to "Instruction Supply" f6ebde9 2017-02-22 Tim Newsome Move authentication to a serial protocol. | ef770bf | 2017 - 02 - 23 | Tim Newsome | mcontrol and icount mask tdata2, not tdata1. |
| Add Abstract Commands to automatic chisel Babbass 2017-02-21 mwachs5 Babbass 2017-02-22 Tim Newsome Commands to automatic chisel Generate Chisel headers as well for Debug Module. Merge pull request #31 from sifive/abstract_command_types Command_types Comm | 27806f2 | 2017-02-23 | mwachs5 | rename 'type' to 'cmdtype' purely so my auto- |
| Generate Chisel headers as well for Debug Module. 3d5b6f6 2017-02-22 Tim Newsome Merge pull request #31 from sifive/abstract_command_types c9db98c 2017-02-22 Tim Newsome Simplify description of op statuses. bda39cc 2017-02-22 mwachs5 Add explicit type field to Abstract Command. 34ff1d8 2017-02-22 Tim Newsome Merge pull request #30 from sifive/more_ibuf_progbuf f83a1ca 2017-02-22 mwachs5 Finish up replacement of ibuf-iprogbuf ddde0a2 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf 9666e51 2017-02-22 mwachs5 IBUF-iPROGBUF 5308ecd 2017-02-22 mwachs5 Remove last references to "Instruction Supply" f6ebde9 2017-02-22 Tim Newsome Move authentication to a serial protocol. | | | | generation scripts work. |
| 3d5b6f62017-02-22Tim NewsomeMerge pull request #31 from sifive/ab-stract_command_typesc9db98c2017-02-22Tim NewsomeSimplify description of op statuses.bda39cc2017-02-22mwachs5Add explicit type field to Abstract Command.34ff1d82017-02-22Tim NewsomeMerge pull request #30 from sifive/-more_ibuf_progbuff83a1ca2017-02-22mwachs5Finish up replacement of ibuf-iprogbufddde0a22017-02-22Tim NewsomeMerge pull request #28 from sifive/inst_supply_vs_progbuf9666e512017-02-22mwachs5IBUF-iPROGBUF5308ecd2017-02-22mwachs5Remove last references to "Instruction Supply"f6ebde92017-02-22Tim NewsomeMove authentication to a serial protocol. | e46798d | 2017 - 02 - 22 | mwachs5 | Add Abstract Commands to automatic chisel |
| stract_command_types c9db98c 2017-02-22 Tim Newsome Simplify description of op statuses. bda39cc 2017-02-22 mwachs5 Add explicit type field to Abstract Command. 34ff1d8 2017-02-22 Tim Newsome Merge pull request #30 from sifive/-more_ibuf_progbuf f83a1ca 2017-02-22 mwachs5 Finish up replacement of ibuf-¿progbuf ddde0a2 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf 9666e51 2017-02-22 mwachs5 IBUF-¿PROGBUF 5308ecd 2017-02-22 mwachs5 Remove last references to "Instruction Supply" f6ebde9 2017-02-22 Tim Newsome Move authentication to a serial protocol. | b3bb939 | 2017-02-21 | | Generate Chisel headers as well for Debug Module. |
| bda39cc 2017-02-22 mwachs5 Add explicit type field to Abstract Command. 34ff1d8 2017-02-22 Tim Newsome Merge pull request #30 from sifive/- more_ibuf_progbuf f83a1ca 2017-02-22 mwachs5 Finish up replacement of ibuf-¿progbuf ddde0a2 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf 9666e51 2017-02-22 mwachs5 IBUF-¿PROGBUF 5308ecd 2017-02-22 mwachs5 Remove last references to "Instruction Supply" f6ebde9 2017-02-22 Tim Newsome Move authentication to a serial protocol. | 3d5b6f6 | 2017-02-22 | Tim Newsome | , |
| 34ff1d82017-02-22Tim NewsomeMerge pull request #30 from sifive/-more_ibuf_progbuff83a1ca2017-02-22mwachs5Finish up replacement of ibuf-¿progbufddde0a22017-02-22Tim NewsomeMerge pull request #28 from sifive/inst_supply_vs_progbuf9666e512017-02-22mwachs5IBUF-¿PROGBUF5308ecd2017-02-22mwachs5Remove last references to "Instruction Supply"f6ebde92017-02-22Tim NewsomeMove authentication to a serial protocol. | c9db98c | 2017-02-22 | Tim Newsome | Simplify description of op statuses. |
| more_ibuf_progbuf f83a1ca 2017-02-22 mwachs5 Finish up replacement of ibuf-¿progbuf ddde0a2 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf 9666e51 2017-02-22 mwachs5 IBUF-¿PROGBUF 5308ecd 2017-02-22 mwachs5 Remove last references to "Instruction Supply" f6ebde9 2017-02-22 Tim Newsome Move authentication to a serial protocol. | bda39cc | 2017 - 02 - 22 | mwachs5 | Add explicit type field to Abstract Command. |
| ddde0a2 2017-02-22 Tim Newsome Merge pull request #28 from sifive/inst_supply_vs_progbuf 9666e51 2017-02-22 mwachs5 IBUF-;PROGBUF 5308ecd 2017-02-22 mwachs5 Remove last references to "Instruction Supply" f6ebde9 2017-02-22 Tim Newsome Move authentication to a serial protocol. | 34ff1d8 | 2017-02-22 | Tim Newsome | |
| sifive/inst_supply_vs_progbuf 9666e51 2017-02-22 mwachs5 IBUF-;PROGBUF 5308ecd 2017-02-22 mwachs5 Remove last references to "Instruction Supply" f6ebde9 2017-02-22 Tim Newsome Move authentication to a serial protocol. | f83a1ca | 2017-02-22 | mwachs5 | Finish up replacement of ibuf-¿progbuf |
| 5308ecd 2017-02-22 mwachs5 Remove last references to "Instruction Supply" f6ebde9 2017-02-22 Tim Newsome Move authentication to a serial protocol. | ddde0a2 | 2017-02-22 | Tim Newsome | - " |
| 5308ecd 2017-02-22 mwachs5 Remove last references to "Instruction Supply" f6ebde9 2017-02-22 Tim Newsome Move authentication to a serial protocol. | 9666e51 | 2017-02-22 | mwachs5 | , – – – – – – – – – – – – – – – – – – – |
| • | 5308ecd | 2017-02-22 | mwachs5 | Remove last references to "Instruction Supply" |
| 0f079c8 2017-02-22 Tim Newsome Reserve bit for per-hart reset. | f6ebde9 | 2017-02-22 | Tim Newsome | Move authentication to a serial protocol. |
| | 0 f 0 79 c 8 | 2017-02-22 | Tim Newsome | Reserve bit for per-hart reset. |

| f2c93ac | 2017-02-22 | Tim Newsome | Clarify that dractive resets authentication. |
|--|------------|----------------|--|
| 59154ac | 2017-02-22 | Tim Newsome | Merge pull request #27 from asb/clarify_reset |
| f5e7b1c | 2017-02-22 | Alex Bradbury | Clarify that the halt state of all harts is maintained |
| | | J. T. T. T. J. | through reset |
| 3dfe8fd | 2017-02-22 | Tim Newsome | More Debug Mode -; Halt Mode. |
| d29fc1f | 2017-02-22 | Tim Newsome | Debug Mode -; Halt Mode |
| 55d6030 | 2017-02-21 | Tim Newsome | Generate debug_defines.h as part of normal make |
| b0e6a7f | 2017-02-21 | Tim Newsome | Minor clarifications. |
| 0f 9885 c | 2017-02-20 | Tim Newsome | Various clarifications. |
| e443ab9 | 2017-02-15 | Tim Newsome | Merge pull request #25 from sifive/ctrl_status |
| 3b08e90 | 2017-02-15 | Tim Newsome | Merge pull request #24 from |
| | | | $sifive/sm_diagram_resumereq$ |
| 0802d5a | 2017-02-15 | mwachs5 | Use consistent 'Control and Status' naming for CS |
| | | | registers. |
| $5 \operatorname{accc} 7 \operatorname{d}$ | 2017-02-15 | Tim Newsome | Change all the "other" JTAG IRs to just reserved. |
| bcbd7da | 2017-02-15 | mwachs5 | sm_diagram: Show using resumereq bit to resume. |
| 18f6e55 | 2017-02-14 | Tim Newsome | Introduce resumered command, similar to haltred. |
| fb40538 | 2017-02-14 | Tim Newsome | Merge pull request #22 from sifive/sb_errors |
| 4b62c40 | 2017-02-14 | mwachs5 | SystemBus: Clean up some formatting and error |
| | | | specification notes. |
| 0f346e4 | 2017-02-14 | Tim Newsome | Merge pull request #21 from |
| | | | $sifive/sm_for_quick_access$ |
| bc97723 | 2017-02-14 | mwachs5 | quick-access: Update SM Diagram for Quick Access |
| d27066e | 2017-02-14 | Tim Newsome | Clarify haltreq bit. |
| 6f8ec43 | 2017-02-14 | Tim Newsome | Always generate long constants when required. |
| c6ac6bc | 2017-02-13 | Tim Newsome | Include field descriptions in C header file. |
| b849213 | 2017-02-13 | Tim Newsome | Fix the build. |
| c82c62e | 2017-02-12 | Tim Newsome | Merge pull request #20 from sifive/jtag_ir_minimum |
| 1cf8033 | 2017-02-12 | mwachs5 | jtag: More clarifications |
| 6203bd 6 | 2017-02-12 | Megan Wachs | Update requirements—W GPRs Required |
| f2b43a7 | 2017-02-12 | Megan Wachs | Remove double 'the' |
| 2c64ef1 | 2017-02-12 | Megan Wachs | Remove comma |
| f84abce | 2017-02-12 | Megan Wachs | Whitespace edits and address come comments |
| 7246b44 | 2017-02-12 | Tim Newsome | Merge pull request $#19$ from sifive/jtag_dtm_edits |
| 23c2648 | 2017-02-11 | mwachs5 | jtag_dtm: ask for clarification on TAP sharing. |
| 7020d23 | 2017-02-11 | mwachs5 | jtag_dtm: Clarifications, DBUS-¿DMI |
| 292d49c | 2017-02-11 | Megan Wachs | fix indentation |
| 55ef8d6 | 2017-02-11 | Tim Newsome | Merge pull request #17 from sifive/prog_buffer_size |
| b879b86 | 2017-02-11 | Megan Wachs | Add missing period |
| bbe0521 | 2017-02-11 | mwachs5 | Make comments on program buffer size match the |
| | | | address map. |
| 4ceaa 37 | 2017-02-11 | mwachs5 | Flesh out and edit the introduction/background Add |
| | | | a description of use cases this spec has in mind, and |
| | | | what it doesn't cover. |
| cbf89d6 | 2017-02-11 | Tim Newsome | Rewrite Quick Access. |
| 9115 db1 | 2017-02-10 | Tim Newsome | Merge pull request #16 from sifive/re- |
| | | | duce_prog_buffer_size |
| $170 \mathrm{bff}1$ | 2017-02-10 | Megan Wachs | Allow size 4 for the program buffer |
| | | | |

| 9d46077 | 2017-02-10 | Tim Newsome | Merge pull request #15 from sifive/dmactive |
|-------------|------------|-------------|---|
| c911e6e | 2017-02-10 | Tim Newsome | Clarify use of dmactive. |
| 2ca296f | 2017-02-09 | Tim Newsome | Reserve command register space for custom use. |
| e49666e | 2017-02-09 | Tim Newsome | Clarify hart index change per Megan's comments. |
| 84865e9 | 2017-02-09 | Tim Newsome | Add header prefix for abstract commands. |
| 2434f4f | 2017-02-09 | Tim Newsome | Select harts by index instead of hart ID. |
| 7bf 112 a | 2017-02-09 | Tim Newsome | Generate correct headers for ¿32-bit registers. |
| 7f0f09a | 2017-02-08 | Tim Newsome | Reset dbus status to "failure" to avoid confusion. |
| 7b1803e | 2017-02-08 | Tim Newsome | Merge pull request #13 from sifive/arg0_clarification |
| 8b1c6f0 | 2017-02-08 | Megan Wachs | Fix line wrap issue |
| 345c33f | 2017-02-08 | Megan Wachs | Call out "arg0" specifically. |
| 9f080f5 | 2017-02-08 | Megan Wachs | Clarify "arguments" to commands |
| 259badd | 2017-02-08 | Tim Newsome | Make haltsum/halt registers mandatory. |
| eb0f1d3 | 2017-02-07 | Tim Newsome | Allow for early abstract command failures. |
| bb49bd1 | 2017-02-07 | Tim Newsome | Clarify error handling a little. |
| 3 fc0a97 | 2017-02-07 | Tim Newsome | Explain when abstract data regs may be clobbered. |
| c37167e | 2017-02-07 | Tim Newsome | Fix old language in description of halt registers. |
| 6943c96 | 2017-02-07 | Tim Newsome | Generate more useful C header files from reg defs |
| d7a8045 | 2017-02-06 | Tim Newsome | Merge pull request #11 from sifive/sm_diagram |
| 8bef 40 e | 2017-02-05 | mwachs5 | Merge remote-tracking branch 'origin/0.13' into |
| | | | $\mathrm{sm_diagram}$ |
| 98639df | 2017-02-05 | mwachs5 | Include the SM Diagram as a figure. Also some minor |
| | | | capitalization fixes. |
| a95e4c3 | 2017-02-05 | mwachs5 | Update State Machine diagram to show uncertainty |
| | | | of halt bit during auto halt/resume. |
| ba76744 | 2017-02-05 | Tim Newsome | Combine loabits and hiabits. |
| 02b1d92 | 2017-02-05 | Tim Newsome | DMI can get away with just 6 address bits. |
| 35d6e33 | 2017-02-05 | mwachs5 | Update State machine diagram to show BUSY with- |
| | | | out HALTED |
| f511b05 | 2017-02-04 | Tim Newsome | Clarify command busy bit. |
| a8e5ae7 | 2017-02-03 | mwachs5 | Merge remote-tracking branch 'origin/0.13' into |
| | | | $\mathrm{sm_diagram}$ |
| d0f8961 | 2017-02-03 | mwachs5 | Update figures |
| e18a68d | 2017-02-03 | Tim Newsome | Clarify prehalt/postresume failure. |
| ac3e2a9 | 2017-02-02 | Tim Newsome | Clarify abstract command failure behavior. |
| ce4baee | 2017-02-02 | Tim Newsome | Add Quick Access section. |
| 0490377 | 2017-02-02 | Tim Newsome | Add prehalt and postresume to reg command. |
| 67515bd | 2017-02-02 | Tim Newsome | Deal with a few minor TODOs. |
| 96456fc | 2017-02-02 | Tim Newsome | Turn register names into links. |
| 317cd98 | 2017-02-02 | Tim Newsome | Explain what register access is required. |
| f3ad2f2 | 2017-02-01 | Tim Newsome | Revert Plain Exception implementation to be simple |
| a0ad281 | 2017-02-01 | Tim Newsome | execb -; preexec, execa -; postexec |
| 1d4a2c3 | 2017-02-01 | Tim Newsome | Limit Program Buffer sizes to 0, 1, 8. |
| cc40815 | 2017-02-01 | Tim Newsome | Incorporate Po-wei's feedback. |
| c8b45d6 | 2017-02-01 | Tim Newsome | Clarify how all autoexec bits work. |
| dbb1deb | 2017-02-01 | Tim Newsome | Remove stale TODO. |
| c5f8f59 | 2017-02-01 | Tim Newsome | Explain why cmderr inhibits starting new commands. |
| 5c69194 | 2017-02-01 | Tim Newsome | Fix editing error. |
| | | | |

| 50 f7 c48 | 2017-02-01 | Tim Newsome | Remove empty hart info register. |
|----------------|------------|-------------|--|
| 781c68e | 2017-02-01 | Megan Wachs | Update README.md |
| f46b32e | 2017-02-01 | mwachs5 | Add a diagram of Abstract Command flow. |
| 633 bd 63 | 2017-02-01 | Tim Newsome | Move Reading Order into About This Document |
| 51ec 4 d 1 | 2017-02-01 | Tim Newsome | Add reading order section. |
| 03d20ad | 2017-02-01 | Tim Newsome | autoexec0 applies to data0, not inst0. |
| c302353 | 2017-01-31 | Tim Newsome | Don't rely on hart fetching instructions once. |
| 2558c25 | 2017-01-31 | Tim Newsome | Change how exceptions in Halt Mode are handled. |
| a36ddce | 2017-01-31 | Tim Newsome | Add size to abstract register command. |
| 64 de 458 | 2017-01-31 | Tim Newsome | Detail bus master reads. |
| c08486f | 2017-01-31 | Megan Wachs | reset: Add some comments (#5) |
| 1558049 | 2017-01-30 | Tim Newsome | Automate Change Log. |
| 51525a4 | 2017-01-29 | Tim Newsome | Update System Overview |
| 7d39ac0 | 2017-01-29 | Tim Newsome | Update Supported Features. |
| 9e7cbea | 2017-01-29 | Tim Newsome | Update RISC-V Core section. |
| 515188d | 2017-01-29 | Tim Newsome | Update Hardware Implementations section. |
| 4b19ed8 | 2017-01-29 | mwachs5 | system_bus: be consistent and always call it 'System |
| | | | Bus'. Even if some dislike the name, we should be |
| | | | consistent and clear in the spec. |
| 9ccef3d | 2017-01-29 | Tim Newsome | Fleshed out some debugger implementation. |
| 04b9176 | 2017-01-28 | Tim Newsome | Rename debug exception to breakpoint exception. |
| 5ac4ea1 | 2017-01-27 | Tim Newsome | WIP on big update on instruction supply. |
| 2d9c3e2 | 2017-01-27 | Tim Newsome | Reorganize dm registers. |
| de50ba8 | 2017-01-27 | Tim Newsome | Abstract command support is already addressed. |
| 27cb 0 da | 2017-01-26 | Tim Newsome | Merge pull request #4 from sifive/access_renames |
| 5085046 | 2017-01-26 | mwachs5 | Rename registers and fields like 'access' that were |
| | | | confusingly the same name. |
| 10bbf6f | 2017-01-26 | Tim Newsome | Fix #2: DM address space table |
| a05c582 | 2017-01-26 | Tim Newsome | Add debugger inspection as a feature. |
| 4062681 | 2017-01-24 | Tim Newsome | Add publish target. |
| 5c8bb83 | 2017-01-24 | Tim Newsome | Clarify use of data registers. |
| 1504 da6 | 2017-01-24 | Tim Newsome | Replace manual date with automatic git hash/date. |
| 997f2a0 | 2017-01-23 | Tim Newsome | Deal with unsupported abstract commands. |
| cb6f2b8 | 2017-01-23 | Tim Newsome | Renumber registers to prevent duplicates. |
| 8b4db96 | 2017-01-23 | Tim Newsome | Don't print out addresses if they're not provided. |
| b00cd21 | 2017-01-23 | Tim Newsome | Add an abstract command. |
| 675b556 | 2017-01-23 | Tim Newsome | Reorganize DM bits into functional group regs. |
| 5 fc 7512 | 2017-01-23 | Tim Newsome | Remove bits 33:32 from sbdata[23]. |
| ceb5d66 | 2017-01-20 | Tim Newsome | Starting point for a comprehensive spec |
| | | | |