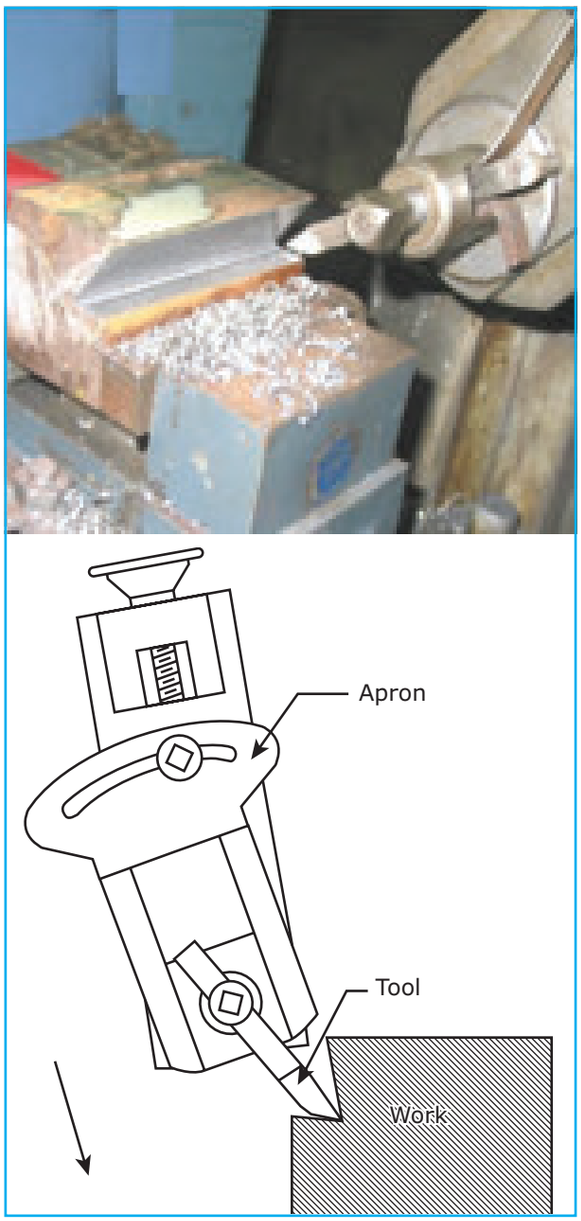



Machining Inclined surfaces

3.15 Special Machining Problem

Apart from machining horizontal, vertical and vertical flat surfaces, the shaping machine can do some special machining operations.


Machining dove tail groove

Dove tail joint is machined on two separate pieces of work as male and female elements. The required shape is marked on the face of the work and the unwanted metal is first removed by the round nose tool. A special form tool is used to finish the machining.

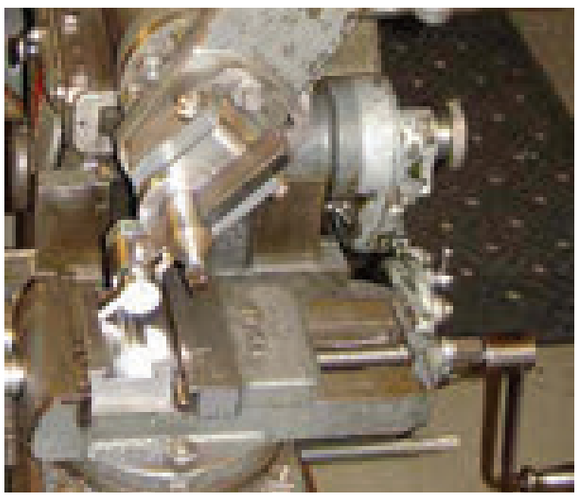

Machining Dove tail groove

Machining external keyways

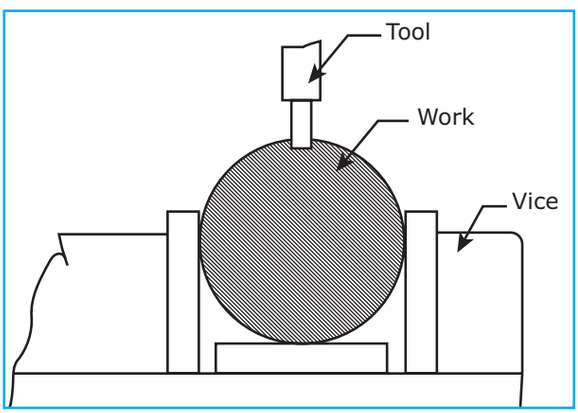

Machining External Keyways

Machining external keyways refers to the cutting of long slots along the length of cylindrical rods. Initially a round nose tool is used and then a square nose tool is used to finish the operation. A hole of depth equal to the depth of the keyway is made at the blind end to leave a clearance to the tool at the end of the stroke. When a keyway is cut at the middle of the shaft, holes are drilled at both ends of the keyway.

XII BME_English version CHAPTER 03.indd 72 1/8/2020 1:44:00 PM