Specify next point or [Close/Undo]: @25<90 ↵

Specify next point or [Close/Undo]: @15<180 ↵

Specify next point or [Close/Undo]: @25<270 ↵

Specify next point or [Close/Undo]: C ↵

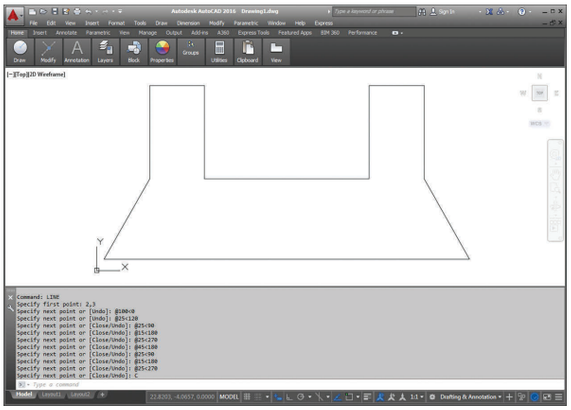


Fig. 6.67. Drawing a Figure by using relative polar coordinates

Direct Distance Entry

The easiest way to draw a line in AutoCAD is by using the Direct Distance Entry method. Before drawing a line by using this method, ensure that the Dynamic Input button is chosen in the Status Bar. Next, choose the Line tool; you will be prompted to specify the start point. Enter the coordinate values in the text box and press ENTER; you will be prompted to specify the next point. Now, enter the absolute length of the line and its angle with respect to the current position of the cursor in the corresponding text boxes, as shown in Figure 6.68.

Note that you can use the TAB key to toggle between the text boxes. If the Ortho mode is on while drawing lines using this method, you can position the cursor only along the X or Y axis. If the Dynamic Input button is not chosen, then you need to enter the length of the line at the Command prompt. Therefore, position the cursor at the desired angle, type the length at the Command prompt, and then press ENTER, refer to Figure 6.68.

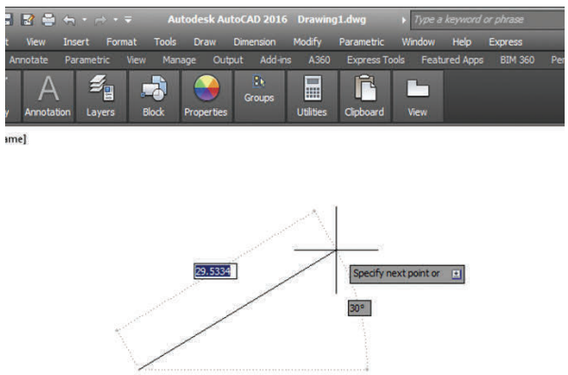


Fig. 6.68 Drawing lines using the Direct Distance Entry method

LINE Specify first point: Start point.

Specify next point or [Undo]: Position the cursor and then enter distance.

Specify next point or [Undo]: Position the cursor and then enter distance.

6.7.3 DRAWING A CIRCLE

Ribbon: Home > Draw > Circle drop-down > Center, Radius

Toolbar: Draw > Circle

Menu Bar: Draw > Circle

Command: CIRCLE or C

A circle is drawn by using the Circle tool. In AutoCAD, you can draw a circle by using six different tools. All these tools are grouped together in the Draw panel of the Ribbon. To view these tools, choose the down arrow next to the circle tool in the Draw panel, as shown in Figure 6.69; all tools will be listed in the drop-down. Note that the name of the tool chosen last will be displayed in the Draw panel. You can also invoke the Circle tool from the Draw toolbar, or by entering C in the command prompt.

XII CompTech_English version CHAPTER 06.indd 197 10-04-2019 11:04:39