


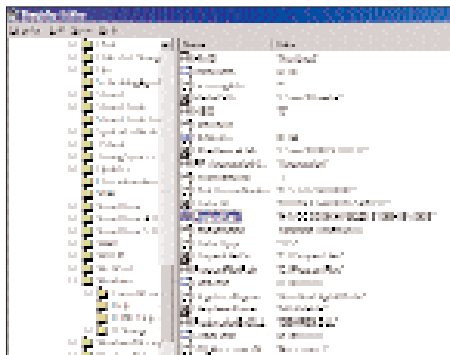

Locate your Windows Product Key from the registry

the Product Key. Note down the number and store it in a safe place.

Overclocking problem

Q I overclocked my Celeron 400 MHz processor to 500 MHz, but I soon reverted back to 400 MHz because after overclocking, my mouse hung after Windows had loaded and subsequently the system

crashed. Now my machine refuses to load Windows and all the files on the drive are corrupt. What is the problem?
Cyrus
Via e-mail

A You have overclocked your Celeron processor by increasing the Front Side

Bus (FSB) speed from the default 66 MHz to 83 MHz. Because of this, your PCI bus is running at 41 MHz, whereas the default PCI bus speed is 33 MHz. Because the PCI bus is overclocked, your hard disk drive cannot handle the extra bus speed. Hence, the files on your drive have become corrupt and you are unable to boot into

Windows. To avoid FAT/file corruption and to maintain your overclock, you can run your drive in PIO mode. To do this, access the BIOS by pressing [Del] when the Power-on Self Test screen comes up during bootup, and disable UDMA. This will ensure that the files on your hard drive don't get corrupted when you overclock and you will be able to boot into Windows. However, the speed with which your system accesses the hard drive will become a lot slower.

What's the buzz?

Q I recently purchased Creative's SoundBlaster Audigy. From the very first day I've been hearing a buzzing sound from the speaker set. I contacted my dealer and he said that there was nothing wrong with the speakers and suggested that I had probably not installed them properly. I reinstalled everything from scratch but the result is the same. How do I solve this problem?

Santosh

Via e-mail


A First, ensure that there are no power lines running too close to the audio cables of your speakers—this sometimes causes a buzz which is the result of noise caused by the 50 Hz frequency of your power line. Move any such power cords away from the signal cables running to your speakers.

Many digital speaker systems do not support the 96 KHz sampling rate of the Audigy, resulting in static or buzzing from your speakers. So if you have a digital speaker system, change the sampling rate to either 48 KHz or 44.1 KHz. To change the sampling rate, click on 'Audio HQ' in the system tray. Then select the 'Device Controls' applet. On the 'Sampling Rate' tab, select the

required sampling rate from the 'Digital Output Sampling Rate' list. Most speakers support the 48 KHz output option. Your speakers should immediately stop buzzing and you should be able to enjoy normal output.

Using FlashGet on proxy

Q I work in a company that has broadband Internet. Earlier all machines could directly access the Net. However, to keep a check on employees' activities while they are online, the system administrator installed a proxy through which we now access the Internet. As a result, we had to apply certain settings in Internet Explorer as provided by the system administrator. Prior to this, I used to use FlashGet to download files

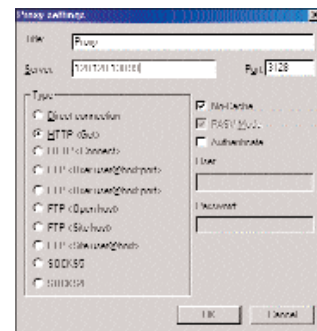

Add your proxy details in FlashGet

from the Internet, however I am unable to do so now. Is there any way by which I can make FlashGet download programs?

Sanjay

Via e-mail

A Since your machine is no longer directly connected to the Internet, you will have to change the settings in FlashGet. By default, FlashGet is configured to access the Internet directly. To change this, go to **Tools > Options > Proxy** and click on the 'Add' button. Here you can define the title of your connection in the 'Title' box. You will have to add the

Problematic USB mouse

Q I recently purchased a new USB mouse. It works well, but whenever I try to wake my computer from standby mode, my mouse stops responding. Since a USB to PS/2 connector was provided in the box, I tried plugging it in the PS/2 port. To my surprise this time the mouse worked just fine. So where exactly does the problem lie?

Gautami Shroff

Via e-mail



ILLUSTRATIONS: Mahesh Benkar

A There is nothing wrong with your mouse. You might have enabled STR (Suspend to RAM) from your BIOS. When you try to wake your computer from Sleep mode any USB device attached will consume more power. If your machine can provide that excess power to the USB device it will be able to wake up, else it won't respond. Check your motherboard manual and if it says that there is an extra jumper setting to draw more power (+5VSB with at least 1A throughput through the power supply) for USB devices, then change the jumper accordingly. If your motherboard does not support this feature then disable the STR feature from the BIOS (access the BIOS by pressing [Del] when the Power-on Self Test screen comes on during bootup) and your problem will be solved.