


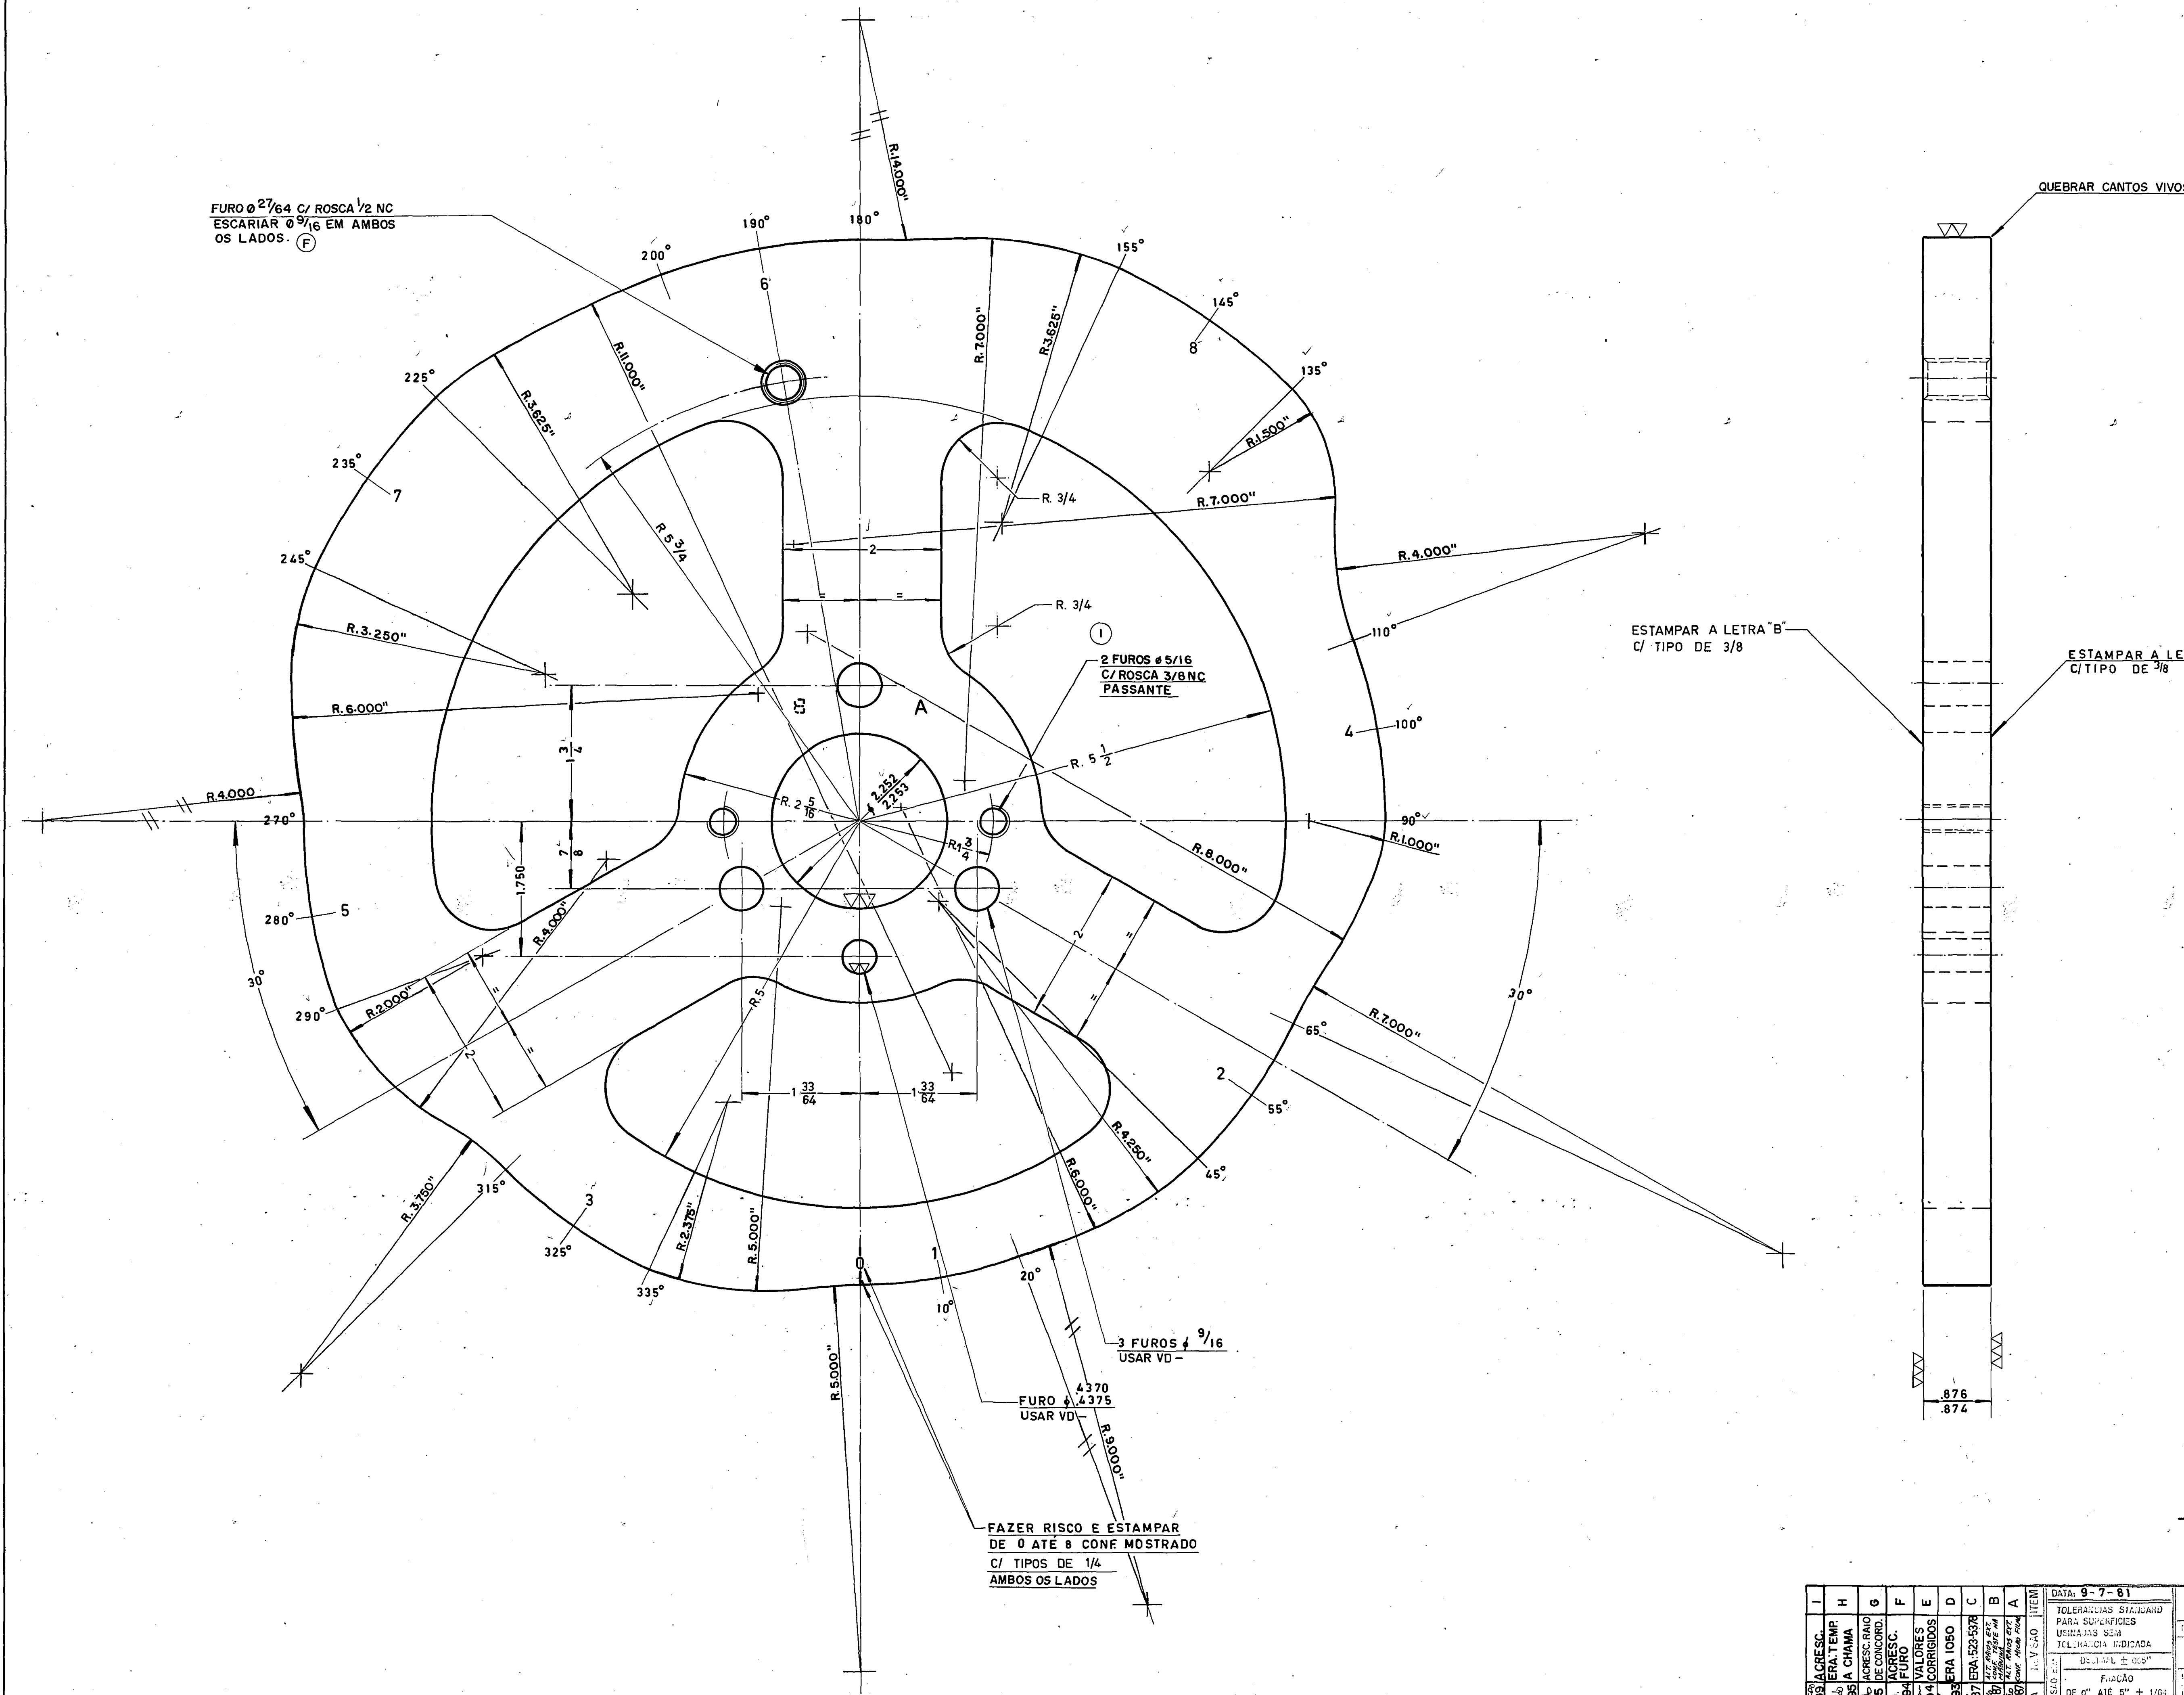

FURO Ø 27/64 C/ ROSCA 1/2 NC
 ESCARIAR Ø 9/16 EM AMBOS
 OS LADOS. (F)

2 FUROS Ø 5/16
 C/ ROSCA 3/8 NC
 PASSANTE

3 FUROS Ø 9/16
 USAR VD -


FURO Ø 4.370
 USAR VD -

FAZER RISCO E ESTAMPAR
 DE 0 ATÉ 8 CONF. MOSTRADO
 C/ TIPOS DE 1/4
 AMBOS OS LADOS

ESTAMPAR A LETRA "B"
 C/ TIPO DE 3/8

ESTAMPAR A LETRA "A"
 C/ TIPO DE 3/8

DIM. DA PISTA		
SEC.	GRAUS	RAIO
1	0° A 20°	5.977
2	45° A 65°	5.972
3	90° A 110°	6.118
4	135° A 155°	6.712
5	180° A 200°	7.841
6	225° A 245°	7.837
7	270° A 290°	7.698
8	315° A 335°	7.694
A CONCORDÂNCIA INTERME- DIÁRIA DEVE SER DE MOVIMENTO SUAVE.		

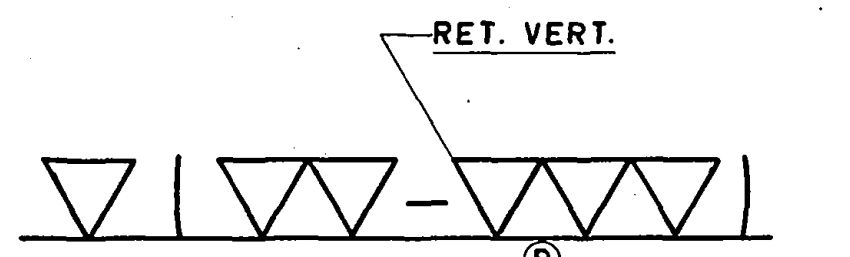

CHAPA DE AÇO SAE 8620 CORTADA
 A MACARICO AUTOM. VE-1884
ATENÇÃO ALIVIA TENSÕES
 ANTES DE USINAR

1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80	81	82	83	84	85	86	87	88	89	90	91	92	93	94	95	96	97	98	99	100
1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80	81	82	83	84	85	86	87	88	89	90	91	92	93	94	95	96	97	98	99	100