



Care Net Consultants (Pty) Ltd
Reg no: 2012 / 038468 / 07
VAT no: 4620265191

 www.carenetconsultants.co.za
 +27 60 070 2723
 salesdesk@carenetconsultants.co.za
 154 Allan Road, Midrand 1684



EXAMPLE DOCUMENT. Stravane Fabrication (Pty) Ltd is a fictitious company. Every company, person, address, date, figure and reference number in this example is made up; only the Care Net letterhead and any public emergency number are real. For guidance only; not a document to sign or rely on.

Example for a Health and Safety File, Section G: Permits and controls

Hot Work Permit to Work

Permit HW 0142. Welding repair to a steel storage tank support, Stravane Fabrication, Vanderbijlpark

About this example	Detail
Company in the example	Stravane Fabrication (Pty) Ltd, a fictitious company
Where it is filed	Section G: Permits and controls
Published by	Care Net Consultants, as guidance for companies building a Health and Safety File

How to use this example


This example shows the form and content Care Net recommends for this document in a Health and Safety File. Adapt it to your company, your sites and your appointments; your registered Health and Safety practitioner confirms it before your File is released. Not legal advice.

Contents

1. Permit details
2. Hazards identified
3. Isolation and preparation
4. Gas test
5. Fire watch
6. Personal protective equipment
7. Sign on
8. Sign off and hand back



YOUR PARTNER IN WORKPLACE HEALTH.

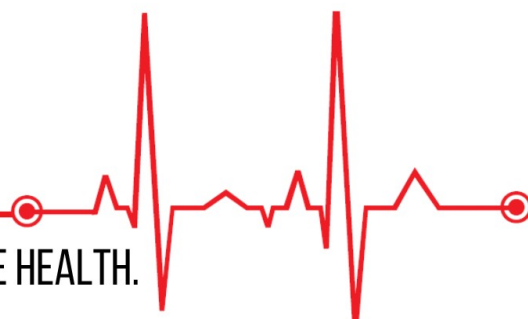

Hot Work Permit to Work

Permit HW 0142. Welding repair to a steel storage tank support, Stravane Fabrication, Vanderbijlpark

1. Permit details


Item	Detail
Permit number	HW 0142 (from the numbered permit book; copy stays in the book)
Date and valid period	Tuesday 12 May 2026, 08:00 to 16:00. Not valid after 16:00 or if conditions change
Location	Bay 3, diesel storage tank support frame, Vanderbijlpark plant (fictitious)
Work	Arc welding and grinding to repair a cracked support leg on the empty diesel storage tank frame
Permit issuer	Johan van Wyk, Plant Engineer, authorised in writing to issue hot work permits
Permit receiver (person in charge of the work)	Sipho Dlamini, Boilermaker Foreman
Work team	Sipho Dlamini (welder), Thabo Nkosi (assistant)
Fire watch after work stops	For the period the permit procedure and the risk assessment set; the issuer wrote 14:40 to 15:40 on this permit

2. Hazards identified

Fire or explosion from diesel vapour or residue near the tank; sparks and hot slag reaching combustible material; arc flash, fumes and hot surfaces; electrical shock from the welding set.

3. Isolation and preparation

Control	Done	Checked by
Tank drained, fill and outlet valves closed, locked and tagged (lock numbers SFB 21 and SFB 22)	Yes, 07:20	J. van Wyk
Transfer pump electrically isolated at the board, locked and tagged (lock SFB 23); start tested and failed to start	Yes, 07:25	J. van Wyk
Combustible material removed from the work area; drains and openings covered with fire blankets	Yes, 07:35	S. Dlamini

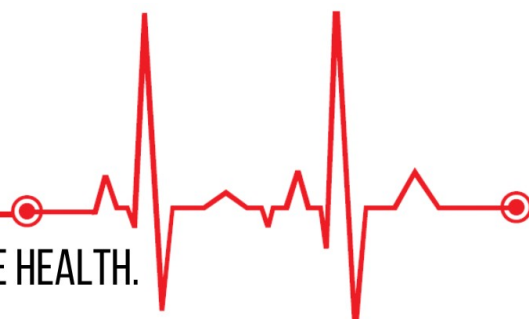

Control	Done	Checked by
Welding screens erected; area barricaded and hot work signs posted	Yes, 07:40	S. Dlamini
Welding set, cables and earth clamp inspected; register entry current (Section F)	Yes, 07:45	S. Dlamini
Two 9 kg dry chemical powder extinguishers and a charged hose reel at the work area	Yes, 07:45	M. Molefe

4. Gas test

Required, because the work is next to a tank that held diesel. Tested with a calibrated flammable gas detector (calibration record on file) at the tank openings, under the frame and at the drains.

Time	Flammable gas reading	Result against the permit procedure	Tested by
07:50	0% of the lower explosive limit	Acceptable; work may start	J. van Wyk
11:30	0% of the lower explosive limit	Acceptable; work may continue	J. van Wyk

5. Fire watch


Fire watch: Mpho Molefe, trained in the use of the extinguishers, stayed at the work area for the whole job with no other duties, and remained after the work stopped for the period the issuer wrote in part 1. Fire watch started 08:00 and ended 15:40 after a final check found no smouldering or hot spots.

6. Personal protective equipment

Welding helmet with the correct filter, leather gloves, apron and spats, safety boots, flame resistant overalls, hearing protection while grinding, and local fume extraction at the weld.

7. Sign on

The issuer and receiver confirm that the controls in parts 3 to 6 are in place and that the work team was briefed on the hazards and controls.

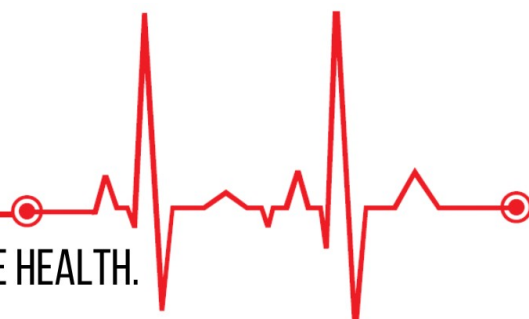

Name	Role on this permit	Date and time	Signature
Johan van Wyk	Permit issuer	12/05/2026 at 07:55	Signed
Sipho Dlamini	Permit receiver	12/05/2026 at 07:55	Signed
Mpho Molefe	Fire watch	12/05/2026 at 07:55	Signed
Thabo Nkosi	Work team member (briefed)	12/05/2026 at 07:55	Signed

8. Sign off and hand back

Step	Time	By
Work complete; team and tools withdrawn; area left clean	14:40	S. Dlamini
Final fire watch check: no smouldering, hot spots or damage	15:40	M. Molefe
Locks SFB 21, 22 and 23 removed; pump and valves returned to service; permit cancelled	15:50	J. van Wyk

Permit receiver (work complete; team and tools withdrawn)

Sipho Dlamini, Date: 12/05/2026 at 14:40

Permit issuer (permit closed)

Johan van Wyk, Date: 12/05/2026 at 15:50

End of the example. The company, people and records in it are fictitious; the cover page explains how to use it.



YOUR PARTNER IN WORKPLACE HEALTH.

