



Care Net Consultants (Pty) Ltd
Reg no: 2012 / 038468 / 07
VAT no: 4620265191

 www.carenetconsultants.co.za
 +27 60 070 2723
 salesdesk@carenetconsultants.co.za
 154 Allan Road, Midrand 1684



EXAMPLE DOCUMENT. Hofsanger Sheet Metal Works (Pty) Ltd is a fictitious company. Every company, person, address, date, figure and reference number in this example is made up; only the Care Net letterhead and any public emergency number are real. For guidance only; not a document to sign or rely on.

Example for a Health and Safety File, Section I: Incident management

Incident Investigation Report

Report IR 2026 07. Minor injury at the guillotine, Hofsanger Sheet Metal Works, Rosslyn

About this example	Detail
Company in the example	Hofsanger Sheet Metal Works (Pty) Ltd, a fictitious company
Where it is filed	Section I: Incident management
Published by	Care Net Consultants, as guidance for companies building a Health and Safety File

How to use this example


This example shows the form and content Care Net recommends for this document in a Health and Safety File. Adapt it to your company, your sites and your appointments; your registered Health and Safety practitioner confirms it before your File is released. Not legal advice.

Contents

1. Incident details
2. What happened
3. Root cause analysis
4. Corrective actions
5. Reporting status



YOUR PARTNER IN WORKPLACE HEALTH.

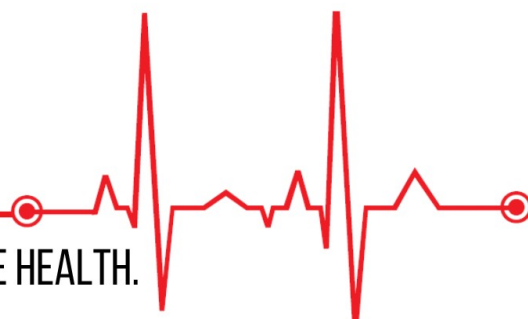

Incident Investigation Report

Report IR 2026 07. Minor injury at the guillotine, Hofsanger Sheet Metal Works, Rosslyn

1. Incident details

Item	Detail
Date and time	Monday 16 March 2026, 13:40
Place	Cutting bay, hydraulic guillotine G2, Rosslyn factory (fictitious)
Type	Minor injury (medical treatment case)
Person involved	Machine operator, employee number HSM 0318 (name held by HR)
Outcome	Treated by the company's appointed doctor the same day; outcome fit , returned to normal duties on 17 March 2026. No clinical detail is kept in this File; the medical record stays with the occupational health practitioner
Investigation team	Karabo Mothibi, Production Manager (lead); Grace Naidoo, Health and Safety Officer; Elias Maluleke, health and safety representative, cutting bay

2. What happened

The operator was removing an offcut from the back of guillotine G2 while the machine was switched on. The rear guard had been left open after a blade change that morning. The operator's hand came into contact with the sharp edge of the offcut as the back gauge moved. First aid was given at once by the bay first aider, and the operator was taken to the doctor.




3. Root cause analysis

The team used the five whys method, with the operator, the maintenance fitter and the supervisor interviewed on 17 March 2026.

Level	Finding
Immediate cause	Hand reached into the rear of the machine while it was live and the back gauge moved
Contributing cause 1	The rear guard was open; its interlock had been bypassed with a cable tie during the blade change
Contributing cause 2	The blade change was done without a lockout, so nothing prompted a check that the guard was closed and the interlock restored
Root cause	The guillotine blade change procedure did not require a guard and interlock check before hand back, and the pre use checklist did not include the rear guard

4. Corrective actions

No.	Action	Owner	Due	Status
1	Remove the cable tie; test the rear guard interlock; guillotine back in use only after the test	Maintenance Supervisor	16/03/2026	Closed 16/03/2026
2	Revise the blade change procedure: lockout, guard and interlock test before hand back, signed by the fitter and the operator	Karabo Mothibi	31/03/2026	Closed 27/03/2026
3	Add the rear guard and interlock to the daily pre use checklist for G1 and G2	Grace Naidoo	31/03/2026	Closed 24/03/2026
4	Toolbox talk to all cutting bay operators and fitters on guards, interlocks and lockout; attendance register filed in Section D	Elias Maluleke	20/03/2026	Closed 19/03/2026
5	Check all other machines for bypassed interlocks and record the result in the Section F register	Maintenance Supervisor	15/04/2026	Closed 10/04/2026; one bypass found on press P4 and removed

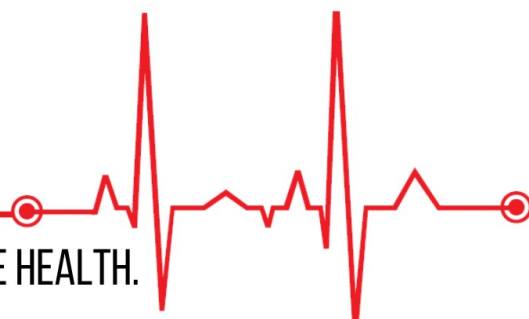

5. Reporting status

Report	Status
Incident register	Entered 16/03/2026, entry 2026/07
COIDA	Employer's report of an accident submitted to the Compensation Fund on 18/03/2026; acknowledgement and claim reference held by HR
Inspector of the Department of Employment and Labour	Not reported: the registered practitioner checked the event against the OHS Act reporting criteria on 17/03/2026 and it did not meet them. Her note is filed with this report
Health and safety committee	Tabled at the meeting of 09/04/2026; actions accepted

Investigation lead

Karabo Mothibi, Date: 20/03/2026

Health and safety representative

Elias Maluleke, Date: 20/03/2026

Chief executive officer (section 16(1)), actions approved

David Kekana, Date: 23/03/2026

End of the example. The company, people and records in it are fictitious; the cover page explains how to use it.



YOUR PARTNER IN WORKPLACE HEALTH.

