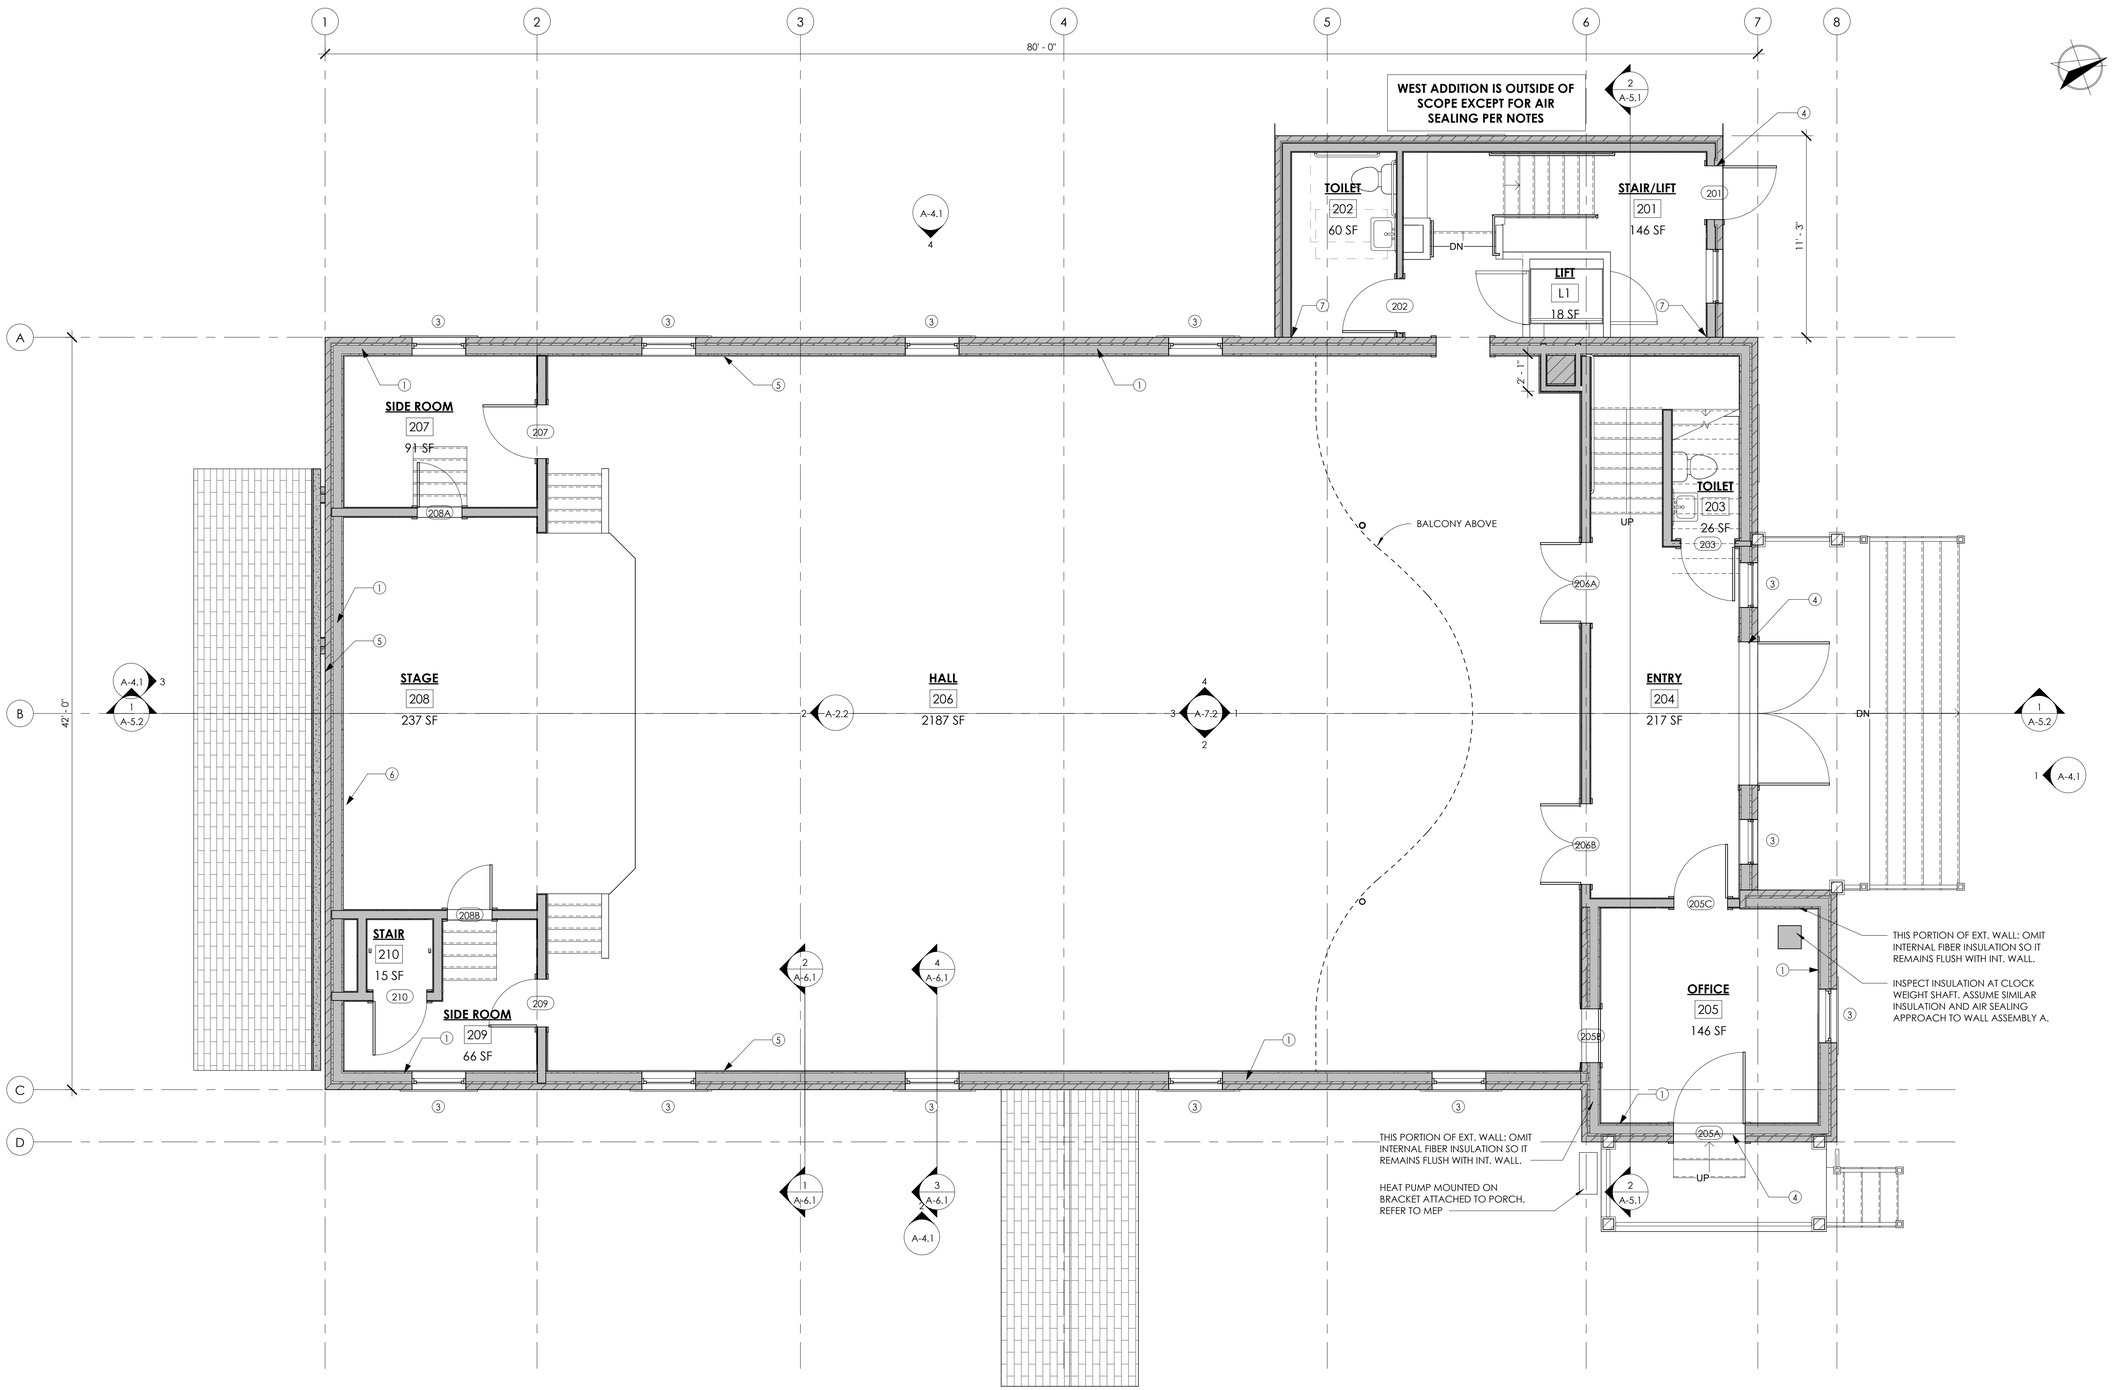


1 Hall Floor Plan
1/4" = 1'-0"

ENVELOPE UPGRADE NOTES	
NO.	NOTE
1	WALL ASSEMBLY UPGRADE A
3	WEATHER STRIP EXISTING WINDOWS AT TOP, BOTTOM, AND EDGES; INSTALL STORM WINDOWS PER SPEC. STORMS TO BE OPERABLE AT SINGLE/ DOUBLE HUNG WINDOWS.
4	ADD WEATHER STRIPPING
5	CAREFULLY REMOVE ALL INTERIOR WOOD TRIM AND WAINSCOT ON EXTERIOR WALLS. SAVE FOR REINSTALLATION. REMOVE PLASTER AND LATHE.
6	OPEN WALL FRAMING UNDER BACK OF STAGE TO BE UPGRADED SIMILAR TO ASSEMBY A BUT WITHOUT WALL LINING
7	AIR SEAL JOINT AT BRICK CORNER BETWEEN ADDITION AND MAIN BUILDING. SEALING TO BE DONE FROM THE INTERIOR
8	INSULATE AND SEAL EXTG. (2) HISTORIC CEILING VENT GRILLES FROM ATTIC. PROVIDE BLACK PTD. MDO OR SIMILAR LAYER AT BOTTOM (VISIBLE FROM BELOW)

VERMONT INTEGRATED
ARCHITECTURE, PC

ANDREA MURRAY, AIA, NCARB, LEED AP
andrea@vermontintegratedarchitecture.com

ASHAR NELSON, AIA, LEED AP
ashar@vermontintegratedarchitecture.com

MEGAN NEDZINSKI, AIA, NCARB, LEED AP, CPHC
megan@vermontintegratedarchitecture.com

P.O. Box 862
Middlebury, VT 05753
802.989.7249

TYPE OF CONSULTANT
First Last
Company
email address
000.000.0000

LICENSED ARCHITECT ASHAR NELSON NO. 2855 STATE OF VERMONT

DATE ISSUED: 3/6/26
Drawn: GB
Checked: NW

REVISIONS:

BRISTOL ENERGY RESILIENCE PROJECTS
HOLLEY HALL

1 South Street,
Bristol,
VT 05443

HALL FLOOR PLAN

A-2.1