

CS-XTEE-01 X TEMPLATE 1:1 X模板 1:1

Proto A. Template page 1 / 2.
Tech pack v0.1 DRAFT 2026-09-29, page 3.


PROPOSAL, not final
建议稿, 非最终版

PRINT AT 100% / 实际大小打印，勿缩放

Proto A: window 200 x 210 mm (base cut line), stitch box 208 x 218 mm, patch box 228 x 238 mm. Arm 25 mm at BASE, visible brown ≥ 12 mm, round tips 11 mm (10-12). Same X for all sizes. Proto A: edge B cut on CUT_JAG, smooth stitch on STITCH.

A件：开口200 x 210mm，车线外框208 x 218mm，底布外框228 x 238mm；BASE处臂宽25mm，可见咖啡色≥12mm，尖端11mm圆头（10-12mm）；全码相同。A件按CUT_JAG做B边，沿STITCH平顺车线。

FACE VIEW (outside). Do not mirror or rotate. Cut guide, stitch stencil and embroidery program must use the same orientation.
正面视图，不可翻转或旋转；剪口模板、画线板及绣花程序方向一致。

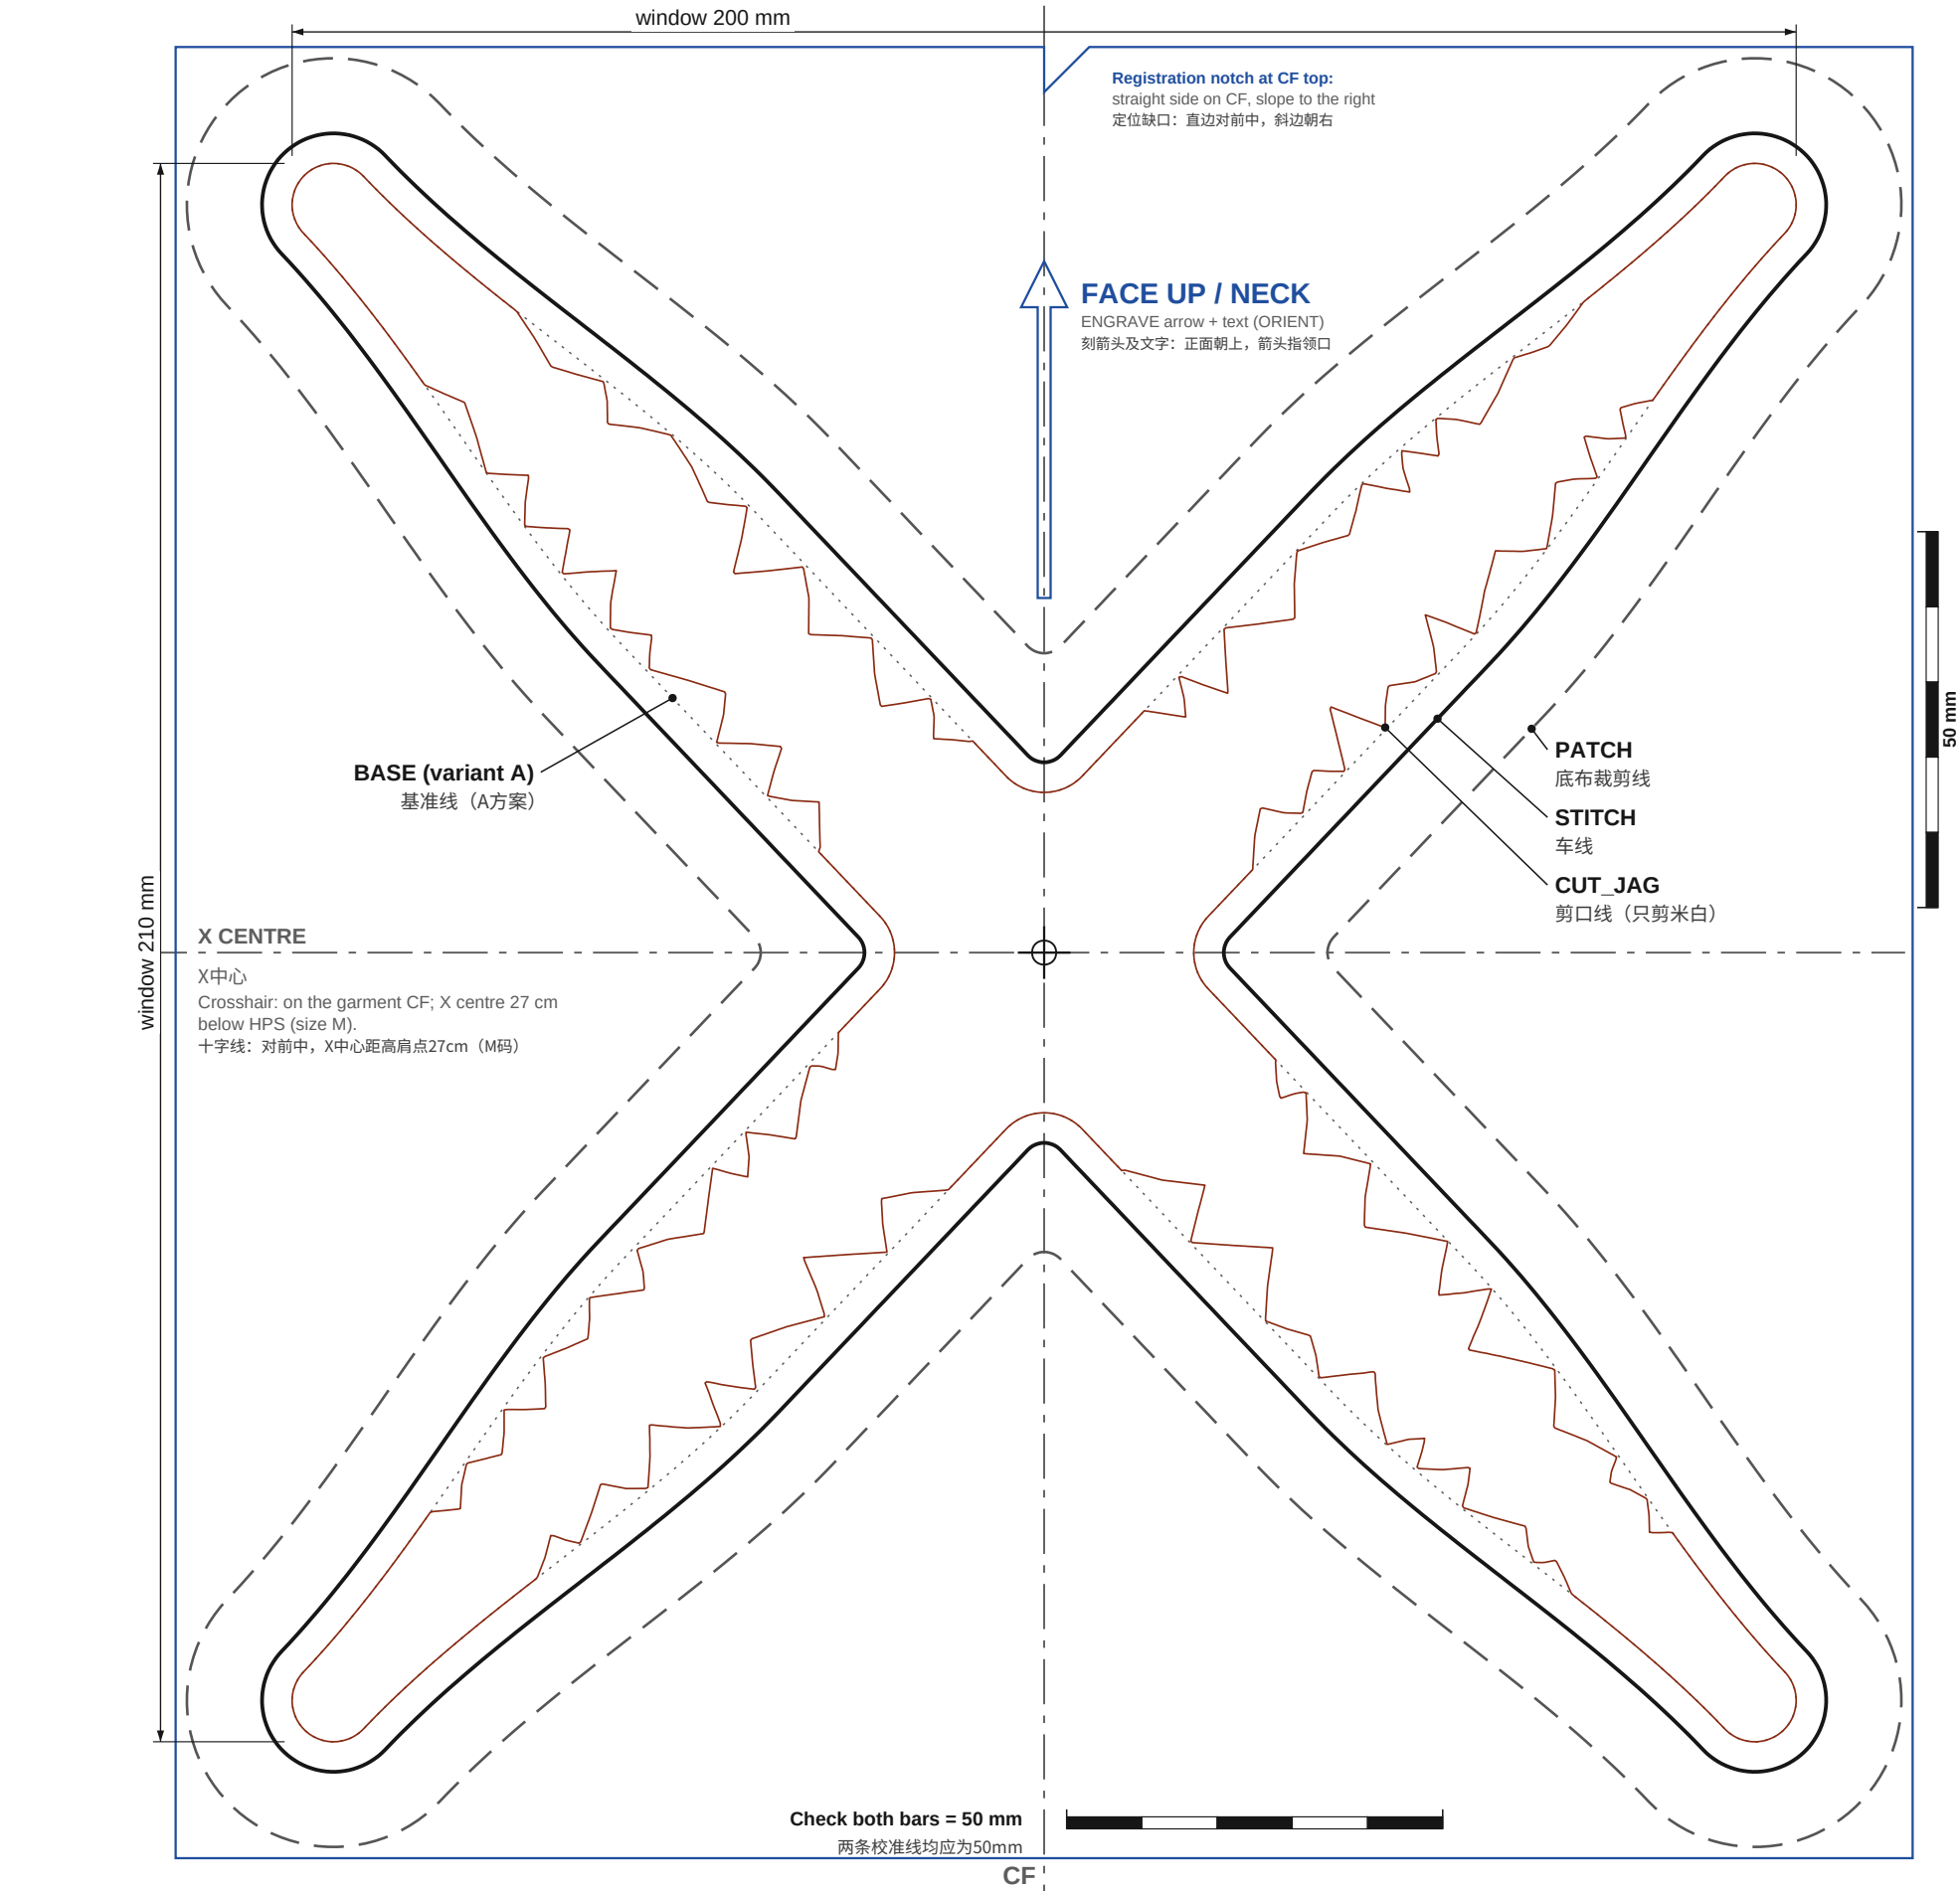

- STITCH (solid): machine path through both layers, 4 mm outside BASE, inner corners $r \geq 3$ mm. Factory digitises it (fee quoted separately).
车线（实线）：穿两层，距BASE 4mm，内角半径 ≥ 3 mm；工厂按此制版（制版费另报）。
- CUT_JAG (jagged layer): cut the cream only. Teeth 3-8 mm deep (less where the arm narrows), 5-15 mm apart, ≥ 3 mm from the stitch, staggered side to side: together $\leq 40\%$ of the arm width, visible brown ≥ 12 mm, never narrower than the tip. No teeth on corner arcs (cut $r \geq 7$ mm) or in the last 18 mm before each tip.
剪口线（锯齿，CUT_JAG）：只剪米白。齿深3-8mm（臂变窄处更浅），齿距5-15mm，距车线 ≥ 3 mm，两侧错开：同一截面合计 $\leq$ 臂宽40%，可见咖啡色 ≥ 12 mm，不窄于尖端。内角圆弧（剪口半径 ≥ 7 mm）及尖端前18mm不做齿。
- BASE (dotted): STITCH offset 4 mm inward, $r \geq 7$ mm; the B valleys sit on it. Variant A (swatch only): cut freehand 0-3 mm inside BASE.
基准线BASE（点线）：车线向内4mm，半径 ≥ 7 mm，B方案齿谷在此线上；A方案（仅小样）：BASE内0-3mm徒手剪。
- PATCH (dashed): brown under-patch cut line = stitch + 10 mm, $r \geq 3$ mm; no trimming after sewing.
底布裁剪线（虚线）：车线外10mm，半径 ≥ 3 mm；车后不修剪。
- GUIDE + ORIENT (blue): cut guide, stitch stencil and placement template are sheets at least this size, used face up. Cut the CF notch (straight side on CF, slope to the right); engrave the arrow + FACE UP / NECK. The cut guide also carries the STITCH line, laid exactly on the sewn stitch.
GUIDE及ORIENT（蓝色）：剪口模板、画线板及定位板不小于此外框，正面朝上使用；前中上端开定位缺口（直边对前中，斜边朝右）；刻箭头及FACE UP / NECK（正面朝上，箭头指领口）。剪口模板同时刻STITCH线，对准已车好的车线。
- DXF: CS-XTEE-01-X-template-200mm.dxf (R12) + R2000 copy. Layers as named here + CENTRE, CHECK, NOTES. Units mm; measure the 50 mm CHECK square after import. Origin = X centre, +Y = neck.
DXF: R12及R2000两版；单位mm，导入后先量50mm校准方块；原点为X中心，+Y指向领口。

CS-XTEE-01 X TEMPLATE 1:1 X模板 1:1

Proto B. Template page 2 / 2.
Tech pack v0.1 DRAFT 2026-09-29, page 3.

PROPOSAL, not final
建议稿, 非最终版


PRINT AT 100% / 实际大小打印, 勿缩放

Proto B: window 150 x 157.5 mm, stitch box 158 x 165.5 mm, patch box 178 x 185.5 mm, arm 19 mm at BASE, visible brown ≥ 10 mm. Outline based on the 200 mm X, tips kept at 10 mm. Use this 150 mm file; do not scale the 200 mm file. Edge B on CUT_JAG, stitch on STITCH_FOLLOW.

B件: 开口150 x 157.5mm, BASE处臂宽19mm, 可见咖啡色 ≥ 10 mm。以200mm为基础, 尖端保持10mm; 须用150mm文件, 不可由200mm文件缩放。按CUT_JAG做B边, 车STITCH_FOLLOW。

FACE VIEW (outside). Do not mirror or rotate. Cut guide, stitch stencil and embroidery program must use the same orientation.

正面视图, 不可翻转或旋转; 剪口模板、画线板及绣花程序方向一致。

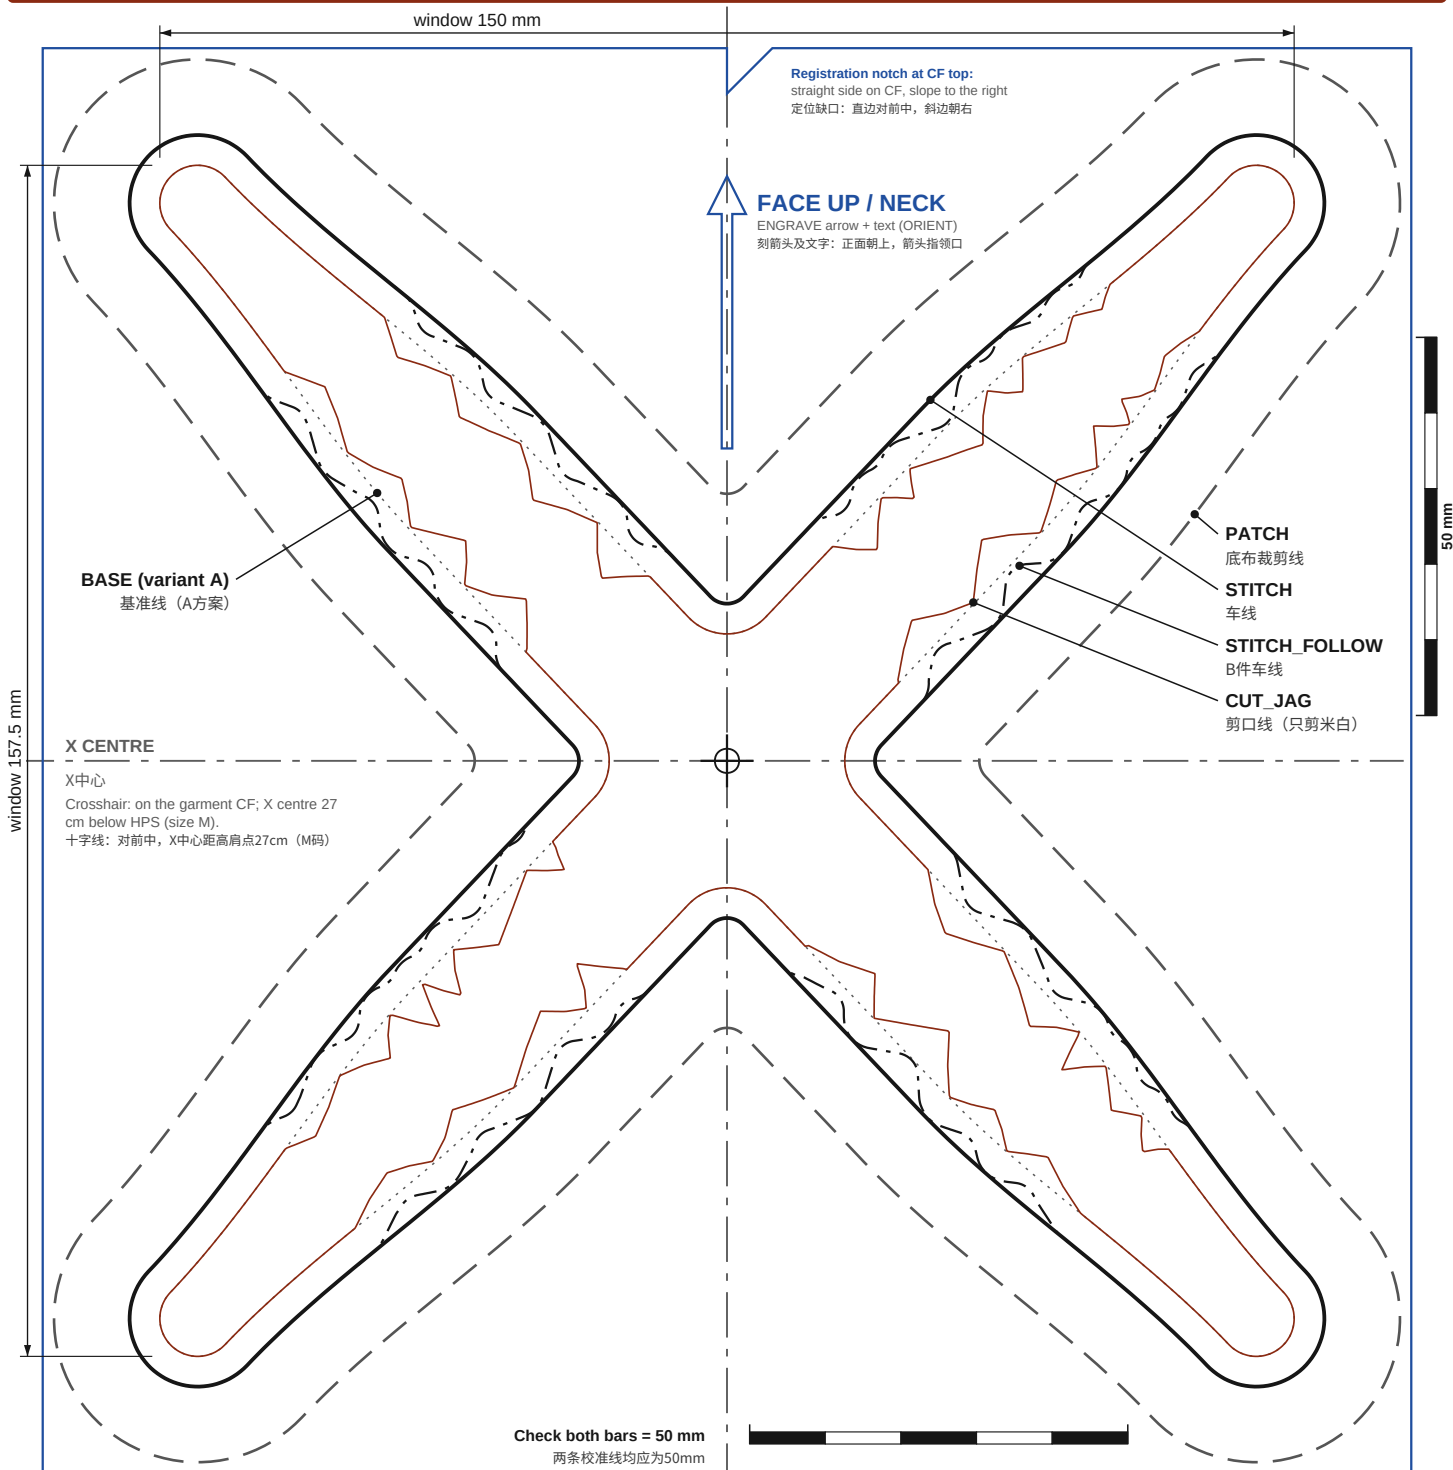

- STITCH (solid): machine path through both layers, 4 mm outside BASE, inner corners $r \geq 3$ mm. Factory digitises it (fee quoted separately).
车线 (实线): 穿两层, 距BASE 4mm, 内角半径 ≥ 3 mm; 工厂按此制版 (制版费另报)。
- CUT_JAG (jagged layer): cut the cream only. Teeth 3-8 mm deep (less where the arm narrows), 5-15 mm apart, ≥ 3 mm from the stitch, staggered side to side: together $\leq 40\%$ of the arm width, visible brown ≥ 10 mm, never narrower than the tip. No teeth on corner arcs (cut $r \geq 7$ mm) or in the last 16 mm before each tip.
剪口线 (锯齿, CUT_JAG): 只剪米白。齿深3-8mm (臂变窄处更浅), 齿距5-15mm, 距车线 ≥ 3 mm, 两侧错开: 同一截面合计 $\leq$ 臂宽40%, 可见咖啡色 ≥ 10 mm, 不窄于尖端。内角圆弧 (剪口半径 ≥ 7 mm) 及尖端前16mm不做齿。
- BASE (dotted): STITCH offset 4 mm inward, $r \geq 7$ mm; the B valleys sit on it. Variant A (swatch only): cut freehand 0-3 mm inside BASE.
基准线BASE (点线): 车线向内4mm, 半径 ≥ 7 mm, B方案齿谷在此线上; A方案 (仅小样): BASE内0-3mm徒手剪。
- PATCH (dashed): brown under-patch cut line = stitch + 10 mm, $r \geq 3$ mm; no trimming after sewing.
底布裁剪线 (虚线): 车线外10mm, 半径 ≥ 3 mm; 车后不修剪。

- STITCH_FOLLOW (dash-dot, Proto B): stitch that follows the jag, ≥ 4 mm from the cut, turns $r \geq 3$ mm. Proto B sews this line, not STITCH.
B件车线 (点划线): 沿锯齿, 距剪口 ≥ 4 mm, 转角半径 ≥ 3 mm; B件车线, 不车STITCH。
- GUIDE + ORIENT (blue): cut guide, stitch stencil and placement template are sheets at least this size, used face up. Cut the CF notch (straight side on CF, slope to the right); engrave the arrow + FACE UP / NECK. The cut guide also carries the STITCH_FOLLOW line: before tracing, check that each tooth on the guide sits where the stitch steps in.
GUIDE及ORIENT (蓝色): 剪口模板、画线板及定位板不小于此外框, 正面朝上使用; 前中上端开定位缺口 (直边对前中, 斜边朝右); 刻箭头及FACE UP / NECK (正面朝上, 箭头指领口)。剪口模板同时刻STITCH_FOLLOW线: 描线前核对模板上每个齿正对车线内折处。

DXF: CS-XTEE-01-X-template-150mm.dxf (R12) + R2000 copy. Layers as named here + CENTRE, CHECK, NOTES. Units mm; measure the 50 mm CHECK square after import. Origin = X centre, +Y = neck.

DXF: R12及R2000两版; 单位mm, 导入后先量50mm校准方块; 原点为X中心, +Y指向领口。