
RoomCleaner

A four-cable ceiling robot that picks laundry off the floor

Jasper Buntinx | Mechanical Engineering | Texas A&M

October 27, 2026

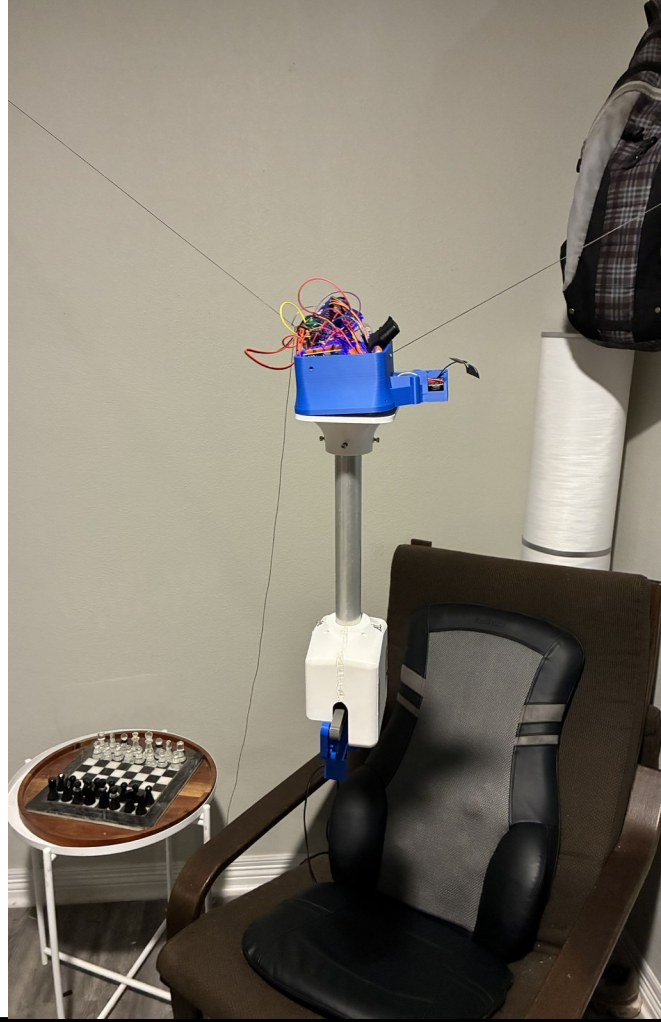

About me

Education: Texas A&M


- Bachelor's, Mechanical Engineering, August 2027

Experience


- ITP Lab, undergraduate research
- Rochester Sensors, mechanical intern
- Petrobras, mechanical intern
- Aggies Create, EcoFil electrical lead

Hobbies

- Personal projects
- Soccer
- Running
- Bouldering
- And man, do I love hiking.

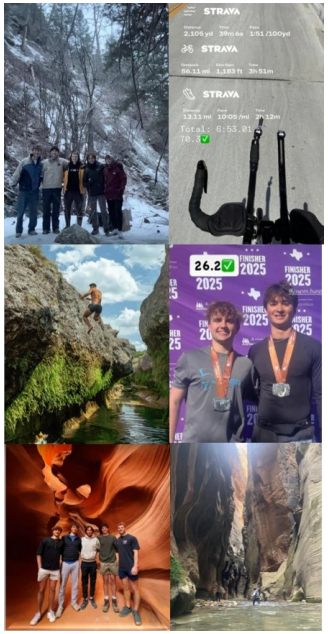

Outdoors and endurance

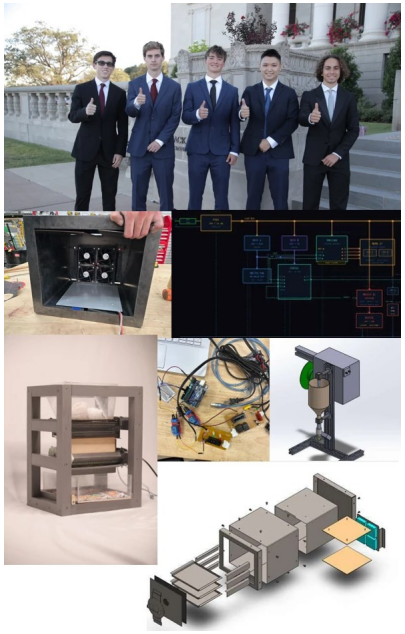

Engineering



Community

Project scope: a robot that picks laundry off the floor

The problem


- Clothes end up on the floor every day; picking them up is a chore
- A floor robot fights the clutter it is meant to clear: furniture, rugs, cords
- A gantry would put a frame across the whole room
- Goal: any garment, anywhere on the floor, into the hamper, with nobody touching it

The proposed solution

- A cable robot: four winch boxes high on the walls hold one claw on four cables
- Changing the four cable lengths moves the claw anywhere in the room
- Nothing on the floor; only the claw moves: 0.60 kg (measured)
- Each box is self-contained: slides off the wall and unplugs when not needed

How it works

- The claw camera locates itself on a printed floor board and finds the garment
- Descend, grip, lift, carry, release over the hamper
- Each move approved on the phone; PAUSE holds; the power strip is the stop
- Success: one garment floor to hamper, no human touch
- Test path: 1 lb weight first (design), then jeans, 0.9 kg (assumed)

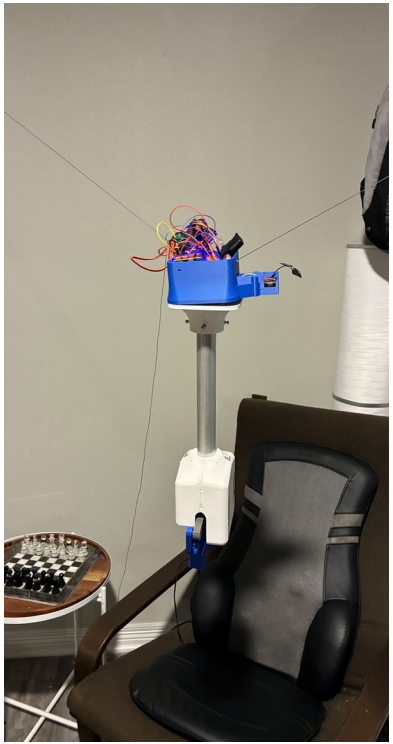


The claw on its cables, room corner

How cable length becomes position, and torque becomes pull

Cable length → position

$$L_i = \|\mathbf{a}_i - \mathbf{p}\|$$

$\mathbf{a}_i$ anchor, $\mathbf{p}$ claw

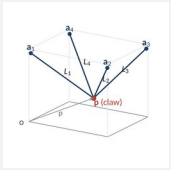

- Line per spool turn = 2π·r: 2π × 7.5 mm core (design) = 47.1 mm → 2π × 10 mm full spool (calc, 20 ft wound) = 62.8 mm (calc)
- Four cable lengths, three position unknowns: overdetermined, solved by least squares
- The camera on the floor board fixes the anchors and cable lengths at startup (calibration)
- Validated in the simulator and by held-out poses during calibration (sim); no physical position measurement yet

Torque → pull on the line

$$I = \frac{V_{\text{ref}}}{8\,R_s} \qquad \tau_{\text{hold}} = \tau_{\text{rated}}\,\frac{I}{I_{\text{rated}}}$$

$$\tau_{\text{run}} \approx 0.7\,\tau_{\text{hold}}\ \text{(assumed)} \qquad F = \frac{\tau}{r}$$

8: A4988 current-sense constant (datasheet)

- At 1.5 A (rated, datasheet; chosen, design): τ_run = 0.7 (assumed) × 0.36 N·m (datasheet) = 0.252 N·m; F = 0.252 / 0.0075 m = 34 N empty, 0.252 / 0.010 m = 25 N full (calc)
- Validated: Vref on the board (measured); 0.7 running fraction (assumed); pull test (planned)

Pull → what four cables hold


$$T = \frac{W}{4\sin\varphi} \qquad \sin\varphi = \frac{d}{\sqrt{d^2 + D_h^2}}$$


- W = (0.454 kg test, design + 0.45 kg claw budget, design) × 9.81 (handbook) = 8.86 N (calc)
- D_h = √(1.676² + 1.372²) = 2.166 m (calc; half the 3.353 × 2.743 m room, measured)
- d = 0.15 m: 8.86 / (4 × 0.069) = 32 N; 16 / 8.3 / 4.6 N at d = 0.3 / 0.6 / 1.2 m (calc)
- Shallow cable: T ≈ W·D_h / (4d), so halving the depth doubles the tension
- Why the planner keeps the claw at least 0.4 m below the anchors (design)
- Validated: calculated only; no cable tension has been measured on the rig

Generation 1: one central unit

The first design

- One Uno and one CNC shield drove four corner motors
- Wires from that one box to every corner
- An overhead ceiling camera scanned the room
- A printed corner plate screwed into a joist: a hook is a pivot, a plate is not
- Each cable found zero against a bead at the outlet
- Bench: a station lifted a test weight; the cable math held (measured)

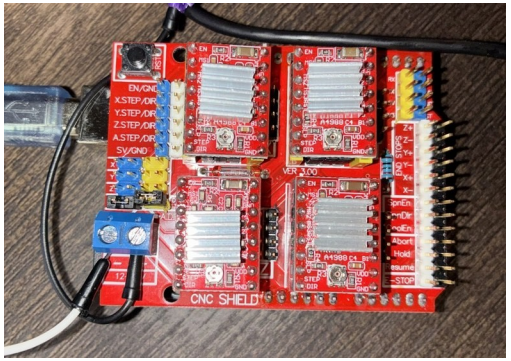

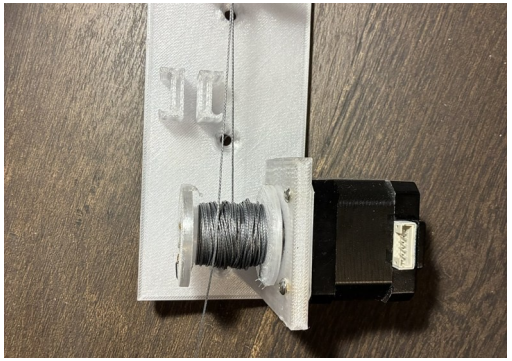



The central board; a gen-1 corner plate; a gen-1 station lifting a test weight


Problems with Generation 1

One central board

- Every motor and every sensor wired back to one place
- One board steps all four motors; a timing error skews the cables
- Skew $\Delta x = v \cdot \Delta t$ = 50 mm/s max cable speed (design) × 0.05 s timing error (assumed) = 2.5 mm (calc)
- Moving a winch means re-running wire to the box

Ceiling camera and bead homing

- The ceiling camera: one more device to mount, wire and calibrate per room
- From above, the claw and cables hide the grasp spot
- Its floor map assumes a flat floor; retired Oct 21
- Bead homing fixes a minimum length on every cable: next slide

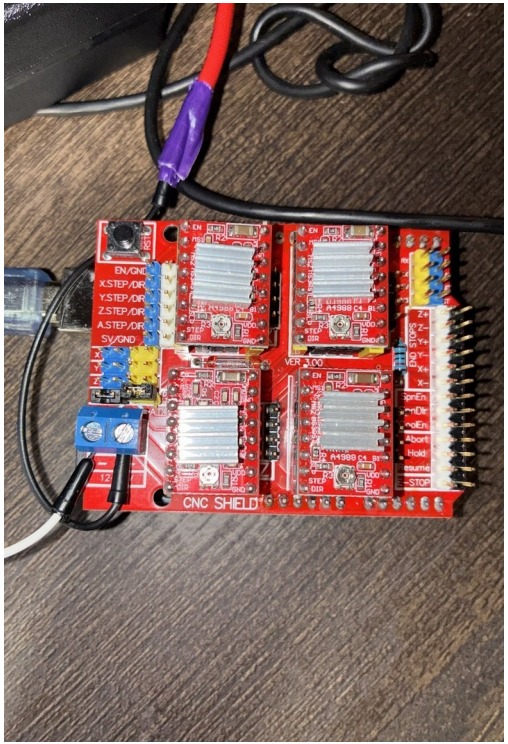


The central board: one shield, four drivers

Homing: one floor board instead of four beads

Bead homing

$$\text{reachable}(\mathbf{p}) \Leftrightarrow \|\mathbf{a}_i - \mathbf{p}\| \geq L_{i,\text{home}} \quad \text{for every } i$$


- A stopper bead cannot pass its outlet: after homing, no cable can be shorter than at home
- Homing all four at once fixes a minimum length on every cable at the same time
- Reachable volume = grid count of the condition over the working volume (calc): 0.0 % (home 0.3 m) to 32.0 % (home 2.19 m); 4.7 % at 1.0 m, 29.1 % at 2.0 m; homing heights (design)

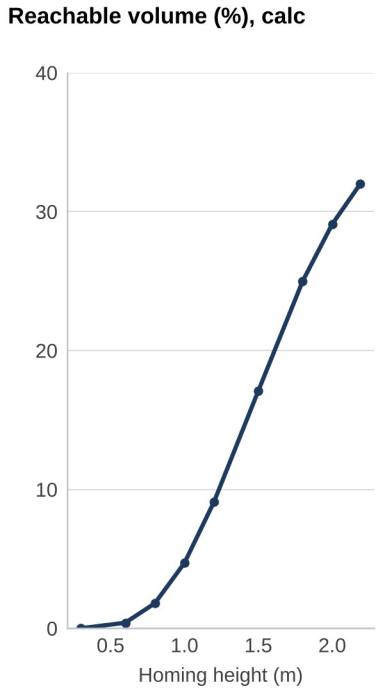

Grid count of the condition above

Floor-board homing

- The camera measures the claw pose against tag 0
- Cable lengths follow from L_i = ‖a_i − p‖
- No length is clamped: the whole working volume stays available
- Nine sheets, 150 mm tags, 250 mm pitch, id 0 = origin (all design)

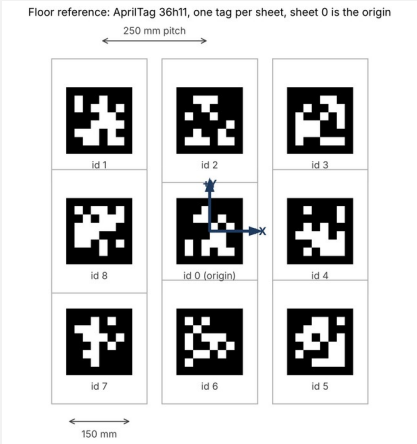


What a winch on a wall needs to work

The switch (button)

- Things go wrong: a camera fails, a spool overwinds, tension rips a mount out, a motor stalls
- A switch the cable's bead can hit: that station stops
- Fail-safe wiring: LOW at rest, HIGH pressed or with a broken wire

The encoder

- On the spool: measures the discrepancies while testing; data first
- Confirms every commanded step
- Catches slip: the tension sensor
- If the camera proves good enough, it can go later

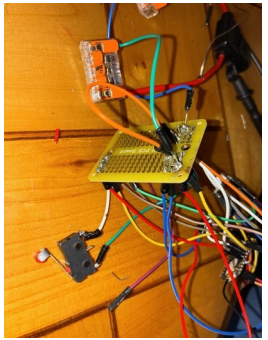


Homing switch



Switch pressed into the slide-in

And now all this wiring, from one box

- Motor, switch and encoder in every corner: 10 conductors per corner (design)
- Routes 6 + 21 + 23 + 32 ft (measured) = 82 ft; × 10 = 820 ft (250 m) of wire to one box (calc)

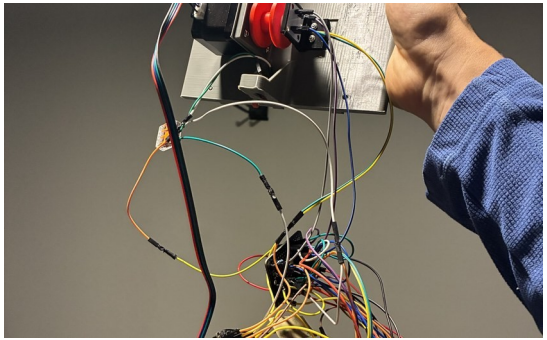

One slide-in, its harness hanging


The solution: a modular box that only needs power

A box with its own brain


- An ESP32 in each box, with its driver, buck, switch and encoder
- The only thing going in is power: one 12 V pair (supply label, datasheet)
- 82 ft of routes (measured) × 2 conductors = 164 ft (50 m), not 820 ft (calc)
- Power can come from anywhere, so a box sits in any position and orientation
- The room's geometry no longer limits where the winches go

Wire drop: Gen 1 leads vs one power pair

- $V = I \cdot \rho \cdot 2L/A$; $\rho = 1.724 \times 10^{-8}$ Ω·m (handbook), L = 9.75 m / 32 ft one way (measured), I = 2 A (assumed)
- 24 AWG Gen 1 motor leads (measured), A = 0.205 mm² (handbook): R = 1.64 Ω, 3.29 V (27 % of 12 V), 6.6 W (calc)
- 16 AWG power pair (design), A = 1.309 mm² (handbook): R = 0.257 Ω, 0.51 V (4.3 %), 1.0 W (calc)
- Thin motor leads over a room-length run lose a quarter of the supply; one thick power pair loses 4 % (calc, above)
- 16 AWG: $30 per 100 ft (assumed price) × 65 ft (design cut list) = $19.50 (calc)

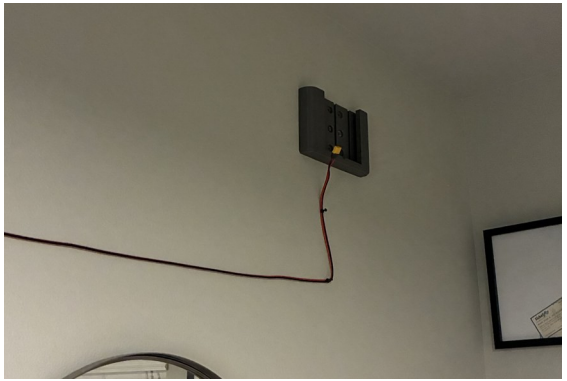

The wall mount: one power plug

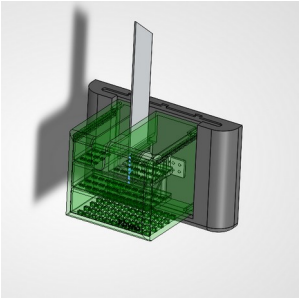

The station: board, driver, motor, fin (CAD)


Modular, for the everyday user

Unmount, remount, plug in

- A box slides off its wall mount and unplugs
- Guests coming: each box goes in a drawer
- Back on: one plug, it joins the Wi-Fi by itself

No screwdriver on the wall


- Slip the station out of the mount, open the electronics
- Close it, slide it back: the mount and its screws stay in the stud
- The mount is separate: a stud today, a pole clamp later

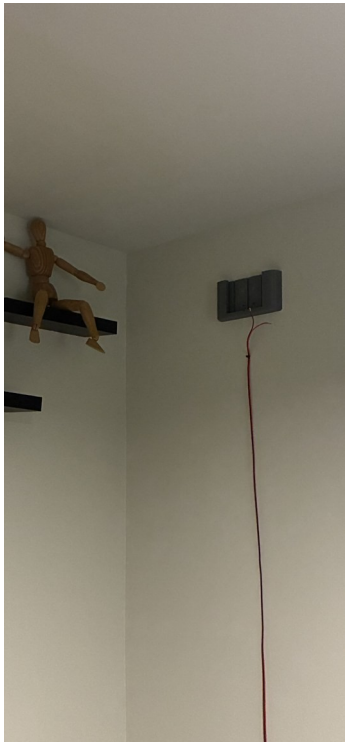

The wall mount alone, lead hanging




The station slid onto it

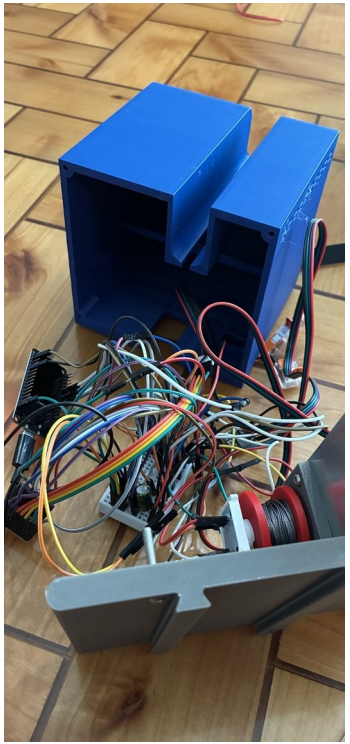

Shell open on the bench


Trade-offs: what each component needs

Tension per cable (N) vs depth (m), calc

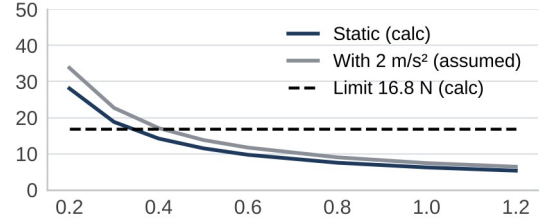


T = m(g + a)/(4 sin φ); m = 0.60 kg claw (measured) + 1 lb (design), a = 2 m/s² (assumed): d 0.4 m → 17.1 N vs 16.8 N limit (calc); jeans 0.9 kg (assumed) need d ≥ 0.6 m (16.6 N, calc)

Motor case (°C) at 1.5 A (design), sim

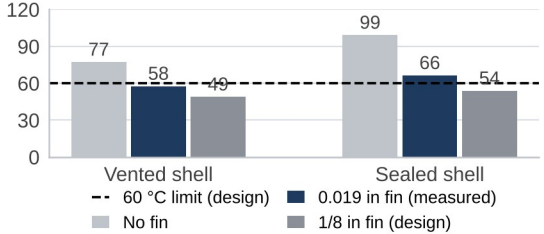


Need < 60 °C (design). Two-node thermal network (sim); input P = I²·R = (1.5 A)² × 1.8 Ω = 4.05 W (calc; 1.5 A rated, datasheet; 1.8 Ω per phase, assumed, not metered); microstepping: total heat = I_peak²·R

Pull per winch (N) vs spool radius (mm), calc

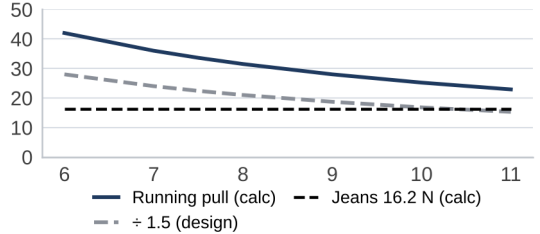


F = 0.7 (assumed) × 0.36 N·m (datasheet) / r: 34 N at 7.5 mm (design), 25 N at 10 mm (calc); ÷ 1.5 skip margin (design) = 16.8 N ≥ 16.2 N jeans (calc)

Winches can hold vs must hold (kg)

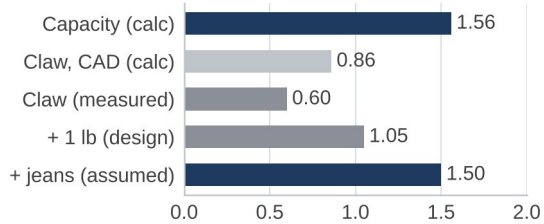

16.8 N / (1.101 worst-cable factor, sim × 9.81, handbook) = 1.56 kg vs 0.60 (measured) + 0.9 (assumed) = 1.50 kg: +4 % (calc); 1.50 × 1.101 × 9.81 = 16.2 N; budget 0.45 kg (design)

Tension at which each part gives (N), calc

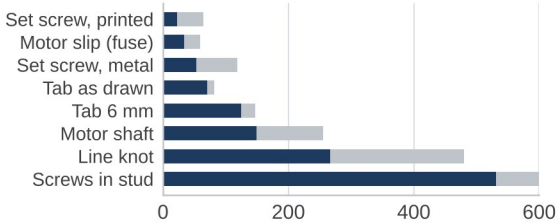

Estimates from hand calcs and published strengths (handbook); no stress concentrations. Motor slip: 0.36 N·m (datasheet) / 7.5 mm (design) = 48 N (calc)


The factors

- Pull ∝ I; heat P = I²R ∝ I²
- 1.0 A earlier setting (design) → 1.5 A: pull × 1.5, heat × 1.5² = 2.25 (calc)
- Every gram on the claw is a gram of payload
- The printed set screw may slip before the motor: metal insert

The mount assembly: slide-in on a dovetail


Slide-in mount and load path


- The wall mount screws into a stud; the station slides onto it on a dovetail
- Dovetail: wall mount offset outward 0.175 mm per side (design); clearance set from fit coupons (measured)
- Load path: cable, spool, set screw, motor, tab, mount, screws, stud
- Motor slips first: F = τ/r = 0.36 N·m (datasheet) / 7.5 mm (design) = 48 N (calc)
- The spool encoder sees the slip: tracking fault, every station holds

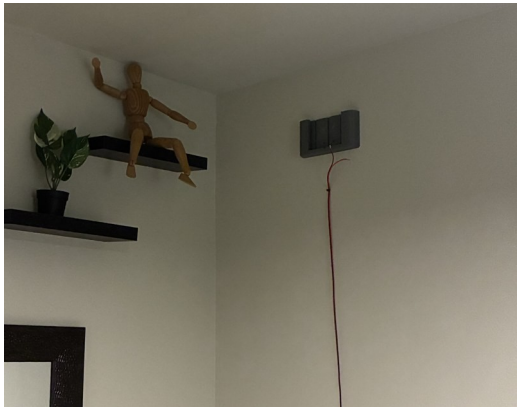



The mount alone, before the station slides in; the station on the mount

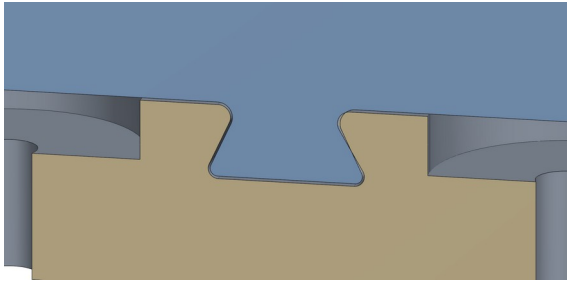

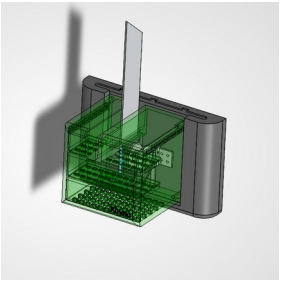

Rib in the dovetail groove (CAD); the station with its shell transparent (CAD)


The mount assembly: fin, vents and the wall

Fin, vents, stud


- The fin: aluminium on the motor face, out through a slot in the top of the shell
- Motor heat: $P = I^2 \cdot R = (1.5\ A)^2 \times 1.8\ \Omega = 4.05\ W$ (calc; 1.5 A rated, datasheet; 1.8 Ω per phase, assumed, not metered)
- With microstepping the two phase currents follow sin and cos, so total heat = $I_{peak}^2 \cdot R$
- That heat leaves through the vents and the fin
- First station in a stud on the TV wall, 12 V down the wall (datasheet)
- The slide-in binds on insertion today; a 1° draft on the dovetail (design) is the next iteration



On the TV wall, 12 V leads (datasheet)

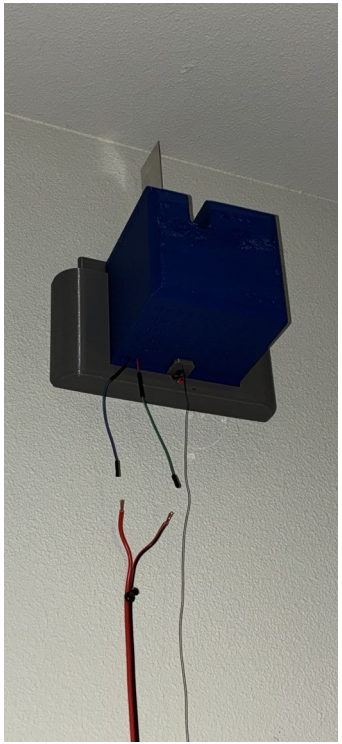

From below: fin through the slot

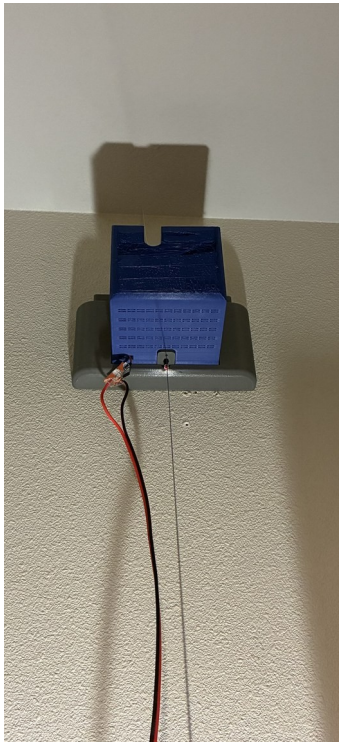

The line leaves the switch tab straight down

Manufacturing: in-house processes and fit control

Processes


- PETG, FDM: 0.4 mm nozzle, 0.20 mm layers, supports at 30° (all design); loads along the layers
- Aluminium fin: sheared blank, five holes drilled in one mill setup
- First hole is the mill zero: pattern ±0.1 mm vs ±0.5 mm sheared edges (design tolerances)
- Heat-set inserts: M3 gear housing, M2.5 encoder board

Make vs buy

- Bought: steppers, drivers, boards, servo, camera, battery, encoders
- Made: every printed part and the fin
- Filament per station: 0.762 kg (calc: CAD volume × 1.27 g/cm³, handbook × fill, assumed) × $15/kg (assumed) = $11.43 (calc)
- Robot, three stations: $210.78 parts (listing prices, partly assumed) + 2.52 kg × $15/kg = $37.74 filament (calc)


Fits


- Printed holes come out undersize: every printed fit carries an allowance
- Spool bore: Ø5.2 (design) printed too tight (measured) on the Ø5.0 shaft (datasheet); opened to Ø5.45 (design)
- Dovetail: wall mount offset outward 0.175 mm per side, 30° flanks (design)
- Bearing pocket Ø14.075 behind a Ø14.000 entry lip, 8 T-slots (design)
- Fit coupons printed first; the allowances above came from them (measured)
- A failed layer was kept on one shell only: the shell carries no load
- TPU 95A (datasheet) grip pads: next iteration

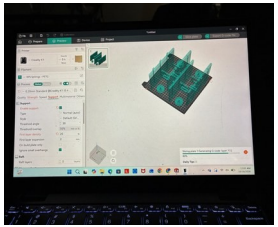



Slicer (K1, PETG); drilling the fin

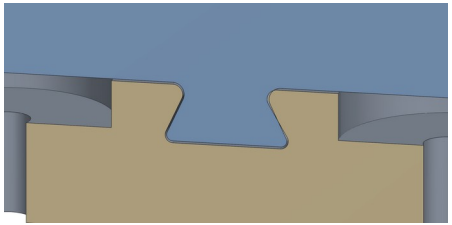

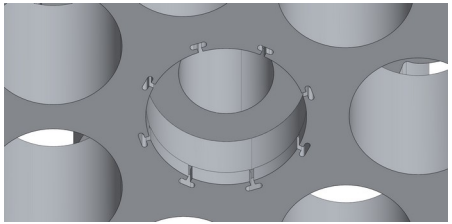

Dovetail rib; bearing pocket and lip (CAD)

The claw, and why it is modular

The claw today

- Four-bar hands on a geared crank; 53 mm opening (design)
- A camera bay in the electronics housing; the camera looks down the tube
- One 7.4 V two-cell pack (datasheet): 6 V regulator for the servo, 5 V buck for the board (design setpoints)
- Weighed 0.60 kg with battery (measured) against a 0.45 kg budget (design)


Modular, on purpose

- The gripper attaches at the tube, so other grippers can be tried
- A hard pinch was expected to grip better; testing showed alignment problems
- The first rack-and-pinion jaws left a gap on thin cloth (Sep 30): 77.4 − 2 × 18 mm × 2.09 rad = 2.0 mm (calc; CAD dimensions, design)
- TPU grip pads go on in the next iteration
- The v6 clamp: 2,061 g in CAD at solid density (calc) / 450 g budget (design) = 4.6 (calc); mass tracked per part since







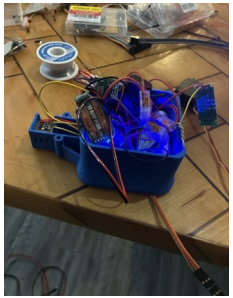

Assembled; the hands (CAD); the v6 clamp (CAD); the housing open


Electrical and testing: bench, then wall

Bench

- Station boards: bench checklist passed on both controller boards (measured)
- Claw: camera live view, battery sense and servo pass (measured)

On the wall

- A boxed station boots and joins Wi-Fi by itself
- Firmware updates over Wi-Fi; no USB cable after boxing
- Motors stay off until the phone arms them; updates only while disarmed
- Planned: pull test, hold test, first three-station lift

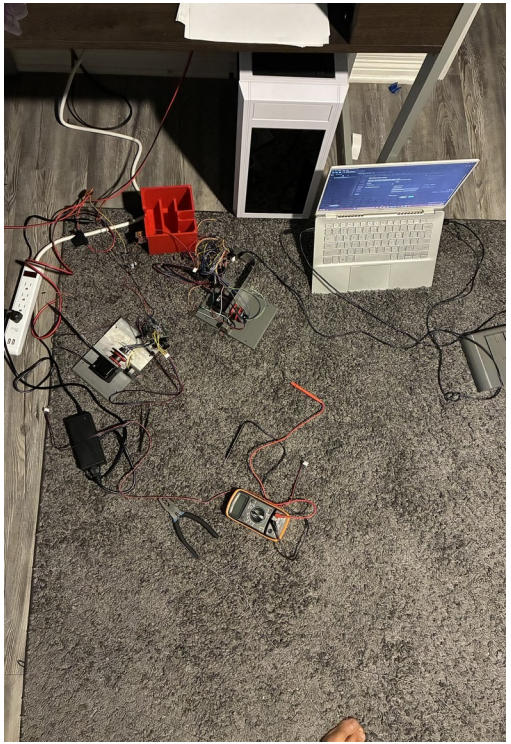

Bench: two stations, laptop, meter, 12 V supply (datasheet)



The first station on the wall

Startup and self-calibration: six states before the robot is READY

1 SELF_CHECK

- Claw online, battery above minimum
- Camera confirms the claw upright at the known height on the floor board
- Stations healthy, homing switches closed; arm

2 SLACK_TAKEUP

- One cable at a time reeled in until the camera sees the claw slide or tip (onset)
- Records spool position and slide bearing; backs off
- Bearings checked against the anchor layout; first fit of cable lengths

3 INITIAL_LIFT

- Pretension all cables; lift in small packets
- Abort on lateral drift, tilt, or commanded lift exceeding observed rise (slack cable)

4 VISUAL_INITIALIZATION

- Settled frame batch of the floor board
- Refit cable lengths and the room-to-marker transform

5 CALIBRATION

- Local → intermediate → expanded pose sets chosen by D-optimal design; refit between stages
- Held-out witness poses
- Accept on witness residuals, identifiability, predicted length sigma over the work volume

6 REFERENCE_VERIFICATION

- Optional bead references
- Trust level VERIFIED or LOCAL_ONLY from the margin check

No automatic retry; any station reboot forces the full sequence again.

Next iteration: what was not working, and what changes

3:1 printed gear stage

- 18T / 54T spur (design), printed PETG pinion
- Designed and checked in CAD; pinion printed; not fitted
- Pull × 3 (design) × 0.9 η (assumed) = 2.7 at equal current (calc)
- At 1.0 A (design): heat × $(1.0/1.5)^2$ = 0.44 (calc)

1° draft on the dovetail


- Today the slide-in binds on insertion; 1° (design)
- Thicker at the top, thinning toward the bottom
- The station self-locates as it slides in (planned)


Lighter back mount

- Today: 597 cm^3 solid (design, CAD volume), far stronger than the motor can pull
- Thinner walls and ribs: about 200 cm^3 (planned)
- Less print time and filament

Also next / still planned

- TPU grip pads on the jaws (planned)
- Pull test at 1.5 A (design): the measured limit goes into the planner (planned)
- Hold test: 90 minutes at 1.5 A, motor below 60 °C (planned; 60 °C limit, design)
- First three-station lift: self-check, calibration, a short move with 1 lb (planned; 1 lb, design)

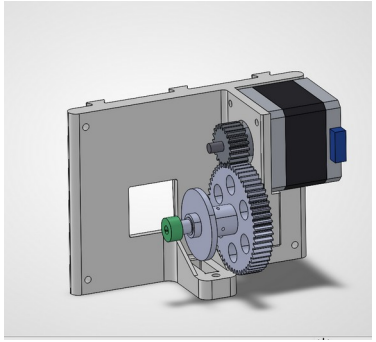

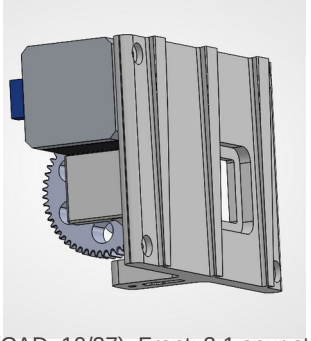

Next iteration (CAD, 10/27). Front: 3:1 spur stage, spool on its own shaft, encoder magnet cap. Back: slide-in rails, window, screw holes

Thank you

Jasper Buntinx | Mechanical Engineering | Texas A&M