



MEMS hydrogen sulfide gas sensor

(Model: GM-602B)

Instruction Manual

Version number: 2.2

Implementation Date: August 25, 2020

Zhengzhou Winsen
Electronic Technology Co., Ltd.

statement

This instruction manual is copyrighted by Zhengzhou Weisheng Electronic Technology Co., Ltd. (hereinafter referred to as "the Company"). Without written permission, this manual may not be reproduced or distributed.

No part of this instruction manual may be copied, translated, stored in a database or retrieval system, nor may it be reproduced electronically, photographed, or recorded.

To spread through any means, including but not limited to, [other means].

Thank you for using Winsen Technology's product series. To help you better utilize our products and reduce the risk of damage caused by improper use...

In case of product malfunction, please read this instruction manual carefully before use and use it according to the recommended methods. If you do not...

The company shall not be liable for any consequences arising from the use of the sensor in accordance with this instruction manual or from any unauthorized removal, disassembly, or replacement of its internal components.

loss.

The color, style, and size of the product you purchase are subject to the actual item.

Our company adheres to the philosophy of technological advancement and is continuously committed to product improvement and technological innovation. Therefore, our company reserves all rights.

The company reserves the right to make product improvements without prior notice. Please ensure you are using the valid version of this manual. Furthermore, the company encourages...

Users are encouraged to explore ways to optimize the use of this product based on their experience.

Please keep this instruction manual safe so that you can refer to it and get help when you need it in the future.

Zhengzhou Weisheng Electronic Technology Co., Ltd.

GM-602B Hydrogen Sulfide Gas Sensor

Product Description

MEMS hydrogen sulfide gas sensors utilize MEMS technology on a Si substrate.

The bottom is fabricated with a micro-heat plate, and the gas-sensitive material used is electrically conductive in clean air.

Metal oxide semiconductor materials with low efficiency. When detected in ambient air...

The conductivity of the sensor changes when a gas is present; the higher the concentration of the gas, the lower the conductivity.

The higher the conductivity of the sensor, the better. A simple circuit can be used to convert the conductivity...

The change is converted into an output signal corresponding to the gas concentration.



Sensor characteristics

This product utilizes MEMS technology, featuring a robust structure and high sensitivity to hydrogen sulfide; it is characterized by small size, low power consumption, high sensitivity, and fast response recovery.

It has advantages such as simple driving circuit, good stability, and long life.

Main applications

Portable and stationary hydrogen sulfide monitors; hydrogen sulfide detectors.

Technical indicators

Table 1

Product Model			GM-602B
Product Type			MEMS hydrogen sulfide gas sensor
Standard package			Ceramic packaging
Detecting gas			hydrogen sulfide, benzene, etc.
Detection concentration			0.5ppm~50ppm H2S
Standard electricity Road conditions	circuit voltage VC		~24V DC
	Heating voltage VH		1.9V±0.1V AC or DC
	Load resistor RL		Adjustable
Standard measurement Test conditions Lower gas sensitivity Component characteristics sex	Heating resistor RH		80~±20~ (room temperature)
	Heating power consumption PH		~40mW
	Sensitive body resistance	RS	1K~±30K~(in 50ppmH2S)
	Sensitivity S		R0(in air)/Rs(in 50ppmH2S)~3
	Concentration slope ~		~0.6(R200ppm/R50ppmH2S)
Standard measurement Test conditions	Temperature and humidity: 20~±2~; 55%RH±5%RH		
	Standard test circuit		VH:1.9V±0.1V VC : 5.0V ± 0.1V

Sensor structure diagram

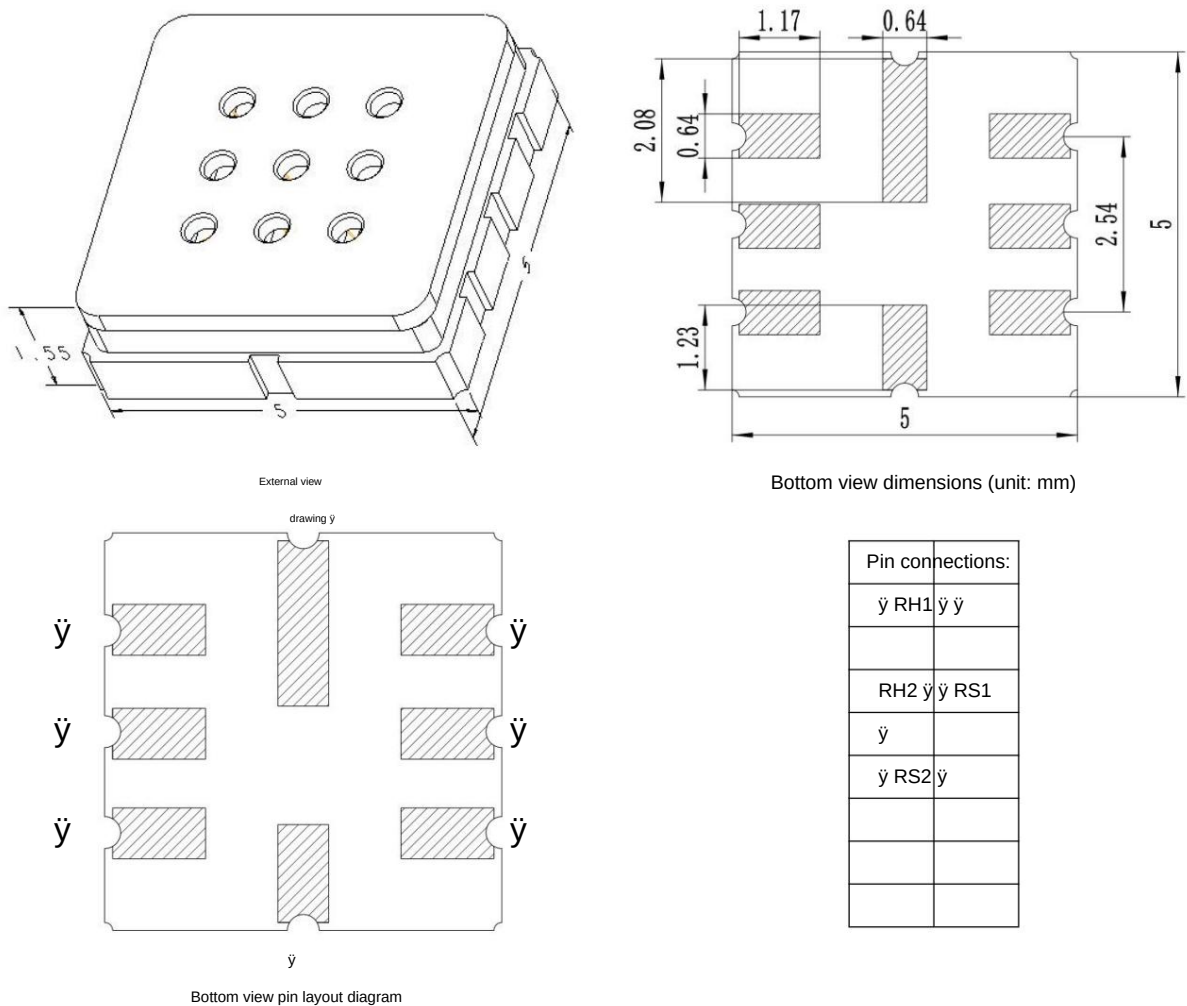


Figure 1 Schematic diagram of sensor structure

Basic circuit

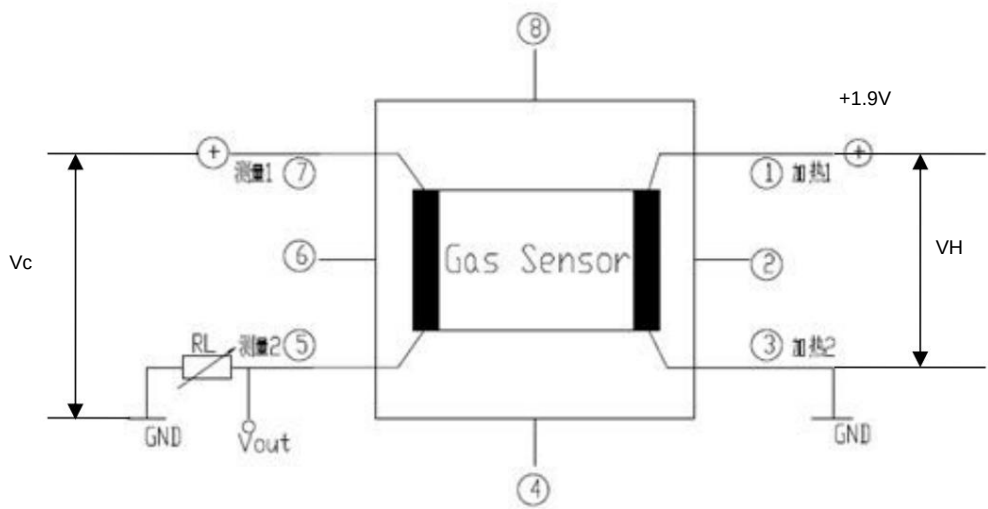


Figure 2 GM-602B Test Circuit

Note: The diagram above shows the basic test circuit for the GM-602B sensor. This sensor requires two voltages: the heater voltage (VH) and the test voltage (VC).

VH is used to provide a specific operating temperature for the sensor and can be supplied by either DC or AC power. Vout is the voltage across the load resistor (RL) connected in series with the sensor. VC is negative.

The on-resistor RL provides the test voltage and requires a DC power supply.

Sensor characteristic description

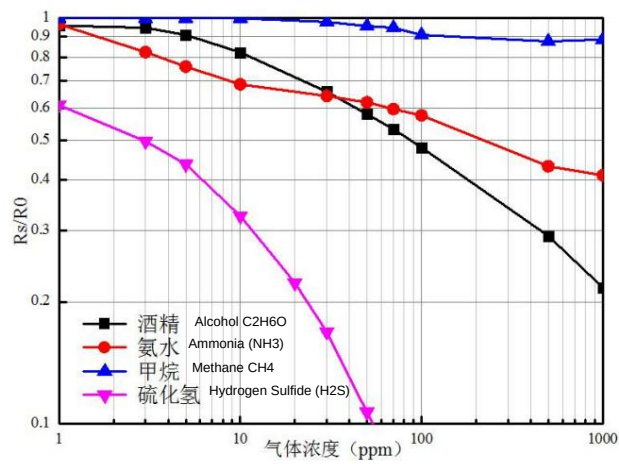


Figure 3. Typical logarithmic sensitivity characteristic curve of the sensor.

In the figure, Rs represents the resistance value of the sensor in gases of different concentrations;

R0 represents the resistance value of the sensor in clean air. All tests shown in the figure were performed

under standard test conditions.

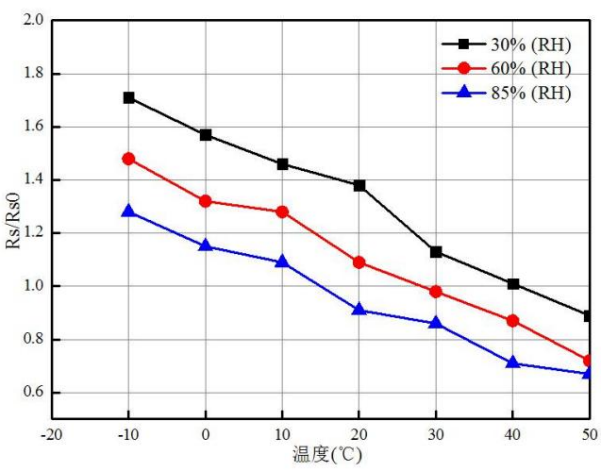


Figure 4 shows typical temperature and humidity characteristic curves of the sensor.

In the figure, Rs represents the resistance value at various temperatures and humidity levels containing

50ppm H2S; Rs0 represents the resistance value at 20°C and 55%RH containing 50ppm H2S.

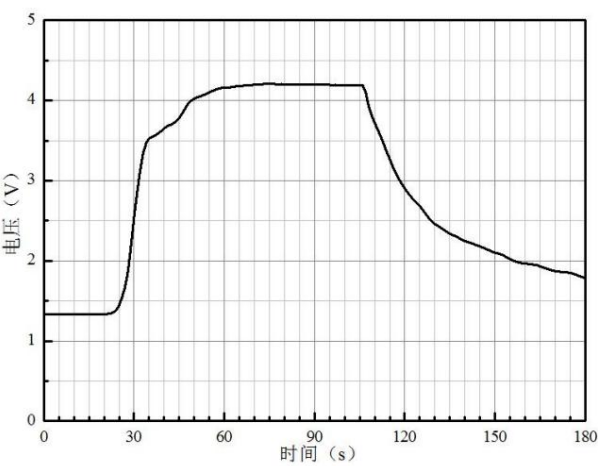


Figure 5 Response recovery curve

The voltage in the diagram is the voltage across the load resistor (RL) connected in series with the sensor.

Pressure. The test shown in the figure was conducted under standard test conditions, using the test gas.

50ppmH2S y

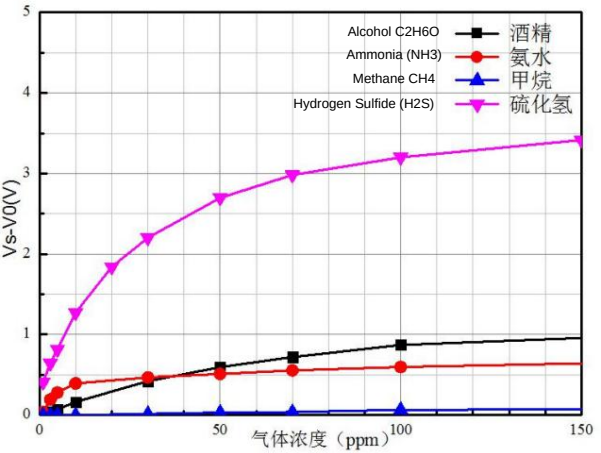


Figure 6. Linear characteristic curve of the sensor

The output voltage shown in the figure is the voltage across the load resistor (RL) connected in series with

the sensor. All tests shown in the figure were performed under standard test conditions.

Long-term stability

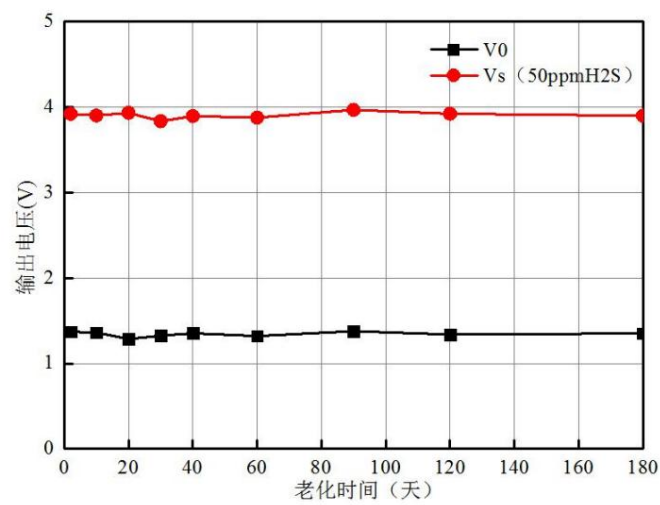


Figure 7 Long-term stable characteristic curves

Note: All tests in the figure were performed under standard test conditions. The horizontal axis represents aging time, and the vertical axis represents output voltage value.

Instructions for use:

1. Preheating time

If a sensor is stored for an extended period without power, its resistance will experience reversible drift. Therefore, the sensor needs to be preheated before use to achieve the desired internal resistance.

To maintain chemical equilibrium, the preheating voltage should be consistent with its heating voltage V_H . Recommended storage times and corresponding preheating times are as follows:

Table 2

Storage time	Recommended preheating time
Less than 1 month	No less than 24 hours
1-6 months	No less than 48 hours
More than 6 months	No less than 72 hours

2. Sensor Calibration

Sensor accuracy is affected by factors such as differences in reference resistance between sensors, differences in sensitivity, temperature, humidity, interfering gases, and aging time.

The input-output relationship is nonlinear, hysteretic, and non-repeatable. Therefore, absolute concentration measurements require periodic monitoring.

Calibration (single-point/multi-point calibration can be performed across the entire measurement range) ensures accurate transmission of measurement values; relative measurements do not require calibration.

Precautions:

1. Situations that must be avoided

1.1 Exposure to volatile silicon compound vapors

The sensor should be kept away from silicone adhesives, hairspray, silicone rubber, putty, or other environments containing volatile silicone compounds. If the sensor...

The surface of the device adsorbs silicon compound vapor, and the sensor's sensitive material is coated with silicon dioxide formed from the decomposition of the silicon compound, suppressing the sensor's...

Sensitive and irreversible.

1.2 Highly corrosive environments

When sensors are exposed to high concentrations of corrosive gases (such as H₂S, SO₂, Cl₂, HCl, etc.), it can cause damage to the heating materials and the sensor itself.

Corrosion or damage to the leads can cause irreversible deterioration of the properties of sensitive materials.

1.3 Pollution from alkalis, alkali metal salts, and halogens

Sensors can also experience performance degradation after being contaminated by alkali metals, especially salt spray, or exposed to halogens such as Freon.

1.4 Contact with water

Splashing water or immersing the sensor in water can cause a decrease in its sensitivity.

1.5 Icing

Water freezing on the surface of the sensor's sensitive material can cause the sensitive layer to crack and lose its sensitive properties.

1.6 Applying voltage

Overload heating caused by overload voltage can cause irreversible damage to the sensor. Static electricity can also damage the sensor. Therefore, when connecting...

Anti-static measures should be taken when touching the sensor.

2. Situations to be avoided as much as possible

2.1 Condensate

Under indoor operating conditions, slight condensation may have a minor impact on sensor performance. If water condenses on the sensitive layer surface and remains there for a period of time...

Over time, the sensor's characteristics will degrade.

2.2 In a high concentration of gas

Regardless of whether the sensor is powered on, prolonged exposure to high concentrations of gas will affect its characteristics. For example, directly spraying lighter fluid onto the sensor...

This will cause great damage to the sensor.

2.3 Long-term exposure to extreme environments

Regardless of whether the sensor is powered on, prolonged exposure to extreme conditions, such as high humidity, high temperature, or high pollution, will affect the sensor's performance.

It has been severely affected.

2.4 Vibration

Frequent and excessive vibration can cause internal resonance in the sensor, leading to breakage. The use of pneumatic screwdrivers/ultrasonic welding during transportation and on the assembly line can also cause this.

Such vibrations are generated when the machine is in contact with the object.

2.5 Impact

If the sensor is subjected to a strong impact or collision, it may break internally.

2.6 Welding

2.6.1 Recommended conditions for reflow soldering

Neutral atmosphere;

Welding temperature 250±10°;

Avoid flux vapor.

2.6.2 Recommended conditions for manual welding

Rosin flux with the lowest chlorine content;

Welding temperature $\geq 350^{\circ}\text{C}$;

Duration $\geq 5\text{s}$.

Violating the above usage conditions will degrade the sensor's performance.

Packaging

MEMS sensors are all coated with a special protective film to prevent the effects of dust, water, atmosphere, and high temperature. This film is applied only after soldering is complete.

Remove the protective film.

We use tape and reel packaging, but other packaging methods can also be provided according to customer requirements.

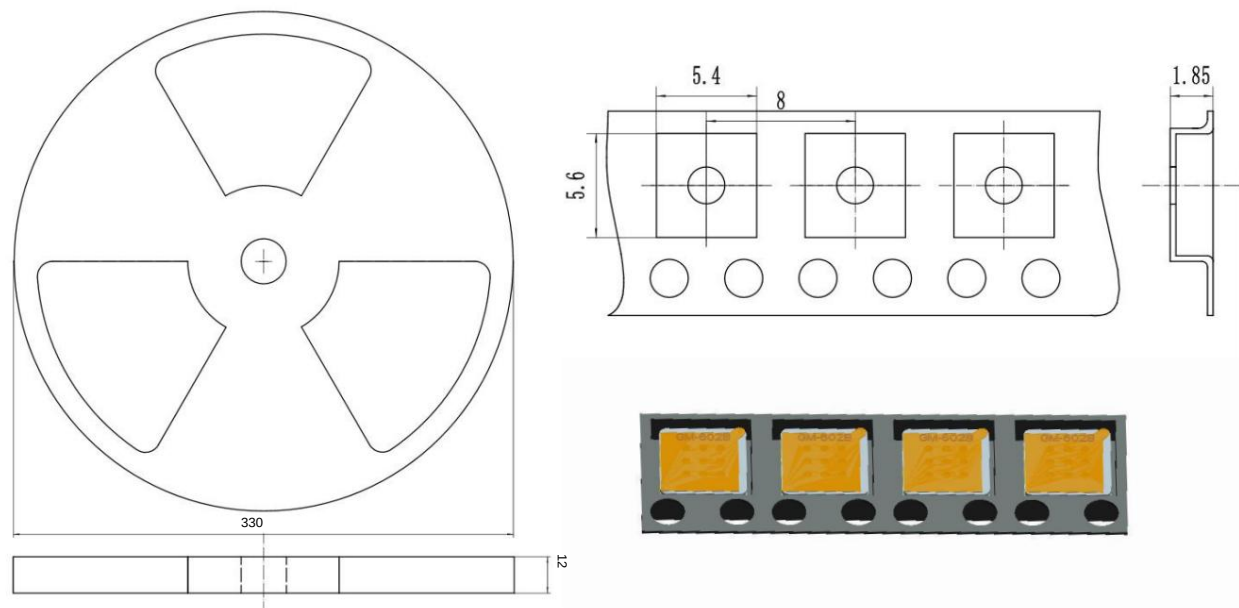


Figure 8 Sensor Packaging Diagram

Environmental Clauses

RoHS: This product complies with the current RoHS directive and does not contain any environmentally friendly substances.

Ten chemical substances restricted by environmental regulations.

Zhengzhou Winsensor Electronic Technology Co., Ltd.

Address: No. 299, Jinshuo Road, High-tech Development Zone, Zhengzhou City Tel:

0371-60932955/60932966/60932977 Fax: 0371-60932988 WeChat: winsensor E-

mail: sales@winsensor.com Website:

<http://www.winsensor.com>

