GDML USER'S GUIDE

Version 2.4

Contents

| GDML USER | X'S GUIDE | 1 |
|--------------|-----------------------------------|----|
| Contents | | 2 |
| 1. Introduct | tion | 4 |
| | started | |
| 2.1 Insta | llation of GDML in Geant4 | 5 |
| 2.2 Runn | ning simple examples | 5 |
| 3. GDMLS | chema | 6 |
| 3.1 Gene | eral structure | 6 |
| 3.1.1 | Splitting GDML file using ENTITY | 8 |
| 3.1.2 | Multiple GDML files | 8 |
| 3.2 Defin | nitions | 9 |
| 3.2.1 | Constants | 9 |
| 3.2.2 | Quantities | 9 |
| 3.2.3 | Variables | 9 |
| 3.2.4 | Positions | 9 |
| 3.2.5 | Rotations | 10 |
| 3.2.6 | Scales | 10 |
| 3.2.7 | Matrices | 10 |
| 3.3 Mate | rials | 12 |
| 3.3.1 | Isotopes | 12 |
| 3.3.2 | Elements | 12 |
| 3.3.3 | Materials | |
| 3.4 Solid | ls | 14 |
| 3.4.1 | Box | 14 |
| 3.4.2 | Cone Segment | 14 |
| 3.4.3 | Ellipsoid | 14 |
| 3.4.4 | Elliptical Tube | |
| 3.4.5 | Elliptical Cone | 15 |
| 3.4.6 | Orb | |
| 3.4.7 | Paraboloid | 16 |
| 3.4.8 | Parallelepiped | 16 |
| 3.4.9 | Polycone | 17 |
| 3.4.10 | Generic Polycone | 17 |
| 3.4.11 | Polyhedron | 18 |
| 3.4.12 | Generic Polyhedron | |
| 3.4.13 | Sphere | |
| 3.4.14 | Torus Segment | |
| 3.4.15 | Trapezoid – x & y varying along z | |
| 3 4 16 | General Transzoid | 20 |

| 3.4.17 | Tube with Hyperbolic Profile | 21 |
|---------|---|----------|
| 3.4.18 | Cut Tube | |
| 3.4.19 | Tube Segment | 22 |
| 3.4.20 | Twisted Box | |
| 3.4.21 | Twisted Trapezoid | 23 |
| 3.4.22 | Twisted General Trapezoid | 23 |
| 3.4.23 | Twisted Tube Segment | 24 |
| 3.4.24 | Extruded Solid | 24 |
| 3.4.25 | Arbitrary Trapezoid (Arb8) | 25 |
| 3.4.26 | Tessellated solid | |
| 3.4.27 | Tetrahedron | |
| 3.4.28 | Using loops for solids | 28 |
| 3.4.29 | Boolean Solids | |
| 3.5 Str | ucture | |
| 3.5.1 | Loops | |
| 3.5.2 | Replicated Volumes | |
| 3.5.3 | Parameterised Volumes | |
| 3.5.3.1 | | |
| 3.5.3.2 | | |
| 3.5.3.3 | | |
| 3.5.3.4 | | |
| 3.5.3.5 | 1 | |
| 3.5.3.6 | | |
| 3.5.3.7 | <i>J</i> 1 | |
| 3.5.3.8 | 1 1 | |
| 3.5.3.9 | 1 | |
| 3.5.3.1 | 1 | |
| 3.5.3.1 | 3 | |
| 3.5.3.1 | J | |
| 3.5.3.1 | 1 | |
| 3.5.4 | GDML Modules | |
| 3.5.5 | Volume Auxiliary Information | |
| | up | |
| | ing and exporting GDML files | |
| | OML Reading | |
| 4.1.1 | Importing GDML files into Geant4 Geometry | |
| | OML Writing | |
| 4.2.1 | Exporting Geant4 Geometry | |
| 4.2.2 | Exporting ST-Viewer CAD Geometry | |
| | redefine' element | |
| | w Flements | 48 48 |
| 1 / INC | W DAGHUHS | 40 |

1. Introduction

The Geometry Description Markup Language (GDML) is a specialized XML-based language designed as an application-independent persistent format for describing the geometries of detectors associated with physics measurements. It serves to implement "geometry trees" which correspond to the hierarchy of volumes a detector geometry can be composed of, and to allow to identify the position of individual solids, as well as to describe the materials they are made of. Being pure XML, GDML can be universally used, and in particular it can be considered as the format for interchanging geometries among different applications.

GDML consists of two elements, an XML definition part containing the set of rules and the list of the legal elements to be used in constructing any GDML document, and the GDML generating and processing code implemented in the client tools. The structure of the GDML document is defined through a set of XML Schema Definition (XSD) files, which we call the GDMLSchema. Any GDML geometry file must be valid with respect to the GDMLSchema. The GDML file itself, can be either written by hand (in case GDML is used as the primary geometry source) or generated automatically (in case GDML is used as an exchange or persistency format) out of the application specific "in-memory" geometry tree using one of the GDML "writers" called by the user application. The GDML reader is responsible for parsing the GDML file and creating the in-memory representation of the geometry tree specific for the user application.

This manual will focus on the Geant4 binding to GDML, which, starting from release 9.2 of the simulation toolkit, it is now integrated in Geant4. The Root binding for GDML is integrated within the Root framework; the user should refer to the general Root manual for any information on importing and/or exporting GDML files to/from the Root geometry model. The description of the GDMLSchema in Section 3, however, is application-independent and therefore is relevant for both Geant4 and Root users.

GDML Schema is distributed with GDML Geant4 binding.

2. Getting started

2.1 Installation of GDML in Geant4

Building the GDML module in Geant4 is *optional*; by default, the GDML plug-in is not built along with the rest of the Geant4 libraries. In order to build the Geant4 module for GDML, one needs to have:

- The XercesC parser pre-installed (presently GDML uses either XercesC 2.8.0 or 3.1.1 versions);
- The following environment variables set at the time the Geant4 libraries get built:
 - XERCESROOT, specifying the path where the XercesC parser library and headers are installed in the system;
 - G4LIB_BUILD_GDML set to "1".

Once the above setup is defined in the user's environment, the GDML module in Geant4 will be built using the standard build procedure applicable for Geant4.

2.2 Running simple examples

The Geant4 binding for GDML comes with three examples, which demonstrate the reading and writing out of different geometry configurations from/to GDML files. The examples also show how user can extend GDML and how to export ST-Viewer CAD Geometry. The directories containing these examples can be found in the Geant4 distribution in the \$G4INSTALL/examples/extended/persistency/gdml directory. NOTE: in case of using dynamic libraries, one needs to set the LD_LIBRARY_PATH variable to point to all the necessary libraries (CLHEP, Geant4, and XercesC) before running the examples. Please refer to the examples README files for more information.

3. GDMLSchema

3.1 General structure

The GDML schema is a set of XSD files which define the structure of the GDML document and its legal elements. The general structure of the GDML file can be seen below (with some parts replaced by '...' for brevity).

```
<?xml version="1.0" encoding="UTF-8"?>
<gdml xsi:noNamespaceSchemaLocation="schema/gdml.xsd">
               <position name="TrackerinWorldpos" unit="mm" x="0" y="0" z="100"/>
       </define>
       <materials>
               <element name="Nitrogen" formula="N" Z="7.">
               <atom value="14.01"/>
               </element>
               <material formula=" " name="Air" >
                      <D value="1.290" unit="mg/cm3"/>
                      <fraction n="0.7" ref="Nitrogen" />
                      <fraction n="0.3" ref="0xygen" />
               </material>
       </materials>
       <solids>
               <box lunit="mm" name="Tracker" x="50" y="50" z="50"/>
       </solids>
       <structure>
               <volume name="World" >
                      <materialref ref="Air" />
                      <solidref ref="world" />
                      <physvol>
                      <volumeref ref="Tracker" />
                      <positionref ref="TrackerinWorldpos"/>
                      <rotationref ref="TrackerinWorldrot"/>
                      </physvol>
               </volume>
       </structure>
       <setup name="Default" version="1.0" >
               <world ref="World" />
       </setup>
</gdml>
```

One can distinguish there five parts, each holding specific type of data.

The <define> ... </define> block contains numerical values of different constants, positions, rotations and scales that will be used later on in the geometry construction.

The <materials> ...</materials> block contains definitions of all the materials used in the given geometry. The supported forms are simple materials, which are made from one element as well as mixtures. Mixtures can be composed on the basis of fraction of mass or atom count.

The <solids> ... </solids> block is the collection of all solid definitions which are used in the given geometry description. The presently supported solids are described in Section 3.4.

Composite solids made using Boolean operation (union, subtraction, intersection) are also supported.

The <structure> ... </structure> block contains the actual implementation of the geometry tree together with the assignment of solids and materials. The hierarchy of volumes is defined by specifying the daughter volumes (physvol) positioned inside a volume. Constructions like assembly volumes, reflections, replicas and divisions are possible. A more detailed discussion of the 'structure' block can be found in Section 3.5.

Finally, the <setup> ... </setup> block serves to specify the top volume of the geometry tree. It is possible to define several "setups" within one file, allowing testing different subparts (or different configurations included in the same file) of the geometry tree without changing the GDML file.

3.1.1 Splitting GDML file using ENTITY

Any GDML file can be split into several files, which are combined together during the parsing by using the ENTITY statement. The files included in such a way are not standalone GDML files, they simply contain parts of the GDML description and in general are meaningful only when put all together.

In order to use such a mechanism, one has to first declare the given ENTITY (just after the <xml...>tag)

```
<!DOCTYPE gdml [
<!ENTITY materials SYSTEM "materials.xml">
]>
```

where materials.xml is the name of the file to be included and materials is the ENTITY name that we have assigned to it. The entity can be then used anywhere inside the GDML description.

```
<gdml ....>
....
&materials;
....
<gdml>
```

The &materials line is then replaced during parsing by the contents of materials.xml file.

3.1.2 Multiple GDML files

It is also possible to define the geometry in the form of several standalone GDML files, each one representing a module of the setup we want to describe. Each GDML file would contain only the materials, the solids and the volumes the module is made of. For example, if one wants to describe a detector, instead of creating a single detector.gdml file with thousands of volumes and materials, one could create smaller modules called tracker.gdml, calorimeter.gdml, beampipe.gdml, etc, and a small main detector.gdml file combining those modules. This approach makes it easier to read and write the geometries and to apply changes. Explanations and details on how GDML modules are defined and put together are given in the Section 3.5.

3.2 Definitions

3.2.1 Constants

Constants are defined in the beginning of the GDML file (in the define section). Once defined, they can be used anywhere inside the file. A constant can be defined as in the following example:

```
<constant name="length" value="6.25"/>
```

3.2.2 Quantities

Quantities are constants with units, they are defined in the beginning of the GDML file (in the define section). Once defined, they can be referenced where quantity is expected with the same type. Example:

```
<quantity name="W Density" type="density" value="1" unit="g/cm3" />
```

3.2.3 Variables

Variables are defined in the beginning of the GDML file (in the define section). Once defined, they can be used anywhere inside the file. Their value will be evaluated each time they are used and it can change if they are used as loop variables (see section 3.5.1). A variable can be defined as in the following example:

```
<variable name="x" value="6"/>
```

This simple code defines a variable with an initial value of 6. Of course previously defined variables may be used in variable definitions, as in the following example:

```
<variable name="x" value="6"/>
<variable name="y" value="x/2"/>
```

In this case variable y is set with an initial value of 3. You can now use your variable wherever you like, for example in a box definition:

```
<box name="my_box" x="x" y="y" z="x+y"/>
```

3.2.4 Positions

Positions are usually defined in the beginning of the GDML file (in the define section). Once defined, they can be referenced in place where positions are expected. A position can be defined as in the following examples:

```
<position name="box_position" x=25.0" y=50.0" z=75.0" unit="cm"/>
```

```
<constant name="size" value="25.0"/>
<position name="position" x="2.0*size" y="size" z="75.0" unit="m"/>
```

3.2.5 Rotations

Rotations are usually defined in the beginning of the GDML file (in the define section). Once defined, they can be referenced in place where rotations are expected. Positive rotations are expected to be right-handed. A rotation can be defined as in the following example:

```
<rotation name="RotateZ" z=="30" unit="deg"/>
```

3.2.6 Scales

Scales are usually defined in the beginning of the GDML file (in the define section). Once defined, they can be referenced in place where scales are expected. Scale can be used to implement reflection and has no units. A scale can be defined as in the following example:

```
<scale name="my_reflection" x="-1" y="-1" z="1"/>
```

3.2.7 Matrices

A matrix definition allows you to store values in matrix format. The definition of a matrix is very simple: <matrix name="name" coldim="number of columns" values="space-separated values" />. A simple example follows:

```
<matrix name="m" coldim="3" values="0.4 9 126 8.5 7 21 34.6 7 9" />
```

Or you could also write it like this (visually clearer):

The elements of a matrix can be accessed anywhere after the definition of the matrix itself, just variables. To access them you have to use the following syntax:

```
matrix_name[row_number, column_number]
```

For example:

m[3,1]

will be evaluated to 34.6. You can also put variables inside the square brackets, like this:

m[y,y]

So if y=3 this will be evaluated to 9. Just be sure that the values of the variables don't exceed the matrix dimensions, otherwise you will get an error when processing the file. A matrix with coldim="1" is a vector and its elements may be accessed using only one index as in the following example:

So,

m[4]

will be evaluated to 6. Matrices can of course be used inside loops (there is where they are actually most useful). We will see how to do this in section 3.5.1.

3.3 Materials

3.3.1 Isotopes

Isotopes can be defined using a very simple contsruct. $<isotope name=its_name Z=atomic_number N=num_of_nucleons>$. The following shows and example:

3.3.2 Elements

Elements can be defined using this very self explanatory construct:

```
<element Z="8" formula="0" name="0xygen" >
    <atom value="16" />
    </element>
```

Instead of an atomic number being used on a child node of the element declaration, a fraction of an isotope can be used using <fraction ref=isotope_name n=fraction />. This is implemented as the following shows:

```
<element name="enriched_uranium" >
    <fraction ref="U235" n="0.9" />
    <fraction ref="U238" n="0.1" />
    </element>
```

3.3.3 Materials

Materials can be defined in three ways. The material can be defined directly from an element, created from previously defined elements or materials on number of atoms, and finally created as a fractional mixture of previously defined elements or materials.

3.4 Solids

3.4.1 Box

The GDML box is formed using the three standard dimensions: x, y and z. The box therefore has 4 attributes, the other being name which is standard for any SolidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a box made from the above dimensions:

```
<box name = "thebox" x= "30" y= "30" z= "30" lunit= "mm" />
```

3.4.2 Cone Segment

The GDML Cone Segment is formed using 7 dimensions.

| rmin1 | inner radius at base of cone |
|----------|------------------------------|
| rmax1 | outer radius at base of cone |
| rmin2 | inner radius at top of cone |
| rmax2 | outer radius at top of cone |
| Z | height of cone segment |
| startphi | start angle of the segment |
| deltaphi | angle of the segment |

The cone segment therefore has 8 attributes, the other being name which is standard for any SolidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a cone segment made from the above dimensions:

```
<cone name = "thecone" rmin1="10" rmax1="15" rmin2="15" rmax2="25" z="30"
startphi="1" deltaphi="4" aunit="rad" lunit= "mm" />
```

3.4.3 Ellipsoid

The GDML Ellipsoid is formed using 3 dimensions.

```
ax x semi axisby y semi axiscz z semi axis
```

There are 2 optional dimensions that can cut the ellipsoid. *zcut1* will remove the specified value from the lower z axis effectively cutting a part of the bottom of the shape off. *zcut2* performs the same action but acts on the upper part of the z axis.

The ellipsoid therefore has 4 attributes, the other being name which is standard for any SolidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a ellipsoid made from the above dimensions:

```
<ellipsoid name = "theellipsoid" ax="10" by="15" cz="20" zcut2="4" lunit= "mm"/>
```

3.4.4 Elliptical Tube

The GDML Elliptical Tube is formed using 3 dimensions:

dx x semi axisdy y semi axisdz z semi axis

The elliptical tube therefore has 4 attributes, the other being name which is standard for any solidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of an elliptical tube made from the above dimensions:

```
<eltube name = "theeltube" dx="10" dy="15" dz="20" lunit= "mm" />
```

3.4.5 Elliptical Cone

NB: supported only by Geant4

The GDML Elliptical Cone is formed using 3 dimensions and one possible upper cut in Z:

dx x semi axis
 dy y semi axis
 zmax total z length without cut
 zcut upper cut in Z

The elliptical cone therefore has 5 attributes, the other being name which is standard for any solidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of an elliptical cone made from the above dimensions:

```
<elcone name = "theelcone" dx="1" dy="1.5" zmax="2" zcut="1.5" lunit= "mm" />
```

3.4.6 Orb

The GDML Orb is formed using only 1 dimension:

r radius

The orb is a simplified GDML Sphere with only the radius specified. The orb therefore has 2 attributes, the other being name which is standard for any <code>solidType</code> element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of an orb made from the above dimensions:

```
<orb name = "theorb" r="10" lunit= "mm"/>
```

3.4.7 Paraboloid

The GDML Paraboloid is formed using 3 dimensions:

```
rlo radius at -z
rhi radius at +z
dz z length
```

The paraboloid therefore has 4 attributes, the other being name which is standard for any solidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a paraboloid made from the above dimensions:

```
<paraboloid name = "theparab" rlo="10" rhi="15" dz="20" aunit="rad" lunit= "mm" />
```

3.4.8 Parallelepiped

The GDML Parallelepiped is formed using 6 dimensions:

```
x length of x
y length of y
z length of z
alpha angle betw
```

alpha angle between x and z planes

theta polar angle of the line joining the centres of the faces at -z & +z in zphi azimuthal angle of the line joining the centres of faces at -z & +z in z

The Parallelepiped therefore has 7 attributes, the other being name which is standard for any SolidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a parallelepiped made from the above dimensions:

```
<para name = "thepara" x="10" y="10" z="10" alpha="1" theta="1" phi="1" aunit="rad"
lunit= "mm"/>
```

3.4.9 Polycone

The GDML Polycone can be described in two ways:

as **Polycone** using *zplanes* with *rmin* and *rmax* and

as **Generic Polycone** using vertices with (r,z) coordinates.

The GDML Polycone is described using the following information:

startphi start angle of the segment – if not given 0.0 is defaulted

deltaphi angle of the segment

zplane see below

The zplane element is required to be used at least once. You can use it as many times as you like. The zplane is formed using the 3 attributes shown above:

rmin inner radius of cone at this point – if not given 0.0 is defaulted.

rmax outer radius of cone at this point

z z coordinate of the plane

The Polycone therefore has a minimum of 7 attributes, the other being name which is standard for any SolidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a polycone made from the above dimensions:

3.4.10 Generic Polycone

The GDML Generic Polycone is described using the following information:

startphi start angle of the segment – if not given 0.0 is defaulted

deltaphi angle of the segment

rzpoint see below

The rzpoint element is required to be used at least three times. You can use it as many times as you like. The rzpoint is formed using the 2 attributes shown above:

r r- coordinate of this pointz z-coordinate of this point

The Generic Polycone therefore has a minimum of 7 attributes, the other being name which is standard for any <code>solidType</code> element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a generic polycone made from the above dimensions:

3.4.11 Polyhedron

The GDML Polychedron (Polyhedra) can be described in two ways:

as Polyhedra using zplanes with rmin and rmax and

as Generic Polyhedra using vertices with (r,z) coordinates.

The GDML Polyhedron (Polyhedra) is described using the following information:

startphistart angle of the segmentdeltaphiangle of the segmentnumsidesnumber of sideszplanesee below

The zplane element is required to be used at least once. You can use it as many times as you like. The zplane is formed using the 3 attributes shown above:

rmin inner radius of cone at this point – if not given 0.0 is defaulted.

rmax outer radius of cone at this point

z z coordinate of the plane

The Polyhedra therefore has a minimum of 6 attributes, the other being name which is standard for any SolidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a polyhedra made from the above dimensions:

3.4.12 Generic Polyhedron

The GDML Generic Polyhedra is described using the following information:

startphistart angle of the segmentdeltaphiangle of the segmentnumsidesnumber of sidesrzpointsee below

The rzpoint element is required to be used at least three times. You can use it as many times as you like. The rzpoint is formed using the 2 attributes shown above:

r r- coordinate of this pointz z-coordinate of this point

The Generic Polyhedra therefore has a minimum of 6 attributes, the other being name which is standard for any SolidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a polyhedra made from the above dimensions:

3.4.13 **Sphere**

The GDML Sphere is formed using 6 dimensions:

rmin inner radius – if not given 0.0 is defaulted

rmax outer radius

startphi starting angle of the segment – if not given 0.0 is defaulted

deltaphi delta angle of the segment

starttheta starting angle of the segment – if not given 0.0 is defaulted

deltatheta delta angle of the segment

The Sphere therefore has a minimum of 7 attributes, the other being name which is standard for any SolidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a sphere made from the above dimensions:

```
<sphere name = "thesphere" rmin="1" rmax="4" deltaphi="1" deltatheta="1" aunit="rad"
lunit= "mm"/>
```

3.4.14 Torus Segment

The GDML Torus Segment is formed using 5 dimensions:

rmininside radius of segmentrmaxoutside radius of segmentrtorswept radius of torus

startphi starting phi position angle of segment

deltaphi delta angle of segment

The Torus segment therefore has a minimum of 6 attributes, the other being name which is standard for any <code>SolidType</code> element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a torus segment made from the above dimensions:

```
<torus name = "thetorus" rmin="1" rmax="4" rtor="2" deltaphi="3" startphi="1" aunit="rad"
lunit= "mm"/>
```

3.4.15 Trapezoid – x & y varying along z

The GDML Trapezoid is formed using 5 dimensions:

```
x1x length at -zx2x length at +zy1y length at -zy2y length at +zzz length
```

The Trapezoid therefore has a minimum of 6 attributes, the other being name which is standard for any solidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a Trapezoid made from the above dimensions:

```
<trd name = "thetrd" x1="9" x2="8" y1="6" y2="5" z="10" lunit= "mm"/>
```

3.4.16 General Trapezoid

The GDML General Trapezoid is formed using 11 dimensions:

z length along z axis

theta polar angle to faces joining at -/+z azimuthal angle of line joining centre of -z face to centre of +z face phi y1 length along y at the face -z x1 length along x at side y = -y1 of the face at -z length along x at side y = +y1 of the face at -z x2 angle with respect to the y axis from the centre of side at y = -y1 to centre of alpha1 y = +y1 of the face at -z length along y at the face +z *y*2 х3 length along x at side y = -y1 of the face at +z length along x at side y = +y1 of the face at +zх4 angle with respect to the y axis from the centre of side at $y = -y^2$ to centre of alpha2 y = +y2 of the face at +z

The General Trapezoid therefore has a minimum of 12 attributes, the other being name which is standard for any SolidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a General Trapezoid made from the above dimensions:

```
<trap name = "thetrap" z="10" theta="1" phi="2" y1="15" x1="10" x2="10" alpha1="1"
y2="15" x3="10" x4="10" alpha2="1" aunit="rad" lunit= "mm"/>
```

3.4.17 Tube with Hyperbolic Profile

The GDML Tube with Hyperbolic Profile is formed using 5 dimensions:

rmin inside radius of tube rmax outside radius of tube inst inner stereo

instinner stereooutstouter stereozz length

The Hyperbolic Tube therefore has a minimum of 6 attributes, the other being name which is standard for any <code>SolidType</code> element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a hyperbolic tube made from the above dimensions:

```
<hype name = "thehype" rmin="1" rmax="2" z="20" inst="3" outst="4" lunit= "mm"/>
```

3.4.18 Cut Tube

The GDML Cut Tube is formed using 11 dimensions:

z length along z axis

rmin inner radius – if not given 0.0 is defaulted

rmax outer radius

startphi starting phi angle of segment – if not given 0.0 is defaulted

deltaphidelta phi of anglelowXnormal at lower z planelowYnormal at lower z planelowZnormal at lower z planehighXnormal at upper z planehighYnormal at upper z planehighZnormal at upper z plane

The cut Tube therefore has a minimum of 12 attributes, the other being name which is standard for any SolidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a cut Tube made from the above dimensions:

```
<cutTube name = "thecuttube" z="20" rmin="1" rmax="5" startphi="1" deltaphi="4" lowX="15"
lowY="15" lowZ="15" highX="10" highY="10" highZ="10" aunit="rad" lunit= "mm"/>
```

3.4.19 Tube Segment

The GDML Tube Segment is formed using 5 dimensions:

rmin inside radius of segment - if not given 0.0 is defaulted

rmax outside radius of segmentz z length of tube segment

startphi starting phi position angle of segment - if not given 0.0 is defaulted

deltaphi delta angle of segment

The Tube segment therefore has a minimum of 6 attributes, the other being name which is standard for any solidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a tube segment made from the above dimensions:

```
<tube name = "thetube" rmin="1" rmax="4" z="20" deltaphi="3" startphi="1"
aunit="rad" lunit= "mm"/>
```

3.4.20 Twisted Box

NB: supported only by Geant4

The GDML Twisted box is formed using the three standard dimensions: x, y and z and one added dimension: PhiTwist. The box therefore has 5 attributes, the other being name which is standard for any SolidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a box made from the above dimensions:

```
<twistedbox name = "twistbox" PhiTwist= "1" x= "30" y= "30" z= "30" aunit="rad"
lunit= "mm"/>
```

3.4.21 Twisted Trapezoid

NB: supported only by Geant4

The GDML Twisted Trapezoid is formed using 6 dimensions:

| PhiTwist | Twist Angle |
|----------|----------------|
| x1 | x length at -z |
| x2 | x length at +z |
| y1 | y length at -z |
| y2 | y length at +z |
| Z | z length |

The Twisted Trapezoid therefore has a minimum of 7 attributes, the other being name which is standard for any <code>SolidType</code> element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a Twisted Trapezoid made from the above dimensions:

```
<twistedtrd name = "twisttrd" PhiTwist="1" x1="9" x2="8" y1="6" y2="5" z="10" aunit="rad" lunit= "mm"/>
```

3.4.22 Twisted General Trapezoid

NB: supported only by Geant4

The GDML Twisted General Trapezoid is formed using 11 dimensions:

| PhiTwist | twist angle |
|------------|--|
| Z | length along z axis |
| Theta | polar angle to faces joining at -/+z |
| Phi | azimuthal angle of line joining centre of -z face to centre of +z face |
| y1 | length along y at the face -z |
| x1 | length along x at side y = -y1 of the face at -z |
| x2 | length along x at side $y = +y1$ of the face at -z |
| <i>y</i> 2 | length along y at the face +z |
| <i>x</i> 3 | length along x at side y = -y1 of the face at +z |
| x4 | length along x at side $y = +y1$ of the face at $+z$ |
| Alph | angle with respect to the y-axis from the centre of the side |

The Twisted General Trapezoid therefore has a minimum of 12 attributes, the other being name which is standard for any SolidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a General Twisted Trapezoid made from the above dimensions:

```
<twistedtrap name = "twisttrap" PhiTwist="1" z="10" Theta="1" Phi="2" y1="15"
x1="10" x2="10" y2="15" x3="10" x4="10" Alph="1" aunit="rad" lunit= "mm"/>
```

3.4.23 Twisted Tube Segment

NB: supported only by Geant4

The GDML Twisted Tube Segment is formed using 5 dimensions:

endinnerradinside radius of segmentendouterradoutside radius of segmentzlenz length of tube segment

twistedangle twist angle

phi phi angle of segment

The Twisted Tube segment therefore has a minimum of 6 attributes, the other being name which is standard for any <code>SolidType</code> element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of a twisted tube segment made from the above dimensions:

```
<twistedtubs name = "twisttube" endinnerrad="1" endouterrad="4" zlen="20" phi="3"
twistedangle="1" aunit="rad" lunit= "mm"/>
```

3.4.24 Extruded Solid

The GDML Extruded Solid (Xtru) is formed using 2 attributes:

twoDimVertex vertices of an unbound blueprint polygon

section z sections

The *twoDimVertex* element is required to be used at least 3 times and the *section* element is required to be used at least twice. You can use both as many times as you like. The *twoDimVertex* is formed using the 2 attributes shown below:

x x coordinate of the vertexy y coordinate of the vertex

The *section* is formed using the 5 attributes shown below:

zOrder index of the section, must be between 0 and n-1 where n is the

number of sections

zPosition distance from the plane z=0

xOffset x offset from centre point of original plane yOffset y offset from centre point of original plane

scalingFactor proportion to original blueprint

The Xtru therefore has a minimum of 17 attributes, the other being name which is standard for any SolidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of an Xtru made from the above dimensions:

3.4.25 Arbitrary Trapezoid (Arb8)

The GDML Arb8 (arbitrary trapezoid with less than 8 vertices) is formed using 17 dimensions. It's made up of two quadrilaterals sitting on parallel planes. V1 to V4 define the vertices for the quadrilateral base situated at -dz, V5 to V8 define the vertices for the other quadrilateral situated at -dx.

| v1x | vertex 1 x position |
|-----|---------------------|
| v1y | vertex 1 y position |
| v2x | vertex 2 x position |
| v2y | vertex 2 y position |
| v3x | vertex 3 x position |
| v3y | vertex 3 y position |
| v4x | vertex 4 x position |
| v4y | vertex 4 y position |
| v5x | vertex 5 x position |
| v5y | vertex 5 y position |
| v6x | vertex 6 x position |
| v6y | vertex 6 y position |
| v7x | vertex 7 x position |
| v7y | vertex 7 y position |
| v8x | vertex 8 x position |
| v8y | vertex 8 y position |
| dz | half z length |

The Arb8 therefore has a minimum of 18 attributes, the other being name which is standard for any SolidType element and corresponds to the name the solid can be referenced by.

The following example illustrates the construction of an Arb8 made from the above dimensions:

```
<arb8 name = "thearb8" v1x="1" v1y="1" v2x="2" v2y="2" v3x="3" v3y="3" v4x="4"
v4y="4" v5x="10" v5y="10" v6x="11" v6y="11" v7x="12" v7y="12" v8x="13" v8y="13"
dz="20" lunit= "mm"/>
```

3.4.26 Tessellated solid

NB: supported only by Geant4

The GDML tessellated solid can be made of any number of triangular and/or quadrangular facets forming a closed space. Each facet is defined by specifying references to (names of) three (for the triangular one) or four (for the quadrangular one) vertices. The vertices are standard position elements and should be declared beforehand within the define section. If a referenced vertex is not defined, an error message is displayed. By looking from the outside of the tessellated solid, vertices are listed in the anti-clockwise order for each of the facets. There are two ways of defining vertices: ABSOLUTE (default), and RELATIVE. In the first case each vertex coordinates are considered to be absolute coordinates in the reference system of the solid. In the second case, only the first listed vertex has absolute coordinates, while the remaining ones are considered to be translations from the first one.

The tessellated solid has only one attribute <code>name</code>, which is standard for any <code>solidType</code> element and corresponds to the name the solid can be referenced by. The sub-elements of tessellated solid element are all of <code>FacetType</code>, in other words they are the triangular and/or guadrangular facets the solid is made of.

The triangular (quadrangular) facet element contains three (four) attributes vertex1, vertex2, vertex3, (vertex4), being references to the vertices (defined beforehand) of the facet and an optional attribute type indicated whether the coordinates of the vertices are ABSOLUTE (default) or RELATIVE.

The following example illustrates the construction of a simple tessellated solid made from a square base and six triangular walls. We first define the vertices

```
<define>
  <position name="v1" x="10" y="10" z="0" unit="m"/>
  <position name="v2" x="-10" y="10" z="0" unit="m"/>
  <position name="v3" x="-10" y="-10" z="0" unit="m"/>
  <position name="v4" x="10" y="-10" z="0" unit="m"/>
  <position name="v5" x="7" y="3" z="20" unit="m"/>
  <position name="v6" x="-3" y="7" z="5" unit="m"/>
  </define>
```

and then we build the tessellated solid out of them

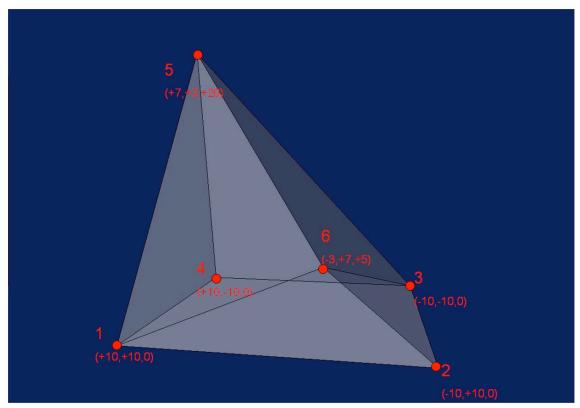


Figure: graphical representation of the tessellated solid as described in the example.

3.4.27 Tetrahedron

NB: supported only by Geant4

The tetrahedron solid in GDML is defined by specifying the coordinates of the four vertices. In order for the solid not to be degenerated, the four points must not lie on the same surface. The tet solid element contains the standard name attribute and four attributes being references to the vertices namely <code>vertex1</code>, <code>vertex2</code>, <code>vertex3</code> and <code>vertex4</code>. These vertices are standard position elements which must be defined beforehand within the <code>define part</code>.

The following example illustrates the construction of the tetrahedron.

```
<define>
  <position name="v1" x="10" y="10" z="0"/>
  <position name="v2" x="-10" y="10" z="0"/>
  <position name="v3" x="-10" y="-10" z="0"/>
  <position name="v4" x="0" y="0" z="10"/>
  </define>
```

```
<tet name="halfpyramid" vertex1="v1" vertex2="v2" vertex3="v3" vertex4="v4"/>
```

3.4.28 Using loops for solids

Suppose you want to define a set of solids with the same shape but with dimensions varying according to a particular function. In this case loops are very useful, because the avoid repetition of solids definitions. For a more detailed discussion on loops please refer to Section 3.5.1. The following example shows you how to use a loop to define a set (10) of boxes with different dimensions. Without a loop you would write the following code:

Using a loop you would only need four lines

```
<variable name="x" value="0"/>
```

declared in the "define" section and

```
<loop for="x" to="9" step="1">
  <box name="box" x="1+(x*3)" y="5-(x/2)" z="20-(2*x)" />
  </loop>
```

3.4.29 Boolean Solids

The GDML Boolean Solids can be described using following Boolean operations: union, subtraction and intersection. As for Geant4 Boolean operations, the second solid is placed with given position and rotation in the system coordinates of the first solid. The following example illustrates the construction of Boolean solid using union operation:

Another way to describe Union Solid is by using the MultiUnion construct, which offers possibility to make union of many solids. The following example illustrates the construction of a MultiUnion structure:

3.5 Structure

The structure section is where volumes in the geometry are defined. Volumes are referenced to solids and materials defined earlier to form the shape and composition of that volume. This volume is then a logical volume. Volumes can be placed within this logical volume; these volumes are called physical volumes. They can be positioned and rotated how you wish within the logical volume. An example of the GDML for this is below:

3.5.1 Loops

Loops can be used to avoid tedious repetitions of definitions. To use a loop you need to define a variable first (section 3.2.1). Suppose you defined a variable x with 0 initial value:


```
<variable name="x" value="0"/>
```

then, you can use it inside a loop statement:

```
<loop for="x" to="8" step="2">
...
</loop>
```

The code within the loop tags will we executed 5 times in this case, because the variable x starting from the initial value of 0 (as in its definition) will be increased by 2 (according to the step value) for each loop until it reaches the value of 8 (as stated in the to attribute). Loops are very useful to access elements of matrices (see section 3.2.2); for example:

We are able to access the three elements of the first row of the matrix, i.e. 0.4, 9 and 126. Loops can be used when defining solids, logical volumes and physical volumes; let's see how this is done in practice. Suppose we want to create the following structure:

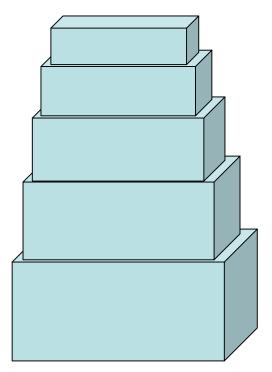

We need to write the code for 5 boxes, 5 logical volumes that refer to the boxes and 5 physical volumes that refer to the 5 logical volumes! The code would be the following:

```
<solids>
<box name="box1" x="10" y="5" z="5" />
<box name="box2" x="9" y="4.5" z="4" />
cbox name="box3" x="8" y="4" z="3.2" />
cbox name="box4" x="7" y="3.5" z="2.56" />
cbox name="box5" x="6" y="3" z="2.048" />
</solids>
<structure>
<volume name="volbox1">
 <solidref ref="box1" />
 <materialref ref="iron" />
 </volume>
<volume name="volbox2">
 <solidref ref="box2" />
 <materialref ref="iron" />
 </volume>
 <volume name="volbox3">
 <solidref ref="box3" />
 <materialref ref="iron" />
</volume>
<volume name="volbox4">
 <solidref ref="box4" />
 <materialref ref="iron" />
</volume>
<volume name="volbox5">
 <solidref ref="box5" />
 <materialref ref="iron" />
 </volume>
<volume name="world">
 <physvol>
  <volumeref ref="volbox1" />
  <position x="5" y="0" z="40" />
 </physvol>
  <volumeref ref="volbox2" />
  <position x="5" y="2" z="38" />
  </physvol>
 <physvol>
  <volumeref ref="volbox3" />
  <position x="5" y="3.5" z="36" />
 </physvol>
 <physvol>
   <volumeref ref="volbox4" />
  <position x="5" y="3.9" z="34" />
 </physvol>
 <physvol>
  <volumeref ref="volbox5" />
  <position x="5" y="4.15" z="32" />
 </physvol>
 </volume>
</structure>
```

Of course this is always possible; but using the loop tags (and combining them properly with matrices), you would have the same result with fewer code lines and less complexity. Here's the equivalent code using the loop and matrix tags:

```
<define>
 <matrix name="m" coldim="5" values="0 2 3.5 3.9 4.15</pre>
                                 5 4 3.2 2.56 2.048" />
<variable name="x" value="1" />
<variable name="x1" value="0" />
<variable name="x2" value="0" />
</define>
<solids>
<loop for="x" to="5" step="1">
 </loop>
</solids>
<structure>
<loop for="x1" to="4" step="1">
 <volume name="volbox">
  <solidref ref="box" />
  <materialref ref="iron" />
 </volume>
</loop>
<volume name="world">
 <loop for="x2" to="8" step="2">
  <physvol>
   <volumeref ref="volbox" />
   <position x="5" y="m[1, x2/2+1]" z="40-x2"/>
  </physvol>
 </loop>
 </volume>
</structure>
```

In this example we only "looped" 5 times, but just think if we needed to loop 100 times or more, the difference (in terms of code lines) between the two approaches would be enormous.

Now two important rules you need to follow when using loops:

- 1) Always use a different (and properly initialized) variable for each loop tag (in our example x, x1, x2 for the three loops).
- 2) When you use linked loop triples (*loop triple* = 3 loop tags, as we did in our example; *linked* in the sense that we looped over a solid, then we looped over a logical volume that referred to that solid, and finally we looped over a physical volume that referred to that logical volume) you always have to be sure that the number of steps is the same for every loop tag of that particular triple. In our example that number was 5: from 1 to 5 in the first loop, from 0 to 4 in the second loop, and from 0 to 8 (but with a step of 2) in the third loop.

3.5.2 Replicated Volumes

NB: supported only by Geant4

Replicated volumes in GDML correspond to Geant4 Replicas. Replica volumes are created along the specific direction of one of Cartesian or Cylindrical Axis. The first replica is placed at the given position and rotated according to given rotation and others are placed using given distance. This repeated Volumes technique is available for volumes described by Geant4 CSG Solids. The following example illustrates the construction of replica volumes

along X Axis. An example 'replicated.gdml' can be found in the \$G4INSTALL/examples/extended/persistency/gdml/G01 girectory.

```
<solids >
 <box name="Mother Cube" x="800" y="100" z="100"/>
 <box name="Cube" x="100" y="100" z="100".>
</solids>
<structure>
<volume name="lvCube">
 <solidref ref="Cube" />
 <materialref ref="ALU" />
 </volume>
<volume name="lvReplica">
 <solidref ref="Mother Cube" />
 <materialref ref="AIR\overline{"} />
 <replicavol number="8">
     <volumeref ref="lvCube" />
     <replicate along axis>
       <direction x="1" />
       <width value="100" unit="mm"/>
       <offset value="0" unit="mm" />
     </replicate along axis>
  </replicavol>
</volume>
</structure>
```

3.5.3 Parameterised Volumes

NB: supported only by Geant4

Parameterised volumes in GDML correspond to the parameterised physical volumes in Geant4 with the difference that in GDML only parameterisation of dimension and placement is supported.

Parameterisation of type of solid or its material is not supported by current implementation; however it can be implemented as possible extension to the GDML schema.

Parameterised volumes are repeated volumes in the case in which the multiple copies of a volume can be different in size and position.

Examples of GDML files describing parameterised volumes are parameterized.gdml and pTube.gdml located in the example G01 distributed with Geant4.

The following example illustrates the construction of parameterised volumes:

```
</volume>
<volume name="Tracker">
 <solidref ref="tracker" />
 <materialref ref="Air" />
 <paramvol ncopies="2">
   <volumeref ref="Chamber"/>
     <parameterised position size>
     <parameters number="1">
      </parameters>
     <parameters number="2">
      <position name="positionCopy2" x="0" y="0" z="-700"/>
      </parameters>
    </parameterised position size>
 </paramvol>
</volume>
</structure>
```

For giving the dimensions of each parameterised solid in GDML a special syntax is used.

3.5.3.1. Dimensions of Parameterised Box

The GDML dimensions of a parameterised box have the following form with 3 standard dimensions: x, y and z. Example:

```
<box_dimensions x="30" y="30" z="30" lunit= "mm"/>
```

3.5.3.2. Dimensions of Parameterised Tube

The GDML dimensions of a parameterised tube are given using:

InR inside radius of segmentOutR outside radius of segmenthz z length of tube segment

StartPhi starting phi position angle of segment

DeltaPhi delta angle of segment

The following example illustrates its construction:

3.5.3.3. Dimensions of Parameterised Cone

The GDML dimensions of a parameterised cone are given using:

rmin1inside radius at base of conermax1outside radius at base of conermin2inside radius at top of conermax2outside radius at top of cone

z z length of cone

startphi starting phi position of segment

deltaphi delta angle of segment

The following example illustrates its construction:

3.5.3.4. Dimensions of Parameterised Orb

The GDML dimensions of a parameterised orb have the following form with 1 standard dimension: r (radius). Example:

```
<orb_dimensions r="30" lunit= "mm"/>
```

3.5.3.5. Dimensions of Parameterised Sphere

The GDML dimensions of a parameterised sphere are given using:

rmin inside radius rmax outside radius

startphi starting phi position of segment

deltaphi delta angle of segment

startthetastarting theta position of segmentdeltathetadelta theta angle of segment

The following example illustrates its construction:

3.5.3.6. Dimensions of Parameterised Torus

The GDML dimensions of a parameterised torus are given using:

rmin inside radius rmax outside radius

rtor swept radius of torus

startphi starting phi position of segment

deltaphi delta angle of segment

The following example illustrates its construction:

3.5.3.7. Dimensions of Parameterised Hype

The GDML dimensions of a parameterised hype are given using:

rmin inside radius rmax outside radius

z length inner stereo outst outer stereo

The following example illustrates its construction:

3.5.3.8. Dimensions of Parameterised Parallelepiped

The GDML dimensions of a parameterised parallelepiped are given using:

xlength of xylength of yzlength of z

alpha angle between x and z plane

theta polar angle of the line joining the centre of the faces –z&+z in z phi azimuthal angle of the line joining the centre of the faces –z&+z in z

The following example illustrates its construction:

3.5.3.9. Dimensions of Parameterised Trapezoid

The GDML dimensions of a parameterised trapezoid are given using:

```
x1x length at - zx2x length at +zy1y length at - zy2y length at +zzz length
```

The following example illustrates its construction:

```
<trd_dimensions x1="30" x2="60" y1="20" y2="40" z ="30" lunit= "mm"/>
```

3.5.3.10. Dimensions of Parameterised General Trapezoid

The GDML dimensions of a parameterised general trapezoid are given using:

| x1 | length along x at side y=-y1 of the face at - z |
|------------|--|
| x2 | length along x at side y=+y1 of the face at - z |
| <i>x</i> 3 | length along x at side y=-y1 of the face at + z |
| x4 | length along x at side y=+y1 of the face at + z |
| alpha1 | angle with respect to the y axis from the centre of side at y=-y1 |
| | to centre of y=+y1 of the face at -z |
| alpha2 | angle with respect to the y axis from the centre of side at y=-y2 |
| | to centre of y=+y2 of the face at -z |
| theta | polar angle of the line joining the centre of the faces –z&+z in z |
| phi | azimuthal angle of the line joining the centre of the faces –z&+z in z |
| y1 | y length at - z |
| <i>y</i> 2 | y length at +z |
| Z | length along z axis |

The following example illustrates its construction:

3.5.3.11. Dimensions of Parametrised Polycone

The GDML dimensions of a parameterised polycone are given using:

startPhistart angle of the segmentopenPhiangle of the segment

numRZ number of zplanes forming polycone

zplane inner radius, outer radius and z coordinate of each plane

The following example illustrates its construction:

3.5.3.12. Dimensions of Parametrised Polyhedron

The GDML dimensions of a parameterised polyhedron (polyhedra) are given using:

startPhistart angle of the segmentopenPhiangle of the segment

numRZ number of zplanes forming polycone

numSide number of sides

zplane inner radius, outer radius and z coordinate of each plane

The following example illustrates its construction:

3.5.3.13. Dimensions of Parametrised Ellipsoid

The GDML dimensions of a parameterised general tellipsoid are given using:

axlength of semi-axis in x directionbylength of semi-axis in y directionczlength of semi-axis in z direction

zcut1 lower cut plane level at -z (solid lies above this plane)
zcut2 upper cut plane level at +z (solid lies below this plane)

The following example illustrates its construction:

```
<ellipsoid_dimensions ax="30" by="60" cz="20" zcut1="-30" zcut2="30" lunit= "mm"/>
```

3.5.4 GDML Modules

GDML modules are GDML files used in the definition of (complex) geometries. They allow an easier to understand view of big geometries as they split it into smaller (and therefore more readable) pieces.

A GDML module is a normal GDML file and it is completely independent from all the other modules (also from its mother module): it contains all the information (definitions, materials, solids and volumes) it needs, to be fully defined. It defines a logical volume (which corresponds to its world volume), which can be referenced by physical volumes of other modules (which are called mother modules).

To include a GDML module (say *child.gdml*) in a mother module (say *mother.gdml*), in the structure section of the mother module you should add a physical volume which points to the child module, as in the following example:

- Instead of having one file:

- You can define child logical volume in a different GDML file, so you will have two files:

So in the general case instead of writing:

```
<volumeref ref="_logical_volume_"/>
```

You will need to write:

```
<file name="_logical_volume_.gdml"/>
```

And then define logical volume inside logical volume .gdml.

In the example given above, the mother module will only contain the material Iron and the solid MotherBox, while the child module will contain only the material Aluminium and the solid ChildBox, thus enhancing readability and modularity.

Some advises:

- While it is not useful to have a module for every single volume of the geometry, it is good to have one for each group of volumes that you would consider as a module in the real world (see par. "Multiple GDML files").
- Modules should have low coupling, i.e. they should be as independent as possible from other modules (this improves reusability dramatically).
- Modules should have high cohesion, i.e. they should contain all (and only) the volumes that contribute to the geometry of the corresponding real world modules (this improves readability).

3.5.5 Volume Auxiliary Information

Volumes can have auxiliary information attached to them through GDML.

The auxiliary tags look like this:

```
<auxiliary auxtype="SensDet" auxvalue="veloSD1"/>
```

They have two attributes, <code>auxtype</code> and <code>auxvalue</code>, which are meant to specify what kind of auxiliary information it is and what is its value. It is important to stress here that the GDML parser does not interpret in any way the auxiliary attributes. The auxiliary attributes are stored in memory and available to the user once the parsing is done. The auxiliary tags are placed within a volume like this:

```
</physvol>
<auxiliary auxtype="SensDet" auxvalue="veloSD1"/>
<auxiliary auxtype="Color" auxvalue="blue"/>
</volume>
```

In order to access the auxiliary information one has to use the ${\tt GetVolumeAuxiliaryInformation(logicalVolume)}$ method of the ${\tt G4GDMLParser}$ class. This method returns a map with the keys being the pointers to the volumes containing auxiliary information and the values being vectors of pairs (auxtype, auxvalue).

An additional GDML file example is <code>auxiliary.gdml</code> located in example <code>G01</code> provided in Geant4; the same example also provides a snippet of code in its <code>main()</code> program showing how to retrieve the auxiliary information. Example <code>G04</code> instead shows how to define a sensitive detector associated to a logical volume, using the Auxiliary Information field.


3.6 Setup

The top volume of the geometry needs to be specified. This is done using the setup section. The following GDML is the generic and most common for the setup section.

```
<setup name="Test1" version="1.0">
  <world ref="World"/>
  </setup>
```

The only part you should need to change is the world ref name to the volume name of the top volume of your geometry. Only one setup is defined here, however it is possible define multiple geometry setups choosing different volumes as world volumes from all the already defined volumes.

GDML file example

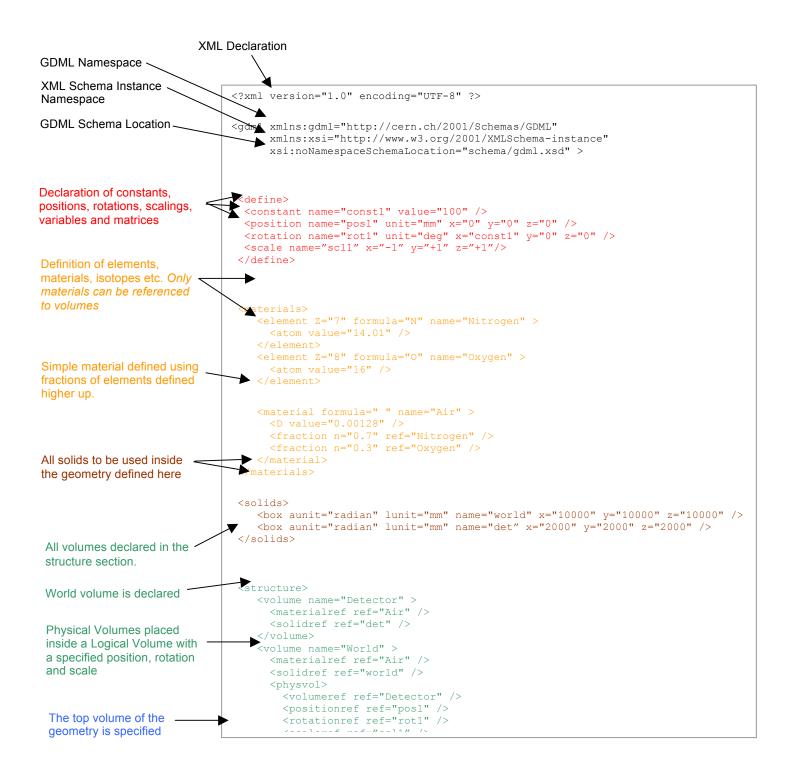

4. Importing and exporting GDML files

4.1 GDML Reading

4.1.1 Importing GDML files into Geant4 Geometry

GDML files can be directly imported into Geant4 geometry, using the GDML plug-in facility in your Geant4 application. Generally you will want to put the following lines into your DetectorCostruction class:

- In the class constructor (as far as the initializations are concerned step 2)
- In the Construct method (steps 3 and 4)

This can be done in four steps:

1) Include the necessary header files

#include "G4GDMLParser.hh"

2) Declare and initialize properly the parser

G4GDMLParser parser;

source_file.gdml will be your GDML source file, in case of multiple GDML files (modules) you should put the main GDML file there (the main mother module).

3) Run the parser

parser.Read("source_file.gdml");

If solids or other entities with the same name are found in different modules, a warning message is generated. Usually this happens when different GDML modules define the same logical volume. This is not a problem, but it may suggest that the input GDML modules have a low cohesion, therefore it maybe useful to review the way you have organized your geometry. All names for solids, volumes and other entities are by default stripped of possible strings concatenating their logical address in hexadecimal format; it is possible to disable the name stripping by calling <code>SetStripFlag(false)</code> available from the parser, before reading.

By default, when the parser reads a GDML file, comparison with the GDML Schema (from GDML Schema Location) is made. It is possible to switch off this comparison by setting to 'false' second optional parameter in the Read:

parser.Read("source file.gdml", false);

4) Get the World volume

G4VphysicalVolume* W = parser.GetWorldVolume(); //world volume
W->GetLogicalVolume()->SetVisAttributes(G4VisAttributes::Invisible);

The second line is optional, but commonly used, because you generally don't want to be able to see the World volume.

4.2 GDML Writing

4.2.1 Exporting Geant4 Geometry

Geant4 geometry can be exported into GDML files. To do so you should do the following:

1) Include the Geant4 header file of the parser

```
#include "G4GDMLParser.hh"
```

2) Get the world volume from the geometry

```
G4VphysicalVolume* W = G4TransportationManager::
GetTransportationManager()->GetNavigatorForTracking()
->GetWorldVolume();
```

3) Instantiate the parser and write to file

```
G4GDMLParser parser;
parser.Write("output.gdml", W, true, "path_to_GDML_schema");
```

The last parameter is optional and refers to the GDML Schema path, it is very important to set this right in order to allow for comparison with the Schema while reading the file back to Geant4; the path can either be an absolute directory path relative to the system (schema location local to that system) or an URL to the Schema. By default the schema location points to the latest version of the GDML schema located in the GDML web site.

There exists also an optional third parameter, which is a Boolean value set by default to TRUE. This parameter tells how you would like the names of volumes (as well as of solids, materials and all entities) to be formatted in your output GDML file:

true (**default**) – The names will be concatenated with their logical address in hexadecimal format. This is to avoid name duplication in the GDML output; in fact Geant4 allows different volumes (as well as materials and solids) with the same name. When you will read the GDML output file back into Geant4 the address part will be stripped off and you will have the original names. This is almost always safe.

false – The names will NOT be concatenated with anything. So the names in the output file will correspond exactly to the ones you have in Geant4. This is the prettiest format although you have to be REALLY sure that you don't have name duplication inside Geant4, otherwise this will generate a GDML output with duplicated names, which will be unreadable by any parser of course.

4) Methods for dumping the geometry

There are three ways of doing this:

- a) parser.Write("output.gdml", W);
 - Dumps all the geometry in a single GDML output file.
- **b)** parser.AddModule(physvol);

Dumps the geometry modularizing the output. The generated module will include the geometry tree starting from the physical-volume pointer physvol.

c) parser.AddModule(depth);

Dumps the geometry modularizing the output. The parameter in input is an integer indicating the depth in the geometry levels from where you wish to start modularization. Any new sub-tree at that depth level will become a module stored in a different GDML file; the main tree binding all modules will include the geometry from the world volume down to that specified level and will be stored in a separate GDML file.

4.2.2 Exporting ST-Viewer CAD Geometry

ST-Viewer is an interactive tool for viewing 3D CAD information. ST-Viewer includes functions to display and relate product identification information, assembly structure information and 3D geometry information. ST-Viewer implements the ISO STEP standard for product model data. ST-Viewer works with a very large range of CAD, CAM, CAE and PDM systems. A list of systems that have been tested with the ST-Viewer can be found at: http://www.steptools.com.

ST-Viewer uses intermediate files to store CAD geometry and structure information. These files (with .geom and .tree extensions respectively) use an internal format that can be parsed and translated into GDML format using the functionalities provided by the Geant4 GDML plug-in.

The geometry of the solids is defined by means of triangular facets, i.e. every solid in the .geom files is a tessellated solid made of *only* triangular facets. Therefore the GDML output will be a collection of tessellated solids where each solid has its own set of facets that are in turn defined by a set of three vertices. The vertices are named vectors of three values (x,y and z coordinates) and are defined in the beginning of the GDML file. The facets within a tessellated solid contain references to the names (*not the values*) of the three vertices they are made of (for more information on how a tessellated solid is defined in GDML please refer to the GDML Solids Schema: solids.xsd).

Of course multiple facets may share a common vertex, therefore in their definition there will be a reference to the same vertex name. Again, the actual values of the vertices' vectors are stored in the first part (the one enclosed by the <define> and </define> tags) of the GDML file.

In order to use the parser in your own application you need to

1) Include the Geant4 parser header:

```
#include "G4GDMLParser.hh"
```

2) Instantiate a Geant4 parser object:

```
G4GDMLParser parser;
```

3) Call the parse method:

```
G4LogicalVolume* STW = parser.ParseST("filename", med mat, geo mat);
```

This method takes three parameters: the first one is a string which specifies the name without file extension for the .geom and .tree files (assumed to have the same names and be located in the current directory). It returns a pointer of a generated mother volume with 'med_mat' material pointer associated, including the imported tessellated geometry with 'geom_mat' material pointer associated.

Common vertices will not be repeated in the define section, i.e. facets sharing the same vertex will refer to the same vertex name defined at the beginning of the GDML file. In this case there will not be any two vertices with the same coordinates.

During a test, a input .geom file of 9.5 MB could be saved in a GDML output file of 10.5 MB; the same input file would have become a 33 MB GDML output file, with repetition of common vertices.

4) Call the dump method:

```
parser.Write("output.gdml", STW phys);
```

The same method of the parser for writing the GDML output file can be used, by passing the placed physical volume pointer of such geometry.

The result is a GDML file corresponding to the .geom and .tree files previously taken as input.

5. User extensions to GDML using Geant4

The GDML syntax is defined in an XML schema. Inside the schema are all the definitions of the tags and the rules associated to those tags. The GDML schema can be extended, as XML is a fully extendable mark-up language. This section will discuss how to add custom elements to GDML. This could be useful if certain information is required to be contained in the GDML file for an application of GDML. The extension can be defined as such to contain a new tag and values within whichever chosen part of the GDML file. It may be the case that within the binding to GDML being used, there are methods already in place for information not supported by the GDML schema, in which case the user extension facility will help implementing that.

An example of a user extension is implemented in Geant4 and can be found in the directory <code>geant4/examples/persistency/gdml/G03</code>. This example will be used as a point of reference throughout this section.

The Schema

The first step in extending GDML is to redefine the GDML schema. It needs to include the custom elements of the extension. The extension is done in a separate schema file that imports the original schema as opposed to adding new parts to the old one. The schema for example G03 is found in a subdirectory of the example:

```
SimpleExtensionSchema/SimpleExtension.xsd
```

The original main GDML schema is imported from its local, relative location within your GDML directory. The new schema file normally will need to contain two main parts:

5.1 A 'redefine' element

This element uses the extension schema to modify existing GDML elements by adding additional content. This is called by this line, which gives the location of the schema to redefine:

```
<xs:redefine schemaLocation="schema/gdml.xsd">
```

In most cases, the extension will consist in defining new objects (like color) to a volume etc. In such case, the redefine needs to add a ReferenceType to the base it needs to be added to:

5.2 New Elements

The new schema will need to define the new 'element' that the ReferenceType will be referencing to. In the example of adding a 'color' reference to a volume, the element color will need to be defined.

When elements are defined, attributes of that element are defined within it, but if tags within the element contain more than one attribute, a type needs to be defined, and then referenced to. This is implemented in the G03 schema file.

All the new elements can't be contained inside the <gdml> tag as they are not part of the original schema, there needs to be a new container defined that contains the new elements AND replaces the original <gdml> tag; we call it here, <gdml simple extension>.

A new special tag, <extension>, is used to include all new tags to be considered as extension to the original GDML schema; in our example, we have only one tag, <color>, which is part of the extension. This is shown below:

```
<xs:element name="gdml_simple_extension">
     <xs:annotation>
     <xs:documentation>
```

This then means that a GDML file now takes the following structure based on the above:

In any GDML file you wish to use your 'extended schema' in, you will need to change the Namespace GDML Schema Location to your extended schema file and replace the original schema. The new schema location must be relative to the location of the GDML file in question. This will then import your new additions as well as the original GDML schema, as shown above.

Customised Reader

Once the GDML schema has been extended as wished, the application making use of the extended GDML, needs to provide the necessary instruments in order to properly handle the extensions. This is done by implementing a specialized 'reader' class, whose instance will replace the standard reader inside the G4GDMLParser class in Geant4. The new class must inherit from G4GDMLStructureRead and override in this case two methods:

```
void ExtensionRead(const xercesc::DOMElement* const element);
void VolumeRead(const xercesc::DOMElement* const element);
```

The former will have to handle the top level parsing of the new tags (in our case, <color>), while the latter will have to properly bound the new reference-type (<colorref>) to the volume, such that the new tag can be assigned as attribute to the volume entity. In our example, the class ColorReader implements such required functionality. An instance of the reader must be dynamically created in the DetectorConstruction class and provided through pointer argument to the G4GDMLParser instance to be created as usual for importing GDML files in Geant4.

Try it...

To run the example application you simply need to build it, using the standard procedure as for any Geant4 application. Then from the $\tt G03$ directory, you can run the example using this command:

The default file is ${\tt color_extension.gdml}$, which defines a single colored box in the world volume.