
#### COMS W4733: Computational Aspects of Robotics

#### Lecture 9: Trajectory Planning

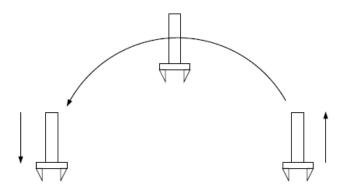


Instructor: Tony Dear

# Trajectory Planning


- So far we've described robot motions in terms of robot velocities and moving joints from one configuration to another configuration nearby ( $\Delta q$ )
- How do we move between points that are not so close together?
- Path: Collection of points that a manipulator follows in sequence
  - $x = \{x_1, x_2, ..., x_n\}$
- Trajectory: Path with a timing law (including velocity, acceleration)
  - x(t) such that  $x(t_i) = x_i$  and  $x(t_f) = x_f$
- Both can be in either joint space or operational space



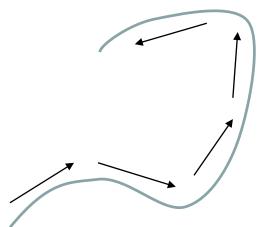

## Joint Space Trajectories

- Trajectories in operational space  $x_e(t)$  easier to describe, harder to compute
- Often easier to do the following:
  - Specify requirements in operational space (initial, final, intermediate poses)
  - Solve IK to find joint configurations for those requirements
- Find a joint space trajectory q(t) connecting configurations
- Positions and velocities should be continuous
- May need to interpolate between multiple points

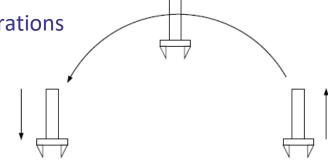

## **Cubic Polynomials**

- Suppose we specify initial and final position and velocity conditions (four constraints)
  - $q(t_i) = q_i, \dot{q}(t_i) = \dot{q}_i, q(t_f) = q_f, \dot{q}_f(t_f) = \dot{q}_f$
- Since we have four constraints, we need at least four free parameters
- Cubic polynomial has the form  $q(t) = a_0 + a_1 t + a_2 t^2 + a_3 t^3$

$$q_{i} = a_{0} + a_{1}t_{i} + a_{2}t_{i}^{2} + a_{3}t_{i}^{3}$$

$$\dot{q}_{i} = a_{1} + 2a_{2}t_{i} + 3a_{3}t_{i}^{2}$$

$$q_{f} = a_{0} + a_{1}t_{f} + a_{2}t_{f}^{2} + a_{3}t_{f}^{3}$$

$$\dot{q}_{f} = a_{1} + 2a_{2}t_{f} + 3a_{3}t_{f}^{2}$$

Solve for unknowns  $a_0$ ,  $a_1$ ,  $a_2$ ,  $a_3$ 

$$\begin{bmatrix} q_i \\ \dot{q}_i \\ q_f \\ \dot{q}_f \end{bmatrix} = \begin{bmatrix} 1 & t_i & t_i^2 & t_i^3 \\ 0 & 1 & 2t_i & 3t_i^2 \\ 1 & t_f & t_f^2 & t_f^3 \\ 0 & 1 & 2t_f & 3t_f^2 \end{bmatrix} \begin{bmatrix} a_0 \\ a_1 \\ a_2 \\ a_3 \end{bmatrix}$$


# **Example: Cubic Polynomial**


• Example:  $t_i = 0, t_f = 1$ 


$$\begin{bmatrix} q_i \\ \dot{q}_i \\ q_f \\ \dot{q}_f \end{bmatrix} = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 \\ 1 & 1 & 1 & 1 \\ 0 & 1 & 2 & 3 \end{bmatrix} \begin{bmatrix} a_0 \\ a_1 \\ a_2 \\ a_3 \end{bmatrix}$$

$$\begin{bmatrix} q_i \\ \dot{q}_i \\ q_f \\ \dot{q}_f \end{bmatrix} = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 \\ 1 & 1 & 1 & 1 \\ 0 & 1 & 2 & 3 \end{bmatrix} \begin{bmatrix} a_0 \\ a_1 \\ a_2 \\ a_3 \end{bmatrix} \qquad q(t) = q_i + \dot{q}_i t + \left( -3q_i - 2\dot{q}_i + 3q_f - \dot{q}_f \right) t^2 + \left( 2q_i + \dot{q}_i - 2q_f + \dot{q}_f \right) t^3$$

•  $q_i = 10, q_f = -20, \dot{q}_i = \dot{q}_f = 0$ 

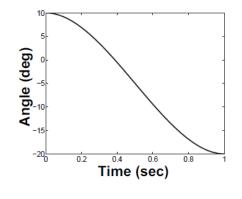

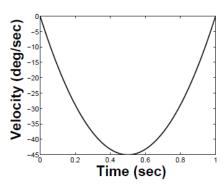

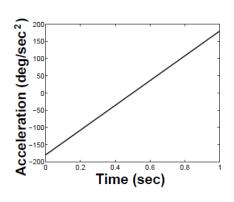

## **Quintic Polynomials**

- Problem: Unspecified accelerations are discontinuous (neither start nor end at 0)
- Jerky motions, may lead to unwanted vibrations and reduced accuracy
- If we specify initial and final accelerations as well, we need six free parameters

$$q(t) = a_0 + a_1t + a_2t^2 + a_3t^3 + a_4t^4 + a_5t^5$$

$$\begin{bmatrix} q_i \\ \dot{q}_i \\ \ddot{q}_f \\ \dot{q}_f \\ \ddot{q}_f \end{bmatrix} = \begin{bmatrix} 1 & t_i & t_i^2 & t_i^3 & t_i^4 & t_i^5 \\ 0 & 1 & 2t_i & 3t_i^2 & 4t_i^3 & 5t_i^4 \\ 0 & 0 & 2 & 6t_i & 12t_i^2 & 20t_i^3 \\ 1 & t_f & t_f^2 & t_f^3 & t_f^4 & t_f^5 \\ 0 & 1 & 2t_f & 3t_f^2 & 4t_f^3 & 5t_f^4 \\ 0 & 0 & 2 & 6t_f & 12t_f^2 & 20t_f^3 \end{bmatrix} \begin{bmatrix} a_0 \\ a_1 \\ a_2 \\ a_3 \\ a_4 \\ a_5 \end{bmatrix}$$

$$\begin{bmatrix} q_i \\ \dot{q}_i \\ \ddot{q}_f \\ \dot{q}_f \\ \ddot{q}_f \end{bmatrix} = \begin{bmatrix} 1 & 0 & 0 & 0 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 & 0 & 0 & 0 \\ 0 & 1 & 1 & 1 & 1 & 1 & 1 \\ 0 & 1 & 2 & 3 & 4 & 5 & 0 \\ 0 & 0 & 2 & 6 & 12 & 20 & 0 \end{bmatrix} \begin{bmatrix} a_0 \\ a_1 \\ a_2 \\ a_3 \\ a_4 \\ a_5 \end{bmatrix}$$


Example: 
$$t_i = 0, t_f = 1$$


$$\begin{bmatrix} q_i \\ \dot{q}_i \\ \ddot{q}_i \\ q_f \\ \dot{q}_f \\ \ddot{q}_f \end{bmatrix} = \begin{bmatrix} 1 & 0 & 0 & 0 & 0 & 0 & 0 \\ 0 & 1 & 0 & 0 & 0 & 0 \\ 0 & 0 & 2 & 0 & 0 & 0 \\ 1 & 1 & 1 & 1 & 1 & 1 \\ 0 & 1 & 2 & 3 & 4 & 5 \\ 0 & 0 & 2 & 6 & 12 & 20 \end{bmatrix} \begin{bmatrix} a_0 \\ a_1 \\ a_2 \\ a_3 \\ a_4 \\ a_5 \end{bmatrix}$$


# **Example: Quintic Polynomial**

- Problem: Unspecified accelerations are discontinuous (neither start nor end at 0)
- Jerky motions, may lead to unwanted vibrations and reduced accuracy
- If we specify initial and final accelerations as well, we need six free parameters

$$q(t) = a_0 + a_1t + a_2t^2 + a_3t^3 + a_4t^4 + a_5t^5$$

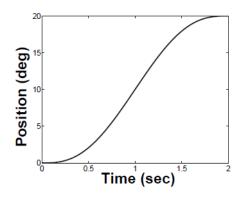


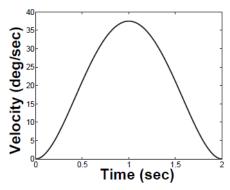

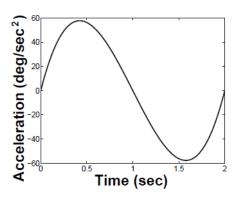


### Linear Segment with Parabolic Blends

- Polynomial trajectories result in non-constant velocities
- Manipulator always accelerating, requiring constant force
- May not be ideal for long trajectories
- Another idea: Maintain constant velocity part of the time
- "Ramp up" to desired velocity, then "ramp down" when done
- Trapezoidal velocity profile
- Trajectory assumed to be symmetric from start to end
- Ramp segments are quadratic in position, linear in velocity, and constant in acceleration

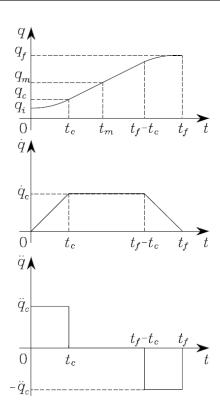

### LSPD: First Parabolic Segment

- Linear segment starts at *blend time*  $t_c$ , ends at  $t_f t_c$
- Initial and final configurations  $q_i$ ,  $q_f$  and time  $t_f$  are specified
- Initial and final velocities  $\dot{q}_i=\dot{q}_f=0$
- Usually either acceleration  $\ddot{q}_c$  or *cruise velocity*  $\dot{q}_c$  is specified as well
- First parabola has the form  $q_{p1}(t) = a_0 + a_1 t + a_2 t^2$
- Initial conditions at t=0:  $q_{p1}(0)=q_i=a_0$   $\dot{q}_{p1}(0)=0=a_1$
- Match velocity at  $t_c$ :  $\dot{q}_{p1}(t_c) = \dot{q}_c = 2a_2t_c$
- Match acceleration:  $\ddot{q}_{p1} = 2a_2 = \ddot{q}_c$

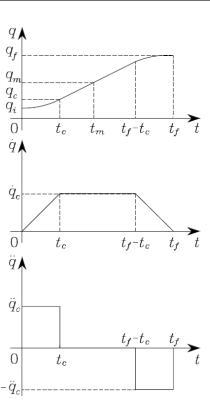

#### LSPD: Blend Time

$$q_{p1}(t) = q_i + a_2 t^2$$

$$\dot{q}_c = 2a_2 t_c$$

$$\ddot{q}_c = 2a_2$$

$$\dot{q}_c = \ddot{q}_c t_c$$

• How does blend time  $t_c$  relate to  $\dot{q}_c$  and  $\ddot{q}_c$ ?


 $q_m = (q_i + q_f)/2$  $t_m = t_f/2$ 

Configuration at 
$$t_c$$
:  $q_{p1}(t_c) = q_c = q_i + a_2 t_c^2$ 

Velocity of linear segment:

$$\dot{q}_c = \frac{q_m - q_c}{t_m - t_c} = \frac{(q_i + q_f)/2 - (q_i + \ddot{q}_c t_c^2/2)}{t_f/2 - t_c} = \frac{(q_i + q_f)/2 - (q_i + \dot{q}_c t_c/2)}{t_f/2 - t_c}$$

$$t_c = \frac{q_i - q_f + \dot{q}_c t_f}{\dot{q}_c} = \frac{t_f}{2} - \frac{1}{2} \sqrt{(t_f^2 \ddot{q}_c - 4(q_f - q_i))/\ddot{q}_c}$$

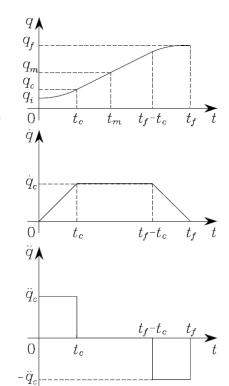

### LSPD: Linear Segment

$$\dot{q}_c = \ddot{q}_c t_c$$

$$t_c = \frac{q_i - q_f + \dot{q}_c t_f}{\dot{q}_c} = \frac{t_f}{2} - \frac{1}{2} \sqrt{(t_f^2 \ddot{q}_c - 4(q_f - q_i))/\ddot{q}_c}$$


- We have a solution for the first parabolic segment:  $q_{p1}(t) = q_i + \frac{1}{2}\ddot{q}_c t$
- Linear segment is  $q_l(t) = b_0 + b_1 t = b_0 + \dot{q}_c t = b_0 + \ddot{q}_c t_c t$
- Configuration at  $t_c$ :

$$q_l(t_c) = q_c = \frac{b_0}{c} + \ddot{q}_c t_c^2$$

From the parabola,

$$q_{p1}(t_c) = q_c = q_i + \ddot{q}_c t_c^2 / 2$$

• Linear segment solution:  $q_l(t) = q_i + \ddot{q}_c t_c (t - t_c/2)$ 

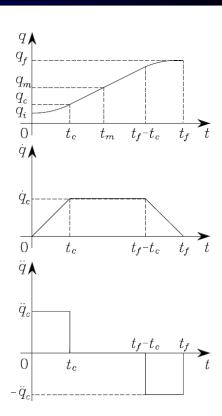


### LSPD: Second Parabolic Segment

$$\dot{q}_c = \ddot{q}_c t_c$$

$$t_c = \frac{q_i - q_f + \dot{q}_c t_f}{\dot{q}_c} = \frac{t_f}{2} - \frac{1}{2} \sqrt{(t_f^2 \ddot{q}_c - 4(q_f - q_i))/\ddot{q}_c}$$

$$q_l(t) = q_i + \ddot{q}_c t_c (t - t_c/2)$$

- Second parabolic segment:  $q_{p2}(t) = c_0 + c_1 t + c_2 t^2$
- Match acceleration:  $\ddot{q}_{p2} = -\ddot{q}_c = 2c_2$
- Match velocity at  $t_f$ :  $\dot{q}_{p2}(t_f) = 0 = c_1 \ddot{q}_c t_f$
- Final configuration at  $t_f$ :  $q_{p2}(t_f) = q_f = c_0 + \ddot{q}_c t_f^2 \frac{1}{2} \ddot{q}_c t_f^2$
- Second parabolic segment solution:  $q_{p2}(t) = q_f \frac{1}{2}\ddot{q}_c(t_f t)^2$

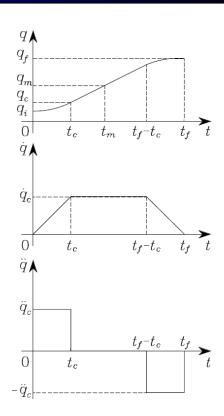


### LSPD: Summary

$$\dot{q}_c = \ddot{q}_c t_c$$

$$\dot{q}_c = \ddot{q}_c t_c$$
  $t_c = \frac{q_i - q_f + \dot{q}_c t_f}{\dot{q}_c} = \frac{t_f}{2} - \frac{1}{2} \sqrt{(t_f^2 \ddot{q}_c - 4(q_f - q_i))/\ddot{q}_c}$ 

$$q(t) = \begin{cases} q_i + \frac{1}{2}\ddot{q}_c t^2 & 0 \le t \le t_c \\ q_i + \ddot{q}_c t_c (t - t_c/2) & t_c < t \le t_f - t_c \\ q_f - \frac{1}{2}\ddot{q}_c (t_f - t)^2 & t_f - t_c < t \le t_f \end{cases}$$


- Initial/final conditions plus either  $\dot{q}_c$  or  $\ddot{q}_c$  produce a unique solution
- For solution to exist,  $\dot{q}_c$  and  $\ddot{q}_c$  must satisfy

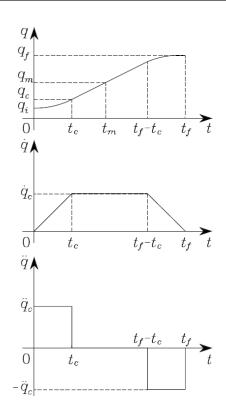



### Example: LSPD

•  $t_0 = 0, t_f = 1, q_i = 0, q_f = 40, \dot{q}_c = 60$ 

$$t_c = \frac{1}{3}, \qquad q(t) = \begin{cases} 90t^2 & 0 \le t \le 1/3 \\ 60(t - 1/6) & 1/3 < t \le 2/3 \\ 40 - 90(1 - t)^2 & 2/3 < t \le 1 \end{cases}$$

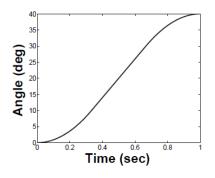


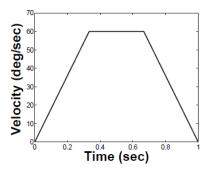

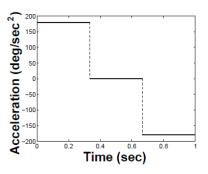

## Minimum-Time Trajectories

- Suppose that we want to reach  $q_f$  as quickly as possible given acceleration  $\ddot{q}_c$
- Bang-bang trajectory minimizes  $t_f$  and has blend time  $t_c=t_f/2$

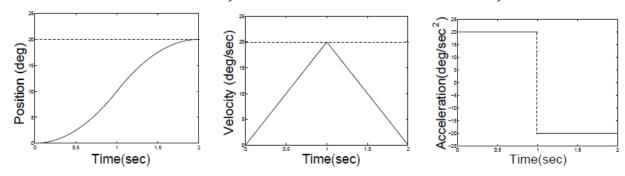

Final time is determined by acceleration:


$$t_{c} = \frac{t_{f}}{2} - \frac{1}{2} \sqrt{(t_{f}^{2} \ddot{q}_{c} - 4(q_{f} - q_{i}))/\ddot{q}_{c}} = \frac{t_{f}}{2} - 0$$

$$t_{f} = 2 \sqrt{|q_{f} - q_{i}|/\ddot{q}_{c}}$$

$$q(t) = \begin{cases} q_{i} + \frac{1}{2} \ddot{q}_{c} t^{2} & 0 \leq t \leq t_{f}/2 \\ q_{f} - \frac{1}{2} \ddot{q}_{c} (t_{f} - t)^{2} & t_{f}/2 < t \leq t_{f} \end{cases}$$


## Sequences of Points

- It is often desirable to specify more than two joint configurations for finer control
- For example, higher density of points near obstacles or for tighter turns
- Possible to generate a n-1 order polynomial to fit n points, but
  - Computationally expensive as number of points increases
  - Resultant polynomial becomes more and more oscillatory
  - Not robust; changing even one point requires re-solving everything
- Better to locally interpolate low-order polynomials
- Place polynomials or LSPDs between pairs of points
- Specify matching conditions for velocities and accelerations

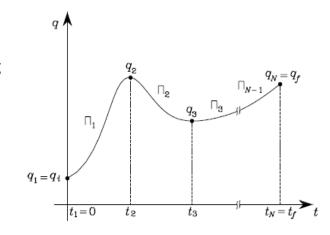


# Example: Cubic and Quintic Splines

- 4 points: q(0) = 10,  $\dot{q}(0) = 0$ ; q(2) = 40,  $\dot{q}(2) = 0$ ; q(4) = 30,  $\dot{q}(4) = 0$ ; q(6) = 90,  $\dot{q}(6) = 0$
- Cubic spline solution matches all velocity conditions, but accelerations are discontinuous:

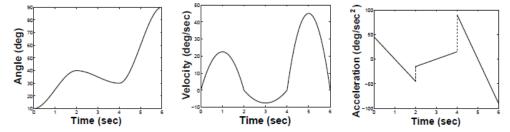

• Quintic spline solution allows us to also specify  $\ddot{q}(0) = \ddot{q}(2) = \ddot{q}(4) = \ddot{q}(6) = 0$ 

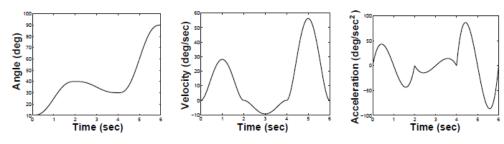

# Summary

- Trajectory planning is the process of generating a time-valued continuous function of configurations that a robot can follow
- Cubic and quintic polynomials allow for specification of velocities and accelerations
- Combining linear segments with parabolic segments allow for constant-velocity trajectories for part of the trajectory
- Sequences of points can be interpolated locally