

LAPORAN REPAIR KOMATSU INDONESIA

Tanggal Repair	08-Mar-25
Jam Berangkat	08.05 WIB
Jam Repair	13.15 s/d 17.15
Jam Kembali	21.15 WIB
Qty Unit Repair	10 pcs
Assy No	14X0625322 dan FUEL GAUGE
Type Unit	D 65 E
Jumlah Man Power	3 Orang
Driver	1 Orang
Methode Repair	Penambahan circuit dan ganti lampu

Maker of Harness ☐ BEI ☒ NON BEI


Couse of Defect ☐ BEI ☒ NON BEI

MATERIAL UNTUK REPAIR :


PART NAME	PART NO	QTY
Wire	AVS 0,85 B	1.75 Meter
Wire	AVS 0,85 B-W	1.75 Meter
Wire	AVS 0,85 R-W	1.75 Meter
Wire	AVS 0,85 Y-B	12.6 Meter
Terminal	B-2	21 Pcs
Terminal	300502-0	14 Pcs
Terminal	300501-0	7 Pcs
Terminal	110500-2	21 Pcs
Terminal	7114-1471	7 Pcs
Rubber Seal	7157-7811-80	7 Pcs
Sleeve	7120-8012	7 Pcs
Sleeve	7120-1010	21 Pcs
Sumitube	SA3-1	0.63 Meter
SH Tube	SH TUBE D5	0.34 Meter
COT	COT D5	9.8 Meter
TAPE	WHVTA 19*20 B	35 Meter
Lampu	Lampu LED putih	3 pcs
Resistor	R 220 ohm 0.5W	3 pcs

1. Modif harness assy 14X0625322 sebanyak 7 pcs

Before

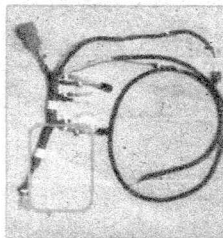

After

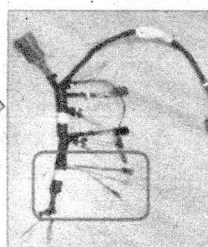


2. Melakukan Repair Lampu Bulb diganti ke LED sebanyak 3 pcs

Before



After

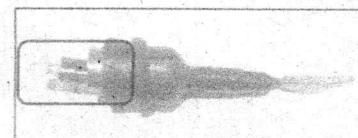

CONFIRM "OK"

Disetujui	Diperiksa	Dibuat
Muhlis Asst Manager	Leader	Repairman