


DIAGNOSTIC (not manuscript evidence): the absolute commissioning gate cannot double as the in-service drift monitor

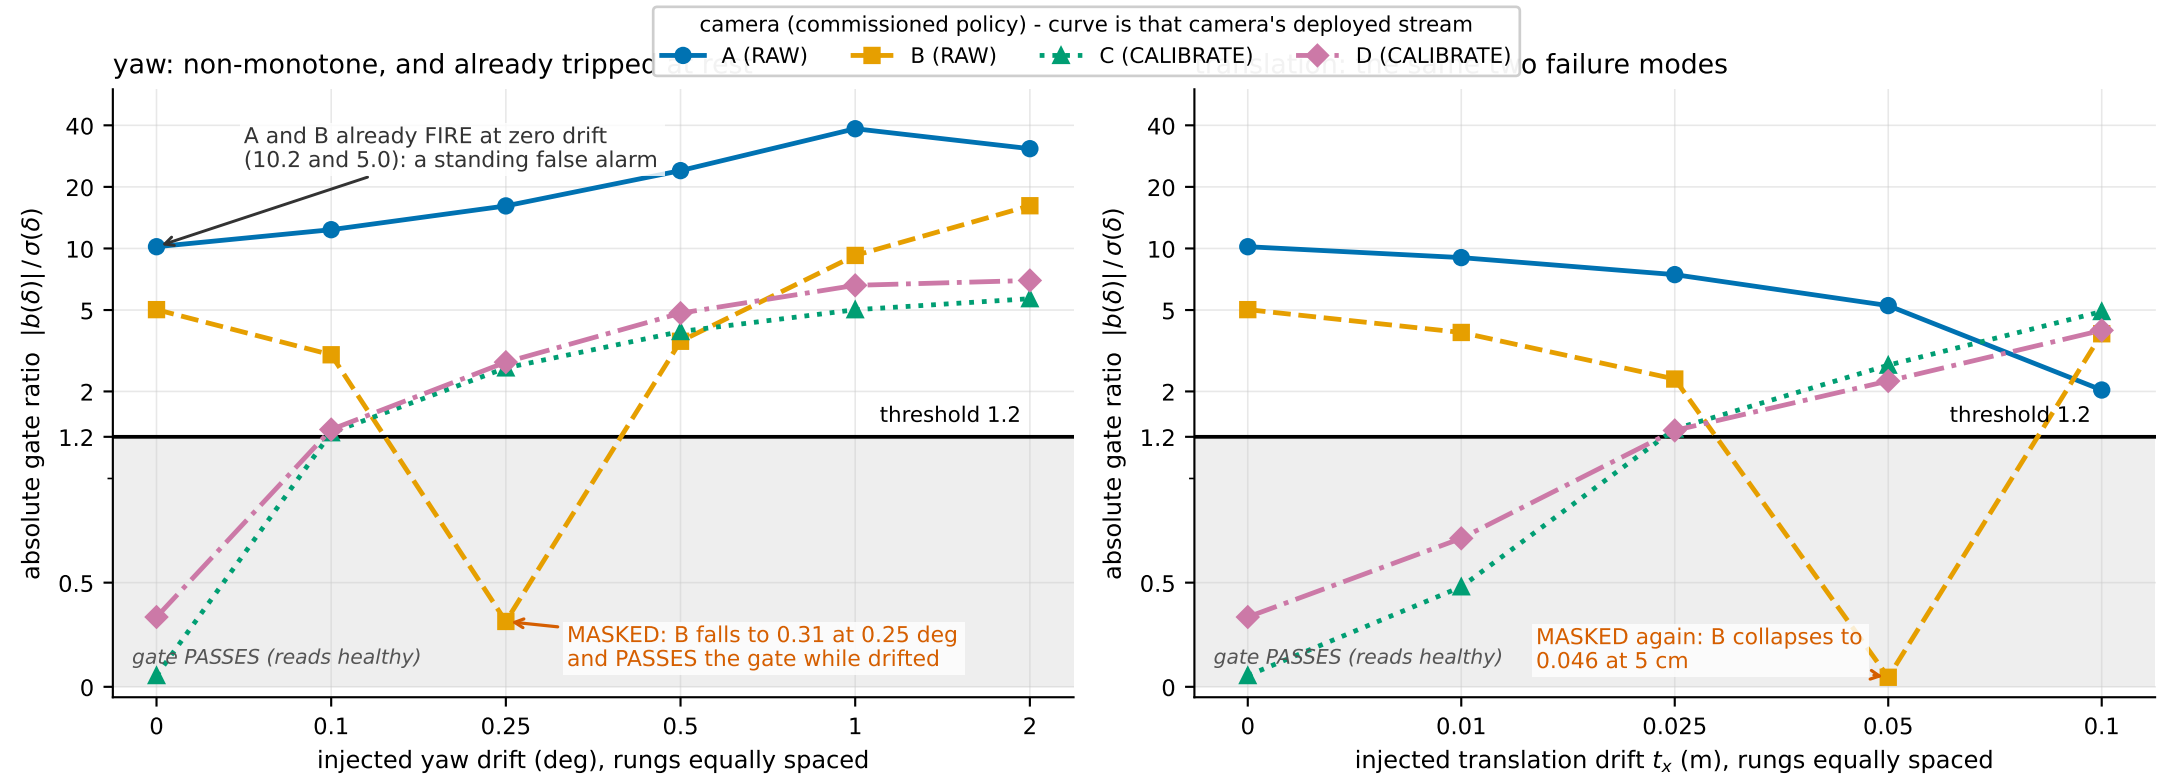

Same audited JSON, same controlled v3 injection, same held-out capture as F04 fig_d1; curves are the commissioned-policy stream per camera. Two independent failure modes: (1) the ratio already exceeds 1.2 at zero drift on the cameras commissioned RAW, so an absolute in-service alarm would be permanently tripped; (2) it is non-monotone, because injected drift can cancel a camera's resident bias, so a drifted camera can read SAFER than at rest. The specific rest-state values are capture-unstable (camera B rests on 15 detections) and must not be quoted as properties of these cameras -- only as evidence that the absolute statistic is capture-unstable. This panel motivates the change statistic; it states no detection performance.