

**E-paper Display Series** 



**IL0326** 



# **Table of Content**

REVISION HISTORY	3
INTRODUCTION	4
MAIN APPLICATIONS	4
FEATURE HIGHLIGHTS	4
BLOCK DIAGRAM	5
ORDERING INFORMATION	6
PIN DESCRIPTION	7
COMMAND TABLE	9
COMMAND DESCRIPTION	2
HOST INTERFACES	6
POWER MANAGEMENT	9
OTP Address Mapping	3
TEMPERATURE RANGE	4
DEEP SLEEP MODE	8
CASCADE APPLICATION CIRCUIT5	0
BOOSTER APPLICATION CIRCUIT4	1
ABSOLUTE MAXIMUM RATINGS 52	2
DC CHARACTERISTICS	3
AC CHARACTERISTICS 54	4
PHYSICAL DIMENSIONS	6
ALIGNMENT MARK INFORMATION58	8
PAD COORDINATES	9
TRAY INFORMATION	ദ



## **REVISION HISTORY**

Revision	Contents	Date
1.0	(N/A)	

# **IL0326**

All-in-one driver IC with Timing Controller for White/Black/Red Dot-Matrix Micro-Cup ESL

#### INTRODUCTION

The IL0326 is an all-in-one driver with timing controller for ESL. Its output is of 1-bit white/black and 1-bit red resolution per pixel. The timing controller provides control signals for source driver and gate driver.

The DC-DC controller allows it to generate the source output voltage VDH/VDL (62.4V~615.0V) and VDHR (2.4V~15.0V). The chip also includes an output buffer for the supply of the COM electrode (AC-VCOM or DC-VCOM). The system is configurable through a 3-wire/4-wire (SPI) serial interface.

#### MAIN APPLICATIONS

E-tag application

#### **FEATURE HIGHLIGHTS**

- System-on-chip (SOC) for ESL
- Timing controller supports several resolutions
  - Up to 800 source x 600 gate resolution+ 1 border + 1 VCOM
  - 2 1 bit for white/black and 1 bit for red per pixel
- Cascade: 2 or more chips cascade mode
- Memory (Max.): 800 x 600 x 2 bits SRAM
- 3-wire/4-wire (SPI) serial interface
  - 2 Clock rate up to 20MHz
- Temperature sensor:
  - 2 On-Chip: -25~50 °C 6 2.0°C / 8-bit status

- 2 Off-Chip: -55~125°C 6 2.0°C /11-bit status (I<sup>2</sup>C/LM75)
- Support LPD, Low Power Detection
  - VDD < 2.5V or 2.4V or 2.3V or 2.2V (by setting)</li>
- OSC / PLL: On-chip RC oscillator
- VCOM:
  - 2 AC-VCOM / DC-VCOM (by LUT)
  - 2 Support VCOM sensing (7-bit digital status)
- Charge Pump: On-chip booster and regulator:
  - 2 VGH: +9V~+12V, +17V~+20V (programmable)
  - 2 VGL: -9V~-12V, -17V~-20V (programmable)
  - 2 VDH: +2.4 ~ +15.0V (programmable, black/white)
  - 2 VDL: -2.4 ~ -15.0V (programmable, black/white)
  - 2 VDHR: +2.4 ~ +15.0V (programmable, red)
- Supply voltage: 2.3~ 3.6V
- OTP: 6K-byte OTP for LUTs and Settings
- Package: COG
- Source/Gate bump information


Bump pitch: 14 μM 6 2 μM
 Bump space: 1 μM 6 3 μM

2 Bump surface: 1200 µM<sup>2</sup>

**Remark:** The inspection standard of the product appearance is based on Good Display's inspection document.



## **BLOCK DIAGRAM**

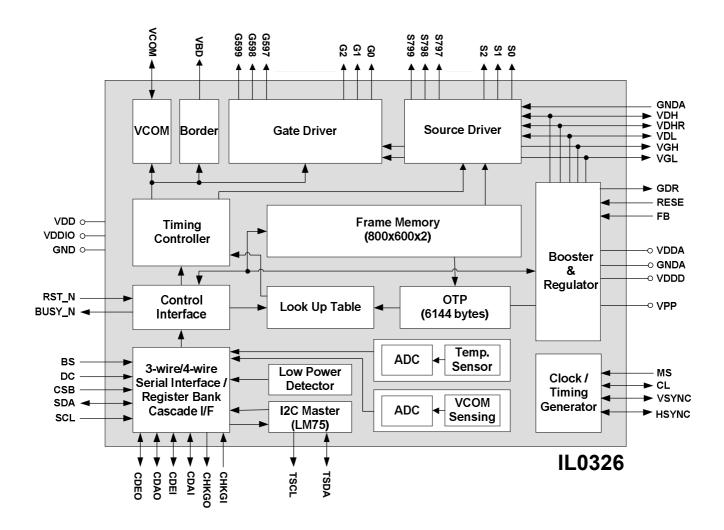



#### **ORDERING INFORMATION**

Part Number	Description
IL0326cGAA-U0X3-3	IC thickness: 300uM, with 3" double-faced tray
IL0326cGAA-U0X3-4	IC thickness: 300uM, with 4" double-faced tray

#### **General Notes**

#### **APPLICATION INFORMATION**

For improved readability, the specification contains many application data points. When application information is given, it is advisory and does not form part of the specification for the device.

#### BARE DIE DISCLAIMER

All die are tested and are guaranteed to comply with all data sheet limits up to the point of wafer sawing. There is no post waffle saw/pack testing performed on individual die. Although the latest modern processes are utilized for wafer sawing and die pick-&-place into waffle pack carriers, Good Display has no control of third party procedures in the handling, packing or assembly of the die. Accordingly, it is the responsibility of the customer to test and qualify their application in which the die is to be used. Good Display assumes no liability for device functionality or performance of the die or systems after handling, packing or assembly of the die.

#### LIFE SUPPORT APPLICATIONS

These devices are not designed for use in life support appliances, or systems where malfunction of these products can reasonably be expected to result in personal injuries. Customer using or selling these products for use in such applications do so at their own risk.

#### **CONTENT DISCLAIMER**

Good Display believes the information contained in this document to be accurate and reliable. However, it is subject to change without notice. No responsibility is assumed by Good Display for its use, nor for infringement of patents or other rights of third parties. No part of this publication may be reproduced, or transmitted in any form or by any means without the prior consent of Good Display Inc. Good Display's terms and conditions of sale apply at all times.



## **PIN DESCRIPTION**

Type: I: Input, O: Output, I/O: Input/Output, PWR: Power, C: Capacitor pin

Pin (Pad) Name	Pin Count	Туре	Description
			Power Supply Pins
VDD	10	PWR	Digital power
VDDA	13	PWR	Analog power
VDDIO	18	PWR	IO power
VDDDO	8	PWR	Digital power output (1.8V)
VDDD (VDDDI)	8	PWR	Digital power input (1.8V)
VPP	10	PWR	OTP program power (7.75V)
VDM	8	PWR	Analog Ground.
GND	19	PWR	Digital Ground.
GNDA	15	PWR	Analog Ground
			LDO Pins
VDH	12	I/O	Positive source driver Voltage (+2.4V ~ +15V)
VDHR	16	I/O	Positive source driver voltage for Red (+2.4V ~ +15V)
VDL	12	I/O	Negative source driver voltage (-2.4V ~ -15V)
		C	CONTROL INTERFACE PINS
			Bus Selection. Select 3-wire / 4-wire SPI interface
BS	2	I	L: 4-wire interface. H: 3-wire interface.
			Global reset pin. Low: active.
RST_N	2	l (Pull-up)	When RST_N becomes low, driver will reset. All register will reset to default value. Driver all function will disable.
		(i dii dp)	Source/Gate/Border/VCOM will be released to floating. The minimal width of RST_N=low is 50us.
			Cascade setting pin.
MS	2	I	L: Slave chip. H: Master chip.
			Clock input/output pin.
CL	2	I/O	Master: Clock output. Slave: Clock input.
CDEI	2	I/O	Cascade signal pin. Leave it open if not used.
CDEO	2	I/O	Cascade signal pin. Leave it open if not used.
CDAI	2	I/O	Cascade data pin. Leave it open if not used.
CDAO	2	I/O	Cascade data pin. Leave it open if not used.
MM	2	I	Cascade setting pin. Leave it open if not used.
LSYNC	2	I/O	Cascade sync pin. Leave it open if not used.
M1M2_SYNC	2	I/O	Cascade sync pin. Leave it open if not used.
M2M1_SYNC	2	I/O	Cascade sync pin. Leave it open if not used.
			Driver busy flag.
BUSY_N	2	0	L: Driver is Busy. H: Host side can send command/data to driver.



Pin (Pad) Name	Pin Count	Туре	Description
		МС	CU INTERFACE (SPI) PINS
CSB	2	I	Serial communication chip select.
SDA	2	I/O	Serial communication data input/output
00.44	0		Serial communication data input for dual mode.
SDA1	2	I	Leave open if single SPI mode is used.
SCL	2	I	Serial communication clock input.
			Command/Data input.
DC	2	1	L: command
	_	•	H: data
			Connect to GND if BS=High.
			I <sup>2</sup> C INTERFACE
TSCL	2	O (apan drain)	I <sup>2</sup> C clock (External pull-up resistor is necessary.)
		(open-drain)	Leave them open if not used.
TSDA	2	I/O	l <sup>2</sup> C data (External pull-up resistor is necessary.)
		(open-drain)	Leave them open if not used.
			OUTPUT PINS
S0~S799	800	0	Source driver output signals.
( S<0>~S<799> )			
G0~G599	600	0	Gate driver output signals.
( G<0>~G<599> )			
VCOM	32	0	VCOM output.
VBD		0	Border output pins.
(VBD<0>, VBD<1>)	1, 1		
			Booster Pins
GDR	14	0	N-MOS gate control
RESE	4	I	Current sense input for control loop.
FB	2	Р	(Keep Open.)
VGH	14	I/O	Positive Gate voltage.
VGL	14	I/O	Negative Gate voltage.
			CHECK PANEL PINS
CHKGI	2	l (Pull-down)	Check panel break input. Leave open if it is not used.
CHKGO	2	0	Check panel break output. Leave open if it is not used.
			RESERVED PINS
VSYNC	2	0	Reserved pins. Leave it floating.
HSYNC	2	0	Reserved pins. Leave it floating.
TEST1~TEST3	2x3	I	Reserved pins. Leave it floating
TEST4~TEST7	2x4	0	Reserved pins. Leave it floating.
TEST8~TEST13	2x6	I	Reserved pins. Leave it floating.
DUMMY	108	-	Reserved pins. Leave it floating.
GD<0>~GD<3>	1x4		Reserved pins. Leave it floating.



## **COMMAND TABLE**

#	Command	W/R	C/D	D7	D6	<b>D5</b>	D4	D3	D2	D1	D0	Registers	Default
		0	0	0	0	0	0	0	0	0	0	9	00н
1	Panel Setting (PSR)	0	1			#	#	#	#	#	#	REG, KW/R, UD, SHL, SHD_N, RST_N	0Fн
		0	0	0	0	0	0	0	0	0	1		01н
		0	1				#		#	#	#	BD_EN, VSR_EN, VS_EN, VG_EN	07н
2	Power Setting (PWR)	0	1	#			#		#	#	#	VPP_EN, VCOM_SLEW, VG_LVL[2:0]	17н
		0	1	_		#	#	#	#	#	#	VDH_LVL[5:0]	3Ан
		0	1			#	#	#	#	#	#	VDL_LVL[5:0]	ЗАн
		0	1			#	#	#	#	#	#	VDHR_LVL[5:0]	03н
3	Power OFF (POF)	0	0	0	0	0	0	0	0	1	0		02н
4	Power OFF Sequence Setting	0	0	0	0	0	0	0	0	1	1		03н
_	(PFS)	0	1	_		#	#					T_VDS_OFF[1:0]	00н
5	Power ON (PON)	0	0	0	0	0	0	0	1	0	0		04н
6	Power ON Measure (PMES)	0	0	0	0	0	0	0	1	0	1		05н
		0	0	0	0	0	0	0	1	1	0	DT DUAG O	<b>06</b> н
l _	D	0	1	#	#	#	#	#	#	#	#	BT_PHA[7:0]	17H
7	Booster Soft Start (BTST)	0	1	#	#	#	#	#	#	#	#	BT_PHB[7:0]	17H
		0	1			#	#	#	#	#	#	BT_PHC1[5:0]	17H
		0	1	#		#	#	#	#	#	#	PHC2_EN, BT_PHC2[5:0]	17H
8	Deep sleep (DSLP)	0	0	0	0	0	0	0	1	1	1	Chapte and a	<b>07</b> н
		0	1	0	0	0	0 1	0	0	0	0	Check code	А5н <b>10</b> н
	Display Start Transmission 1		0	#	#				#	_	#	K/W or OLD Pixel Data (800x600):	
9	(DTM1, White/Black Data)	0	1	:	:	#	#	#		#	:	KPXL[1:8]	-
	(x-byte command)	0	1	#	#	: #	#	#	#	: #	#	KPXL[n-7:n]	:
		0	0	0	0	0	1	0	0	0	1	KPAL[II-7.II]	11H
10	Data Stop (DSP)	1	1	#	U	U		U	U	U	•		00н
11	Display Refresh (DRF)	0	0	0	0	0	1	0	0	1	0		12н
	Display Reliesh (BRL)	0	0	0	0	0	1	0	0	1	1	Red or NEW Pixel Data (800x600):	13н
	Display Start transmission 2	0	1	#	#	#	#	#	#	#	#	RPXL[1:8]	-
12	(DTM2, Red Data)	0	1	:	:	:	:	:	:	:	:	:	:
	(x-byte command)	0	1	#	#	#	#	#	#	#	#	RPXL[n-7:n]	-
		0	0	0	0	0	1	0	1	0	1		15н
13	Dual SPI	1	1	_		#	#	_		_		MM_EN, DUSPI_EN	00н
		0	0	0	0	0	1	0	1	1	1	<u> </u>	17н
14	Auto Sequence (AUTO)	0	1	1	0	1	0	0	1	0	1	Check code	А5н
		0	0	0	0	1	0	1	0	1	0		2Ан
15	LUT option (LUTOPT)	0	1	#	#							STATE_XON[9:8]	00н
	,	0	1	#	#	#	#	#	#	#	#	STATE_XON[7:0]	00н
		0	0	0	0	1	0	1	0	1	1	_ 1 - 1	2Вн
1,	IAMILIT antique (IAMART)	0	1							#	#	ATRED, NORED	00н
16	KW LUT option (KWOPT)	0	1	#	#							KWE[9:8]	00н
		0	1	#	#	#	#	#	#	#	#	KWE[7:0]	00н
47	DIL control (DIL)	0	0	0	0	1	1	0	0	0	0		30н
17	PLL control (PLL)	0	1	_				#	#	#	#	FRS[3:0]	06н



#	Command	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	Registers	Default
		0	0	0	1	0	0	0	0	0	0		<b>40</b> H
18	Temperature Sensor Calibration (TSC)	1	1	#	#	#	#	#	#	#	#	D[10:3] / TS[7:0]	00н
	(130)	1	1	#	#	#		-				D[2:0] / -	00н
10	Temperature Sensor Selection	0	0	0	1	0	0	0	0	0	1		41н
19	(TSĖ)	0	1	#				#	#	#	#	TSE,TO[3:0]	00н
		0	0	0	1	0	0	0	0	1	0		<b>42</b> H
	T 1 0 14 % (TO)A()	0	1	#	#	#	#	#	#	#	#	WATTR[7:0]	00н
20	Temperature Sensor Write (TSW)	0	1	#	#	#	#	#	#	#	#	WMSB[7:0]	00н
		0	1	#	#	#	#	#	#	#	#	WLSB[7:0]	00н
		0	0	0	1	0	0	0	0	1	1		43н
21	Temperature Sensor Read (TSR)	1	1	#	#	#	#	#	#	#	#	RMSB[7:0]	00н
ľ		1	1	#	#	#	#	#	#	#	#	RLSB[7:0]	00н
	D	0	0	0	1	0	0	0	1	0	0		44н
22	Panel Break Check (PBC)	1	1								#	PSTA	00н
		0	0	0	1	0	1	0	0	0	0		<b>50</b> H
23	VCOM and data interval setting	0	1	#		#	#			#	#	BDZ, BDV[1:0], DDX[1:0]	31н
1	(CDI)	0	1					#	#	#	#	CDI[3:0]	07H
		0	0	0	1	0	1	0	0	0	1		<b>51</b> н
24	Lower Power Detection (LPD)	1	1	_							#	LPD	01н
		0	0	0	1	0	1	0	0	1	0		<b>52</b> H
25	End Voltage Setting (EVS)	0	1	_				#		#	#	VCEND, BDEND[1:0]	02н
		0	0	0	1	1	0	0	0	0	0		60н
26	TCON setting (TCON)	0	1	#	#	#	#	#	#	#	#	S2G[3:0], G2S[3:0]	22н
		0	0	0	1	1	0	0	0	0	1	010[010], 010[010]	61н
		0	1					_		#	#	HRES[9:8]	03н
27	Resolution setting (TRES)	0	1	#	#	#	#	#	0	0	0	HRES[7:3]	20н
	. 100010 11011 00 ttm. 1g (11 1=0)	0	1	<u></u>						#	#		02н
		0	1	#	#	#	#	#	#	#	#	VRES[9:0]	52н 58н
		0	0	0	1	1	0	0	1	0	1		65H
		0	1	Ė	Ė	Ė	Ť	_	<u> </u>	#	#	HST[9:8]	00н
28	Gate/Source Start setting (GSST)	0	1	#	#	#	#	#	0	0	0	HST[7:3]	00н
20	Gate/Godifee Glart Setting (GGG1)	0	1							#	#		00н
		0	1	#	#	#	#	#	#	#	#	VST[9:0]	00н
		0	0	0	1	1	1	0	0	0	0		<b>70</b> H
		1	1	#	#	#	#	#	#	#	#	PROD_REV[23:16]	FFH
		1	1	#	#	#	#	#	#	#	#	PROD_REV[15:8]	FFH
		1	1	#	#	#	#	#	#	#	#	PROD_REV[7:0]	FFH
29	Revision (REV)	1	1	#	#	#	#	#	#	#	#	LUT_REV[23:16]	FFH
		1	1	#	#	#	#	#	#	#	#	LUT_REV[15:8]	FFH
		1	1	#	#	#	#	#	#	#	#	LUT_REV[7:0]	FFH
		1	1	#	#		#	#	#	#	#	CHIP_REV[7:0]	0Сн
		0	0	0	1	# 1	1	0	0	0	1	GHIF_NEV[1.0]	71н
30	Get Status (FLG)	$\vdash$	$\vdash$	_			-		•			PTL FLAG ,I <sup>2</sup> C ERR, I <sup>2</sup> C BUSYN,	
	Oct Oldius (1 EG)	1	1	_	#	#	#	#	#	#	#	DATA_FLAG, PON, POF, BUSY_N	13н
31	Auto Measurement VCOM (AMV)	0	0	1	0	0	0	0	0	0	0		80н
		0	1	-		#	#	#	#	#	#	AMVT[1:0], XON,AMVS, AMV, AMVE	10н
32	Read VCOM Value (VV)	0	0	1	0	0	0	0	0	0	1		81н
		1	1	<u> </u>	#	#	#	#	#	#	#	VV[6:0]	00н
33	VCOM DC Setting (VDCS)	0	0	1	0	0	0	0	0	1	0		82н
		0	1	-	#	#	#	#	#	#	#	VDCS[6:0]	00н



#	Command	W/R	C/D	<b>D7</b>	D6	D5	D4	D3	D2	D1	D0	Registers	Default
		0	0	1	0	0	1	0	0	0	0		90н
		0	1	-	-		-	-	-	#	#	HRST[9:8]	00н
		0	1	#	#	#	#	#	0	0	0	HRST[7:3]	00н
		0	1						-	#	#	HRED[9:8]	03н
34	Partial Window (PTL)	0	1	#	#	#	#	#	1	1	1	HRED[7:3]	1FH
34	Faitiai Willdow (FTL)	0	1							#	#	VRST[9:0]	00н
		0	1	#	#	#	#	#	#	#	#	VICO [ [8:0]	00н
		0	1	-						#	#	VRED[8:0]	02н
		0	1	#	#	#	#	#	#	#	#	VICED[0.0]	57н
		0	1	-							#	PT_SCAN	01н
35	Partial In (PTIN)	0	0	1	0	0	1	0	0	0	1		91н
36	Partial Out (PTOUT)	0	0	1	0	0	1	0	0	1	0		<b>92</b> H
37	Program Mode (PGM)	0	0	1	0	1	0	0	0	0	0		<b>А0</b> н
38	Active Programming (APG)	0	0	1	0	1	0	0	0	0	1		А1н
		0	0	1	0	1	0	0	0	1	0		А2н
39	Read OTP (ROTP)	1	1	#	#	#	#	#	#	#	#	Data of Address = 000h	N/A
39	Read OTF (ROTF)	1	1	:	:	:	:	:	:	:	:	:	N/A
		1	1	#	#	#	#	#	#	#	#	Data of Address = n	N/A
40	Cascade Setting (CCSET)	0	0	1	1	1	0	0	0	0	0		Е0н
40	Cascade Setting (CCSET)	0	1							#	#	TSFIX, CCEN	00н
41	Dower Coving (DMC)	0	0	1	1	1	0	0	0	1	1		Е3н
41	Power Saving (PWS)	0	1	#	#	#	#	#	#	#	#	VCOM_W[3:0], SD_W[3:0]	00н
42	LVD Voltage Saleet (LVSEL)	0	0	1	1	1	0	0	1	0	0		Е4н
42	LVD Voltage Select (LVSEL)	0	1							#	#	LVD_SEL[1:0]	03н
43	Force Temporature (TSSET)	0	0	1	1	1	0	0	1	0	1		Е5н
43	Force Temperature (TSSET)	0	1	#	#	#	#	#	#	#	#	TS_SET[7:0]	00н
44	Temperature Boundary Phase-C2	0	0	1	1	1	0	0	1	1	1		Е7н
**	(TSBDRY)	0	1	#	#	#	#	#	#	#	#	TSBDRY_PHC2[7:0]	00н

Note: (1) All other register addresses are invalid or reserved by WF, and should NOT be used.

- (2) Any bits shown here as 0 must be written with a 0. All unused bits should also be set to zero. Device malfunction may occur if this is not done.
- (3) Commands are processed on the 'stop' condition of the interface.
- (4) Registers marked 'W/R' can be read, but the contents are written when the SPI command completes so the contents can be read and altered. The user can subsequently write the register to restore the contents following an SPI read.



#### **COMMAND DESCRIPTION**

W/R: 0: Write Cycle / 1: Read Cycle C/D: 0: Command / 1: Data D7-D0: -: Don't Care

#### (1) PANEL SETTING (PSR) (REGISTER: R00H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Setting the panel	0	0	0	0	0	0	0	0	0	0	00н
Setting the parter	0	1	-	-	REG	KW/R	UD	SHL	SHD_N	RST_N	0Гн

REG: LUT selection

0: LUT from OTP. (Default)

1: LUT from register.

KW/R: Black / White / Red

0: Pixel with Black/White/Red, KWR mode. (Default)

1: Pixel with Black/White, KW mode.

**UD:** Gate Scan Direction

0: Scan down. First line to Last line:  $Gn-1 \rightarrow Gn-2 \rightarrow Gn-3 \rightarrow ... \rightarrow G0$ 1: Scan up. (Default) First line to Last line:  $G0 \rightarrow G1 \rightarrow G2 \rightarrow ... \rightarrow Gn-1$ 

SHL: Source Shift Direction

0: Shift left. First data to Last data:  $Sn-1 \rightarrow Sn-2 \rightarrow Sn-3 \rightarrow ... \rightarrow S0$ 1: Shift right. (Default) First data to Last data:  $Sn-1 \rightarrow Sn-2 \rightarrow Sn-3 \rightarrow ... \rightarrow Sn-1$ 

SHD\_N: Booster Switch

0: Booster OFF

1: Booster ON (Default)

When SHD\_N becomes LOW, charge pump will be turned OFF, register and SRAM data will keep until VDD OFF. And Source/Gate/Border/VCOM will be released to floating.

RST\_N: Soft Reset

0: Reset. Booster OFF, Register data are set to their default values, all drivers will be reset, and all functions will be disabled. Source/Gate/Border/VCOM will be released to floating.

1: No effect (Default).



## (2) POWER SETTING (PWR) (R01H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0			
Selecting Internal/External	0	0	0	0	0	0	0	0	0	1	01н		
	0	1	-	-	-	BD_EN	-	VSR_EN	VS_EN	VG_EN	07н		
	0	1	VPP_EN	-	- VCOM - VG_LVL[2:0] 1								
Power	0	1	-				VDH_L	.VL[5:0]			ЗАн		
	0	1	-	-		VDL_LVL[5:0] 3.							
	0	1	-	-		VDHR_LVL[5:0]							

BD\_EN: Border LDO enable

0 : Border LDO disable (Default)

Border level selection: 00b: VCOM 10b: VDL 01b: VDH 11b: VDHR

1: Border LDO enable

10b:VBL(VCOM-VDH) Border level selection: 00b: VCOM 01b: VBH(VCOM-VDL) 11b: VDHR

VSR\_EN: Source LV power selection

0 : External source power from VDHR pins
1 : Internal DC/DC function for generating VDHR. (Default)

VS\_EN: Source power selection

0 : External source power from VDH/VDL pins
1 : Internal DC/DC function for generating VDH/VDL. (Default)

VG\_EN: Gate power selection

0 : External gate power from VGH/VGL pins

1 : Internal DC/DC function for generating VGH/VGL. (Default)

VPP\_EN: OTP program power selection

0 : External OTP program power from VPP pin

1: OTP program power from internal power circuit.

Internal OTP program power voltage is selected by VDHR\_LVL[5:0].

VCOM\_SLEW: VCOM slew rate selection for voltage transition

0: Slow slew rate

1: Fast slew rate

VG\_LVL[2:0]: VGH / VGL Voltage Level selection.

VG_LVL[2:0]	VGH/VGL Voltage Level
000	VGH=9V, VGL= -9V
001	VGH=10V, VGL= -10V
010	VGH=11V, VGL= -11V
011	VGH=12V, VGL= -12V
100	VGH=17V, VGL= -17V
101	VGH=18V, VGL= -18V
110	VGH=19V, VGL= -19V
111 (Default)	VGH=20V, VGL= -20V

VDH\_LVL[5:0]: Internal VDH power selection for KW pixel.(Default value: 111010b)

VDH_LVL	Voltage	VDH_LVL	Voltage	VDH_LVL	Voltage	VDH_LVL	Voltage
000000	2.4 V	010001	5.8 V	100010	9.2 V	110011	12.6 V
000001	2.6 V	010010	6.0 V	100011	9.4 V	110100	12.8 V
000010	2.8 V	010011	6.2 V	100100	9.6 V	110101	13.0 V
000011	3.0 V	010100	6.4 V	100101	9.8 V	110110	13.2 V
000100	3.2 V	010101	6.6 V	100110	10.0 V	110111	13.4 V
000101	3.4 V	010110	6.8 V	100111	10.2 V	111000	13.6 V
000110	3.6 V	010111	7.0 V	101000	10.4 V	111001	13.8 V
000111	3.8 V	011000	7.2 V	101001	10.6 V	111010	14.0 V
001000	4.0 V	011001	7.4 V	101010	10.8 V	111011	14.2 V
001001	4.2 V	011010	7.6 V	101011	11.0 V	111100	14.4 V
001010	4.4 V	011011	7.8 V	101100	11.2 V	111101	14.6 V
001011	4.6 V	011100	8.0 V	101101	11.4 V	111110	14.8 V
001100	4.8 V	011101	8.2 V	101110	11.6 V	111111	15.0 V
001101	5.0 V	011110	8.4 V	101111	11.8 V		
001110	5.2 V	011111	8.6 V	110000	12.0 V		
001111	5.4 V	100000	8.8 V	110001	12.2 V		
010000	5.6 V	100001	9.0 V	110010	12.4 V		

VDL\_LVL[5:0]: Internal VDL power selection for K/W pixel. (Default value: 111010b)

VDL LVL	Voltage						
000000	-2.4 V	010001	-5.8 V	100010	-9.2 V	110011	-12.6 V
000001	-2.6 V	010010	-6.0 V	100011	-9.4 V	110100	-12.8 V
000010	-2.8 V	010011	-6.2 V	100100	-9.6 V	110101	-13.0 V
000011	-3.0 V	010100	-6.4 V	100101	-9.8 V	110110	-13.2 V
000100	-3.2 V	010101	-6.6 V	100110	-10.0 V	110111	-13.4 V
000101	-3.4 V	010110	-6.8 V	100111	-10.2 V	111000	-13.6 V
000110	-3.6 V	010111	-7.0 V	101000	-10.4 V	111001	-13.8 V
000111	-3.8 V	011000	-7.2 V	101001	-10.6 V	111010	-14.0 V
001000	-4.0 V	011001	-7.4 V	101010	-10.8 V	111011	-14.2 V
001001	-4.2 V	011010	-7.6 V	101011	-11.0 V	111100	-14.4 V
001010	-4.4 V	011011	-7.8 V	101100	-11.2 V	111101	-14.6 V
001011	-4.6 V	011100	-8.0 V	101101	-11.4 V	111110	-14.8 V
001100	-4.8 V	011101	-8.2 V	101110	-11.6 V	111111	-15.0 V
001101	-5.0 V	011110	-8.4 V	101111	-11.8 V		
001110	-5.2 V	011111	-8.6 V	110000	-12.0 V		
001111	-5.4 V	100000	-8.8 V	110001	-12.2 V		
010000	-5.6 V	100001	-9.0 V	110010	-12.4 V		

VDHR\_LVL[5:0]: Internal VDHR power selection for Red pixel. (Default value: 000011b)

VDHR_LVL	Voltage	VDHR_LVL	Voltage	VDHR_LVL	Voltage	VDHR_LVL	Voltage
000000	2.4 V	010001	5.8 V	100010	9.2 V	110011	12.6 V
000001	2.6 V	010010	6.0 V	100011	9.4 V	110100	12.8 V
000010	2.8 V	010011	6.2 V	100100	9.6 V	110101	13.0 V
000011	3.0 V	010100	6.4 V	100101	9.8 V	110110	13.2 V
000100	3.2 V	010101	6.6 V	100110	10.0 V	110111	13.4 V
000101	3.4 V	010110	6.8 V	100111	10.2 V	111000	13.6 V
000110	3.6 V	010111	7.0 V	101000	10.4 V	111001	13.8 V
000111	3.8 V	011000	7.2 V	101001	10.6 V	111010	14.0 V
001000	4.0 V	011001	7.4 V	101010	10.8 V	111011	14.2 V
001001	4.2 V	011010	7.6 V	101011	11.0 V	111100	14.4 V
001010	4.4 V	011011	7.8 V	101100	11.2 V	111101	14.6 V
001011	4.6 V	011100	8.0 V	101101	11.4 V	111110	14.8 V
001100	4.8 V	011101	8.2 V	101110	11.6 V	111111	15.0 V
001101	5.0 V	011110	8.4 V	101111	11.8 V		
001110	5.2 V	011111	8.6 V	110000	12.0 V		
001111	5.4 V	100000	8.8 V	110001	12.2 V		
010000	5.6 V	100001	9.0 V	110010	12.4 V		



#### (3) Power OFF (POF) (R02H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Tuming OFF the power	0	0	0	0	0	0	0	0	1	0	02н

After the Power OFF command, the driver will be powered OFF. Refer to the POWER MANAGEMENT section for the sequence.

This command will turn off booster, controller, source driver, gate driver, VCOM, and temperature sensor, but register data will be kept until VDD turned OFF or Deep Sleep Mode. Source/Gate/Border/VCOM will be released to floating.

#### (4) Power OFF Sequence Setting (PFS) (R03H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Catting Dower OFF acquence	0	0	0	0	0	0	0	0	1	1	03⊦
Setting Power OFF sequence	0	1	-	-	T_VDS_	OFF[1:0]	-	-	-	-	00H

**T\_VDS\_OFF[1:0]:** Source to gate power off interval time.

**00b: 1 frame (Default)** 01b: 2 frames 10b: 3 frames 11b: 4 frame

#### (5) Power ON (PON) (REGISTER: R04H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Turning ON the power	0	0	0	0	0	0	0	1	0	0	04н

After the Power ON command, the driver will be powered ON. Refer to the POWER MANAGEMENT section for the sequence.

This command will turn on booster, controller, regulators, and temperature sensor will be activated for one-time sensing before enabling booster. When all voltages are ready, the BUSY N signal will return to high.

#### (6) POWER ON MEASURE (PMES) (R05H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Internal Bandgap Set	0	0	0	0	0	0	0	1	0	1	05н

This command enables the internal bandgap, which will be cleared by the next POF.

#### (7) BOOSTER SOFT START (BTST) (R06H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
	0	0	0	0	0	0	0	1	1	0	06н
	0	1	BT_Pl	HA[7:6]	В	T_PHA[5:	3]	В	T_PHA[2:0	0]	17н
Booster Software Start Set	0	1	BT_Pl			BT_PHB[5:3]			BT_PHB[2:0]		
	0	1	-	-	B <sup>-</sup>	Γ_PHC1[5:	:3]	BT_PHC1[2:0]			17н
	0	1	PHC2EN	-	В	Γ_PHC2[5:	:3]	В	T_PHC2[2:	:0]	17н

BT\_PHA[7:6]: Soft start period of phase A.

**00b: 10mS** 01b: 20mS 10b: 30mS 11b: 40mS

BT\_PHA[5:3]: Driving strength of phase A

000b: strength 1 001b: strength 2 **010b: strength 3** 011b: strength 4

100b: strength 5 101b: strength 6 110b: strength 7 111b: strength 8 (strongest)

BT\_PHA[2:0]: Minimum OFF time setting of GDR in phase A

 000b: 0.27uS
 001b: 0.34uS
 010b: 0.40uS
 011b: 0.54uS

 100b: 0.80uS
 101b: 1.54uS
 110b: 3.34uS
 111b: 6.58uS

BT\_PHB[7:6]: Soft start period of phase B.

**00b: 10mS** 01b: 20mS 10b: 30mS 11b: 40mS



BT\_PHB[5:3]: Driving strength of phase B

000b: strength 1 001b: strength 2 **010b: strength 3** 011b: strength 4

100b: strength 5 101b: strength 6 110b: strength 7 111b: strength 8 (strongest)

BT\_PHB[2:0]: Minimum OFF time setting of GDR in phase B

000b: 0.27uS 001b: 0.34uS 010b: 0.40uS 011b: 0.54uS 100b: 0.80uS 101b: 1.54uS 110b: 3.34uS **111b: 6.58uS** 

BT\_PHC1[5:3]: Driving strength of phase C1

000b: strength 1 001b: strength 2 **010b: strength 3** 011b: strength 4

100b: strength 5 101b: strength 6 110b: strength 7 111b: strength 8 (strongest)

BT\_PHC1[2:0]: Minimum OFF time setting of GDR in phase C1

 000b: 0.27uS
 001b: 0.34uS
 010b: 0.40uS
 011b: 0.54uS

 100b: 0.80uS
 101b: 1.54uS
 110b: 3.34uS
 111b: 6.58uS

PHC2EN: Booster phase-C2 enable

0: Booster phase-C2 disable

Phase-C1 setting always is applied for booster phase-C.

1: Booster phase-C2 enable

If temperature > temperature boundary phase-C2(RE7h[7:0]), phase-C1 setting is applied for booster phase-C. If temperature <= temperature boundary phase-C2(RE7h[7:0]), phase-C2 setting is applied for booster phase-C.

BT\_PHC2[5:3]: Driving strength of phase C2

000b: strength 1 001b: strength 2 **010b: strength 3** 011b: strength 4

100b: strength 5 101b: strength 6 110b: strength 7 111b: strength 8 (strongest)

BT\_PHC2[2:0]: Minimum OFF time setting of GDR in phase C2

 000b: 0.27uS
 001b: 0.34uS
 010b: 0.40uS
 011b: 0.54uS

 100b: 0.80uS
 101b: 1.54uS
 110b: 3.34uS
 111b: 6.58uS

#### (8) DEEP SLEEP (DSLP) (R07H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Doon Cloon	0	0	0	0	0	0	0	1	1	1	07н
Deep Sleep	0	1	1	0	1	0	0	1	0	1	А5н

After this command is transmitted, the chip will enter Deep Sleep Mode to save power. Deep Sleep Mode will return to Standby Mode by hardware reset. The only one parameter is a check code, the command will be executed if check code = 0xA5.

#### (9) DATA START TRANSMISSION 1 (DTM1) (R10H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
	0	0	0	0	0	1	0	0	0	0	10
Starting data transmission	0	1	Pixel1	Pixel2	Pixel3	Pixel4	Pixel5	Pixel6	Pixel7	Pixel8	]
Starting data transmission	0	1	:	:	:	:	:	:	:	:	]
	0	1	Pixel(n-7)	Pixel(n-6)	Pixel(n-5)	Pixel(n-4)	Pixel(n-3)	Pixel(n-2)	Pixel(n-1)	Pixel(n)	]

This command starts transmitting data and write them into SRAM.

In KW mode, this command writes "OLD" data to SRAM.

In KWR mode, this command writes "K/W" data to SRAM.

In Program mode, this command writes "OTP" data to SRAM for programming.



## (10) DATA STOP (DSP) (R11H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Stopping data transmission	0	0	0	0	0	1	0	0	0	1	11⊦
Stopping data transmission	1	1	data_flag		-	-	-	-	-	-	00H

Check the completeness of data. If data is complete, start to refresh display.

Data\_flag: Data flag of receiving user data.

0: Driver didn't receive all the data.

1: Driver has already received all the one-frame data (DTM1 and DTM2).

After "Data Start" (R10h) or "Data Stop" (R11h) commands and when data\_flag=1, the refreshing of panel starts and BUSY\_N signal will become "0".

#### (11) DISPLAY REFRESH (DRF) (R12H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Refreshing the display	0	0	0	0	0	1	0	0	1	0	12н

While user sent this command, driver will refresh display (data/VCOM) according to SRAM data and LUT.

After Display Refresh command, BUSY\_N signal will become "0" and the refreshing of panel starts.

#### (12) DATA START TRANSMISSION 2 (DTM2) (R13H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
	0	0	0	0	0	1	0	0	1	1	13н
Starting data transmission	0	1	Pixel1	Pixel2	Pixel3	Pixel4	Pixel5	Pixel6	Pixel7	Pixel8	]
	0	1	:	:	:	:	:	:	:	:	
	0	1	Pixel(n-7)	Pixel(n-6)	Pixel(n-5)	Pixel(n-4)	Pixel(n-3)	Pixel(n-2)	Pixel(n-1)	Pixel(n)	

This command starts transmitting data and write them into SRAM.

In KW mode, this command writes "NEW" data to SRAM.

In KWR mode, this command writes "RED" data to SRAM.

## (13) DUAL SPI MODE (DUSPI) (R15H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Stopping data transmission	0	0	0	0	0	1	0	1	0	1	15н
Stopping data transmission	0	1	-	-	MM_EN	DUSPI_EN	-	-	-	-	00н

This command sets dual SPI mode.

**MM\_EN:** MM input pin definition enable.

0: MM input pin definition disable1: MM input pin definition enable.

**DUSPI\_EN:** Dual SPI mode enable.

0: Dual SPI mode disable (single SPI mode)

1: Dual SPI mode enable



## (14) AUTO SEQUENCE (AUTO) (R17H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Auto Coguenco	0	0	0	0	0	1	0	1	1	1	17н
Auto Sequence	0	1	1	0	1	0	0	1	0	1	А5н

The command can enable the internal sequence to execute several commands continuously. The successive execution can minimize idle time to avoid unnecessary power consumption and reduce the complexity of host's control procedure. The sequence contains several operations, including PON, DRF, POF, DSLP.

AUTO  $(0x17) + Code(0xA5) = (PON \rightarrow DRF \rightarrow POF)$ 

AUTO  $(0x17) + Code(0xA7) = (PON \rightarrow DRF \rightarrow POF \rightarrow DSLP)$ 

## (15) LUT OPTION (LUTOPT) (R2AH)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
	0	0	0	0	1	0	1	0	1	0	2Ан
LUT Option	0	1	STATE_	XON[9:8]	-	-	-	-	-	-	00н
	0	1				STATE_	XON[7:0]				00н

This command sets XON control enable.

## STATE\_XON[9:0]:

All Gate ON (Each bit controls one state, STATE\_XON [0] for state-1, STATE\_XON [1] for state-2 .....)

00 0000 0000b: no All-Gate-ON

00 0000 0001b: State-1 All-Gate-ON

00 0000 0011b: State-1 and State2 All-Gate-ON

: :



## (16) KW LUT OPTION (KWOPT) (R2BH)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
	0	0	0	0	1	0	1	0	1	1	2Вн
KW LUT Option	0	1	-	-	-	-	-	-	ATRED	NORED	00н
KW LOT Option	0	1	KWE	[9:8]	-	-	-	-	-	-	00н
	0	1				KWE	[7:0]				00н

This command sets KW LUT mechanism option in KWR mode's LUT and only valid in K/W/R mode.

## {ATRED, NORED}: KW LUT or KWR LUT selection control

ATRED	NORED	Description
0	0	KWR LUT always
0	1	KW LUT only
1	0	Auto detect by red data
1	1	KW LUT only

## KWE[9:0]:

KW LUT enable control bits. Each bit controls one state, KWE[0] for state-1, KWE[1] for state-2, ....

At least 1 Enable Control bit should be set when KW LUT only is selected in KWR mode.

00 0000 0001b: KW LUT enable in State-1

00 0000 0011b: KW LUT enable in State-1 and State2

00 0000 1011b: KW LUT enable in State-1, State2 and State-4



## (17) PLL CONTROL (PLL) (R30H)


Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Controlling PLL	0	0	0	0	1	1	0	0	0	0	30н
Controlling PLL	0	1	-	-	-	-		FRS	[3:0]		06н

The command controls the PLL clock frequency. The PLL structure must support the following frame rates:

FMR[3:0]: Frame rate setting

FRS	Frame rate
0000	5Hz
0001	10Hz
0010	15Hz
0011	20Hz
0100	30Hz
0101	40Hz
0110	50Hz
0111	60Hz

FRS	Frame rate
1000	70Hz
1001	80Hz
1010	90Hz
1011	100Hz
1100	110Hz
1101	130Hz
1110	150Hz
1111	200Hz

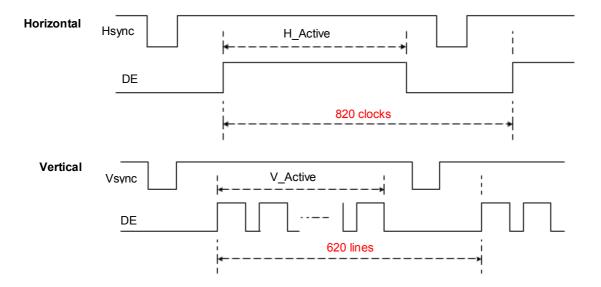



## (18) TEMPERATURE SENSOR CALIBRATION (TSC) (R40H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
	0	0	0	1	0	0	0	0	0	0	40⊦
Sensing Temperature	1	1	D10/TS7	D9/TS6	D8/TS5	D7/TS4	D6 / TS3	D5 / TS2	D4 / TS1	D3 / TS0	00H
	1	1	D2	D1	D0	-	-	-	-	-	00H

This command enables internal or external temperature sensor, and reads the result.

**TS[7:0]:** When TSE (R41h) is set to 0, this command reads internal temperature sensor value.

**D[10:0]:** When TSE (R41h) is set to 1, this command reads external LM75 temperature sensor value.

1:	when ISE (	(R41n) is set to
-	TS[7:0]/D[10:3]	Temp. (°C)
	1110_0111	-25
	1110_1000	-24
	1110_1001	-23
	1110_1010	-22
	1110_1011	-21
	1110_1100	-20
	1110_1101	-19
	1110_1110	-18
	1110_1111	-17
	1111_0000	-16
	1111_0001	-15
	1111_0010	-14
	1111_0011	-13
	1111_0100	-12
	1111_0101	-11
	1111_0110	-10
	1111_0111	-9
	1111_1000	-8
	1111_1001	-7
	1111_1010	-6
	1111_1011	-5
	1111_1100	-4 -3 -2
	1111_1101	-3
	1111_1110	-2
	1111_1111	-1

TS[7:0]/D[10:3] Tel 0000_0000 0000_0001 0000_0010	mp. (°C) 0 1
0000_0001	1
0000 0010	
	2
0000_0011	3
0000_0100	4
0000_0101	5
0000_0110	6
0000_0111	7
0000_1000	8
0000_1001	9
0000_1010	10
0000_1011	11
0000_1100	12
0000_1101	13
0000_1110	14
0000_1111	15
0001_0000	16
0001_0001	17
0001_0010	18
0001_0011	19
0001_0100	20
0001_0101	21
0001_0110	22
0001_0111	23
0001_1000	24

emperature sensor value.									
TS[7:0]/D[10:3]	Temp. (°C)								
0001_1001	25								
0001_1010	26								
0001_1011	27								
0001_1100	28								
0001_1101	29								
0001_1110	30								
0001_1111	31								
0010_0000	32								
0010_0001	33								
0010_0010	34								
0010_0011	35								
0010_0100	36								
0010_0101	37								
0010_0110	38								
0010_0111	39								
0010_1000	40								
0010_1001	41								
0010_1010	42								
0010_1011	43								
0010_1100	44								
0010_1101	45								
0010_1110	46								
0010_1111	47								
0011_0000	48								
0011_0001	49								

## (19) TEMPERATURE SENSOR ENABLE (TSE) (R41H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Enable Temperature Sensor	0	0	0	1	0	0	0	0	0	1	41
/Offset	0	1	TSE	-	-	-		TO	3:0]		00

This command selects Internal or External temperature sensor.

**TSE:** Internal temperature sensor switch

0: Enable (default)

1: Disable; using external sensor.

TO[3:0]: Temperature offset.

TO[3:0]	Calibration
0000 b	+0 (Default)
0001	+1
0010	+2
0011	+3
0100	+4
0101	+5
0110	+6
0111	+7

TO[3:0]	Calibration
1000	-8
1001	-7
1010	-6
1011	-5
1100	-4
1101	-3
1110	-2
1111	-1



#### (20) TEMPERATURE SENSOR WRITE (TSW)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
	0	0	0	1	0	0	0	0	1	0	42н
Write External Temperature	0	1				WATT	R[7:0]				00н
Sensor	0	1				WMS	B[7:0]				00н
	0	1				WLS	B[7:0]				00н

This command writes the temperature sensed by the temperature sensor.

WATTR[7:6]: I<sup>2</sup>C Write Byte Number

00b: 1 byte (head byte only)

01b: 2 bytes (head byte + pointer)

10b : 3 bytes (head byte + pointer + 1<sup>st</sup> parameter) 11b : 4 bytes (head byte + pointer + 1<sup>st</sup> parameter + 2<sup>nd</sup> parameter)

WATTR[5:3]: User-defined address bits (A2, A1, A0)

WATTR[2:0]: Pointer setting

WMSB[7:0]: MSByte of write-data to external temperature sensor

WLSB[7:0]: LSByte of write-data to external temperature sensor

#### (21) TEMPERATURE SENSOR READ (TSR) (R43H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Deed Feterral Terran control	0	0	0	1	0	0	0	0	1	1	43н
Read External Temperature Sensor	1	1				RMS	B[7:0]				00н
Sensor	1	1				RLS	3[7:0]				00н

This command reads the temperature sensed by the temperature sensor.

RMSB[7:0]: MSByte read data from external temperature sensor

RLSB[7:0]: LSByte read data from external temperature sensor

#### (22) PANEL GLASS CHECK (PBC)

											_
Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Check Panel Glass	0	0	0	1	0	0	0	1	0	0	44н
Check Fallel Glass	1	1	-	-	-	-	-	-	-	PSTA	00н

This command is used to enable panel check, and to disable after reading result.

PSTA: 0: Panel check fail (panel broken) 1: Panel check pass



## (23) VCOM AND DATA INTERVAL SETTING (CDI) (R50H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Set Interval between	0	0	0	1	0	1	0	0	0	0	50h
VCOM and Data	0	1	BDZ	-	BDV	[1:0]	N2OCP	-	DDX	[1:0]	31h
V COIVI AND DATA	0	1	-	-	-	-		CDI	[3:0]		07H

This command indicates the interval of VCOM and data output. When setting the vertical back porch, the total blanking will be kept (20 Hsync).

BDZ: Border Hi-Z control

0: Border output Hi-Z disabled (default)

1: Border output Hi-Z enabled

BDV[1:0]: Border LUT selection

KWR mode (KW/R=0)

DDX[0]	BDV[1:0]	LUT
	00	LUTBD
0	01	LUTR
U	10	LUTW
	11	LUTK
	00	LUTK
1	01	LUTW
(Default)	10	LUTR
	11	LUTBD

#### KW mode (KW/R=1)

DDX[0]	BDV[1:0]	LUT
0	00	LUTBD
	01	LUTKW (1 → 0)
U	10	LUTWK (0 → 1)
	11	LUTKK $(0 \rightarrow 0)$
	00	LUTKK (0 → 0)
1	01	LUTWK (1 → 0)
(Default)	10	LUTKW (0 → 1)
	11	LUTBD

**N2OCP:** Copy frame data from NEW data to OLD data enable control after display refresh with NEW/OLD in KW mode.

**0: Copy NEW data to OLD data disabled (default)** 1: Copy NEW data to OLD data enabled



## **DDX[1:0]:** Data polality.

Under KWR mode (KW/R=0):

DDX[1] is for RED data. DDX[0] is for K/W data,

DDX[1:0]	Data {Red, K/W}	LUT
	00	LUTW
00	01	LUTK
00	10	LUTR
	11	LUTR
	00	LUTK
01	01	LUTW
(Default)	10	LUTR
	11	LUTR

DDX[1:0]	Data {Red, KW}	LUT			
	00	LUTR			
10	01	LUTR			
10	10	LUTW			
	11	LUTK			
	00	LUTR			
11	01	LUTR			
11	10	LUTK			
	11	LUTW			

Under KW mode (KW/R=1):

DDX[1]=0 is for KW mode with NEW/OLD, DDX[1]=1 is for KW mode without NEW/OLD.


DDX[1:0]	Data {NEW, OLD}	LUT
	00	LUTWW $(0 \rightarrow 0)$
00	01	LUTKW $(1 \rightarrow 0)$
00	10	LUTWK $(0 \rightarrow 1)$
	11	LUTKK $(1 \rightarrow 1)$
	00	LUTKK $(0 \rightarrow 0)$
01	01	LUTWK (1 → 0)
(Default)	10	LUTKW (0 → 1)
	11	LUTWW (1 → 1)

DDX[1:0]	Data (NEW)	LUT
10	0	LUTKW (1 → 0)
10	1	LUTWK (0 → 1)
11	0	LUTWK (1 → 0)
	1	LUTKW (0 → 1)

## CDI[3:0]: VCOM and data interval

CDI[3:0]	VCOM and Data Interval
0000 b	17 hsync
0001	16
0010	15
0011	14
0100	13
0101	12
0110	11
0111	10 (Default)

CDI[3:0]	VCOM and Data Interval
1000	9
1001	8
1010	7
1011	6
1100	5
1101	4
1110	3
1111	2

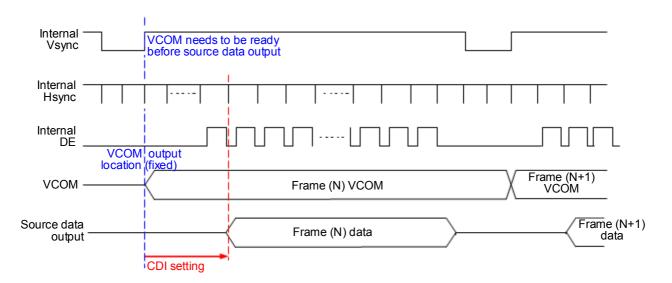



#### (24) Low Power Detection (LPD) (R51H)


Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Detect Low Power	0	0	0	1	0	1	0	0	0	1	51h
	1	1	-	-	-	-	-	-	-	LPD	01h

This command indicates the input power condition. Host can read this flag to learn the battery condition.

LPD: Internal Low Power Detection Flag

0: Low power input (VDD < 2.5V, 2.4V, 2.3V, or 2.2V, selected by  $LVD\_SEL[1:0]$  in command LVSEL)

1: Normal status (default)

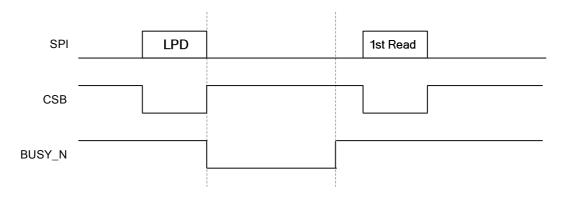

## (25) END VOLTAGE SETTING (EVS) (R52H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
End Voltage Cetting	0	0	0	1	0	1	0	0	1	0	52h
End Voltage Setting	0	1	-	-	-	-	VCEND	-	BDEN	ID[1:0]	02h

This command selects source end voltage and border end voltage after LUTs are finished.

VCEND: VCOM end voltage selection

**0b: VCOM\_DC** 1b: floating

BDEND[1:0]: Border end voltage selection

00b: 0V 01b: 0V **10b: VCOM\_DC** 11b: floating



## (26) TCON SETTING (TCON) (R60H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Set Gate/Source Non-overlap	0	0	0	1	1	0	0	0	0	0	60h
Period	0	1		S2G	[3:0]			G2S	[3:0]		22h


This command defines non-overlap period of Gate and Source.

S2G[3:0] or G2S[3:0]: Source to Gate / Gate to Source Non-overlap period

S2G[3:0] or G2S[3:0]	Period
0000 b	4
0001	8
0010	12 (Default)
0011	16
0100	20
0101	24
0110	28
0111	32

S2G[3:0] or G2S[3:0]	Period
1000 b	36
1001	40
1010	44
1011	48
1100	52
1101	56
1110	60
1111	64

Period Unit = 667 nS.

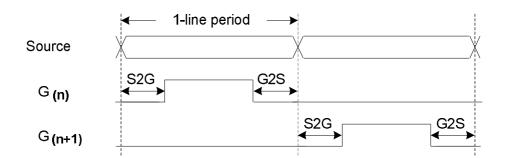



#### (27) RESOLUTION SETTING (TRES) (R61H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
	0	0	0	1	1	0	0	0	0	1	61h
	0	1	-	-	-	-	-	-	HRE	S[9:8]	03h
Set Display Resolution	0	1			HRES[7:3]			0	0	0	20h
	0	1	-	-	-	-	-	-	VRES	S[9:8]	02h
	0	1				VRE	S[7:0]				58h

This command defines resolution setting.

HRES[9:3]: Horizontal Display Resolution (Value range: 01h ~ 64h)VRES[9:0]: Vertical Display Resolution (Value range: 001h ~ 258h)

Active channel calculation, assuming HST[9:0]=0, VST[9:0]=0:

Gate: First active gate = G0;

Last active gate = VRES[9:0] - 1

Source: First active source = S0;

Last active source = HRES[9:3]\*8 - 1

Example: 128 (source) x 272 (gate), assuming HST[9:0]=0, VST[9:0]=0

Gate: First active gate = G0,

Last active gate = G271; (VRES[9:0] = 272, 272 - 1 = 271)

Source: First active source = S0,

Last active source = S127; (HRES[9:3]=16, 16\*8 - 1 = 127)

## (28) GATE/SOURCE START SETTING (GSST) (R65h)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
	0	0	0	1	1	0	0	1	0	1	65h
	0	1	-	-	-	-	-	-	HST	[9:8]	00h
Set Gate/Source Start	0	1			HST[7:3]			0	0	0	00h
	0	1	-	-	-	-	-	-	VST	[9:8]	00h
	0	1				VST	[7:0]				00h

This command defines resolution start gate/source position.

**HST[9:3]:** Horizontal Display Start Position (Source). (Value range: 00h ~ 63h)

**VST[9:0]:** Vertical Display Start Position (Gate). (Value range: 000h ~ 257h)

Example: For 128(Source) x 240(Gate)

HST[9:3] = 4 (HST[9:0] = 4\*8 = 32),

VST[9:0] = 32

Gate: First active gate = G32 (VST[9:0] = 32),

Last active gate = G271 (VRES[9:0] = 240, VST[9:0] = 32, 240-1+32=271)

Source: First active source = S32 (HST[9:0]= 32),

Last active source = \$239 (HRES[9:0] = 128, HST[9:0] = 32, 128-1+32=239)



## (29) REVISION (REV) (R70H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0		
	0	0	0	1	1	1	0	0	0	0	70h	
	1	1				PROD_R	EV[23:16]				FFh	
	1	1		PROD_REV[15:8] FF								
LUT/Chin Dovinion	1	1	PROD_REV[7:0]								FFh	
LUT/Chip Revision	1	1				LUT_RE	V[23:16]				FFh	
	1	1				LUT_RI	EV[15:8]				FFh	
	1	1				LUT_R	EV[7:0]				FFh	
	1	1				CHIP_F	REV[7:0]				0Ch	

The command reads the product revision, LUT revision and chip revision.

**PROD\_REV[23:0]:** Product Revision. PROD\_REV[23:0] is read from OTP address 0x0BDD ~ 0X0BDF or 0x17DD ~ 0x17DF.

**LUT\_REV[23:0]:** LUT Revision. LUT\_REV[23:0] is read from OTP address  $0x0BE0 \sim 0X0BE2$  or  $0x17E0 \sim 0x17E2$ .

CHIP\_REV[7:0]: Chip Revision, fixed at 00001100b.

## (30) GET STATUS (FLG) (R71H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
	0	0	0	1	1	1	0	0	0	1	71h
Read Flags	1	1	-	PTL_ Flag	I <sup>2</sup> C_ERR	I <sup>2</sup> C_ BUSYN	Data_ Flag	PON	POF	BUSY_N	13h

This command reads the IC status.

PTL\_Flag: Partial display status (high: partial mode)

**I<sup>2</sup>C\_ERR**: I<sup>2</sup>C master error status

I<sup>2</sup>C\_BUSYN: I<sup>2</sup>C master busy status (low active)

Data\_Flag: Driver has already received all the one frame data

**PON:** Power ON status **POF:** Power OFF status

**BUSY\_N:** Driver busy status (low active)



## (31) AUTO MEASURE VCOM (AMV) (R80H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Automatically measure VCOM	0	0	1	0	0	0	0	0	0	0	80h
Automatically measure VCOM	0	1	-	-	AMV	T[1:0]	XON	AMVS	AMV	AMVE	10h

This command triggers auto VCOM sensing mechanism.

AMVT[1:0]: Auto Measure VCOM Time

00b: 3s **01b: 5s (default)** 

10b: 8s 11b: 10s

**XON:** All Gate ON of AMV

0: Gate normally scan during Auto Measure VCOM period. (default)

1: All Gate ON during Auto Measure VCOM period.

AMVS: Source output of AMV

0: Source output 0V during Auto Measure VCOM period. (default)

1: Source output VDHR during Auto Measure VCOM period.

AMV: Analog signal

0: Get VCOM value with the VV command (R81h) (default)

1: Get VCOM value in analog signal. (External analog to digital converter)

AMVE: Auto Measure VCOM Enable (/Disable)

0: No effect (default)

1: Trigger auto VCOM sensing.



# (32) VCOM VALUE (VV) (R81H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Automatically measure VCOM	0	0	1	0	0	0	0	0	0	1	81h
Automatically measure VCOM	1	1	-				VV[6:0]				00h

This command gets the VCOM value.

## **VV[6:0]:** VCOM Value Output

VV [6:0]	VCOM Voltage (V)	VV [6:0]	VCOM Voltage (V)	VV [6:0]	VCOM Voltage (V)
000 0000b	-0.10	001 1011b	-1.45	011 0110b	-2.80
000 0001b	-0.15	001 1100b	-1.50	011 0111b	-2.85
000 0010b	-0.20	001 1101b	-1.55	011 1000b	-2.90
000 0011b	-0.25	001 1110b	-1.60	011 1001b	-2.95
000 0100b	-0.30	001 1111b	-1.65	011 1010b	-3.00
000 0101b	-0.35	010 0000b	-1.70	011 1011b	-3.05
000 0110b	-0.40	010 0001b	-1.75	011 1100b	-3.10
000 0111b	-0.45	010 0010b	-1.80	011 1101b	-3.15
000 1000b	-0.50	010 0011b	-1.85	011 1110b	-3.20
000 1001b	-0.55	010 0100b	-1.90	011 1111b	-3.25
000 1010b	-0.60	010 0101b	-1.95	100 0000b	-3.30
000 1011b	-0.65	010 0110b	-2.00	100 0001b	-3.35
000 1100b	-0.70	010 0111b	-2.05	100 0010b	-3.40
000 1101b	-0.75	010 1000b	-2.10	100 0011b	-3.45
000 1110b	-0.80	010 1001b	-2.15	100 0100b	-3.50
000 1111b	-0.85	010 1010b	-2.20	100 0101b	-3.55
001 0000b	-0.90	010 1011b	-2.25	100 0110b	-3.60
001 0001b	-0.95	010 1100b	-2.30	100 0111b	-3.65
001 0010b	-1.00	010 1101b	-2.35	100 1000b	-3.70
001 0011b	-1.05	010 1110b	-2.40	100 1001b	-3.75
001 0100b	-1.10	010 1111b	-2.45	100 1010b	-3.80
001 0101b	-1.15	011 0000b	-2.50	100 1011b	-3.85
001 0110b	-1.20	011 0001b	-2.55	100 1100b	-3.90
001 0111b	-1.25	011 0010b	-2.60	100 1101b	-3.95
001 1000b	-1.30	011 0011b	-2.65	100 1110b	-4.00
001 1001b	-1.35	011 0100b	-2.70	100 1111b	-4.05
001 1010b	-1.40	011 0101b	-2.75		



# (33) VCOM\_DC SETTING (VDCS) (R82H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Set VCOM DC	0	0	1	0	0	0	0	0	1	0	82h
Set vCOM_DC	0	1	-				VDCS[6:0]				00h

This command sets VCOM\_DC value

VDCS[6:0]: VCOM\_DC Setting

VDCS [6:0]	VCOM Voltage (V)	VDCS [6:0]	VCOM Voltage (V)	VDCS [6:0]	VCOM Voltage (V)
000 0000b	-0.10	001 1011b	-1.45	011 0110b	-2.80
000 0001b	-0.15	001 1100b	-1.50	011 0111b	-2.85
000 0010b	-0.20	001 1101b	-1.55	011 1000b	-2.90
000 0011b	-0.25	001 1110b	-1.60	011 1001b	-2.95
000 0100b	-0.30	001 1111b	-1.65	011 1010b	-3.00
000 0101b	-0.35	010 0000b	-1.70	011 1011b	-3.05
000 0110b	-0.40	010 0001b	-1.75	011 1100b	-3.10
000 0111b	-0.45	010 0010b	-1.80	011 1101b	-3.15
000 1000b	-0.50	010 0011b	-1.85	011 1110b	-3.20
000 1001b	-0.55	010 0100b	-1.90	011 1111b	-3.25
000 1010b	-0.60	010 0101b	-1.95	100 0000b	-3.30
000 1011b	-0.65	010 0110b	-2.00	100 0001b	-3.35
000 1100b	-0.70	010 0111b	-2.05	100 0010b	-3.40
000 1101b	-0.75	010 1000b	-2.10	100 0011b	-3.45
000 1110b	-0.80	010 1001b	-2.15	100 0100b	-3.50
000 1111b	-0.85	010 1010b	-2.20	100 0101b	-3.55
001 0000b	-0.90	010 1011b	-2.25	100 0110b	-3.60
001 0001b	-0.95	010 1100b	-2.30	100 0111b	-3.65
001 0010b	-1.00	010 1101b	-2.35	100 1000b	-3.70
001 0011b	-1.05	010 1110b	-2.40	100 1001b	-3.75
001 0100b	-1.10	010 1111b	-2.45	100 1010b	-3.80
001 0101b	-1.15	011 0000b	-2.50	100 1011b	-3.85
001 0110b	-1.20	011 0001b	-2.55	100 1100b	-3.90
001 0111b	-1.25	011 0010b	-2.60	100 1101b	-3.95
001 1000b	-1.30	011 0011b	-2.65	100 1110b	-4.00
001 1001b	-1.35	011 0100b	-2.70	100 1111b	-4.05
001 1010b	-1.40	011 0101b	-2.75		



## (34) PARTIAL WINDOW (PTL) (R90H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
	0	0	1	0	0	1	0	0	0	0	90h
	0	1	-	-	-	-	-	-	HRS	T[9:8]	00h
	0	1			HRST[7:3]			0	0	0	00h
	0	1	-	-	-	-	-	-	HRE	D[9:8]	03h
Set Partial Window	0	1			HRED[7:3]			1	1	1	1Fh
Set Partial Willdow	0	1	-	-	-	-	-	-	VRS	T[9:8]	00h
	0	1				VRS	T[7:0]				00h
	0	1	-	-	-	-	-	-	VREI	D[9:8]	02h
	0	1				VRE	D[7:0]	•		•	57h
	0	1	-	-	-	-	-	-	-	PT_SCAN	01h

This command sets partial window.

HRST[9:3]: Horizontal start channel bank. (Value range: 00h~63h)

HRED[9:3]: Horizontal end channel bank. (Value range: 00h~63h). HRED must be greater than HRST.

VRST[9:0]: Vertical start line. (Value range: 000h~257h)

VRED[9:0]: Vertical end line. (Value range: 000h~257h). VRED must be greater than VRST.

PT\_SCAN: 0: Gates scan only inside of the partial window.

1: Gates scan both inside and outside of the partial window. (default)

## (35) PARTIAL IN (PTIN) (R91H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Partial In	0	0	1	0	0	1	0	0	0	1	91h

This command makes the display enter partial mode.

### (36) PARTIAL OUT (PTOUT) (R92H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Partial Out	0	0	1	0	0	1	0	0	1	0	92h

This command makes the display exit partial mode and enter normal mode.

## (37) PROGRAM MODE (PGM) (RA0H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Enter Program Mode	0	0	1	0	1	0	0	0	0	0	A0h

After this command is issued, the chip would enter the program mode.

After the programming procedure completed, a hardware reset is necessary for leaving program mode.

## (38) ACTIVE PROGRAM (APG) (RA1H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Active Program OTP	0	0	1	0	1	0	0	0	0	1	A1h

After this command is transmitted, the programming state machine would be activated.

The BUSY\_N flag would fall to 0 until the programming is completed.




## (39) READ OTP DATA (ROTP) (RA2H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
	0	0	1	0	1	0	0	0	1	0	A2h
	1	1			The data	of addres	s 0x000 in	the OTP			
Read OTP data for check	1	1			The data	of addres	s 0x001 in	the OTP			
Read OTP data for check	1	1					:				
	1	1			The dat	a of addre	ss (n-1) in	the OTP			
	1	1			The da	ita of addre	ess (n) in tl	ne OTP			

The command is used for reading the content of OTP for checking the data of programming.

The value of (n) is depending on the amount of programmed data, the max address = 0x17FF.

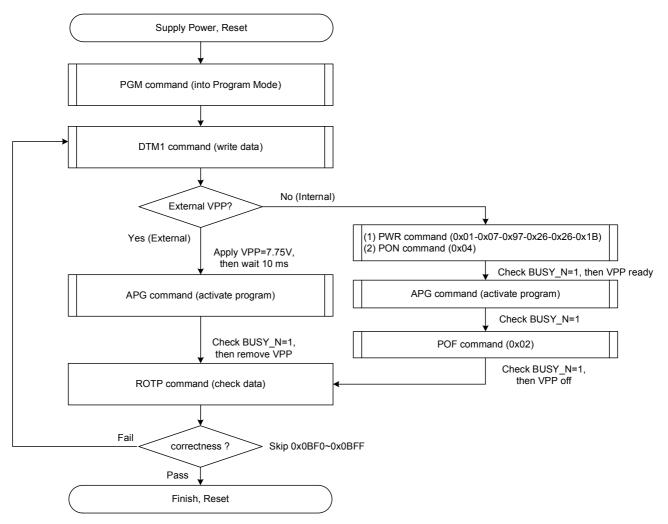

The sequence of programming OTP.



## (40) CASCADE SETTING (CCSET) (RE0H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Set Cascade Option	0	0	1	1	1	0	0	0	0	0	E0h
Set Cascade Option	0	1	-	-	-	-	-	-	TSFIX	CCEN	00h

This command is used for cascade.

**TSFIX:** Let the value of slave's temperature is same as the master's.

0: Temperature value is defined by internal temperature sensor / external LM75. (default)

1: Temperature value is defined by TS\_SET[7:0] registers.

CCEN: Output clock enable/disable.

0: Output 0V at CL pin. (default)


1: Output clock at CL pin to slave chip.

#### (41) POWER SAVING (PWS) (RE3H)


Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Power Saving for VCOM &	0	0	1	1	1	0	0	0	1	1	E3h
Source	0	1	VCOM_W[3:0]					SD_V	V[3:0]		00h

This command is set for saving power during refreshing period. If the output voltage of VCOM / Source is from negative to positive or from positive to negative, the power saving mechanism will be activated. The active period width is defined by the following two parameters.

**VCOM\_W[3:0]:** VCOM power saving width (Unit: line period)

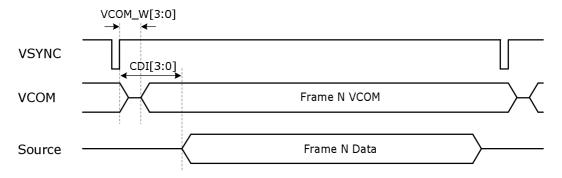

## **SD\_W[3:0]:** Source power saving width (Unit: 660nS)

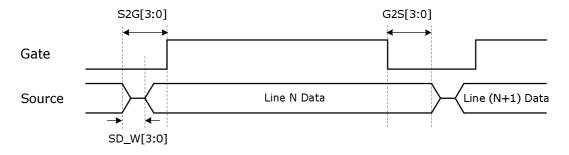



## (42) LVD VOLTAGE SELECT (LVSEL) (RE4H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Select LVD Voltage	0	0	1	1	1	0	0	1	0	0	E4h
	0	1	-	-	-	•	-	-	LVD_S	EL[1:0]	03h

LVD\_SEL[1:0]: Low Power Voltage selection

LVD_SEL[1:0]	LVD value
00	< 2.2 V
01	< 2.3 V
10	< 2.4 V
11	< 2.5 V (default)

## (43) FORCE TEMPERATURE (TSSET) (RE5H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Force Temperature Value for	0	0	1	1	1	0	0	1	0	1	E5h
Cascade	0	1				TS_SE	ET[7:0]				00h

This command is used for cascade to fix the temperature value of master and slave chip.

## (44) TEMPERATURE BOUNDARY PHASE-C2 (TSBDRY) (RE7H)

Action	W/R	C/D	D7	D6	D5	D4	D3	D2	D1	D0	
Temperature Boundary Phase-	0	0	1	1	1	0	0	1	1	1	E7h
C2	0	1		TSBDRY PHC2[7:0]							00h

This command is used to set the temperature boundary to judge whether booster phase-C2 is applied or not.



## **HOST INTERFACES**

IL0326 provides 3-wire/4-wire serial interface for command and display data transferred from the MCU. The serial interface supports 8-bit mode. Data can be input/output by clocks while the chip is active (CSB =LOW). While input, data are written in order from MSB at the clock rising edge. When too many parameters are input, the chip accepts only defined parameters, and ignores undefined ones.

BS	Interface	CSB	DC	SCL	SDA
High	3-wire SPI	Available	Fix to GND	Available	Available
Low	4-wire SPI	Available	Available	Available	Available

#### 3 wire SPI format

Data / Command is recognized with the first bit transferred. Data are transferred in the unit of 9 bits. To prevent malfunction due to noise, it is recommended to set the CSB signal to HIGH every 9 bits. (The serial counter is reset at the rising edge of the CSB signal.)

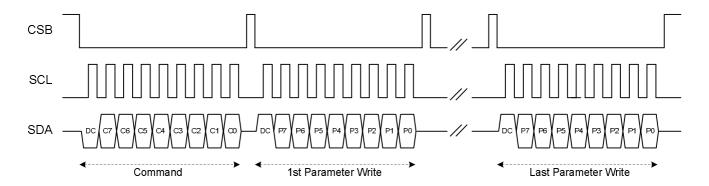


Figure: 3-wire SPI write operation

The MSB bit of data will be output at SDA pin after the 1<sup>st</sup> SCL falling edge, if the 1<sup>st</sup> input data at SDA is high.

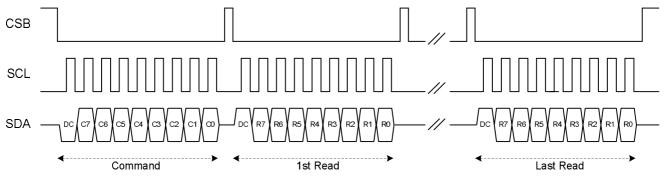


Figure: 3-wire SPI read operation

#### 4 wire SPI format

Data / Command is recognized with DC pin. Data are transferred in the unit of 8 bits. To prevent malfunction due to noise, it is recommended to set the CSB signal to HIGH every 8 bits. (The serial counter is reset at the rising edge of the CSB signal.)

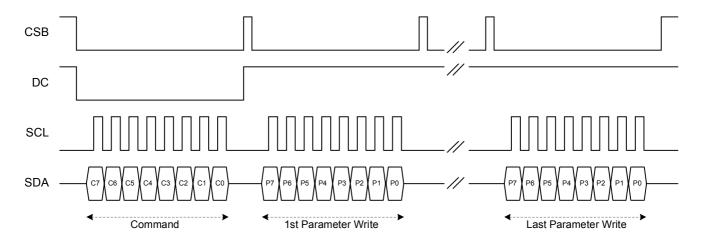


Figure: 4-wire SPI write operation

The MSB bit of data will be output at SDA pin after the CSB falling edge, if DC pin is High.

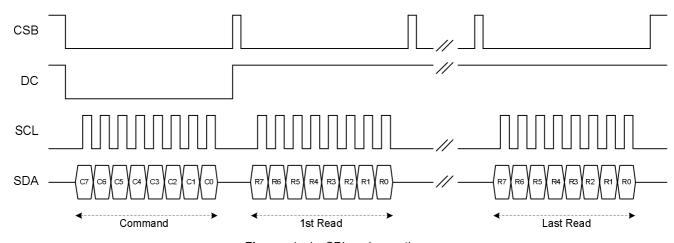


Figure: 4-wire SPI read operation

#### 3 wire dual SPI format

Data / Command is recognized with the first bit transferred at SDA. Data are transferred in the unit of 5 SPI clocks. To prevent malfunction due to noise, it is recommended to set the CSB signal to HIGH every 5 SPI clocks. (The serial counter is reset at the rising edge of the CSB signal.) In 3-wire dual SPI mode, SDA and SDA1 are only input mode for data write transmission.

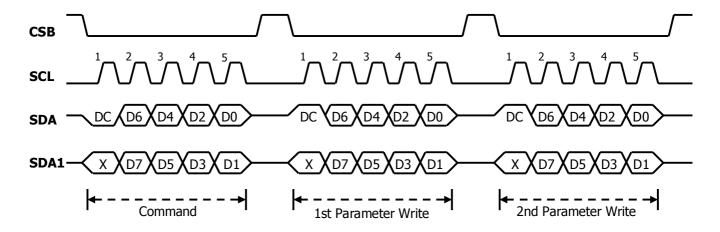


Figure: 3-wire dual SPI write operation

#### 4 wire dual SPI format

Data / Command is recognized with DC pin. Data are transferred in the unit of 4 SPI clocks. To prevent malfunction due to noise, it is recommended to set the CSB signal to HIGH every 4 SPI clocks. (The serial counter is reset at the rising edge of the CSB signal.) In 4-wire dual SPI mode, SDA and SDA1 are only input mode for data write transmission.

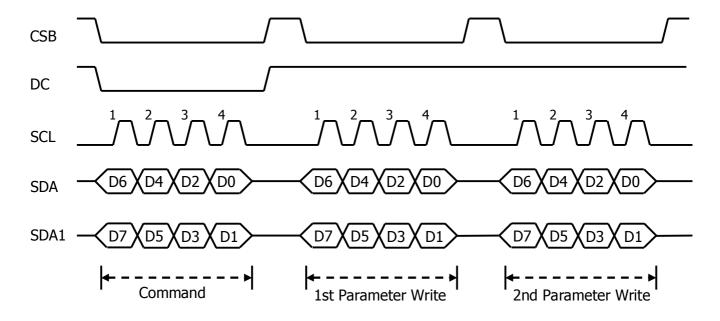



Figure: 4-wire dual SPI write operation



#### **POWER MANAGEMENT**

### **Power ON/OFF Sequence**

- 1. Temperature sensor will be activated automatically for one-time sensing before enabling booster.
- 2. After refreshing display, VCOM will be set to floating automatically.
- 3. After RST\_N rising, the waiting time for internal initial processing, greater than 1mS, is necessary. Any commands transmitted to chip during this time will be ignored.

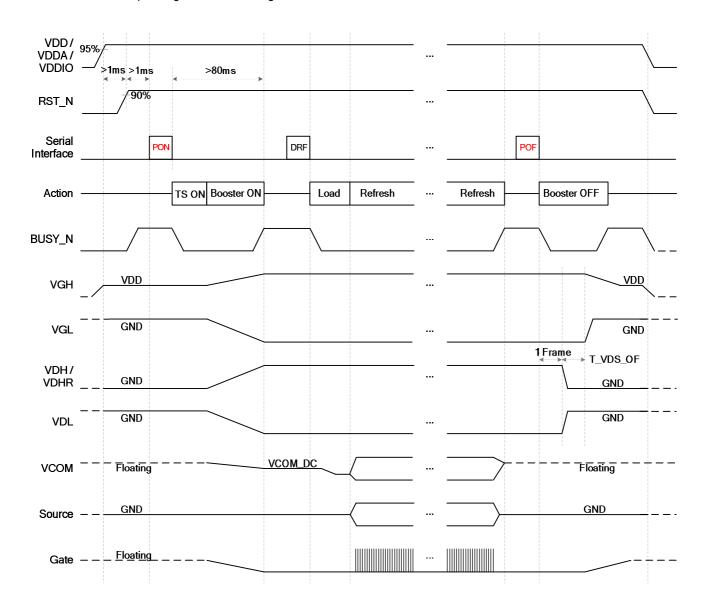




### **Data Transmission Waveform**


Example 1: After 3 cases, the VCOM driver will send 2 frame VCOM\_DC and then floating; and source drivers output 0V.

- 1. All 7 LUT states (KW mode) or 10 LUT states (KWR mode) complete and VCEND=0.
- 2. Meet the state whose Times to Repeat =0 and VCEND=0
- 3. Meet the state whose all Number of Frames =0 and VCEND=0

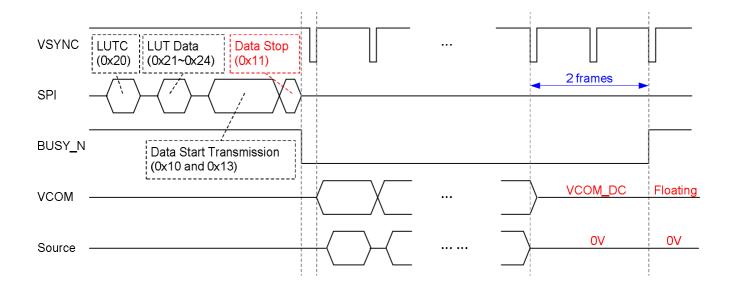

**Example2:** After 4 cases, the VCOM driver will send 2 frame VCOM\_DC and then floating; and source drivers output 0V.

- 1. While level selection in LUT (LUTC only) is "1111\_1111b", all frame number are not '0' and repeat times are not '0', the driver will float VCOM.
- 2. All 7 LUT states (KW mode) or 10 LUT states (KWR mode) complete and VCEND=1.
- 3. Meet the state whose Times to Repeat =0 and VCEND=1.
- 4. Meet the state whose all Number of Frames =0 and VCEND=1.

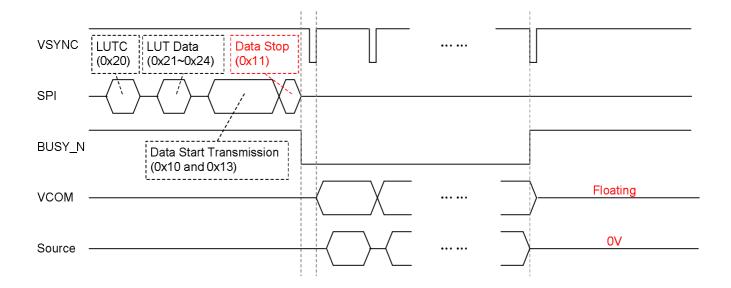




### **Display Refresh Waveform**


Example 1: After 3 cases, the VCOM driver will send 2 frame VCOM\_DC and then floating; and source drivers output 0V.

- 1. All 7 LUT states (KW mode) or 10 LUT states (KWR mode) complete and VCEND=0.
- 2. Meet the state whose Times to Repeat =0 and VCEND=0
- 3. Meet the state whose all Number of Frames =0 and VCEND=0

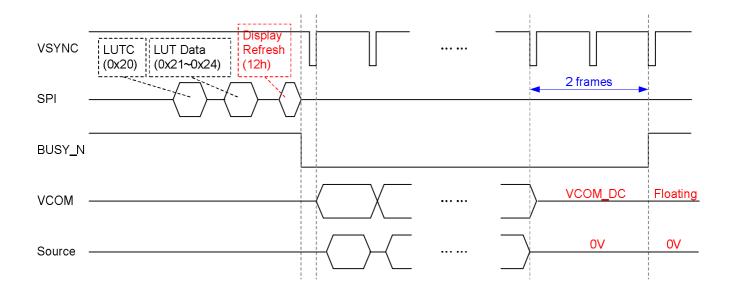

**Example2:** After 4 cases, the VCOM driver will send 2 frame VCOM\_DC and then floating; and source drivers output 0V.

- 1. While level selection in LUT (LUTC only) is "1111\_1111b", all frame number are not '0' and repeat times are not '0', the driver will float VCOM.
- 2. All 7 LUT states (KW mode) or 10 LUT states (KWR mode) complete and VCEND=1.
- 3. Meet the state whose Times to Repeat =0 and VCEND=1.
- 4. Meet the state whose all Number of Frames =0 and VCEND=1.

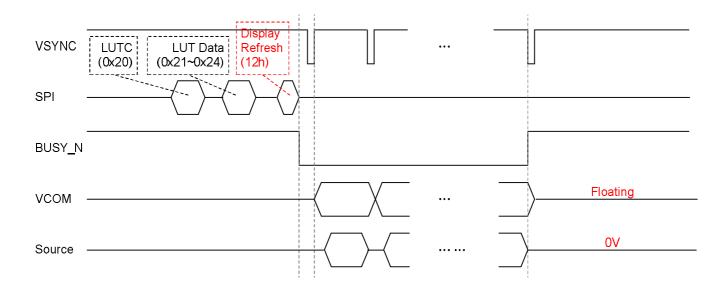



# **BUSY N Signal**

Commands, except reading command, are restricted by refreshing display (DRF / DSP) as listed in the following table.

BUSY\_N is used to represent the status of internal action. Commands activating internal operation or calculation will cause BUSY\_N falling to LOW. After actions completed, BUSY\_N will return to HIGH.

Command	Refresh Restriction	BUSY_N flag
PSR	X	No action
PWR	X	No action
POF	X	Flag
PFS	X	No action
PON	X	Flag
PMES	X	Flag
BTST	X	No action
DSLP	X	Flag
AUTO	X	Flag
DTM1	X	No action
DSP	X	Flag
DRF	X	Flag
DTM2	X	No action
DUSPI EN	X	No action
LUTC	X	No action
LUTWW	X	No action
LUTWB/LUTW	X	No action
LUTBW/LUTR	X	No action
LUTBB/LUTB	X	No action
LUTOPT	X	No action
KWOPT	X	No action
PLL	X	No action
TSC	X	Flag
TSE	X	No action
TSW	X	No action
TSR	X	No action
PBC	X	No action
CDI	X	No action
LPD	X	Flag
EVS	X	No action
TCON	X	No action
TRES	X	No action
GSST	X	No action
REV	V	No action
FLG	V	No action
AMV	X	Flag
VV	V	No action
VDCS	X	No action
PTL	X	No action
PTIN	X	No action
PTOUT	X	No action
PGM	X	No action
APG	X	Flag
ROTP	X	No action
CCSET	X	No action
PWS	X	No action
LVSEL	X	No action
TSSET	X	No action
TSBDRY	X	No action

V: Accepted, X: Ignored



#### **OTP ADDRESS MAPPING**

The size of the internal One Time Programmable (OTP) memory is 6K bytes, and the address is from 0x000 to 0x17FF. The unprogrammed bit is logic 1. Only the bit at logic 1 can be programmed to logic 0, but the bit at logic 0 can't be changed to logic 1.

There is one area (0x0BF0~0x0BFF) reserved for WF only. Write all 0xFF of data to skip the area. The recommended voltage of VPP during programming is 7.75V. In conditions other than programming, let VPP float or be connected to GND. The maximum current of VPP during programming is 5mA.

There are 2 banks in the internal OTP, and each bank has 3K bytes storage memory. The formats of each bank are the same, and the selection of bank is controlled by Check Code (0x0000 and 0x0C00). The 2 banks are used for two times programming.

Bank0 Bank1 Address Content Address Content 0x0000 Check Code (0xA5) 0x0C00 Check Code (0xA5) 0x0001 Temperature Boundary 0 (TB0) 0x0C01 Temperature Boundary 0 (TB0) 0x0002 Temperature Boundary 1 (TB1) 0x0C02 Temperature Boundary 1 (TB1) 0x0003 Temperature Boundary 2 (TB2) 0x0C03 Temperature Boundary 2 (TB2) 0x0004 0x0C04 Temperature Boundary 3 (TB3) Temperature Boundary 3 (TB3) Temperature Boundary 4 (TB4) 0x0005 0x0C05 Temperature Boundary 4 (TB4) 0x0006 0x0C06 Temperature Boundary 5 (TB5) Temperature Boundary 5 (TB5) 0x0007 0x0C07 Temperature Boundary 6 (TB6) Temperature Boundary 6 (TB6) 0x0008 Temperature Boundary 7 (TB7) 0x0C08 Temperature Boundary 7 (TB7) 0x0009 Temperature Boundary 8 (TB8) 0x0C09 Temperature Boundary 8 (TB8) Temperature Boundary 9 (TB9) 0x000A 0x0C0A Temperature Boundary 9 (TB9) 0x000B Temperature Boundary 10 (TB10) 0x0C0B Temperature Boundary 10 (TB10) 0x000C~0x001E Command Defatult Setting (Note 1) 0x0C0C~0x0C1E Command Defatult Setting (Note 1) 0x001F~0x0048 0x0C1F~0x0C48 Border LUT Border LUT 0x0049~0x013F TR0 (Note 2) 0x0C49~0x0D3F TR0 (Note 2) 0x0140~0x0236 TR1 (Note 2) 0x0D40~0x0E36 TR1 (Note 2) 0x0237~0x032D TR2 (Note 2) 0x0E37~0x0F2D TR2 (Note 2) 0x032E~0x0424 TR3 (Note 2) 0x0F2E~0x1024 TR3 (Note 2) 0x0425~0x051B TR4 (Note 2) 0x1025~0x111B TR4 (Note 2) 0x051C~0x0612 TR5 (Note 2) 0x111C~0x1212 TR5 (Note 2) 0x0613~0x0709 TR6 (Note 2) 0x1213~0x1309 TR6 (Note 2) 0x070A~0x0800 TR7 (Note 2) 0x130A~0x1400 TR7 (Note 2) 0x0801~0x08F7 TR8 (Note 2) 0x1401~0x14F7 TR8 (Note 2) 0x08F8~0x09EE TR9 (Note 2) 0x14F8~0x15EE TR9 (Note 2) 0x09EF~0x0AE5 TR10 (Note 2) 0x15EF~0x16E5 TR10 (Note 2) 0x0AE6~0x0BDC TR11 (Note 2) 0x16E6~0x17DC TR11 (Note 2) 0x0BDD~0x0BDF Production Version[23:0] 0x17DD~0x17DF Production Version[23:0] 0x0BE0~0x0BE2 LUT Version[23:0] 0x17E0~0x17E2 LUT Version[23:0] Blank (Note 3) 0x17E3~0x17FF 0x0BE3~0x0BEF Blank (Note 3) 0x0BF0~0x0BFF Reserved (Note 3)

Table 1: OTP Address Map

### Note:

- (1) See section "COMMAND DEFAULT SETTING" for more detail.
- (2) See section "LUT FORMAT IN OTP" for more detail.
- (3) "Blank" is available for user and "Reserved" is for Good Display definition.



### **TEMPERATURE RANGE**

The temperature selection mechanism consists of a less-than-or-equal-to operator and 11 temperature boundary settings (TBx) to determine 12 temperature ranges. The sequence of mechanism is from TB0 to TB10, as shown below. If less than 12 tempeature ranges are used, the last TBx must be set to 0x7F to end the mechanism.

Procedure Order	Comparison Condition	Action & Segment Selection
1-0. Read 0x0000	Content = 0xA5 ?	Yes: Jump to Procedure 2 (Bank0), No: Jump to Procedure 1-1
1-1. Read 0x0C00	Content = 0xA5 ?	Yes: Jump to Procedure 2 (Bank1), No: Stop Refresh
2. Read 0x0001 / 0x0C01	Real Temperature ≦ TB0	Use TR0's table & setting, exit
3. Read 0x0002 / 0x0C02	Real Temperature ≤ TB1	Use TR1's table & setting, exit
4. Read 0x0003 / 0x0C03	Real Temperature ≤ TB2	Use TR2's table & setting, exit
5. Read 0x0004 / 0x0C04	Real Temperature ≤ TB3	Use TR3's table & setting, exit
6. Read 0x0005 / 0x0C05	Real Temperature ≤ TB4	Use TR4's table & setting, exit
7. Read 0x0006 / 0x0C06	Real Temperature ≤ TB5	Use TR5's table & setting, exit
8. Read 0x0007 / 0x0C07	Real Temperature ≤ TB6	Use TR6's table & setting, exit
9. Read 0x0008 / 0x0C08	Real Temperature ≤ TB7	Use TR7's table & setting, exit
10. Read 0x0009 / 0x0C09	Real Temperature ≤ TB8	Use TR8's table & setting, exit
11. Read 0x000A / 0x0C0A	Real Temperature ≤ TB9	Use TR9's table & setting, exit
12. Read 0x000B / 0x0C0B	Real Temperature ≤ TB10	Use TR10's table & setting, exit
13. Other	Real Temperature > TB10	Use TR11's table & setting, finish

Note: TRx's content is defined in "LUT FORMAT IN OTP" section.

# Example:

If temperature = -20 °C, TR0 is selected.

If temperature = -10 °C, TR1 is selected.


If temperature = 0 °C, TR2 is selected.

If temperature = 20 °C, TR4 is selected.

If temperature = 40 °C, TR5 is selected.

If temperature > 40  $^{\circ}$ C, TR5 is selected.

OTP Address	Content	
002h	0xF1	(-15 °C)
003h	0xFB	(-5 °C)
004h	0x00	( 0 °C)
005h	0x0A	( 10 °C)
006h	0x1E	(30 °C)
007h	0x7F	-

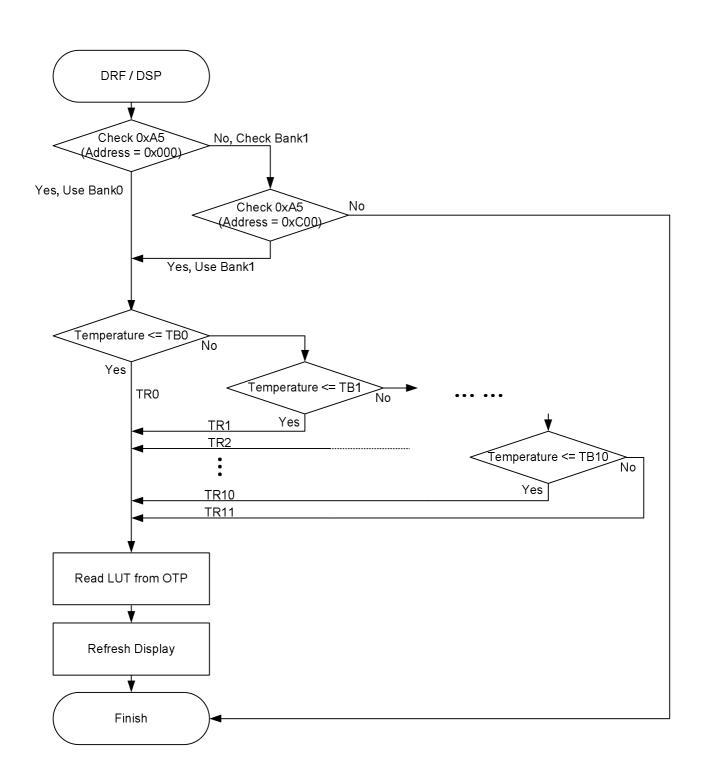

Temperature Selection Mechanism



### **COMMAND DEFAULT SETTING**

This function can modify the default value of command registers by the OTP content between address 0x000C~0x001E (or 0x0C0C~0x0C1E). The data of address 0x000C (or 0x0C0C) is the enable key of the function. Changing default value function is used to reduce the initial code length executed by the microcontroller.

Address (Hex)	<b>D7</b>	D6	D5	D4	D3	D2	D1	D0	Command	Registers	Original
0x000C	#	#	#	#	#	#	#	#	Check Code	0xA5 (Enable Key)	
0x000D			#	#	#	#			PSR	REG, KW/R, UD, SHL	0x0F
0x000E	#	#	#	#	#	#	#	#		BT_PHA[7:0]	0x17
0x000F	#	#	#	#	#	#	#	#	BTST	BT_PHB[7:0]	0x17
0x0010			#	#	#	#	#	#	візі	BT_PHC1[5:0]	0x17
0x0011	#		#	#	#	#	#	#		PHC2EN, BT_PHC2[5:0]	0x17
0x0012				-	-		#	#	KWOPT	ATRED, NORED	0x00
0x0013	#		#	#	#		#	#	CDI	BDZ, BDV[1:0], N2OCP, DDX[1:0]	0x31
0x0014				-	#	#	#	#	CDI	CDI[3:0]	0x07
0x0015	#	#	#	#	#	#	#	#	TCON	S2G[3:0], G2S[3:0]	0x22
0x0016		#	#	#	#	#	#	#		HRES[9:3]	0x64
0x0017				-	-		#	#	TRES	VRES[9:0]	0x02
0x0018	#	#	#	#	#	#	#	#		VKES[8.0]	0x58
0x0019		#	#	#	#	#	#	#		HST[9:3]	0x00
0x001A				-	-		#	#	GSST	VCTIO-01	0x00
0x001B	#	#	#	#	#	#	#	#		VST[9:0]	0x00
0x001C	#	#	#	#	#	#	#	#	PWS	VCOM_W[3:0], SD_W[3:0]	0x00
0x001D	-			_	_	-	#	#	LVSEL	LVD_SEL[1:0]	0x03
0x001E	#	#	#	#	#	#	#	#	TSBDRY	TSBDRY_PHC2[7:0]	0x00



### **LUT FORMAT IN OTP**

There are 12 TRs (temperature range) in a bank. Each TR has independent frame rate, voltage, XON settings, KW option enable setting and LUTs. The fomat of LUT is different in different mode. In KWR mode, there are only 4 LUTs including LUTC, LUTR, LUTW and LUTB in TRs. LUTC, LUTR, LUTW and LUTB have 10 states. In KW mode, there are 5 LUTs including LUT, LUTWW, LUTBW, LUTWB and LUTBB in TRs. All LUTs have 7 states. Besides, there is 1 common border LUT, regardless of temperature range, in KWR mode or KW mode.

#### **Common Border LUT Table**

Common Border LUT Table	KWR Mode or KW Mode					
	Address (Bank0 / Bank1)	Content				
	0x001F ~ 0x0048 / 0x0C1F ~ 0x0C48	LUTBD				


### Separate VCOM LUT and Source LUT (Example: Bank0 / TR0)

0x0049 0x004A 0x004B 0x004C	Content Frame Rate[3:0], VCEND, VG Voltage[2:0] BDEND[1:0], VDH Voltage[5:0]	Address 0x0049	Content Frame Rate[3:0],VCEND,VG Voltage[2:0]
0x004A 0x004B	BDEND[1:0], VDH Voltage[5:0]		Frame Pate(3:01 V/CENID V/C V/oltage(3:01
0x004B			Traine Nate[5.0], VCLND, VG Voltage[2.0]
		0x004A	BDEND[1:0], VDH Voltage[5:0]
0x004C	XON[9:8], VDL Voltage [5:0]	0x004B	XON[9:8], VDL Voltage [5:0]
0,100 10	KWE[9:8], VDHR Voltage [5:0]	0x004C	KWE[9:8], VDHR Voltage [5:0]
0x004D	XON [7:0]	0x004D	XON [7:0]
		0x004E	0b, VCOM_DC[6:0]
	KWE[7:0]	0x004F	LUTC
0x0050	LUTC (10 states)	0x0078	(7 states)
0x008B	(10 states)	0x0079	LUTWW
0,000		0x00A2	(7 states)
UXUUSC	LUTR	0x00A3	LUTKW
0x00C7	(10 states)	0x00CC	(7 states)
		0x00CD	LUTWK
0x00C8	LUTW	0x00F6	(7 states)
0x0103	(10 states)	0x00F7	LUTKK
0x0104	1.11	0x0120	(7 states)
0x013F	LUTK (10 states)	0x0121	Reserved
	0x004D 0x004E 0x004F 0x0050   0x008B 0x008C   0x00C7 0x00C8   0x0103	0x004D         XON [7:0]           0x004E         0b, VCOM_DC[6:0]           0x004F         KWE[7:0]           0x0050         LUTC           0x008B         (10 states)           0x000C7         LUTR           0x00C8         LUTW           0x0103         LUTK           0x0104         LUTK           LUTK         (10 states)	0x004D         XON [7:0]         0x004D           0x004E         0b, VCOM_DC[6:0]         0x004E           0x004F         KWE[7:0]         0x004F           0x0050         LUTC         0x0078           0x008B         (10 states)         0x0079           0x000A2         0x00A2           0x00C7         (10 states)         0x00CC           0x00CD         0x00CD           0x0103         (10 states)         0x00F7           0x0104         LUTK         0x0120           0x0121



### **DEEP SLEEP MODE**

After deep sleep command (R07H) is transmitted, IL0326 enter "Deep Sleep Mode", and leaves by RST\_N falling. In "Deep Sleep Mode", the control signals are recommended tied to 0v to avoid IO leakage current. And the die must be keep away from light which causes photoelectric effect to make internal nodes unstable.

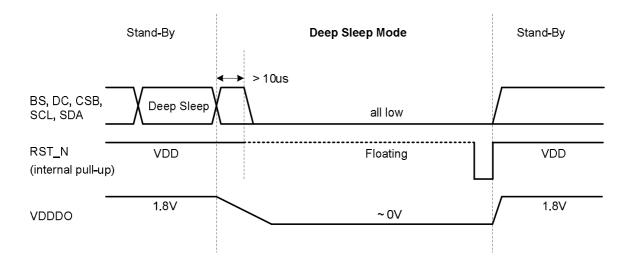



### PANEL BREAK CHECK

The panel break check (PBC) function is accomplished by testing the connection of the ITO along panel edge. If the panel is broken, the loop ITO may be cut off. The connection check is judged by signal transmission from CHKGO to CHKGI.

Figure: Panel break check layout example


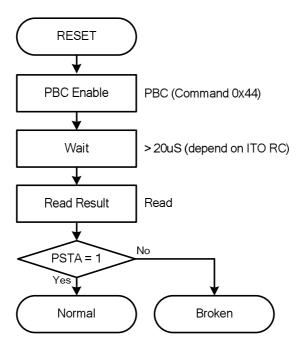


Figure: Panel Break Check (PBC) Sequence




### **CASCADE APPLICATION CIRCUIT**

All commands sent to **Master** must be also sent to **Slave** except for data writing (DTM1 and DTM2). The display data must be separated to two parts, one is for **Master** and another is for **Slave**. They are transmitted to **Master** and **Slave** individually by using CSB1 and CSB2.

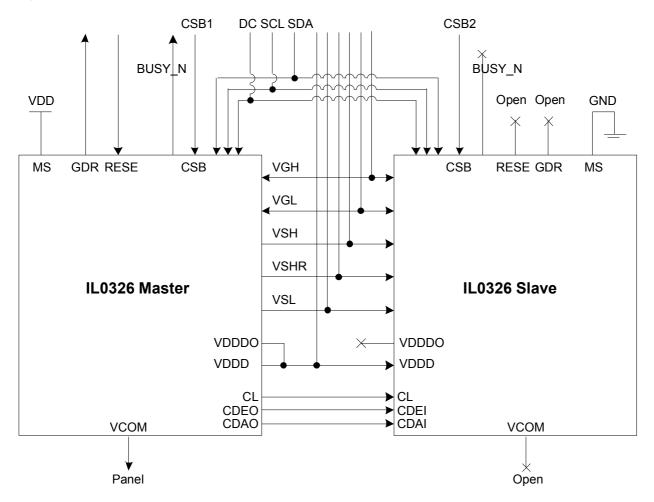



#### **BOOSTER APPLICATION CIRCUIT**

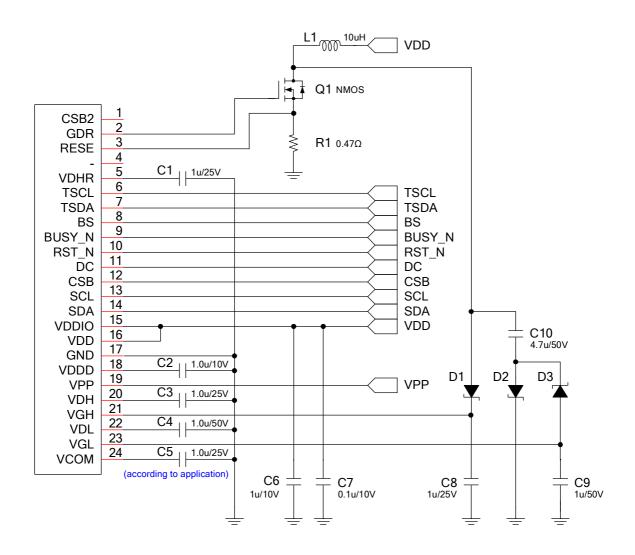

#### **Recommended Device**

1. Switch MOS NMOS: Vishay Si1308EDL  $(V_{DS} > 20V, I_D > 500mA, V_{GS}(th) < 1.5V, C_{ISS} < 200pF, R_{DS}(on) < 400m\Omega)$ 

2. Schottky Diode: OnSemi MBR0530 ( $V_R > 20V$ ,  $I_F > 500mA$ ,  $I_R < 1mA @ V_R=15V$ ,  $T_A=100$ °C)

### **Recommended Resistor**

Item	Pins	Resistance
Powers	VDD, VDDA, VDDIO, GND, GNDA, VDM	< 10 Ω
Boosters	VGL, VGH, GDR, RESE	< 10 Ω
Regulators	VDH, VDL, VDHR, VCOM, VDDD, VDDDO	< 10 Ω
Logics	MS, BS, CSB, SCL, SDA, SDA1, GDR, etc.	< 50 Ω
OTP	VPP	< 20 Ω



### **ABSOLUTE MAXIMUM RATINGS**

Signal	Item	Min	Max.	Unit	
Vdd, Vddio, Vdda	Logic Supply voltage	-0.3	+6.0	V	
VPP	OTP programming voltage	-0.3	+8.0	V	
Vı	Digital input range	-0.3	VDDIO+0.3	V	
VGH-VGL	Supply range	-	+44.0	V	
Source				_	
VDH	Analog supply voltage – positive +16				
VDL	Analog supply voltage negative	-1	V		
VDHR	Analog supply voltage – positive	+	+16		
Gate					
VGH	Analog supply voltage – positive	-0.3	+22	V	
VGL	Analog supply voltage negative	-22	0.3	V	
IVGH	Input rush current for VGH	(TBD)	(TBD)	mA	
IVGL	Input rush current for VGL	(TBD)	(TBD)	mA	
Тѕтс	Storage temperature range	-55	+125	°C	

#### Warning:

If ICs are stressed beyond those listed above "absolute maximum ratings", they may be permanently destroyed. These are stress ratings only, and functional operation of the device at these or any other condition beyond those indicated under "recommended operating conditions" is not implied. Exposure to absolute maximum rated conditions for extended periods may affect device reliability.



# **DC CHARACTERISTICS**

Symbol	Parameter	Conditions	MIN.	TYP.	MAX.	Unit
VDDIO	IO supply voltage		2.3	3.3	3.6	V
VDD	Supply voltage		2.3	3.3	3.6	V
VDDA	DCDC driver supply voltage		2.3	3.3	3.6	V
VIL	LOW Level input voltage	Digital input pins	0	-	0.3xVDD	V
VIH	HIGH Level input voltage	Digital input pins	0.7xVDDIO		VDDIO	V
Vон	HIGH Level output voltage	Digital input pins, loн=400∪A	VDDIO-0.4	-		V
Vol	LOW Level Output voltage	Digital input pins, lo∟=-400∪A	0	-	0.4	V
lin	Input leakage current	Digital input pins except pull-up, pull-down pin	-1		1	uA
RIN	Pull-up/down impedance			200		<b>K</b> ς
Тор	Operating temperature		-30		85	°C
dVGH	VGH Supply voltage dev		-400	0	+400	mV
VGH-VGL	Voltage Range of VGH - VGL				40	V
dVDH	Supply voltage dev		-200	0	+200	mV
dVDL	Supply voltage dev		-200	0	+200	mV
dVDHR	Supply voltage dev		-200	0	+200	mV
dVCOM	Supply voltage dev		-200	0	+200	mV
Ron	Driver Output Resistance	For source driver, Top=25°C, Vout = ±15V		16.0	38.4	<b>K</b> ς
IXON	Driver Output Nesistance	For gate driver, Top=25°C, Vout = ±20V		4.0	8	ING

# VDD=VDDA=VDDIO=3.0V, TOP=25.0 °C

Symbol	Parameter	Conditions	MIN.	TYP.	MAX.	Unit
	Digital deep sleep current	VDDD OFF		0.3	0.5	uA
IVDD	Digital stand-by current	All stopped		8.2	10.0	uA
	Digital operating current				0.1	mA
	IO deep sleep current	VDDD OFF		0.1	0.3	uA
IVDDIO	IO stand-by current	Booster OFF		2.5	4.0	uA
	IO operating current	No load			0.1	mA
	DCDC deep sleep current	VDDD OFF		0.1	0.3	uA
	DCDC stand-by current	Booster OFF		15.5	20.0	uA
		Source output VDH/VDL,				
		Duty=0.5, Period =126us			4.0	
		VCOM DC			4.0	
IVDDA		No load				
	DCDC operating current	Source output VDH/VDL,				mA
		Duty=0.5, Period =126us,				
		VCOM DC			20.0	
		External cap: 415pF,				
		NMOS=340pF				

### **AC CHARACTERISTICS**

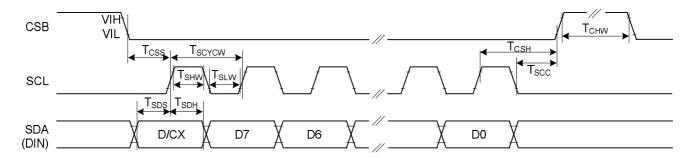


Figure: 3-wire Serial Interface Characteristics (Write mode)

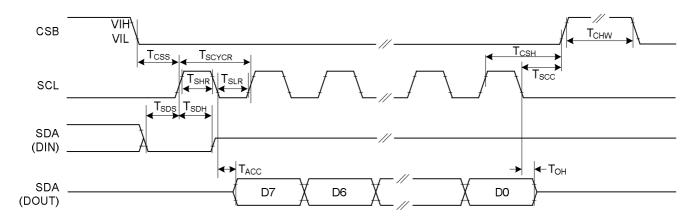


Figure: 3-wire Serial Interface Characteristics (Read mode)

Symbol	Signal / Parameter	Conditions	Min.	Тур.	Max.	Unit
T <sub>CSS</sub>		Chip select setup time	60			ns
T <sub>CSH</sub>	CSB	Chip select hold time	65			ns
T <sub>SCC</sub>	COB	Chip select setup time	20			ns
$T_CHW$		Chip select setup time	40			ns
T <sub>SCYCW</sub>		Serial clock cycle (Write)	100			ns
T <sub>SHW</sub>		SCL "H" pulse width (Write)	35			ns
T <sub>SLW</sub>	SCL	SCL "L" pulse width (Write)	35			ns
T <sub>SCYCR</sub>	SCL	Serial clock cycle (Read)	150			ns
T <sub>SHR</sub>		SCL "H" pulse width (Read)	60			ns
$T_{SLR}$		SCL "L" pulse width (Read)	60			ns
$T_{SDS}$	SDA	Data setup time	30			ns
T <sub>SDH</sub>	(DIN)	Data hold time	30			ns
T <sub>ACC</sub>	SDA	Access time			50	ns
Тон	(DOUT)	Output disable time	15			ns

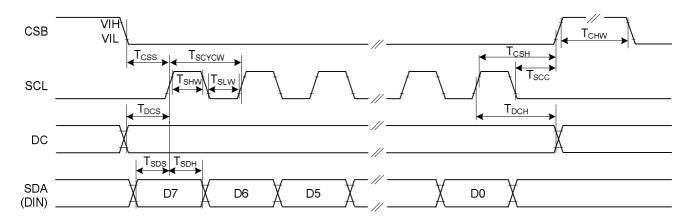


Figure: 4-wire Serial Interface Characteristics (Write mode)

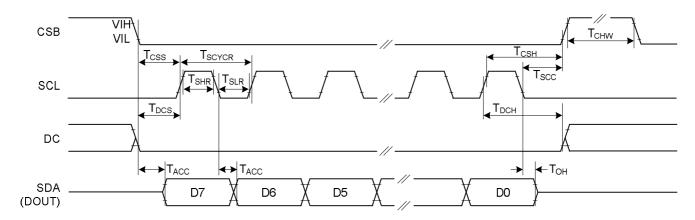


Figure: 4-wire Serial Interface Characteristics (Read mode)

Symbol	Signal / Parameter	Conditions	Min.	Тур.	Max.	Unit
T <sub>CSS</sub>		Chip select setup time	60			ns
T <sub>CSH</sub>	CSB	Chip select hold time	65			ns
T <sub>SCC</sub>	CSB	Chip select setup time	20			ns
T <sub>CHW</sub>		Chip select setup time	40			ns
T <sub>SCYCW</sub>		Serial clock cycle (Write)	100			ns
T <sub>SHW</sub>		SCL "H" pulse width (Write)	35			ns
T <sub>SLW</sub>	901	SCL "L" pulse width (Write)	35			ns
T <sub>SCYCR</sub>	SCL	Serial clock cycle (Read)	150			ns
T <sub>SHR</sub>		SCL "H" pulse width (Read)	60			ns
T <sub>SLR</sub>		SCL "L" pulse width (Read)	60			ns
T <sub>DCS</sub>	DC	DC setup time	30			ns
T <sub>DCH</sub>	DC	DC hold time	30			ns
T <sub>SDS</sub>	SDA	Data setup time	30			ns
T <sub>SDH</sub>	(DIN)	Data hold time	30			ns
T <sub>ACC</sub>	SDA	Access time			50	ns
Тон	(DOUT)	Output disable time	15			ns



### **PHYSICAL DIMENSIONS**

Die Size:  $(18512 \mu M 6 40 \mu M) x (1142 \mu M 6 40 \mu M)$ 

Die Thickness: 300 μM 6 20μM

Die TTV:  $(D_{MAX} - D_{MIN})$  within die  $\leq 2\mu M$ 

Bump Height: 12 µM 6 3µM


 $(H_{MAX}-H_{MIN})$  within die  $\leq 2 \mu M$ 

Bump Size:  $12 \mu M \times 100 \mu M 6 2 \mu M$ 


Bump Area:  $1200 \mu M^2$ Bump Pitch:  $25 \mu M$ 


Bump Gap:  $19 \mu M 6 3 \mu M$ Hardness: 65 Hv 6 15 HvShear:  $/5g/Mil^2$ 

Coordinate origin: Chip center
Pad reference: Pad center

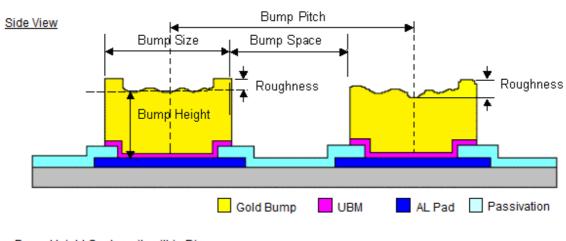



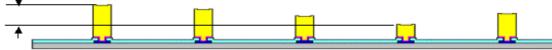


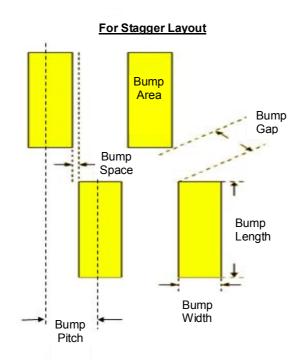




# **ALIGNMENT MARK INFORMATION**


# Location:

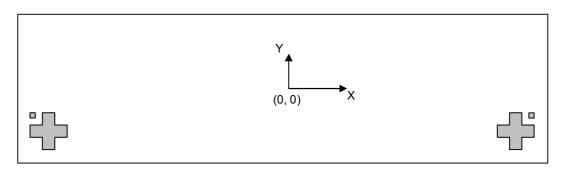

D-Left Mark D-Right Mark

# **Shapes and Points:**

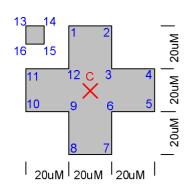

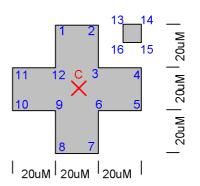

### **Point Coordinates:**

	D-Leff	t Mark	D-Righ	nt Mark
Point	X	Υ	X	Υ
C(X)	-9183	-498	9183	-498
1	-9193	-468	9173	-468
2	-9173	-468	9193	-468
3	-9173	-488	9193	-488
4	-9153	-488	9213	-488
5	-9153	-508	9213	-508
6	-9173	-508	9193	-508
7	-9173	-528	9193	-528
8	-9193	-528	9173	-528
9	-9193	-508	9173	-508
10	-9213	-508	9153	-508
11	-9213	-488	9153	-488
12	-9193	-488	9173	-488
13	-9213	-468	9203	-468
14	-9203	-468	9213	-468
15	-9203	-478	9213	-478
16	-9213	-478	9203	-478



# **PAD COORDINATES**

#	Pad	Х	Υ	W	Н
1	DUMMY	-9062	-515	28	70
2	DUMMY	-9016	-515	28	70
3	VCOM	-8970	-515	28	70
4	VCOM	-8924	-515	28	70
5	VCOM	-8878	-515	28	70
6	VCOM	-8832	-515	28	70
7	VCOM	-8786	-515	28	70
8	VCOM	-8740	-515	28	70
9	VCOM	-8694	-515	28	70
10	VCOM	-8648	-515	28	70
11	VCOM	-8602	-515	28	70
12	VCOM	-8556	-515	28	70
13	VCOM	-8510	-515		
14				28 28	70
	VCOM	-8464	-515		70
15	VCOM	-8418	-515	28	70
16	VCOM	-8372	-515	28	70
17	VCOM	-8326	-515	28	70
18	VCOM	-8280	-515	28	70
19	VCOM	-8234	-515	28	70
20	VCOM	-8188	-515	28	70
21	VCOM	-8142	-515	28	70
22	VDM	-8096	-515	28	70
23	VGL	-8050	-515	28	70
24	VGL	-8004	-515	28	70
25	VGL	-7958	-515	28	70
26	VGL	-7912	-515	28	70
27	VGL	-7866	-515	28	70
28	VGL	-7820	-515	28	70
29	VGL	-7774	-515	28	70
30	VGL	-7728	-515	28	70
31	VGL	-7682	-515	28	70
32	VGL	-7636	-515	28	70
33	VGL	-7590	-515	28	70
34	VGL	-7544	-515	28	70
35	VGL	-7498	-515	28	70
36	VGL	-7452	-515	28	70
37	VDM	-7406	-515	28	70
38	VDL	-7360	-515	28	70
39	VDL	-7314	-515	28	70
40	VDL	-7268	-515	28	70
41	VDL	-7222	-515	28	70
42	VDL	-7176	-515	28	70
43	VDL	-7130	-515	28	70
44	VDL	-7084	-515	28	70
45	VDL	-7038	-515	28	70
46	VDL	-6992	-515	28	70
47	VDL	-6946	-515	28	70
48	VDL	-6900	-515	28	70
49	VDL	-6854	-515	28	70
50	GNDA	-6808	-515	28	70
51	VGH	-6762	-515	28	70
52	VGH	-6716	-515	28	70
53	VGH	-6670		28	
54			-515 515		70
	VGH	-6624	-515 515	28	70
55	VGH	-6578	-515 -515	28	70
56	VGH	-6532	-515	28	70
57	VGH	-6486	-515	28	70

58         VGH         -6440         -515         28         70           59         VGH         -6394         -515         28         70           60         VGH         -6304         -515         28         70           61         VGH         -6302         -515         28         70           62         VGH         -6256         -515         28         70           63         VGH         -6210         -515         28         70           64         VGH         -6164         -515         28         70           65         GNDA         -6118         -515         28         70           66         VDH         -6026         -515         28         70           67         VDH         -5980         -515         28         70           68         VDH         -5934         -515         28         70           70         VDH         -5888         -515         28         70           71         VDH         -5882         -515         28         70           72         VDH         -5796         -515         28         70	#	Pad	Х	Υ	W	Н
S9				-		
60         VGH         -6348         -515         28         70           61         VGH         -6302         -515         28         70           62         VGH         -6256         -515         28         70           63         VGH         -6210         -515         28         70           64         VGH         -6164         -515         28         70           65         GNDA         -6118         -515         28         70           66         VDH         -6072         -515         28         70           67         VDH         -6980         -515         28         70           68         VDH         -5980         -515         28         70           69         VDH         -5934         -515         28         70           70         VDH         -5882         -515         28         70           71         VDH         -5842         -515         28         70           72         VDH         -5750         -515         28         70           73         VDH         -5651         28         70           75			+			
61         VGH         -6302         -515         28         70           62         VGH         -6256         -515         28         70           63         VGH         -6210         -515         28         70           64         VGH         -6164         -515         28         70           65         GNDA         -6118         -515         28         70           66         VDH         -6072         -515         28         70           67         VDH         -6026         -515         28         70           68         VDH         -5934         -515         28         70           68         VDH         -5934         -515         28         70           70         VDH         -5848         -515         28         70           71         VDH         -5842         -515         28         70           71         VDH         -5750         -515         28         70           73         VDH         -5658         -515         28         70           75         VDH         -5658         -515         28         70			+	_		
62         VGH         -6256         -515         28         70           63         VGH         -6210         -515         28         70           64         VGH         -6164         -515         28         70           65         GNDA         -6118         -515         28         70           66         VDH         -6072         -515         28         70           67         VDH         -6026         -515         28         70           68         VDH         -5980         -515         28         70           69         VDH         -5843         -515         28         70           70         VDH         -5848         -515         28         70           70         VDH         -5842         -515         28         70           71         VDH         -5842         -515         28         70           72         VDH         -5796         -515         28         70           73         VDH         -5662         -515         28         70           75         VDH         -5662         -515         28         70			+			
63         VGH         -6210         -515         28         70           64         VGH         -6164         -515         28         70           65         GNDA         -6118         -515         28         70           66         VDH         -6072         -515         28         70           67         VDH         -6026         -515         28         70           68         VDH         -5980         -515         28         70           68         VDH         -5934         -515         28         70           69         VDH         -5934         -515         28         70           70         VDH         -5888         -515         28         70           71         VDH         -5796         -515         28         70           72         VDH         -5750         -515         28         70           74         VDH         -5704         -515         28         70           75         VDH         -5658         -515         28         70           76         VDH         -56612         -515         28         70			1			
64         VGH         -6164         -515         28         70           65         GNDA         -6118         -515         28         70           66         VDH         -6072         -515         28         70           67         VDH         -6026         -515         28         70           68         VDH         -5980         -515         28         70           69         VDH         -5934         -515         28         70           70         VDH         -5884         -515         28         70           70         VDH         -5884         -515         28         70           71         VDH         -5796         -515         28         70           72         VDH         -5790         -515         28         70           73         VDH         -5750         -515         28         70           74         VDH         -5704         -515         28         70           75         VDH         -5658         -515         28         70           76         VDH         -5566         -515         28         70						
65         GNDA         -6118         -515         28         70           66         VDH         -6072         -515         28         70           67         VDH         -6026         -515         28         70           68         VDH         -5980         -515         28         70           69         VDH         -5934         -515         28         70           70         VDH         -5888         -515         28         70           70         VDH         -5842         -515         28         70           71         VDH         -5842         -515         28         70           72         VDH         -5796         -515         28         70           73         VDH         -5750         -515         28         70           74         VDH         -5668         -515         28         70           75         VDH         -5566         -515         28         70           78         GNDA         -5520         -515         28         70           79         VPP         -5428         -515         28         70			1			
66         VDH         -6072         -515         28         70           67         VDH         -6026         -515         28         70           68         VDH         -5980         -515         28         70           69         VDH         -5984         -515         28         70           70         VDH         -5888         -515         28         70           71         VDH         -5842         -515         28         70           71         VDH         -5796         -515         28         70           72         VDH         -5796         -515         28         70           73         VDH         -5750         -515         28         70           74         VDH         -5658         -515         28         70           75         VDH         -5658         -515         28         70           76         VDH         -5656         -515         28         70           78         GNDA         -5520         -515         28         70           79         VPP         -5382         -515         28         70						
67         VDH         -6026         -515         28         70           68         VDH         -5980         -515         28         70           69         VDH         -5934         -515         28         70           70         VDH         -5888         -515         28         70           71         VDH         -5888         -515         28         70           71         VDH         -5796         -515         28         70           72         VDH         -5750         -515         28         70           73         VDH         -5750         -515         28         70           74         VDH         -5658         -515         28         70           75         VDH         -5668         -515         28         70           76         VDH         -5566         -515         28         70           78         GNDA         -5520         -515         28         70           79         VPP         -5428         -515         28         70           81         VPP         -5382         -515         28         70						
68         VDH         -5980         -515         28         70           69         VDH         -5934         -515         28         70           70         VDH         -5888         -515         28         70           71         VDH         -5842         -515         28         70           72         VDH         -5760         -515         28         70           73         VDH         -5704         -515         28         70           74         VDH         -5704         -515         28         70           75         VDH         -5658         -515         28         70           76         VDH         -5668         -515         28         70           78         GNDA         -5520         -515         28         70           79         VPP         -5474         -515         28         70           79         VPP         -5428         -515         28         70           81         VPP         -5382         -515         28         70           82         VPP         -5336         -515         28         70						
69         VDH         -5934         -515         28         70           70         VDH         -5888         -515         28         70           71         VDH         -5842         -515         28         70           72         VDH         -5796         -515         28         70           73         VDH         -5704         -515         28         70           74         VDH         -5764         -515         28         70           75         VDH         -5668         -515         28         70           76         VDH         -5668         -515         28         70           78         GNDA         -5520         -515         28         70           79         VPP         -5474         -515         28         70           80         VPP         -5428         -515         28         70           81         VPP         -5336         -515         28         70           81         VPP         -5336         -515         28         70           84         VPP         -5244         -515         28         70						
70         VDH         -5888         -515         28         70           71         VDH         -5842         -515         28         70           72         VDH         -5796         -515         28         70           73         VDH         -5750         -515         28         70           74         VDH         -5658         -515         28         70           75         VDH         -5658         -515         28         70           76         VDH         -5656         -515         28         70           76         VDH         -5566         -515         28         70           78         GNDA         -5520         -515         28         70           79         VPP         -5428         -515         28         70           80         VPP         -5428         -515         28         70           81         VPP         -5382         -515         28         70           82         VPP         -5336         -515         28         70           84         VPP         -5198         -515         28         70			1			_
71         VDH         -5842         -515         28         70           72         VDH         -5796         -515         28         70           73         VDH         -5750         -515         28         70           74         VDH         -5704         -515         28         70           75         VDH         -5658         -515         28         70           76         VDH         -5612         -515         28         70           76         VDH         -5666         -515         28         70           78         GNDA         -5520         -515         28         70           78         GNDA         -5520         -515         28         70           80         VPP         -5428         -515         28         70           81         VPP         -5382         -515         28         70           81         VPP         -5382         -515         28         70           82         VPP         -5336         -515         28         70           84         VPP         -5198         -515         28         70			+			
72         VDH         -5796         -515         28         70           73         VDH         -5750         -515         28         70           74         VDH         -5704         -515         28         70           75         VDH         -5668         -515         28         70           76         VDH         -5566         -515         28         70           77         VDH         -5566         -515         28         70           78         GNDA         -5520         -515         28         70           79         VPP         -5474         -515         28         70           79         VPP         -5428         -515         28         70           80         VPP         -5428         -515         28         70           81         VPP         -5382         -515         28         70           82         VPP         -5336         -515         28         70           84         VPP         -5290         -515         28         70           85         VPP         -5198         -515         28         70			+			
73         VDH         -5750         -515         28         70           74         VDH         -5704         -515         28         70           75         VDH         -5658         -515         28         70           76         VDH         -5668         -515         28         70           77         VDH         -5566         -515         28         70           78         GNDA         -5520         -515         28         70           79         VPP         -5474         -515         28         70           80         VPP         -5428         -515         28         70           81         VPP         -5382         -515         28         70           81         VPP         -5336         -515         28         70           82         VPP         -5336         -515         28         70           84         VPP         -5290         -515         28         70           85         VPP         -5198         -515         28         70           86         VPP         -5106         -515         28         70						
74         VDH         -5704         -515         28         70           75         VDH         -5658         -515         28         70           76         VDH         -56612         -515         28         70           77         VDH         -5566         -515         28         70           78         GNDA         -5520         -515         28         70           79         VPP         -5474         -515         28         70           80         VPP         -5428         -515         28         70           81         VPP         -5336         -515         28         70           82         VPP         -5336         -515         28         70           83         VPP         -5290         -515         28         70           84         VPP         -5198         -515         28         70           85         VPP         -5198         -515         28         70           86         VPP         -5106         -515         28         70           89         DUMMY         -4968         -515         28         70						
75         VDH         -5658         -515         28         70           76         VDH         -5612         -515         28         70           77         VDH         -5566         -515         28         70           78         GNDA         -5520         -515         28         70           79         VPP         -5474         -515         28         70           80         VPP         -5428         -515         28         70           81         VPP         -5382         -515         28         70           82         VPP         -5336         -515         28         70           83         VPP         -5290         -515         28         70           84         VPP         -5244         -515         28         70           85         VPP         -5198         -515         28         70           86         VPP         -5106         -515         28         70           88         VPP         -5060         -515         28         70           90         DUMMY         -4968         -515         28         70						
76         VDH         -5612         -515         28         70           77         VDH         -5566         -515         28         70           78         GNDA         -5520         -515         28         70           79         VPP         -5474         -515         28         70           80         VPP         -5428         -515         28         70           81         VPP         -5382         -515         28         70           82         VPP         -5336         -515         28         70           83         VPP         -5290         -515         28         70           84         VPP         -5290         -515         28         70           85         VPP         -5198         -515         28         70           86         VPP         -5162         -515         28         70           87         VPP         -5106         -515         28         70           89         DUMMY         -4968         -515         28         70           91         DUMMY         -4968         -515         28         70						
77         VDH         -5566         -515         28         70           78         GNDA         -5520         -515         28         70           79         VPP         -5474         -515         28         70           80         VPP         -5428         -515         28         70           81         VPP         -5382         -515         28         70           82         VPP         -5336         -515         28         70           83         VPP         -5290         -515         28         70           84         VPP         -5290         -515         28         70           85         VPP         -5198         -515         28         70           86         VPP         -5162         -515         28         70           87         VPP         -5060         -515         28         70           89         DUMMY         -4968         -515         28         70           90         DUMMY         -4968         -515         28         70           92         DUMMY         -4876         -515         28         70 <tr< td=""><td></td><td></td><td></td><td></td><td></td><td></td></tr<>						
78         GNDA         -5520         -515         28         70           79         VPP         -5474         -515         28         70           80         VPP         -5428         -515         28         70           81         VPP         -5382         -515         28         70           82         VPP         -5336         -515         28         70           83         VPP         -5290         -515         28         70           84         VPP         -5244         -515         28         70           85         VPP         -5198         -515         28         70           86         VPP         -5106         -515         28         70           87         VPP         -5106         -515         28         70           88         VPP         -5060         -515         28         70           89         DUMMY         -4968         -515         28         70           91         DUMMY         -4968         -515         28         70           92         DUMMY         -4876         -515         28         70 <tr< td=""><td></td><td></td><td></td><td></td><td></td><td></td></tr<>						
79         VPP         -5474         -515         28         70           80         VPP         -5428         -515         28         70           81         VPP         -5382         -515         28         70           82         VPP         -5336         -515         28         70           83         VPP         -5290         -515         28         70           84         VPP         -5244         -515         28         70           85         VPP         -5198         -515         28         70           86         VPP         -5166         -515         28         70           87         VPP         -5106         -515         28         70           89         DUMMY         -5014         -515         28         70           90         DUMMY         -4968         -515         28         70           91         DUMMY         -4968         -515         28         70           92         DUMMY         -4876         -515         28         70           93         DUMMY         -4784         -515         28         70			_			
80         VPP         -5428         -515         28         70           81         VPP         -5382         -515         28         70           82         VPP         -5336         -515         28         70           83         VPP         -5290         -515         28         70           84         VPP         -5244         -515         28         70           85         VPP         -5198         -515         28         70           86         VPP         -5106         -515         28         70           87         VPP         -5106         -515         28         70           88         VPP         -5060         -515         28         70           89         DUMMY         -5014         -515         28         70           90         DUMMY         -4968         -515         28         70           91         DUMMY         -4968         -515         28         70           92         DUMMY         -4876         -515         28         70           93         DUMMY         -4784         -515         28         70						
81         VPP         -5382         -515         28         70           82         VPP         -5336         -515         28         70           83         VPP         -5290         -515         28         70           84         VPP         -5244         -515         28         70           85         VPP         -5198         -515         28         70           86         VPP         -5160         -515         28         70           87         VPP         -5106         -515         28         70           88         VPP         -5060         -515         28         70           89         DUMMY         -5014         -515         28         70           90         DUMMY         -4968         -515         28         70           91         DUMMY         -4968         -515         28         70           92         DUMMY         -4876         -515         28         70           93         DUMMY         -4784         -515         28         70           95         DUMMY         -4784         -515         28         70						
82         VPP         -5336         -515         28         70           83         VPP         -5290         -515         28         70           84         VPP         -5244         -515         28         70           85         VPP         -5198         -515         28         70           86         VPP         -5106         -515         28         70           87         VPP         -5106         -515         28         70           88         VPP         -5060         -515         28         70           89         DUMMY         -5014         -515         28         70           90         DUMMY         -4968         -515         28         70           91         DUMMY         -4968         -515         28         70           91         DUMMY         -4968         -515         28         70           92         DUMMY         -4876         -515         28         70           93         DUMMY         -4784         -515         28         70           95         DUMMY         -47692         -515         28         70			_			
83         VPP         -5290         -515         28         70           84         VPP         -5244         -515         28         70           85         VPP         -5198         -515         28         70           86         VPP         -5152         -515         28         70           87         VPP         -5106         -515         28         70           88         VPP         -5060         -515         28         70           89         DUMMY         -5014         -515         28         70           90         DUMMY         -4968         -515         28         70           91         DUMMY         -4968         -515         28         70           91         DUMMY         -4968         -515         28         70           92         DUMMY         -4876         -515         28         70           93         DUMMY         -4830         -515         28         70           94         DUMMY         -4784         -515         28         70           95         DUMMY         -4692         -515         28         70 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
84         VPP         -5244         -515         28         70           85         VPP         -5198         -515         28         70           86         VPP         -5152         -515         28         70           87         VPP         -5106         -515         28         70           88         VPP         -5060         -515         28         70           89         DUMMY         -5014         -515         28         70           90         DUMMY         -4968         -515         28         70           91         DUMMY         -4968         -515         28         70           91         DUMMY         -4968         -515         28         70           92         DUMMY         -4968         -515         28         70           93         DUMMY         -4876         -515         28         70           94         DUMMY         -4784         -515         28         70           95         DUMMY         -4692         -515         28         70           97         DUMMY         -4646         -515         28         70 </td <td></td> <td></td> <td>1</td> <td>_</td> <td></td> <td></td>			1	_		
85         VPP         -5198         -515         28         70           86         VPP         -5152         -515         28         70           87         VPP         -5106         -515         28         70           88         VPP         -5060         -515         28         70           89         DUMMY         -5014         -515         28         70           90         DUMMY         -4968         -515         28         70           91         DUMMY         -4968         -515         28         70           91         DUMMY         -4968         -515         28         70           92         DUMMY         -4876         -515         28         70           93         DUMMY         -4830         -515         28         70           94         DUMMY         -4784         -515         28         70           95         DUMMY         -4784         -515         28         70           97         DUMMY         -4692         -515         28         70           98         DUMMY         -4646         -515         28         70						
86         VPP         -5152         -515         28         70           87         VPP         -5106         -515         28         70           88         VPP         -5060         -515         28         70           89         DUMMY         -5014         -515         28         70           90         DUMMY         -4968         -515         28         70           91         DUMMY         -4922         -515         28         70           92         DUMMY         -4876         -515         28         70           93         DUMMY         -4830         -515         28         70           94         DUMMY         -4784         -515         28         70           95         DUMMY         -4738         -515         28         70           96         DUMMY         -4692         -515         28         70           97         DUMMY         -4646         -515         28         70           99         DUMMY         -4554         -515         28         70           100         DUMMY         -4662         -515         28         70						
87         VPP         -5106         -515         28         70           88         VPP         -5060         -515         28         70           89         DUMMY         -5014         -515         28         70           90         DUMMY         -4968         -515         28         70           91         DUMMY         -4922         -515         28         70           92         DUMMY         -4876         -515         28         70           93         DUMMY         -4830         -515         28         70           94         DUMMY         -4784         -515         28         70           95         DUMMY         -4738         -515         28         70           96         DUMMY         -4692         -515         28         70           97         DUMMY         -4646         -515         28         70           98         DUMMY         -4554         -515         28         70           100         DUMMY         -4508         -515         28         70           101         DUMMY         -4462         -515         28         70 <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>						
88         VPP         -5060         -515         28         70           89         DUMMY         -5014         -515         28         70           90         DUMMY         -4968         -515         28         70           91         DUMMY         -4922         -515         28         70           92         DUMMY         -4876         -515         28         70           93         DUMMY         -4830         -515         28         70           94         DUMMY         -4784         -515         28         70           95         DUMMY         -4738         -515         28         70           96         DUMMY         -4692         -515         28         70           97         DUMMY         -4646         -515         28         70           98         DUMMY         -4600         -515         28         70           100         DUMMY         -4554         -515         28         70           101         DUMMY         -4462         -515         28         70           102         DUMMY         -4462         -515         28         70<		9.5.5				
89         DUMMY         -5014         -515         28         70           90         DUMMY         -4968         -515         28         70           91         DUMMY         -4922         -515         28         70           92         DUMMY         -4876         -515         28         70           93         DUMMY         -4830         -515         28         70           94         DUMMY         -4784         -515         28         70           95         DUMMY         -4738         -515         28         70           96         DUMMY         -4692         -515         28         70           97         DUMMY         -4646         -515         28         70           98         DUMMY         -4600         -515         28         70           99         DUMMY         -4554         -515         28         70           100         DUMMY         -4462         -515         28         70           101         DUMMY         -4462         -515         28         70           102         DUMMY         -4462         -515         28         7			_			
90         DUMMY         -4968         -515         28         70           91         DUMMY         -4922         -515         28         70           92         DUMMY         -4876         -515         28         70           93         DUMMY         -4830         -515         28         70           94         DUMMY         -4784         -515         28         70           95         DUMMY         -4738         -515         28         70           96         DUMMY         -4692         -515         28         70           97         DUMMY         -4646         -515         28         70           98         DUMMY         -4600         -515         28         70           99         DUMMY         -4554         -515         28         70           100         DUMMY         -4462         -515         28         70           101         DUMMY         -4462         -515         28         70           102         DUMMY         -4462         -515         28         70           103         VDDDO         -4370         -515         28				_		
91         DUMMY         -4922         -515         28         70           92         DUMMY         -4876         -515         28         70           93         DUMMY         -4830         -515         28         70           94         DUMMY         -4784         -515         28         70           95         DUMMY         -4738         -515         28         70           96         DUMMY         -4692         -515         28         70           97         DUMMY         -4646         -515         28         70           98         DUMMY         -4600         -515         28         70           99         DUMMY         -4554         -515         28         70           100         DUMMY         -4462         -515         28         70           101         DUMMY         -4462         -515         28         70           102         DUMMY         -4462         -515         28         70           103         VDDDO         -4370         -515         28         70           104         VDDDO         -4278         -515         28 <td< td=""><td></td><td>_</td><td></td><td></td><td></td><td></td></td<>		_				
92         DUMMY         -4876         -515         28         70           93         DUMMY         -4830         -515         28         70           94         DUMMY         -4784         -515         28         70           95         DUMMY         -4738         -515         28         70           96         DUMMY         -4692         -515         28         70           97         DUMMY         -4646         -515         28         70           98         DUMMY         -4600         -515         28         70           99         DUMMY         -4554         -515         28         70           100         DUMMY         -4462         -515         28         70           101         DUMMY         -4462         -515         28         70           102         DUMMY         -4462         -515         28         70           103         VDDDO         -4370         -515         28         70           104         VDDDO         -4278         -515         28         70           105         VDDDO         -4278         -515         28 <t< td=""><td></td><td></td><td></td><td></td><td></td><td></td></t<>						
93         DUMMY         -4830         -515         28         70           94         DUMMY         -4784         -515         28         70           95         DUMMY         -4738         -515         28         70           96         DUMMY         -4692         -515         28         70           97         DUMMY         -4646         -515         28         70           98         DUMMY         -4600         -515         28         70           99         DUMMY         -4554         -515         28         70           100         DUMMY         -4462         -515         28         70           101         DUMMY         -4462         -515         28         70           102         DUMMY         -4416         -515         28         70           103         VDDDO         -4370         -515         28         70           104         VDDDO         -4278         -515         28         70           105         VDDDO         -4232         -515         28         70           106         VDDDO         -4186         -515         28         <						
94         DUMMY         -4784         -515         28         70           95         DUMMY         -4738         -515         28         70           96         DUMMY         -4692         -515         28         70           97         DUMMY         -4646         -515         28         70           98         DUMMY         -4600         -515         28         70           99         DUMMY         -4554         -515         28         70           100         DUMMY         -4508         -515         28         70           101         DUMMY         -4462         -515         28         70           102         DUMMY         -4416         -515         28         70           103         VDDDO         -4370         -515         28         70           104         VDDDO         -4278         -515         28         70           105         VDDDO         -4278         -515         28         70           106         VDDDO         -4186         -515         28         70           108         VDDDO         -4140         -515         28						
95         DUMMY         -4738         -515         28         70           96         DUMMY         -4692         -515         28         70           97         DUMMY         -4646         -515         28         70           98         DUMMY         -4600         -515         28         70           99         DUMMY         -4554         -515         28         70           100         DUMMY         -4508         -515         28         70           101         DUMMY         -4462         -515         28         70           102         DUMMY         -4416         -515         28         70           103         VDDDO         -4370         -515         28         70           104         VDDDO         -4324         -515         28         70           105         VDDDO         -4278         -515         28         70           106         VDDDO         -4232         -515         28         70           108         VDDDO         -4186         -515         28         70           109         VDDDO         -4094         -515         28						
96         DUMMY         -4692         -515         28         70           97         DUMMY         -4646         -515         28         70           98         DUMMY         -4600         -515         28         70           99         DUMMY         -4554         -515         28         70           100         DUMMY         -4508         -515         28         70           101         DUMMY         -4462         -515         28         70           102         DUMMY         -4416         -515         28         70           103         VDDDO         -4370         -515         28         70           104         VDDDO         -4324         -515         28         70           105         VDDDO         -4278         -515         28         70           106         VDDDO         -4232         -515         28         70           107         VDDDO         -4186         -515         28         70           108         VDDDO         -4140         -515         28         70           109         VDDDO         -4094         -515         28			_			
97         DUMMY         -4646         -515         28         70           98         DUMMY         -4600         -515         28         70           99         DUMMY         -4554         -515         28         70           100         DUMMY         -4508         -515         28         70           101         DUMMY         -4462         -515         28         70           102         DUMMY         -4416         -515         28         70           103         VDDDO         -4370         -515         28         70           104         VDDDO         -4324         -515         28         70           105         VDDDO         -4278         -515         28         70           106         VDDDO         -4232         -515         28         70           107         VDDDO         -4186         -515         28         70           108         VDDDO         -4140         -515         28         70           109         VDDDO         -4094         -515         28         70		_				
98         DUMMY         -4600         -515         28         70           99         DUMMY         -4554         -515         28         70           100         DUMMY         -4508         -515         28         70           101         DUMMY         -4462         -515         28         70           102         DUMMY         -4416         -515         28         70           103         VDDDO         -4370         -515         28         70           104         VDDDO         -4324         -515         28         70           105         VDDDO         -4278         -515         28         70           106         VDDDO         -4232         -515         28         70           107         VDDDO         -4186         -515         28         70           108         VDDDO         -4140         -515         28         70           109         VDDDO         -4094         -515         28         70						
99         DUMMY         -4554         -515         28         70           100         DUMMY         -4508         -515         28         70           101         DUMMY         -4462         -515         28         70           102         DUMMY         -4416         -515         28         70           103         VDDDO         -4370         -515         28         70           104         VDDDO         -4324         -515         28         70           105         VDDDO         -4278         -515         28         70           106         VDDDO         -4232         -515         28         70           107         VDDDO         -4186         -515         28         70           108         VDDDO         -4140         -515         28         70           109         VDDDO         -4094         -515         28         70						_
100         DUMMY         -4508         -515         28         70           101         DUMMY         -4462         -515         28         70           102         DUMMY         -4416         -515         28         70           103         VDDDO         -4370         -515         28         70           104         VDDDO         -4324         -515         28         70           105         VDDDO         -4278         -515         28         70           106         VDDDO         -4232         -515         28         70           107         VDDDO         -4186         -515         28         70           108         VDDDO         -4140         -515         28         70           109         VDDDO         -4094         -515         28         70						
101         DUMMY         -4462         -515         28         70           102         DUMMY         -4416         -515         28         70           103         VDDDO         -4370         -515         28         70           104         VDDDO         -4324         -515         28         70           105         VDDDO         -4278         -515         28         70           106         VDDDO         -4232         -515         28         70           107         VDDDO         -4186         -515         28         70           108         VDDDO         -4140         -515         28         70           109         VDDDO         -4094         -515         28         70						
102         DUMMY         -4416         -515         28         70           103         VDDDO         -4370         -515         28         70           104         VDDDO         -4324         -515         28         70           105         VDDDO         -4278         -515         28         70           106         VDDDO         -4232         -515         28         70           107         VDDDO         -4186         -515         28         70           108         VDDDO         -4140         -515         28         70           109         VDDDO         -4094         -515         28         70			_			
103         VDDDO         -4370         -515         28         70           104         VDDDO         -4324         -515         28         70           105         VDDDO         -4278         -515         28         70           106         VDDDO         -4232         -515         28         70           107         VDDDO         -4186         -515         28         70           108         VDDDO         -4140         -515         28         70           109         VDDDO         -4094         -515         28         70						
104         VDDDO         -4324         -515         28         70           105         VDDDO         -4278         -515         28         70           106         VDDDO         -4232         -515         28         70           107         VDDDO         -4186         -515         28         70           108         VDDDO         -4140         -515         28         70           109         VDDDO         -4094         -515         28         70						
105         VDDDO         -4278         -515         28         70           106         VDDDO         -4232         -515         28         70           107         VDDDO         -4186         -515         28         70           108         VDDDO         -4140         -515         28         70           109         VDDDO         -4094         -515         28         70						
106         VDDDO         -4232         -515         28         70           107         VDDDO         -4186         -515         28         70           108         VDDDO         -4140         -515         28         70           109         VDDDO         -4094         -515         28         70						
107         VDDDO         -4186         -515         28         70           108         VDDDO         -4140         -515         28         70           109         VDDDO         -4094         -515         28         70						
108         VDDDO         -4140         -515         28         70           109         VDDDO         -4094         -515         28         70	107					
109 VDDDO -4094 -515 28 70						
	110	VDDDO	-4048	-515	28	70
111 VDDD -4002 -515 28 70						
112 VDDD -3956 -515 28 70						
113 VDDD -3910 -515 28 70						
114 VDDD -3864 -515 28 70						

#	Pad	Х	Υ	W	Н
115	VDDD	-3818	-515	28	70
116	VDDD	-3772	-515	28	70
117	VDDD	-3726	-515	28	70
118	VDDD	-3680	-515	28	70
119	GNDA	-3634	-515	28	70
120	GNDA	-3588	-515	28	70
121	GNDA	-3542	-515	28	70
122	GNDA	-3496	-515	28	70
123	GNDA	-3450	-515	28	70
124	GNDA	-3404	-515	28	70
125	GNDA	-3358	-515	28	70
126	GNDA	-3312	-515	28	70
127	GNDA	-3266	-515	28	70
128	GNDA	-3220	-515	28	70
129	GND	-3174	-515	28	70
130	GND	-3128	-515	28	70
131	GND	-3082	-515	28	70
132	GND	-3036	-515	28	70
133	GND	-2990	-515	28	70
134	GND	-2944	-515	28	70
135	GND	-2898	-515	28	70
136	GND	-2852	-515	28	70
137	GND	-2806	-515	28	70
138	GND	-2760	-515	28	70
139	VDM	-2714	-515	28	70
140	VDM	-2668	-515	28	70
141	VDM	-2622	-515	28	70
142	VDM	-2576	-515	28	70
143	VDD	-2530	-515	28	70
144	VDD	-2484	-515	28	70
145	VDD	-2438	-515	28	70
146	VDD	-2392	-515	28	70
147	VDD	-2346	-515	28	70
148	VDD	-2300	-515	28	70
149	VDD	-2254	-515	28	70
150	VDD	-2208	-515	28	70
151	VDD	-2162	-515	28	70
152	VDD	-2116	-515	28	70
153	VDDIO	-2070	-515	28	70
154	VDDIO	-2024	-515	28	70
155	VDDIO	-1978	-515	28	70
156 157	VDDIO VDDIO	-1932 -1886	-515 -515	28	70 70
157 158	VDDIO	-1886 -1840	-515 -515	28 28	70 70
159	VDDIO	-1794	-515 -515	28	70
160	VDDIO	-1794	-515	28	70
161	VDDIO	-1748	-515	28	70
162	VDDIO	-1656	-515 -515	28	70
163	VDDIO	-1610	-515	28	70
164	DUMMY	-1564	-515	28	70
165	DUMMY	-1518	-515	28	70
166	DUMMY	-1472	-515	28	70
167	DUMMY	-1426	-515	28	70
168	DUMMY	-1380	-515	28	70
169	DUMMY	-1334	-515	28	70
170	DUMMY	-1288	-515	28	70
171	DUMMY	-1242	-515	28	70
172	DUMMY	-1196	-515	28	70
173	DUMMY	-1150	-515	28	70
174	DUMMY	-1104	-515	28	70
			0.0	v	. 0

ш	Dod	v	V	W	ш
#	Pad	X 4050	Y		H 70
175	DUMMY	-1058	-515	28	70
176	DUMMY	-1012	-515	28	70
177	DUMMY	-966	-515	28	70
178	DUMMY	-920	-515	28	70
179	DUMMY	-874	-515	28	70
180	DUMMY	-828	-515	28	70
181	DUMMY	-782	-515	28	70
182	DUMMY	-736	-515	28	70
183	DUMMY	-690	-515	28	70
184	DUMMY	-644	-515	28	70
185	DUMMY	-598	-515	28	70
186	DUMMY	-552	-515	28	70
187	DUMMY	-506	-515	28	70
188	DUMMY	-460	-515	28	70
189	DUMMY	-414	-515	28	70
190	DUMMY	-368	-515	28	70
191	DUMMY	-322	-515	28	70
192	DUMMY	-276	-515	28	70
193	DUMMY	-230	-515	28	70
194	DUMMY	-184	-515	28	70
195	M2M1_SYNC	-138	-515	28	70
196	M2M1_SYNC	-92	-515	28	70
197	M1M2_SYNC	-46	-515	28	70
198	M1M2_SYNC	0	-515	28	70
199	LSYNC	46	-515	28	70
200	LSYNC	92	-515	28	70
201	MM	138	-515	28	70
202	MM	184	-515	28	70
203	DUMMY	230	-515	28	70
204	DUMMY	276	-515	28	70
205	DUMMY	322	-515	28	70
206	DUMMY	368	-515	28	70
207	DUMMY	414	-515	28	70
208	DUMMY	460	-515	28	70
209	DUMMY	506	-515	28	70
210	DUMMY	552	-515	28	70
211	VDDA	598	-515	28	70
212	VDDA	644	-515	28	70
213	VDDA	690	-515	28	70
214	VDDA	736	-515	28	70
215	VDDA	782	-515	28	70
216	VDDA	828	-515	28	70
217	VDDA	874	-515	28	70
218	VDDA	920	-515	28	70
219	VDDA	966	-515	28	70
220	VDDA	1012	-515	28	70
221	VDDA	1058	-515	28	70
222	VDDA	1104	-515	28	70
223	VDDA	1150	-515	28	70
224	SDA1	1196	-515	28	70
225	SDA1	1242	-515	28	70
226	SDA	1288	-515	28	70
227	SDA	1334	-515	28	70
228	SCL	1380	-515	28	70
229	SCL	1426	-515	28	70
230	GND	1472	-515	28	70
231	CSB	1518	-515	28	70
232	CSB	1564	-515	28	70
233	VDDIO	1610	-515	28	70
234	DUMMY	1656	-515	28	70
۷۵4	DOMINI	1000	-010	20	70

			24	10.0	
#	Pad	X	Υ	W	H
235	DUMMY	1702	-515	28	70
236	GND	1748	-515	28	70
237	DC	1794	-515	28	70
238	DC	1840	-515	28	70
239	VDDIO	1886	-515	28	70
240	DUMMY	1932	-515	28	70
241	DUMMY	1978	-515	28	70
242	RST_N	2024	-515	28	70
243	RST_N	2070	-515	28	70
244	BUSY_N	2116	-515	28	70
245	BUSY_N	2162	-515	28	70
246	GND	2208	-515	28	70
247	DUMMY	2254	-515	28	70
248	DUMMY	2300	-515	28	70
249	DUMMY	2346	-515	28	70
250	CL	2392	-515	28	70
251	CL	2438	-515	28	70
252	CDEO	2484	-515	28	70
253	CDEO	2530	-515	28	70
254	CDAO	2576	-515	28	70
255	CDAO	2622	-515	28	70
256	CDAI	2668	-515	28	70
257	CDAI	2714	-515	28	70
258	CDEI	2760	-515	28	70
259	CDEI	2806	-515	28	70
260	GND	2852	-515	28	70
261	HSYNC	2898	-515	28	70
262	HSYNC	2944	-515	28	70
263	VDDIO	2990	-515	28	70
264	VSYNC	3036	-515	28	70
265	VSYNC	3082	-515	28	70
266	GND	3128	-515	28	70
267	DUMMY	3174	-515	28	70
268	VDDIO	3220	-515	28	70
269	BS	3266	-515	28	70
270	BS	3312	-515	28	70
271	GND	3358	-515	28	70
272	DUMMY	3404	-515	28	70
273	VDDIO	3450	-515	28	70
274	CHKGI	3496	-515	28	70
275	CHKGI	3542	-515	28	70
276	GND	3588	-515	28	70
277	MS	3634	-515	28	70
278	MS	3680	-515	28	70
279	VDDIO	3726	-515	28	70
280	GND	3772	-515	28	70
281	TSDA	3818	-515	28	70
282	TSDA	3864	-515	28	70
283	VDDIO	3910	-515	28	70
284	TSCL	3956	-515	28	70
285	TSCL	4002	-515	28	70
286	GND	4048	-515	28	70
287	CHKGO	4094	-515	28	70
288	CHKGO	4140	-515	28	70
289	DUMMY	4186	-515	28	70
290	DUMMY	4232	-515	28	70
291	DUMMY	4278	-515	28	70
292	DUMMY	4324	-515	28	70
293	DUMMY	4370	-515	28	70
294	DUMMY	4416	-515	28	70
	20.711711	0	0.10		. 0

#	Pad	X	Υ	W	Н
					<b>7</b> 0
295 296	TEST13	4462	-515	28 28	
	TEST13	4508	-515		70
297	TEST12	4554	-515	28	70
298	TEST12	4600	-515	28	70
299	TEST11	4646	-515	28	70
300	TEST11	4692	-515	28	70
301	TEST10	4738	-515	28	70
302	TEST10	4784	-515	28	70
303	TEST9	4830	-515	28	70
304	TEST9	4876	-515	28	70
305	TEST8	4922	-515	28	70
306	TEST8	4968	-515	28	70
307	TEST7	5014	-515	28	70
308	TEST7	5060	-515	28	70
309	TEST6	5106	-515	28	70
310	TEST6	5152	-515	28	70
311	DUMMY	5198	-515	28	70
312	DUMMY	5244	-515	28	70
313	TEST5	5290	-515	28	70
314	TEST5	5336	-515	28	70
315	TEST4	5382	-515	28	70
316	TEST4	5428	-515	28	70
317	TEST3	5474	-515	28	70
318	TEST3	5520	-515	28	70
319	TEST2	5566	-515	28	70
320	TEST2	5612	-515	28	70
320	TEST2			28	70
		5658	-515		
322	TEST1	5704	-515	28	70
323	DUMMY	5750	-515	28	70
324	DUMMY	5796	-515	28	70
325	DUMMY	5842	-515	28	70
326	DUMMY	5888	-515	28	70
327	DUMMY	5934	-515	28	70
328	DUMMY	5980	-515	28	70
329	DUMMY	6026	-515	28	70
330	DUMMY	6072	-515	28	70
331	DUMMY	6118	-515	28	70
332	DUMMY	6164	-515	28	70
333	DUMMY	6210	-515	28	70
334	DUMMY	6256	-515	28	70
335	VDHR	6302	-515	28	70
336	VDHR	6348	-515	28	70
337	VDHR	6394	-515	28	70
338	VDHR	6440	-515	28	70
339	VDHR	6486	-515	28	70
340	VDHR	6532	-515	28	70
341	VDHR	6578	-515	28	70
342	VDHR	6624	-515	28	70
343	VDHR	6670	-515	28	70
344	VDHR	6716	-515	28	70
345	VDHR	6762	-515	28	70
346	VDHR	6808	-515	28	70
347	VDHR	6854	-515	28	70
348	VDHR	6900	-515	28	70
349	VDHR	6946	-515	28	70
350	VDHR	6992	-515	28	70
	DUMMY			28	70
351 352		7038	-515 515		70
	DUMMY	7084	-515	28	
353	DUMMY	7130	-515	28	70
354	DUMMY	7176	-515	28	70

#	Pad	Х	Υ	W	Н
355	DUMMY	7222	-515	28	70
356	DUMMY	7268	-515	28	70
357	GNDA	7314	-515	28	70
358	FB	7360	-515	28	70
359	FB	7406	-515	28	70
360	GNDA	7452	-515	28	70
361	RESE	7498	-515	28	70
362	RESE	7544	-515	28	70
363	RESE	7590	-515	28	70
364	RESE	7636	-515	28	70
365	VDM	7682	-515	28	70
366	GDR	7728	-515	28	70
367	GDR	7774	-515	28	
					70
368	GDR	7820	-515	28	70
369	GDR	7866	-515	28	70
370	GDR	7912	-515	28	70
371	GDR	7958	-515	28	70
372	GDR	8004	-515	28	70
373	GDR	8050	-515	28	70
374	GDR	8096	-515	28	70
375	GDR	8142	-515	28	70
376	GDR	8188	-515	28	70
377	GDR	8234	-515	28	70
378	GDR	8280	-515	28	70
379	GDR	8326	-515	28	70
380	VDM	8372	-515	28	70
381	VCOM	8418	-515	28	70
382	VCOM	8464	-515	28	70
383	VCOM	8510	-515	28	70
384	VCOM	8556	-515	28	70
385	VCOM	8602	-515	28	70
386	VCOM	8648	-515	28	70
387	VCOM	8694	-515	28	70
388	VCOM	8740	-515	28	70
389	VCOM	8786	-515	28	70
390	VCOM	8832	-515	28	70
391	VCOM	8878	-515	28	70
392	VCOM	8924	-515	28	70
393	VCOM	8970	-515	28	70
394	DUMMY	9016	-515	28	70
395	DUMMY	9062	-515	28	70
396	DUMMY	9169.5	500	12	100
397	DUMMY	9156.5	381	12	100
398	DUMMY	9144.5	500	12	100
399	GD<0>	9131.5	381	12	100
400	G<0>	9119.5	500	12	100
401	G<2>	9106.5	381	12	100
402	G<4>	9094.5	500	12	100
403	G<6>	9081.5	381	12	100
404	G<8>	9069.5	500	12	100
405	G<10>	9056.5	381	12	100
406	G<12>	9044.5	500	12	100
407	G<14>	9031.5	381	12	100
408	G<16>	9019.5	500	12	100
409	G<18>	9006.5	381	12	100
410	G<20>	8994.5	500	12	100
411	G<22>	8981.5	381	12	100
412	G<24>	8969.5	500	12	100
413	G<26>	8956.5	381	12	100
414	G<28>	8944.5	500	12	100
717	0 -20-	UU-7U	550	14	100

#	Pad	Х	Υ	W	Н
415	G<30>	8931.5	381	12	100
416	G<32>	8919.5	500	12	100
417	G<34>	8906.5	381	12	100
418	G<36>	8894.5	500	12	100
419	G<38>	8881.5	381	12	100
420	G<40>	8869.5	500	12	100
421	G<42>	8856.5	381	12	100
422	G<44>	8844.5	500	12	100
423	G<46>	8831.5	381	12	100
424	G<48>	8819.5	500	12	100
425	G<50>	8806.5	381	12	100
426	G<52>	8794.5	500	12	100
427	G<54>	8781.5	381	12	100
428	G<56>	8769.5	500	12	100
429	G<58>	8756.5	381	12	100
430	G<60>	8744.5	500	12	100
431	G<62>	8731.5	381	12	100
432	G<64>	8719.5	500	12	100
433	G<66>	8706.5	381	12	100
434	G<68>	8694.5	500	12	100
435	G<70>	8681.5	381	12	100
436	G<72>	8669.5	500	12	100
437	G<74>	8656.5	381	12	100
438	G<76>	8644.5	500	12	100
439	G<78>	8631.5	381	12	100
440	G<80>	8619.5	500	12	100
441	G<82>	8606.5	381	12	100
442	G<84>	8594.5	500	12	100
443	G<86>	8581.5	381	12	100
444	G<88>	8569.5	500	12	100
445	G<90>	8556.5	381	12	100
446	G<92>	8544.5	500	12	100
447	G<94>	8531.5	381	12	100
448	G<96>	8519.5	500	12	100
449	G<98>	8506.5	381	12	100
450	G<100> G<102>	8494.5	500	12 12	100
451 452	G<102>	8481.5	381 500	12	100 100
453	G<104>	8469.5 8456.5	381	12	100
454	G<100>	8444.5	500	12	100
455	G<110>	8431.5	381	12	100
456	G<112>	8419.5	500	12	100
457	G<114>	8406.5	381	12	100
458	G<116>	8394.5	500	12	100
459	G<118>	8381.5	381	12	100
460	G<120>	8369.5	500	12	100
461	G<122>	8356.5	381	12	100
462	G<124>	8344.5	500	12	100
463	G<126>	8331.5	381	12	100
464	G<128>	8319.5	500	12	100
465	G<130>	8306.5	381	12	100
466	G<132>	8294.5	500	12	100
467	G<134>	8281.5	381	12	100
468	G<136>	8269.5	500	12	100
469	G<138>	8256.5	381	12	100
470	G<140>	8244.5	500	12	100
471	G<142>	8231.5	381	12	100
472	G<144>	8219.5	500	12	100
473	G<146>	8206.5	381	12	100
474	G<148>	8194.5	500	12	100

#	Pad	Х	Υ	W	Н
475	G<150>	8181.5	381	12	100
476	G<152>	8169.5	500	12	100
477	G<154>	8156.5	381	12	100
478	G<156>	8144.5	500	12	100
479	G<158>	8131.5	381	12	100
480	G<160>	8119.5	500	12	100
481	G<162>	8106.5	381	12	100
482	G<164>	8094.5	500	12	100
483	G<166>	8081.5	381	12	100
484	G<168>	8069.5	500	12	100
485	G<170>	8056.5	381	12	100
486	G<172>	8044.5	500	12	100
487	G<174>	8031.5	381	12	100
488	G<176>	8019.5	500	12	100
489	G<178>	8006.5	381	12	100
490	G<180>	7994.5	500	12	100
491	G<182>	7981.5	381	12	100
492	G<184>	7969.5	500	12	100
493	G<186>	7956.5	381	12	100
494	G<188>	7944.5	500	12	100
495	G<190>	7931.5	381	12	100
496	G<192>	7919.5	500	12	100
497	G<194>	7906.5	381	12	100
498	G<196>	7894.5	500	12	100
499	G<198>	7881.5	381	12	100
500	G<200>	7869.5	500	12	100
501	G<202>	7856.5	381	12	100
502	G<204>	7844.5	500	12	100
503	G<206>	7831.5	381	12	100
504	G<208>	7819.5	500	12	100
505	G<210>	7806.5	381	12	100
506	G<212>	7794.5	500	12	100
507	G<214>	7781.5	381	12	100
508	G<216>	7769.5	500	12	100
509	G<218>	7756.5 7744.5	381	12 12	100
510 511	G<220> G<222>	7731.5	500 381	12	100 100
512	G<224>	7719.5	500	12	100
513	G<226>	7706.5	381	12	100
514	G<228>	7694.5	500	12	100
515	G<230>	7681.5	381	12	100
516	G<232>	7669.5	500	12	100
517	G<234>	7656.5	381	12	100
518	G<236>	7644.5	500	12	100
519	G<238>	7631.5	381	12	100
520	G<240>	7619.5	500	12	100
521	G<242>	7606.5	381	12	100
522	G<244>	7594.5	500	12	100
523	G<246>	7581.5	381	12	100
524	G<248>	7569.5	500	12	100
525	G<250>	7556.5	381	12	100
526	G<252>	7544.5	500	12	100
527	G<254>	7531.5	381	12	100
528	G<256>	7519.5	500	12	100
529	G<258>	7506.5	381	12	100
530	G<260>	7494.5	500	12	100
531	G<262>	7481.5	381	12	100
532	G<264>	7469.5	500	12	100
533	G<266>	7456.5	381	12	100
534	G<268>	7444.5	500	12	100

,,	5 1	V	\ \/	107	
#	Pad	X 7424.5	Y 204	W	H
535	G<270>	7431.5	381	12	100
536 537	G<272>	7419.5	500	12 12	100
538	G<274> G<276>	7406.5 7394.5	381 500	12	100
539	G<278>	7394.5	381	12	100 100
	G<280>		500	12	
540 541	G<282>	7369.5 7356.5	381	12	100 100
542	G<284>	7344.5	500	12	100
543	G<286>	7344.5	381	12	100
544	G<288>	7319.5	500	12	100
545	G<290>	7306.5	381	12	100
546	G<292>	7294.5	500	12	100
547	G<294>	7281.5	381	12	100
548	G<296>	7269.5	500	12	100
549	G<298>	7256.5	381	12	100
550	G<300>	7244.5	500	12	100
551	G<302>	7231.5	381	12	100
552	G<304>	7219.5	500	12	100
553	G<306>	7206.5	381	12	100
554	G<308>	7194.5	500	12	100
555	G<310>	7181.5	381	12	100
556	G<312>	7169.5	500	12	100
557	G<314>	7156.5	381	12	100
558	G<316>	7144.5	500	12	100
559	G<318>	7131.5	381	12	100
560	G<320>	7119.5	500	12	100
561	G<322>	7106.5	381	12	100
562	G<324>	7094.5	500	12	100
563	G<326>	7081.5	381	12	100
564	G<328>	7069.5	500	12	100
565	G<330>	7056.5	381	12	100
566	G<332>	7044.5	500	12	100
567	G<334>	7031.5	381	12	100
568	G<336>	7019.5	500	12	100
569	G<338>	7006.5	381	12	100
570	G<340>	6994.5	500	12	100
571	G<342>	6981.5	381	12 12	100
572 573	G<344> G<346>	6969.5 6956.5	500 381	12	100 100
574	G<348>	6944.5		12	100
575	G<350>	6931.5	381	12	100
576	G<352>	6919.5	500	12	100
577	G<354>	6906.5	381	12	100
578	G<356>	6894.5	500	12	100
579	G<358>	6881.5	381	12	100
580	G<360>	6869.5	500	12	100
581	G<362>	6856.5	381	12	100
582	G<364>	6844.5	500	12	100
583	G<366>	6831.5	381	12	100
584	G<368>	6819.5	500	12	100
585	G<370>	6806.5	381	12	100
586	G<372>	6794.5	500	12	100
587	G<374>	6781.5	381	12	100
588	G<376>	6769.5	500	12	100
589	G<378>	6756.5	381	12	100
590	G<380>	6744.5	500	12	100
591	G<382>	6731.5	381	12	100
592	G<384>	6719.5	500	12	100
593	G<386>	6706.5	381	12	100
594	G<388>	6694.5	500	12	100

#	Pad	Х	Υ	W	Н
595	G<390>	6681.5	381	12	100
596	G<392>	6669.5	500	12	100
597	G<394>	6656.5	381	12	100
598	G<396>	6644.5	500	12	100
599	G<398>	6631.5	381	12	100
600	G<400>	6619.5	500	12	100
601	G<402>	6606.5	381	12	100
602	G<404>	6594.5	500	12	100
603	G<406>	6581.5	381	12	100
604	G<408>	6569.5	500	12	100
605	G<410>	6556.5	381	12	100
606	G<412>	6544.5	500	12	100
607	G<414>	6531.5	381	12	100
608	G<416>	6519.5	500	12	100
609	G<418>	6506.5	381	12	100
610	G<420>	6494.5	500	12	100
611	G<422>	6481.5	381	12	100
612	G<424>	6469.5	500	12	100
613	G<426>	6456.5	381	12	100
614	G<428>	6444.5	500	12	100
615	G<430>	6431.5	381	12	100
616	G<432>	6419.5	500	12	100
617	G<434>	6406.5	381	12	100
618	G<436>	6394.5	500	12	100
619	G<438>	6381.5	381	12	100
620	G<440>	6369.5	500	12	100
621	G<442>	6356.5	381	12	100
622	G<444>	6344.5	500	12	100
623	G<446>	6331.5	381	12	100
624	G<448>	6319.5	500	12	100
625 626	G<450> G<452>	6306.5 6294.5	381 500	12 12	100 100
627	G<454>	6281.5	381	12	100
628	G<456>	6269.5	500	12	100
629	G<458>	6256.5	381	12	100
630	G<460>	6244.5	500	12	100
631	G<462>	6231.5	381	12	100
632	G<464>	6219.5	500	12	100
633	G<466>	6206.5	381	12	100
634	G<468>	6194.5	500	12	100
635	G<470>	6181.5	381	12	100
636	G<472>	6169.5	500	12	100
637	G<474>	6156.5	381	12	100
638	G<476>	6144.5	500	12	100
639	G<478>	6131.5	381	12	100
640	G<480>	6119.5	500	12	100
641	G<482>	6106.5	381	12	100
642	G<484>	6094.5	500	12	100
643	G<486>	6081.5	381	12	100
644	G<488>	6069.5	500	12	100
645	G<490>	6056.5	381	12	100
646	G<492>	6044.5	500	12	100
647	G<494>	6031.5	381	12	100
648	G<496>	6019.5	500	12	100
649	G<498>	6006.5	381	12	100
650	G<500>	5994.5	500	12	100
651	G<502>	5981.5	381	12	100
652	G<504>	5969.5	500	12	100
653	G<506>	5956.5	381	12	100
654	G<508>	5944.5	500	12	100

#	Pad	Х	Υ	W	Н
655	G<510>	5931.5	381	12	100
656	G<510>	5919.5	500	12	100
657	G<514>	5906.5	381	12	100
658	G<516>	5894.5	500	12	100
659	G<518>	5881.5	381	12	100
660	G<520>	5869.5	500	12	100
661	G<522>	5856.5	381	12	100
662	G<524>	5844.5	500	12	100
663	G<526>	5831.5	381	12	100
664	G<528>	5819.5	500	12	100
665	G<530>	5806.5	381	12	100
666	G<532>	5794.5	500	12	100
667	G<534>	5781.5	381	12	100
668	G<536>	5769.5	500	12	100
669	G<538>	5756.5	381	12	100
670	G<540>	5744.5	500	12	100
671	G<542>	5731.5	381	12	100
672	G<544>	5719.5	500	12	100
673	G<546>	5706.5	381	12	100
674	G<548>	5694.5	500	12	100
675	G<550>	5681.5	381	12	100
676	G<552>	5669.5	500	12	100
677	G<554>	5656.5	381	12	100
678	G<556>	5644.5	500	12	100
679	G<558>	5631.5	381	12	100
680	G<560>	5619.5	500	12	100
681	G<562>	5606.5	381	12	100
682	G<564>	5594.5	500	12	100
683	G<566>	5581.5	381	12	100
684	G<568>	5569.5	500	12	100
685	G<570>	5556.5	381	12	100
686	G<572>	5544.5	500	12	100
687	G<574>	5531.5	381	12	100
688	G<576>	5519.5	500	12	100
689	G<578>	5506.5 5494.5	381	12 12	100
690 691	G<580> G<582>	5494.5	500 381	12	100 100
692	G<584>	5469.5	500	12	100
693	G<586>	5456.5	381	12	100
694	G<588>	5444.5	500	12	100
695	G<590>	5431.5	381	12	100
696	G<592>	5419.5	500	12	100
697	G<594>	5406.5	381	12	100
698	G<596>	5394.5	500	12	100
699	G<598>	5381.5	381	12	100
700	GD<2>	5369.5	500	12	100
701	DUMMY	5356.5	381	12	100
702	DUMMY	5344.5	500	12	100
703	DUMMY	5331.5	381	12	100
704	DUMMY	5232.5	500	12	100
705	DUMMY	5219.5	381	12	100
706	VBD<0>	5206.5	500	12	100
707	S<0>	5193.5	381	12	100
708	S<1>	5180.5	500	12	100
709	S<2>	5167.5	381	12	100
710	S<3>	5154.5	500	12	100
711	S<4>	5141.5	381	12	100
712	S<5>	5128.5	500	12	100
713	S<6>	5115.5	381	12	100
714	S<7>	5102.5	500	12	100

) ) ) ) ) ) ) ) ) ) )
) ) ) ) ) ) ) ) )
) ) ) ) ) ) ) )
) ) ) ) ) ) )
)
)
) ) ) )
) ) )
) ) )
) )
)
)
)
)
)
)
)
)
)
)
)
)
)
)
)
(
)
)
)
)
)
)
)
)
)
)
)
)
)
)
)
)
)
)
)
)
) ) )
) )

#	Dod	Х	Υ	W	Н
775	Pad S<68>	4309.5	381	12	100
776	S<69>	4296.5	500	12	100
777	S<70>	4283.5	381	12	100
778	S<71>	4270.5	500	12	100
779	S<72>	4257.5	381	12	100
780	S<73>	4244.5	500	12	100
781	S<74>	4231.5	381	12	100
782	S<75>	4218.5	500	12	100
783	S<76>	4205.5	381	12	100
784	S<77>	4192.5	500	12	100
785	S<78>	4179.5	381	12	100
786	S<79>	4166.5	500	12	100
787	S<80>	4153.5	381	12	100
788	S<81>	4140.5	500	12	100
789	S<82>	4127.5	381	12	100
790	S<83>	4114.5	500	12	100
791	S<84>	4101.5	381	12	100
792	S<85>	4088.5	500	12	100
793	S<86>	4075.5	381	12	100
794	S<87>	4062.5	500	12	100
795	S<88>	4049.5	381	12	100
796	S<89>	4036.5	500	12	100
797	S<90>	4023.5	381	12	100
798	S<91>	4010.5	500	12	100
799	S<92>	3997.5	381	12	100
800	S<93>	3984.5	500	12	100
801	S<94>	3971.5	381	12	100
802	S<95>	3958.5	500	12	100
803	S<96>	3945.5	381	12	100
804	S<97>	3932.5	500	12	100
805	S<98>	3919.5	381	12	100
806	S<99>	3906.5	500	12	100
807	S<100>	3893.5	381	12	100
808	S<101>	3880.5	500	12	100
809	S<102>	3867.5	381	12	100
810	S<103>	3854.5	500	12	100
811	S<104>	3841.5	381	12	100
812	S<105>	3828.5	500	12	100
813	S<106>	3815.5	381	12	100
814	S<107>	3802.5	500	12	100
815	S<108>	3789.5	381	12	100
816	S<109>	3776.5	500	12	100
817	S<110>	3763.5	381	12	100
818	S<111>	3750.5	500	12	100
819	S<112>	3737.5	381	12	100
820	S<113>	3724.5	500	12	100
821	S<114>	3711.5	381	12	100
822	S<115>	3698.5	500	12	100
823	S<116>	3685.5	381	12	100
824	S<117>	3672.5	500	12	100
825	S<118>	3659.5	381	12	100
826	S<119>	3646.5	500	12	100
827	S<120>	3633.5	381	12	100
828	S<121>	3620.5	500	12	100
829	S<122>	3607.5	381	12	100
830	S<123>	3594.5	500	12	100
831	S<124>	3581.5	381	12	100
832	S<125>	3568.5	500	12	100
833	S<126>	3555.5	381	12	100
834	S<127>	3542.5	500	12	100

#	Pad	Х	Υ	W	Н
835	S<128>	3529.5	381	12	100
836	S<129>	3516.5	500	12	100
837	S<130>	3503.5	381	12	100
838	S<131>	3490.5	500	12	100
839	S<132>	3477.5	381	12	100
840	S<133>	3464.5	500	12	100
841	S<134>	3451.5	381	12	100
842	S<135>	3438.5	500	12	100
843	S<136>	3425.5	381	12	100
844	S<137>	3412.5	500	12	100
845	S<138>	3399.5	381	12	100
846	S<139>	3386.5	500	12	100
847	S<140>	3373.5	381	12	100
848	S<141>	3360.5	500	12	100
849	S<142>	3347.5	381	12	100
850	S<143>	3334.5	500	12	100
851	S<144>	3321.5	381	12	100
852	S<145>	3308.5	500	12	100
853	S<146>	3295.5	381	12	100
854	S<147>	3282.5	500	12	100
855	S<148>	3269.5	381	12	100
856	S<149>	3256.5	500	12	100
857	S<150>	3243.5	381	12	100
858	S<151>	3230.5	500	12	100
859	S<152>	3217.5	381	12	100
860	S<153>	3204.5	500	12	100
861	S<154>	3191.5	381	12	100
862	S<155>	3178.5	500	12	100
863	S<156>	3165.5	381	12	100
864	S<157>	3152.5	500	12	100
865	S<158>	3139.5	381	12	100
866	S<159>	3126.5	500	12	100
867	S<160>	3113.5	381	12	100
868	S<161>	3100.5	500	12	100
869	S<162>	3087.5	381	12	100
870	S<163>	3074.5	500	12	100
871	S<164>	3061.5	381	12	100
872	S<165>	3048.5	500	12	100
873	S<166>	3035.5	381	12	100
874	S<167>	3022.5	500	12	100
875	S<168>	3009.5	381	12	100
876	S<169>	2996.5	500	12	100
877	S<170>	2983.5	381	12	100
878	S<171>	2970.5	500	12	100
879	S<172>	2957.5	381	12	100
880	S<173>	2944.5	500	12	100
881	S<174>	2931.5	381	12	100
882	S<175>	2918.5	500	12	100
883	S<176>	2905.5	381	12	100
884	S<177>	2892.5	500	12	100
885	S<178>	2879.5	381 500	12 12	100
886	S<179>	2866.5			100 100
887	S<180>	2853.5	381	12	
888	S<181>	2840.5	500	12	100
889	S<182>	2827.5	381	12 12	100
890	S<183>	2814.5	500	12	100
891	S<184>	2801.5	381		100
892	S<185>	2788.5	500	12	100
893	S<186>	2775.5	381	12	100
894	S<187>	2762.5	500	12	100

#	Pad	X	Υ	W	Н
895	S<188>	2749.5	381	12	100
896	S<189>	2736.5	500	12	100
897	S<190>	2723.5	381	12	100
898	S<190>	2710.5	500	12	100
899	S<191>	2697.5	381	12	100
900	S<193>	2684.5	500	12 12	100
901	S<194> S<195>	2671.5 2658.5	381	12	100
902	S<195>	2645.5	500 381	12	100 100
903	S<190>	2632.5	500	12	100
904	S<197>	2619.5	381	12	100
906	S<199>	2606.5	500	12 12	100
907	S<200>	2593.5	381		100
908	S<201>	2580.5	500	12	100
909	S<202>	2567.5	381	12	100
910	S<203>	2554.5	500	12	100
911	S<204>	2541.5	381	12	100
912	S<205>	2528.5	500	12	100
913	S<206>	2515.5	381	12	100
914	S<207>	2502.5	500	12	100
915	S<208>	2489.5	381	12	100
916	S<209>	2476.5	500	12	100
917	S<210>	2463.5	381	12	100
918	S<211>	2450.5	500	12	100
919	S<212>	2437.5	381	12	100
920	S<213>	2424.5	500	12	100
921	S<214>	2411.5	381	12	100
922	S<215>	2398.5	500	12	100
923	S<216>	2385.5	381	12	100
924	S<217>	2372.5	500	12	100
925	S<218>	2359.5	381	12	100
926	S<219>	2346.5	500	12	100
927	S<220>	2333.5	381	12	100
928	S<221>	2320.5	500	12	100
929	S<222>	2307.5	381	12	100
930	S<223>	2294.5	500	12	100
931	S<224>	2281.5	381	12	100
932	S<225>	2268.5	500	12	100
933	S<226>	2255.5	381	12	100
934	S<227>	2242.5	500	12	100
935	S<228>	2229.5	381	12	100
936	S<229>	2216.5	500	12	100
937	S<230>	2203.5	381	12	100
938	S<231>	2190.5	500	12	100
939	S<232>	2177.5	381	12	100
940	S<233>	2164.5	500	12	100
941	S<234>	2151.5	381	12	100
942	S<235>	2138.5	500	12	100
943	S<236>	2125.5	381	12	100
944	S<237>	2112.5	500	12	100
945	S<238>	2099.5	381	12	100
946	S<239>	2086.5	500	12	100
947	S<240>	2073.5	381	12	100
948	S<241>	2060.5	500	12	100
949	S<242>	2047.5	381	12	100
950	S<243>	2034.5	500	12	100
951	S<244>	2021.5	381	12	100
952	S<245>	2008.5	500	12	100
953	S<246>	1995.5	381	12	100
954	S<247>	1982.5	500	12	100

#	Pad	Х	Υ	W	Н
955	S<248>	1969.5	381	12	100
956	S<249>	1956.5	500	12	100
957	S<250>	1943.5	381	12	100
958	S<251>	1930.5	500	12	100
959	S<252>	1917.5	381	12	100
960	S<253>	1904.5	500	12	100
961	S<254>	1891.5	381	12	100
962	S<255>	1878.5	500	12	100
963	S<256>	1865.5	381	12	100
964	S<257>	1852.5	500	12	100
965	S<258>	1839.5	381	12	100
966	S<259>	1826.5	500	12	100
967	S<260>	1813.5	381	12	100
968	S<261>	1800.5	500	12	100
969	S<262>	1787.5	381	12	100
970	S<263>	1774.5	500	12	100
971	S<264>	1761.5	381	12	100
972	S<265>	1748.5	500	12	100
973	S<266>	1735.5	381	12	100
974	S<267>	1722.5	500	12	100
975	S<268>	1709.5	381	12	100
976	S<269>	1696.5	500	12	100
977	S<270>	1683.5	381	12	100
978	S<271>	1670.5	500	12	100
979	S<272>	1657.5	381	12	100
980	S<273>	1644.5	500	12	100
981	S<274>	1631.5	381	12	100
982	S<275>	1618.5	500	12	100
983	S<276>	1605.5	381	12	100
984	S<277>	1592.5	500	12	100
985	S<278>	1579.5	381	12	100
986	S<279>	1566.5	500	12	100
987	S<280>	1553.5	381	12	100
988	S<281>	1540.5	500	12	100
989	S<282> S<283>	1527.5	381	12 12	100
990 991	S<284>	1514.5 1501.5	500 381	12	100 100
991	S<285>	1488.5	500	12	100
993	S<286>	1475.5	381	12	100
994	S<287>	1462.5	500	12	100
995	S<288>	1449.5	381	12	100
996	S<289>	1436.5	500	12	100
997	S<290>	1423.5	381	12	100
998	S<291>	1410.5	500	12	100
999	S<292>	1397.5	381	12	100
1000	S<293>	1384.5	500	12	100
1001	S<294>	1371.5	381	12	100
1002	S<295>	1358.5	500	12	100
1003	S<296>	1345.5	381	12	100
1004	S<297>	1332.5	500	12	100
1005	S<298>	1319.5	381	12	100
1006	S<299>	1306.5	500	12	100
1007	S<300>	1293.5	381	12	100
1008	S<301>	1280.5	500	12	100
1009	S<302>	1267.5	381	12	100
1010	S<303>	1254.5	500	12	100
1011	S<304>	1241.5	381	12	100
1012	S<305>	1228.5	500	12	100
1013	S<306>	1215.5	381	12	100
1014	S<307>	1202.5	500	12	100

#	Pad	Х	Υ	W	Н
1015	S<308>	1189.5	381	12	100
1016	S<309>	1176.5	500	12	100
1017	S<310>	1163.5	381	12	100
1017	S<311>	1150.5	500	12	100
1019	S<312>	1137.5	381	12	100
1020	S<313>	1124.5	500	12	100
1020	S<314>	1111.5	381	12	100
1021	S<315>	1098.5	500	12	100
1023	S<316>	1085.5	381	12	100
1023	S<317>	1072.5	500	12	100
1025	S<318>	1059.5	381	12	100
1026	S<319>	1046.5	500	12	100
1027	S<320>	1033.5	381	12	100
1028	S<321>	1020.5	500	12	100
1029	S<322>	1007.5	381	12	100
1030	S<323>	994.5	500	12	100
1031	S<324>	981.5	381	12	100
1032	S<325>	968.5	500	12	100
1033	S<326>	955.5	381	12	100
1034	S<327>	942.5	500	12	100
1035	S<328>	929.5	381	12	100
1036	S<329>	916.5	500	12	100
1037	S<330>	903.5	381	12	100
1038	S<331>	890.5	500	12	100
1039	S<332>	877.5	381	12	100
1040	S<333>	864.5	500	12	100
1041	S<334>	851.5	381	12	100
1042	S<335>	838.5	500	12	100
1043	S<336>	825.5	381	12	100
1044	S<337>	812.5	500	12	100
1045	S<338>	799.5	381	12	100
1046	S<339>	786.5	500	12	100
1047	S<340>	773.5	381	12	100
1048	S<341>	760.5	500	12	100
1049	S<342>	747.5	381	12	100
1050	S<343>	734.5	500	12	100
1051	S<344>	721.5	381	12	100
1052	S<345>	708.5	500	12	100
1053	S<346>	695.5	381	12	100
1054	S<347>	682.5	500	12	100
1055	S<348>	669.5	381	12	100
1056	S<349>	656.5	500	12	100
1057	S<350>	643.5	381	12	100
1058	S<351>	630.5	500	12	100
1059	S<352>	617.5	381	12	100
1060	S<353>	604.5	500	12	100
1061	S<354>	591.5	381	12	100
1062	S<355>	578.5	500	12	100
1063	S<356>	565.5	381	12	100
1064	S<357>	552.5	500	12	100
1065	S<358>	539.5	381	12	100
1066	S<359>	526.5	500	12	100
1067	S<360>	513.5	381	12	100
1068	S<361>	500.5	500	12	100
1069	S<362>	487.5	381	12	100
1070	S<363>	474.5	500	12	100
1071	S<364>	461.5	381	12	100
1072	S<365>	448.5	500	12	100
1073	S<366>	435.5	381	12	100
1074	S<367>	422.5	500	12	100

#	Pad	Х	Υ	W	Н
1075	S<368>	409.5	381	12	100
1076	S<369>	396.5	500	12	100
1077	S<370>	383.5	381	12	100
1078	S<371>	370.5	500	12	100
1079	S<372>	357.5	381	12	100
1080	S<373>	344.5	500	12	100
1081	S<374>	331.5	381	12	100
1082	S<375>	318.5	500	12	100
1083	S<376>	305.5	381	12	100
1084	S<377>	292.5	500	12	100
1085	S<378>	279.5	381	12	100
1086	S<379>	266.5	500	12	100
1087	S<380>	253.5	381	12	100
1088	S<381>	240.5	500	12	100
1089	S<382>	227.5	381	12	100
1090	S<383>	214.5	500	12	100
1091	S<384>	201.5	381	12	100
1092	S<385>	188.5	500	12	100
1093	S<386>	175.5	381	12	100
1094	S<387>	162.5	500	12	100
1095	S<388>	149.5	381	12	100
1096	S<389>	136.5	500	12	100
1097	S<390>	123.5	381	12	100
1098	S<391>	110.5	500	12	100
1099	S<392>	97.5	381	12	100
1100	S<393>	84.5	500	12	100
1101	S<394>	71.5	381	12	100
1102	S<395>	58.5	500	12	100
1103	S<396>	45.5	381	12	100
1104	S<397>	32.5	500	12	100
1105	S<398>	19.5	381	12	100
1106 1107	S<399>	6.5	500	12	100
	S<400>	-6.5	381	12	100
1108 1109	S<401> S<402>	-19.5	500 381	12 12	100 100
11109	S<402>	-32.5 -45.5	500	12	100
1111	S<404>	-58.5	381	12	100
1112	S<405>	-71.5	500	12	100
1113	S<406>	-84.5	381	12	100
1114	S<407>	-97.5	500	12	100
1115	S<408>	-110.5	381	12	100
1116	S<409>	-123.5	500	12	100
1117	S<410>	-136.5	381	12	100
1118	S<411>	-149.5	500	12	100
1119	S<412>	-162.5	381	12	100
1120	S<413>	-175.5	500	12	100
1121	S<414>	-188.5	381	12	100
1122	S<415>	-201.5	500	12	100
1123	S<416>	-214.5	381	12	100
1124	S<417>	-227.5	500	12	100
1125	S<418>	-240.5	381	12	100
1126	S<419>	-253.5	500	12	100
1127	S<420>	-266.5	381	12	100
1128	S<421>	-279.5	500	12	100
1129	S<422>	-292.5	381	12	100
1130	S<423>	-305.5	500	12	100
1131	S<424>	-318.5	381	12	100
1132	S<425>	-331.5	500	12	100
1133	S<426>	-344.5	381	12	100
1134	S<427>	-357.5	500	12	100

щ	Deal	V	Υ	\A/	- 11
1135	Pad	X 270 F		W 12	H 100
	S<428> S<429>	-370.5	381	12 12	100 100
1136 1137	S<429>	-383.5 -396.5	500 381	12	100
1138	S<431>	-409.5	500	12	100
1139	S<431>	-422.5	381	12	100
1140	S<433>	-435.5	500	12	100
1141	S<434>	-435.5 -448.5	381	12	100
1142	S<435>	-461.5	500	12	100
1143	S<436>	- <del>4</del> 74.5	381	12	100
1144	S<437>	-487.5	500	12	100
1145	S<438>	-500.5	381	12	100
1146	S<439>	-513.5	500	12	100
1147	S<440>	-526.5	381	12	100
1148	S<441>	-539.5	500	12	100
1149	S<442>	-552.5	381	12	100
1150	S<443>	-565.5	500	12	100
1151	S<444>	-578.5	381	12	100
1152	S<445>	-591.5	500	12	100
1153	S<446>	-604.5	381	12	100
1154	S<447>	-617.5	500	12	100
1155	S<448>	-630.5	381	12	100
1156	S<449>	-643.5	500	12	100
1157	S<450>	-656.5	381	12	100
1158	S<451>	-669.5	500	12	100
1159	S<452>	-682.5	381	12	100
1160	S<453>	-695.5	500	12	100
1161	S<454>	-708.5	381	12	100
1162	S<455>	-721.5	500	12	100
1163	S<456>	-734.5	381	12	100
1164	S<457>	-747.5	500	12	100
1165	S<458>	-760.5	381	12	100
1166	S<459>	-773.5	500	12	100
1167	S<460>	-786.5	381	12	100
1168	S<461>	-799.5	500	12	100
1169	S<462>	-812.5	381	12	100
1170	S<463>	-825.5	500	12	100
1171	S<464>	-838.5	381	12	100
1172 1173	S<465> S<466>	-851.5	500	12	100
		-864.5	381	12	100
1174 1175	S<467> S<468>	-877.5	500 381	12 12	100 100
1176	S<469>	-890.5 -903.5	500	12	100
1177	S<470>	-916.5	381	12	100
1178	S<471>	-929.5	500	12	100
1179	S<472>	-942.5	381	12	100
1180	S<473>	-955.5	500	12	100
1181	S<474>	-968.5	381	12	100
1182	S<475>	-981.5	500	12	100
1183	S<476>	-994.5	381	12	100
1184	S<477>	-1007.5	500	12	100
1185	S<478>	-1020.5	381	12	100
1186	S<479>	-1033.5	500	12	100
1187	S<480>	-1046.5	381	12	100
1188	S<481>	-1059.5	500	12	100
1189	S<482>	-1072.5	381	12	100
1190	S<483>	-1085.5	500	12	100
1191	S<484>	-1098.5	381	12	100
1192	S<485>	-1111.5	500	12	100
1193	S<486>	-1124.5	381	12	100
1194	S<487>	-1137.5	500	12	100

#	Pad	Х	Υ	W	Н
1195	S<488>	-1150.5	381	12	100
1196	S<489>	-1163.5	500	12	100
1197	S<490>	-1176.5	381	12	100
1198	S<491>	-1170.5	500	12	100
1199	S<491>		381	12	100
	S<492>	-1202.5 -1215.5		12	
1200 1201	S<494>	-1213.5	500 381	12	100 100
1201	S<494>	-1241.5	500	12	100
1203	S<496> S<497>	-1254.5	381	12 12	100
1204	S<497>	-1267.5	500	12	100
1205		-1280.5	381		100
1206	S<499>	-1293.5	500	12	100
1207	S<500>	-1306.5	381	12	100
1208	S<501>	-1319.5	500	12	100
1209	S<502>	-1332.5	381	12	100
1210	S<503>	-1345.5	500	12	100
1211	S<504>	-1358.5	381	12	100
1212	S<505>	-1371.5	500	12	100
1213	S<506>	-1384.5	381	12	100
1214	S<507>	-1397.5	500	12	100
1215	S<508>	-1410.5	381	12	100
1216	S<509>	-1423.5	500	12	100
1217	S<510>	-1436.5	381	12	100
1218	S<511>	-1449.5	500	12	100
1219	S<512>	-1462.5	381	12	100
1220	S<513>	-1475.5	500	12	100
1221	S<514>	-1488.5	381	12	100
1222	S<515>	-1501.5	500	12	100
1223	S<516>	-1514.5	381	12	100
1224	S<517>	-1527.5	500	12	100
1225	S<518>	-1540.5	381	12	100
1226	S<519>	-1553.5	500	12	100
1227	S<520>	-1566.5	381	12	100
1228	S<521>	-1579.5	500	12	100
1229	S<522>	-1592.5	381	12	100
1230	S<523>	-1605.5	500	12	100
1231	S<524>	-1618.5	381	12	100
1232	S<525>	-1631.5	500	12	100
1233	S<526>	-1644.5	381	12	100
1234	S<527>	-1657.5	500	12	100
1235	S<528>	-1670.5	381	12	100
1236	S<529>	-1683.5	500	12	100
1237	S<530>	-1696.5	381	12	100
1238	S<531>	-1709.5	500	12	100
1239	S<532>	-1722.5	381	12	100
1240	S<533>	-1735.5	500	12	100
1241	S<534>	-1748.5	381	12	100
1242	S<535>	-1761.5	500	12	100
1243	S<536>	-1774.5	381	12	100
1244	S<537>	-1787.5	500	12	100
1245	S<538>	-1800.5	381	12	100
1246	S<539>	-1813.5	500	12	100
1247	S<540>	-1826.5	381	12	100
1248	S<541>	-1839.5	500	12	100
1249	S<542>	-1852.5	381	12	100
1250	S<543>	-1865.5	500	12	100
1251	S<544>	-1878.5	381	12	100
1252	S<545>	-1891.5	500	12	100
1253	S<546>	-1904.5	381	12	100
1254	S<547>	-1904.5	500	12	100
1207	יודטי ט	1017.0	550	14	100

#	Pad	Х	Υ	W	Н
1255	S<548>	-1930.5	381	12	100
1256	S<549>	-1930.5	500	12	100
1257	S<550>	-1943.5	381	12	100
1258	S<551>	-1969.5	500	12	100
1259	S<552>	-1982.5	381	12	100
1260	S<553>	-1902.5	500	12	100
1261	S<554>	-2008.5	381	12	100
1262	S<555>	-2008.5	500	12	100
1263	S<556>	-2021.5	381	12	100
1264	S<557>	-2047.5	500	12	100
1265	S<558>	-2060.5	381	12	100
1266	S<559>	-2073.5	500	12	100
1267	S<560>	-2086.5	381	12	100
1268	S<561>	-2099.5	500	12	100
1269	S<562>	-2112.5	381	12	100
1270	S<563>	-2125.5	500	12	100
1271	S<564>	-2138.5	381	12	100
1272	S<565>	-2151.5	500	12	100
1273	S<566>	-2164.5	381	12	100
1274	S<567>	-2177.5	500	12	100
1275	S<568>	-2190.5	381	12	100
1276	S<569>	-2203.5	500	12	100
1277	S<570>	-2216.5	381	12	100
1278	S<571>	-2229.5	500	12	100
1279	S<572>	-2242.5	381	12	100
1280	S<573>	-2255.5	500	12	100
1281	S<574>	-2268.5	381	12	100
1282	S<575>	-2281.5	500	12	100
1283	S<576>	-2294.5	381	12	100
1284	S<577>	-2307.5	500	12	100
1285	S<578>	-2320.5	381	12	100
1286	S<579>	-2333.5	500	12	100
1287	S<580>	-2346.5	381	12	100
1288	S<581>	-2359.5	500	12	100
1289	S<582>	-2372.5	381	12	100
1290	S<583>	-2385.5	500	12	100
1291	S<584>	-2398.5	381	12	100
1292	S<585>	-2411.5	500	12	100
1293	S<586>	-2424.5	381	12	100
1294	S<587>	-2437.5	500	12	100
1295	S<588>	-2450.5	381	12	100
1296	S<589>	-2463.5	500	12	100
1297	S<590>	-2476.5	381	12	100
1298	S<591>	-2489.5	500	12	100
1299	S<592>	-2502.5	381	12	100
1300	S<593>	-2515.5	500	12	100
1301	S<594>	-2528.5	381	12	100
1302	S<595>	-2541.5	500	12	100
1303	S<596>	-2554.5	381	12	100
1304	S<597>	-2567.5	500	12	100
1305	S<598>	-2580.5	381	12	100
1306	S<599>	-2593.5	500	12	100
1307	S<600>	-2606.5	381	12	100
1308	S<601>	-2619.5	500	12	100
1309	S<602>	-2632.5	381	12	100
1310	S<603>	-2645.5	500	12	100
1311	S<604>	-2658.5	381	12	100
1312	S<605>	-2671.5	500	12	100
1313	S<606>	-2684.5	381	12	100
1314	S<607>	-2697.5	500	12	100

# Pad X Y W H 1315	
1316         S<609>         -2723.5         500         12         100           1317         S<610>         -2736.5         381         12         100           1318         S<611>         -2749.5         500         12         100           1319         S<612>         -2762.5         381         12         100           1320         S<613>         -2775.5         500         12         100           1321         S<614>         -2788.5         381         12         100           1322         S<615>         -2801.5         500         12         100           1323         S<616>         -2814.5         381         12         100           1324         S<617>         -2827.5         500         12         100           1325         S<618>         -2840.5         381         12         100           1327         S<620>         -2853.5         500         12         100           1328         S<621>         -2879.5         500         12         100           1330         S<622>         -2892.5         381         12         100           1331         S<624>         -	
1317         S<610>         -2736.5         381         12         100           1318         S<611>         -2749.5         500         12         100           1319         S<612>         -2762.5         381         12         100           1320         S<613>         -2775.5         500         12         100           1321         S<614>         -2788.5         381         12         100           1322         S<615>         -2801.5         500         12         100           1323         S<616>         -2814.5         381         12         100           1323         S<616>         -2840.5         381         12         100           1324         S<617>         -2827.5         500         12         100           1325         S<618>         -2840.5         381         12         100           1327         S<620>         -2866.5         381         12         100           1328         S<621>         -2879.5         500         12         100           1330         S<622>         -2892.5         381         12         100           1331         S<624>         -	
1318         S<611>         -2749.5         500         12         10           1319         S<612>         -2762.5         381         12         10           1320         S<613>         -2775.5         500         12         10           1321         S<614>         -2788.5         381         12         10           1322         S<615>         -2801.5         500         12         10           1323         S<616>         -2814.5         381         12         10           1324         S<617>         -2827.5         500         12         10           1325         S<618>         -2840.5         381         12         10           1326         S<619>         -2853.5         500         12         10           1327         S<620>         -2866.5         381         12         10           1328         S<621>         -2879.5         500         12         10           1330         S<622>         -2892.5         381         12         10           1331         S<624>         -2918.5         381         12         10           1333         S<626>         -2931.5	
1319         S<612>         -2762.5         381         12         100           1320         S<613>         -2775.5         500         12         100           1321         S<614>         -2788.5         381         12         100           1322         S<615>         -2801.5         500         12         100           1323         S<616>         -2814.5         381         12         100           1324         S<617>         -2827.5         500         12         100           1325         S<618>         -2840.5         381         12         100           1326         S<619>         -2853.5         500         12         100           1327         S<620>         -2866.5         381         12         100           1328         S<621>         -2879.5         500         12         100           1329         S<622>         -2892.5         381         12         100           1330         S<623>         -2905.5         500         12         100           1331         S<626>         -2918.5         381         12         100           1333         S<626>         -	
1320         S<613>         -2775.5         500         12         100           1321         S<614>         -2788.5         381         12         100           1322         S<615>         -2801.5         500         12         100           1323         S<616>         -2814.5         381         12         100           1324         S<617>         -2827.5         500         12         100           1325         S<618>         -2840.5         381         12         100           1326         S<619>         -2853.5         500         12         100           1327         S<620>         -2866.5         381         12         100           1328         S<621>         -2879.5         500         12         100           1329         S<622>         -2892.5         381         12         100           1330         S<622>         -2892.5         500         12         100           1331         S<622>         -2918.5         500         12         100           1333         S<6262>         -2931.5         500         12         100           1333         S<6262> <td< td=""><td></td></td<>	
1321         S<614>         -2788.5         381         12         100           1322         S<615>         -2801.5         500         12         100           1323         S<616>         -2814.5         381         12         100           1324         S<617>         -2827.5         500         12         100           1325         S<618>         -2840.5         381         12         100           1326         S<619>         -2853.5         500         12         100           1327         S<620>         -2866.5         381         12         100           1328         S<621>         -2879.5         500         12         100           1329         S<622>         -2892.5         381         12         100           1329         S<622>         -2892.5         381         12         100           1330         S<622>         -2892.5         381         12         100           1331         S<624>         -2918.5         381         12         100           1333         S<626>         -2944.5         381         12         100           1334         S<627>         -	
1322         S<615>         -2801.5         500         12         100           1323         S<616>         -2814.5         381         12         100           1324         S<617>         -2827.5         500         12         100           1325         S<618>         -2840.5         381         12         100           1326         S<619>         -2853.5         500         12         100           1327         S<620>         -2866.5         381         12         100           1328         S<621>         -2879.5         500         12         100           1329         S<622>         -2892.5         381         12         100           1330         S<623>         -2905.5         500         12         100           1331         S<624>         -2918.5         381         12         100           1332         S<625>         -2931.5         500         12         100           1333         S<626>         -2944.5         381         12         100           1334         S<627>         -2957.5         500         12         100           1335         S<628>         -	
1323         S<616>         -2814.5         381         12         10           1324         S<617>         -2827.5         500         12         10           1325         S<618>         -2840.5         381         12         10           1326         S<619>         -2853.5         500         12         10           1327         S<620>         -2866.5         381         12         10           1328         S<621>         -2879.5         500         12         10           1329         S<622>         -2892.5         381         12         10           1330         S<622>         -2892.5         500         12         10           1331         S<622>         -2995.5         500         12         10           1331         S<624>         -2918.5         381         12         10           1332         S<625>         -2931.5         500         12         10           1333         S<626>         -2944.5         381         12         10           1334         S<627>         -2957.5         500         12         10           1335         S<628>         -2970.5	
1324         S<617>         -2827.5         500         12         100           1325         S<618>         -2840.5         381         12         100           1326         S<619>         -2853.5         500         12         100           1327         S<620>         -2866.5         381         12         100           1328         S<621>         -2879.5         500         12         100           1329         S<622>         -2892.5         381         12         100           1330         S<623>         -2905.5         500         12         100           1331         S<624>         -2918.5         381         12         100           1332         S<625>         -2931.5         500         12         100           1333         S<626>         -2944.5         381         12         100           1334         S<627>         -2957.5         500         12         100           1335         S<628>         -2970.5         381         12         100           1337         S<630>         -2983.5         500         12         100           1338         S<631>         -	
1325         S<618>         -2840.5         381         12         100           1326         S<619>         -2853.5         500         12         100           1327         S<620>         -2866.5         381         12         100           1328         S<621>         -2879.5         500         12         100           1329         S<622>         -2892.5         381         12         100           1330         S<623>         -2905.5         500         12         100           1331         S<624>         -2918.5         381         12         100           1332         S<625>         -2931.5         500         12         100           1333         S<626>         -2944.5         381         12         100           1334         S<627>         -2957.5         500         12         100           1335         S<628>         -2970.5         381         12         100           1337         S<630>         -2983.5         500         12         100           1337         S<630>         -2996.5         381         12         100           1339         S<632>         -	
1326         S<619>         -2853.5         500         12         100           1327         S<620>         -2866.5         381         12         100           1328         S<621>         -2879.5         500         12         100           1329         S<622>         -2892.5         381         12         100           1330         S<623>         -2905.5         500         12         100           1331         S<624>         -2918.5         381         12         100           1332         S<625>         -2931.5         500         12         100           1333         S<626>         -2944.5         381         12         100           1334         S<627>         -2957.5         500         12         100           1335         S<628>         -2970.5         381         12         100           1336         S<629>         -2983.5         500         12         100           1337         S<630>         -2996.5         381         12         100           1338         S<631>         -3009.5         500         12         100           1340         S<633>         -	
1327         S<620>         -2866.5         381         12         100           1328         S<621>         -2879.5         500         12         100           1329         S<622>         -2892.5         381         12         100           1330         S<623>         -2905.5         500         12         100           1331         S<624>         -2918.5         381         12         100           1332         S<625>         -2931.5         500         12         100           1333         S<626>         -2944.5         381         12         100           1334         S<627>         -2957.5         500         12         100           1335         S<628>         -2970.5         381         12         100           1336         S<629>         -2983.5         500         12         100           1337         S<630>         -2996.5         381         12         100           1338         S<631>         -3009.5         500         12         100           1340         S<633>         -3035.5         500         12         100           1341         S<634>         -	
1328         S<621>         -2879.5         500         12         100           1329         S<622>         -2892.5         381         12         100           1330         S<623>         -2905.5         500         12         100           1331         S<624>         -2918.5         381         12         100           1332         S<625>         -2931.5         500         12         100           1333         S<626>         -2944.5         381         12         100           1334         S<627>         -2957.5         500         12         100           1335         S<628>         -2970.5         381         12         100           1336         S<629>         -2983.5         500         12         100           1337         S<630>         -2996.5         381         12         100           1338         S<631>         -3009.5         500         12         100           1339         S<632>         -3022.5         381         12         100           1340         S<633>         -3035.5         500         12         100           1341         S<634>         -	0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0
1329         \$<622>         -2892.5         381         12         100           1330         \$<623>         -2905.5         500         12         100           1331         \$<624>         -2918.5         381         12         100           1332         \$<625>         -2931.5         500         12         100           1333         \$<626>         -2944.5         381         12         100           1334         \$<626>         -2957.5         500         12         100           1335         \$<628>         -2970.5         381         12         100           1336         \$<629>         -2983.5         500         12         100           1337         \$<630>         -2996.5         381         12         100           1338         \$<631>         -3009.5         500         12         100           1339         \$<632>         -3022.5         381         12         100           1340         \$<633>         -3035.5         500         12         100           1341         \$<634>         -3048.5         381         12         100           1342         \$<635>         -	
1330         S<623>         -2905.5         500         12         100           1331         S<624>         -2918.5         381         12         100           1332         S<625>         -2931.5         500         12         100           1333         S<626>         -2944.5         381         12         100           1334         S<627>         -2957.5         500         12         100           1335         S<628>         -2970.5         381         12         100           1336         S<629>         -2983.5         500         12         100           1337         S<630>         -2996.5         381         12         100           1338         S<631>         -3009.5         500         12         100           1339         S<632>         -3022.5         381         12         100           1340         S<633>         -3035.5         500         12         100           1341         S<634>         -3048.5         381         12         100           1342         S<635>         -3061.5         500         12         100           1343         S<636>         -	0
1331         \$<624>         -2918.5         381         12         100           1332         \$<625>         -2931.5         500         12         100           1333         \$<626>         -2944.5         381         12         100           1334         \$<627>         -2957.5         500         12         100           1335         \$<628>         -2970.5         381         12         100           1336         \$<629>         -2983.5         500         12         100           1337         \$<630>         -2996.5         381         12         100           1338         \$<631>         -3009.5         500         12         100           1339         \$<632>         -3022.5         381         12         100           1340         \$<633>         -3035.5         500         12         100           1341         \$<634>         -3048.5         381         12         100           1342         \$<635>         -3061.5         500         12         100           1343         \$<636>         -3074.5         381         12         100           1344         \$<637>         -	0
1332         S<625>         -2931.5         500         12         100           1333         S<626>         -2944.5         381         12         100           1334         S<627>         -2957.5         500         12         100           1335         S<628>         -2970.5         381         12         100           1336         S<629>         -2983.5         500         12         100           1337         S<630>         -2996.5         381         12         100           1338         S<631>         -3009.5         500         12         100           1339         S<632>         -3022.5         381         12         100           1340         S<633>         -3035.5         500         12         100           1341         S<634>         -3048.5         381         12         100           1342         S<635>         -3061.5         500         12         100           1343         S<636>         -3074.5         381         12         100           1344         S<637>         -3087.5         500         12         100           1345         S<638>         -	0
1333         \$<626>         -2944.5         381         12         100           1334         \$<627>         -2957.5         500         12         100           1335         \$<628>         -2970.5         381         12         100           1336         \$<629>         -2983.5         500         12         100           1337         \$<630>         -2996.5         381         12         100           1338         \$<631>         -3009.5         500         12         100           1338         \$<631>         -3009.5         500         12         100           1339         \$<632>         -3022.5         381         12         100           1340         \$<633>         -3035.5         500         12         100           1341         \$<634>         -3048.5         381         12         100           1342         \$<635>         -3061.5         500         12         100           1343         \$<636>         -3074.5         381         12         100           1344         \$<637>         -3087.5         500         12         100           1345         \$<638>         -	0
1334         \$<627>         -2957.5         500         12         100           1335         \$<628>         -2970.5         381         12         100           1336         \$<629>         -2983.5         500         12         100           1337         \$<630>         -2996.5         381         12         100           1338         \$<631>         -3009.5         500         12         100           1339         \$<632>         -3022.5         381         12         100           1340         \$<633>         -3035.5         500         12         100           1341         \$<634>         -3048.5         381         12         100           1342         \$<635>         -3061.5         500         12         100           1343         \$<636>         -3074.5         381         12         100           1344         \$<637>         -3087.5         500         12         100           1345         \$<638>         -3100.5         381         12         100           1346         \$<639>         -3113.5         500         12         100           1347         \$<640>         -	0 0
1335         S<628>         -2970.5         381         12         100           1336         S<629>         -2983.5         500         12         100           1337         S<630>         -2996.5         381         12         100           1338         S<631>         -3009.5         500         12         100           1339         S<632>         -3022.5         381         12         100           1340         S<633>         -3035.5         500         12         100           1341         S<634>         -3048.5         381         12         100           1342         S<635>         -3061.5         500         12         100           1343         S<636>         -3074.5         381         12         100           1344         S<637>         -3087.5         500         12         100           1345         S<638>         -3100.5         381         12         100           1346         S<639>         -3113.5         500         12         100           1347         S<640>         -3126.5         381         12         100           1348         S<641>         -	0
1336         S<629>         -2983.5         500         12         100           1337         S<630>         -2996.5         381         12         100           1338         S<631>         -3009.5         500         12         100           1339         S<632>         -3022.5         381         12         100           1340         S<633>         -3035.5         500         12         100           1341         S<634>         -3048.5         381         12         100           1342         S<635>         -3061.5         500         12         100           1343         S<636>         -3074.5         381         12         100           1344         S<637>         -3087.5         500         12         100           1345         S<638>         -3100.5         381         12         100           1346         S<639>         -3113.5         500         12         100           1347         S<640>         -3126.5         381         12         100           1348         S<641>         -3139.5         500         12         100           1349         S<642>         -	
1337         \$<630>         -2996.5         381         12         100           1338         \$<631>         -3009.5         500         12         100           1339         \$<632>         -3022.5         381         12         100           1340         \$<633>         -3035.5         500         12         100           1341         \$<634>         -3048.5         381         12         100           1342         \$<635>         -3061.5         500         12         100           1343         \$<636>         -3074.5         381         12         100           1344         \$<637>         -3087.5         500         12         100           1345         \$<638>         -3100.5         381         12         100           1346         \$<639>         -3113.5         500         12         100           1347         \$<640>         -3126.5         381         12         100           1348         \$<641>         -3139.5         500         12         100           1349         \$<642>         -3152.5         381         12         100           1350         \$<643>         -	י ח
1338         S<631>         -3009.5         500         12         100           1339         S<632>         -3022.5         381         12         100           1340         S<633>         -3035.5         500         12         100           1341         S<634>         -3048.5         381         12         100           1342         S<635>         -3061.5         500         12         100           1343         S<636>         -3074.5         381         12         100           1344         S<637>         -3087.5         500         12         100           1345         S<638>         -3100.5         381         12         100           1346         S<639>         -3113.5         500         12         100           1347         S<640>         -3126.5         381         12         10           1348         S<641>         -3139.5         500         12         10           1349         S<642>         -3152.5         381         12         10           1350         S<643>         -3165.5         500         12         10	-
1339         \$<632>         -3022.5         381         12         100           1340         \$<633>         -3035.5         500         12         100           1341         \$<634>         -3048.5         381         12         100           1342         \$<635>         -3061.5         500         12         100           1343         \$<636>         -3074.5         381         12         100           1344         \$<637>         -3087.5         500         12         100           1345         \$<638>         -3100.5         381         12         100           1346         \$<639>         -3113.5         500         12         100           1347         \$<640>         -3126.5         381         12         100           1348         \$<641>         -3139.5         500         12         100           1349         \$<642>         -3152.5         381         12         100           1350         \$<643>         -3165.5         500         12         100	
1340         S<633>         -3035.5         500         12         100           1341         S<634>         -3048.5         381         12         100           1342         S<635>         -3061.5         500         12         100           1343         S<636>         -3074.5         381         12         100           1344         S<637>         -3087.5         500         12         100           1345         S<638>         -3100.5         381         12         100           1346         S<639>         -3113.5         500         12         100           1347         S<640>         -3126.5         381         12         100           1348         S<641>         -3139.5         500         12         100           1349         S<642>         -3152.5         381         12         100           1350         S<643>         -3165.5         500         12         100	
1341         S<634>         -3048.5         381         12         100           1342         S<635>         -3061.5         500         12         100           1343         S<636>         -3074.5         381         12         100           1344         S<637>         -3087.5         500         12         100           1345         S<638>         -3100.5         381         12         100           1346         S<639>         -3113.5         500         12         100           1347         S<640>         -3126.5         381         12         100           1348         S<641>         -3139.5         500         12         100           1349         S<642>         -3152.5         381         12         100           1350         S<643>         -3165.5         500         12         100	-
1342         S<635>         -3061.5         500         12         100           1343         S<636>         -3074.5         381         12         100           1344         S<637>         -3087.5         500         12         100           1345         S<638>         -3100.5         381         12         100           1346         S<639>         -3113.5         500         12         100           1347         S<640>         -3126.5         381         12         100           1348         S<641>         -3139.5         500         12         100           1349         S<642>         -3152.5         381         12         100           1350         S<643>         -3165.5         500         12         100	
1343         \$<636>         -3074.5         381         12         100           1344         \$<637>         -3087.5         500         12         100           1345         \$<638>         -3100.5         381         12         100           1346         \$<639>         -3113.5         500         12         100           1347         \$<640>         -3126.5         381         12         100           1348         \$<641>         -3139.5         500         12         100           1349         \$<642>         -3152.5         381         12         100           1350         \$<643>         -3165.5         500         12         100	
1344         S<637>         -3087.5         500         12         100           1345         S<638>         -3100.5         381         12         100           1346         S<639>         -3113.5         500         12         100           1347         S<640>         -3126.5         381         12         100           1348         S<641>         -3139.5         500         12         100           1349         S<642>         -3152.5         381         12         100           1350         S<643>         -3165.5         500         12         100	
1345         S<638>         -3100.5         381         12         100           1346         S<639>         -3113.5         500         12         100           1347         S<640>         -3126.5         381         12         100           1348         S<641>         -3139.5         500         12         100           1349         S<642>         -3152.5         381         12         100           1350         S<643>         -3165.5         500         12         100	
1346         S<639>         -3113.5         500         12         100           1347         S<640>         -3126.5         381         12         100           1348         S<641>         -3139.5         500         12         100           1349         S<642>         -3152.5         381         12         100           1350         S<643>         -3165.5         500         12         100	
1347         S<640>         -3126.5         381         12         100           1348         S<641>         -3139.5         500         12         100           1349         S<642>         -3152.5         381         12         100           1350         S<643>         -3165.5         500         12         100	
1348         S<641>         -3139.5         500         12         100           1349         S<642>         -3152.5         381         12         100           1350         S<643>         -3165.5         500         12         100	_
1349         S<642>         -3152.5         381         12         100           1350         S<643>         -3165.5         500         12         100	
1350 S<643> -3165.5 500 12 100	
I 1351   S<644>   -3178.5   381   12   10	
1352 S<645> -3191.5 500 12 100	
1353 S<646> -3204.5 381 12 100	
1354 S<647> -3217.5 500 12 100	
1355 S<648> -3230.5 381 12 10	
1356 S<649> -3243.5 500 12 100	
1357 S<650> -3256.5 381 12 100	
1358 S<651> -3269.5 500 12 10	
1359 S<652> -3282.5 381 12 10	
1360 S<653> -3295.5 500 12 100	
1361 S<654> -3308.5 381 12 10	
1362 S<655> -3321.5 500 12 100	
1363 S<656> -3334.5 381 12 100	
1364 S<657> -3347.5 500 12 100	
1365 S<658> -3360.5 381 12 10	
1366 S<659> -3373.5 500 12 100	
1367 S<660> -3386.5 381 12 10	J
1368 S<661> -3399.5 500 12 100	
1369 S<662> -3412.5 381 12 100	)
1370 S<663> -3425.5 500 12 100	
1371 S<664> -3438.5 381 12 10	0
1372 S<665> -3451.5 500 12 100	0 0
1373 S<666> -3464.5 381 12 10	0
1374 S<667> -3477.5 500 12 100	0

#	Pad	Х	Υ	W	Н
1375	S<668>	-3490.5	381	12	100
1376	S<669>	-3503.5	500	12	100
1377	S<670>	-3516.5	381	12	100
1378	S<671>	-3529.5	500	12	100
1379	S<672>	-3542.5	381	12	100
1380	S<673>	-3555.5	500	12	100
1381	S<674>	-3568.5	381	12	100
1382	S<675>	-3581.5	500	12	100
1383	S<676>	-3594.5	381	12	100
1384	S<677>	-3607.5	500	12	100
1385	S<678>	-3620.5	381	12	100
1386	S<679>	-3633.5	500	12	100
1387	S<680>	-3646.5	381	12	100
1388	S<681>	-3659.5	500	12	100
1389	S<682>	-3672.5	381	12	100
1390	S<683>	-3685.5	500	12	100
1391	S<684>	-3698.5	381	12	100
1392	S<685>	-3711.5	500	12	100
1393	S<686>	-3724.5	381	12	100
1394	S<687>	-3737.5	500	12	100
1395	S<688>	-3750.5	381	12	100
1396	S<689>	-3763.5	500	12	100
1397	S<690>	-3776.5	381	12	100
1398	S<691>	-3789.5	500	12	100
1399	S<692>	-3802.5	381	12	100
1400	S<693>	-3815.5	500	12	100
1401	S<694>	-3828.5	381	12	100
1402	S<695>	-3841.5	500	12	100
1403	S<696>	-3854.5	381	12	100
1404	S<697>	-3867.5	500	12	100
1405	S<698>	-3880.5	381	12	100
1406	S<699>	-3893.5	500	12	100
1407	S<700>	-3906.5	381	12	100
1408	S<701>	-3919.5	500	12	100
1409	S<702> S<703>	-3932.5	381	12 12	100
1410 1411	S<703>	-3945.5 -3958.5	500 381	12	100 100
1412	S<704>	-3971.5	500	12	100
1413	S<705>	-3984.5	381	12	100
1414	S<700>	-3997.5	500	12	100
1415	S<707>	-4010.5	381	12	100
1416	S<709>	-4023.5	500	12	100
1417	S<710>	-4036.5	381	12	100
1418	S<711>	-4049.5	500	12	100
1419	S<712>	-4062.5	381	12	100
1420	S<713>	-4075.5	500	12	100
1421	S<714>	-4088.5	381	12	100
1422	S<715>	-4101.5	500	12	100
1423	S<716>	-4114.5	381	12	100
1424	S<717>	-4127.5	500	12	100
1425	S<718>	-4140.5	381	12	100
1426	S<719>	-4153.5	500	12	100
1427	S<720>	-4166.5	381	12	100
1428	S<721>	-4179.5	500	12	100
1429	S<722>	-4192.5	381	12	100
1430	S<723>	-4205.5	500	12	100
1431	S<724>	-4218.5	381	12	100
1432	S<725>	-4231.5	500	12	100
1433	S<726>	-4244.5	381	12	100
1434	S<727>	-4257.5	500	12	100

#	Pad	Х	Υ	W	Н
1435	S<728>	-4270.5	381	12	100
1436	S<729>	-4283.5	500	12	100
1437	S<730>	-4296.5	381	12	100
1438	S<731>	-4309.5	500	12	100
1439	S<732>	-4322.5	381	12	100
1440	S<733>	-4335.5	500	12	100
1441	S<734>	-4348.5	381	12	100
1442	S<735>	-4361.5	500	12	100
1443	S<736>	-4374.5	381	12	100
1444	S<737>	-4387.5	500	12	100
1445	S<738>	-4400.5	381	12	100
1446	S<739>	-4413.5	500	12	100
1447	S<740>	-4426.5	381	12	100
1448	S<741>	-4439.5	500	12	100
1449	S<742>	-4452.5	381	12	100
1449	S<742>	-4465.5	500	12	100
1451	S<744>	-4478.5	381	12	100
1452	S<745>	-4491.5	500	12	100
1453	S<746>	-4504.5	381	12	100
1454	S<747>	-4517.5	500	12	100
1455	S<748>	-4530.5	381	12	100
1456	S<749>	-4543.5	500	12	100
1457	S<750>	-4556.5	381	12	100
1458	S<751>	-4569.5	500	12	100
1459	S<752>	-4582.5	381	12	100
1460	S<753>	-4595.5	500	12	100
1461	S<754>	-4608.5	381	12	100
1462	S<755>	-4621.5	500	12	100
1463	S<756>	-4634.5	381	12	100
1464	S<757>	-4647.5	500	12	100
1465	S<758>	-4660.5	381	12	100
1466	S<759>	-4673.5	500	12	100
1467	S<760>	-4686.5	381	12	100
1468	S<761>	-4699.5	500	12	100
1469	S<762>	-4712.5	381	12	100
1470	S<763>	-4725.5	500	12	100
1471	S<764>	-4738.5	381	12	100
1472	S<765>	-4751.5	500	12	100
1473	S<766>	-4764.5	381	12	100
1474	S<767>	-4777.5	500	12	100
1475	S<768>	-4790.5	381	12	100
1476	S<769>	-4803.5	500	12	100
1477	S<770>	-4816.5	381	12	100
1478	S<771>	-4829.5	500	12	100
1479	S<772>	-4842.5	381	12	100
1480	S<773>	-4855.5	500	12	100
1481	S<774>	-4868.5	381	12	100
1482	S<775>	-4881.5	500	12	100
1483	S<776>	-4894.5	381	12	100
1484	S<777>	-4907.5	500	12	100
1485	S<778>	-4920.5	381	12	100
1486	S<779>	-4933.5	500	12	100
1487	S<780>	-4946.5	381	12	100
1488	S<781>	-4959.5	500	12	100
1489	S<782>	-4972.5	381	12	100
1490	S<783>	-4985.5	500	12	100
1491	S<784>	-4998.5	381	12	100
1492	S<785>	-5011.5	500	12	100
1493	S<786>	-5024.5	381	12	100
1494	S<787>	-5037.5	500	12	100

#	Pad	Х	Υ	W	Н
1495	S<788>	-5050.5	381	12	100
1496	S<789>	-5063.5	500	12	100
1497	S<790>	-5076.5	381	12	100
1498	S<791>	-5089.5	500	12	100
1499	S<792>	-5102.5	381	12	100
1500	S<793>	-5102.5	500	12	100
1501	S<794>	-5128.5	381	12	100
1502	S<795>	-5120.5	500	12	100
1502	S<796>	-5154.5	381	12	100
1504	S<797>	-5167.5	500	12	100
1505	S<798>	-5180.5	381	12	100
1506	S<799>	-5193.5	500	12	100
1507	VBD<1>	-5206.5	381	12	100
1508	DUMMY	-5219.5	500	12	100
1509	DUMMY	-5232.5	381	12	100
1510	DUMMY	-5331.5	500	12	100
1511	DUMMY	-5344.5	381	12	100
1512	DUMMY	-5356.5	500	12	100
1513	GD<3>	-5369.5	381	12	100
1514	G<599>	-5381.5	500	12	100
1515	G<597>	-5394.5	381	12	100
1516	G<595>	-5406.5	500	12	100
1517	G<593>	-5419.5	381	12	100
1518	G<591>	-5431.5	500	12	100
1519	G<589>	-5444.5	381	12	100
1520	G<587>	-5456.5	500	12	100
1521	G<585>	-5469.5	381	12	100
1522	G<583>	-5481.5	500	12	100
1523	G<581>	-5494.5	381	12	100
1524	G<579>	-5506.5	500	12	100
1525	G<577>	-5519.5	381	12	100
1526	G<575>	-5531.5	500	12	100
1527	G<573>	-5544.5	381	12	100
1528	G<571>	-5556.5	500	12	100
1529	G<569>	-5569.5	381	12	100
1530	G<567>	-5581.5	500	12	100
1531	G<565>	-5594.5	381	12	100
1532	G<563>	-5606.5	500	12	100
1533	G<561>	-5619.5	381	12	100
1534	G<559>	-5631.5	500	12	100
1535	G<557>	-5644.5	381	12	100
1536	G<555>	-5656.5	500	12	100
1537	G<553>	-5669.5	381	12	100
1538	G<551>	-5681.5	500	12	100
1539	G<549>	-5694.5	381	12	100
1540	G<547>	-5706.5	500	12	100
1541	G<545>	-5719.5	381	12	100
1542	G<543>	-5731.5	500	12	100
1543	G<541>	-5744.5	381	12	100
1544	G<539>	-5756.5	500	12	100
1545 1546	G<537>	-5769.5 5791.5	381	12 12	100
	G<535>	-5781.5 5704.5	500		100
1547 1548	G<533>	-5794.5	381	12 12	100 100
	G<531>	-5806.5 -5810.5	381		
1549 1550	G<529> G<527>	-5819.5 -5831.5	381 500	12 12	100 100
1551	G<527>	-5844.5	381	12	100
1552	G<523>	-5856.5	500	12	100
1553	G<523>	-5869.5	381	12	100
1554	G<521>	-5881.5	500	12	100
.007	0 1010	0001.0	500	14	100

#	Pad	Х	Υ	W	Н
1555	G<517>	-5894.5	381	12	100
1556	G<515>	-5906.5	500	12	100
1557	G<513>	-5919.5	381	12	100
1558	G<511>	-5931.5	500	12	100
1559	G<509>	-5944.5	381	12	100
1560	G<507>	-5956.5	500	12	100
1561	G<505>	-5969.5	381	12	100
1562	G<503>	-5981.5	500	12	100
1563	G<501>	-5994.5	381	12	100
1564	G<499>	-6006.5	500	12	100
1565	G<497>	-6019.5	381	12	100
1566	G<495>	-6031.5	500	12	100
1567	G<493>	-6044.5	381	12	100
1568	G<491>	-6056.5	500	12	100
1569	G<489>	-6069.5	381	12	100
1570	G<487>	-6081.5	500	12	100
1571	G<485>	-6094.5	381	12	100
1572	G<483>	-6106.5	500	12	100
1573	G<481>	-6119.5	381	12	100
1574	G<479>	-6131.5	500	12	100
1575	G<477>	-6144.5	381	12	100
1576	G<475>	-6156.5	500	12	100
1577	G<473>	-6169.5	381	12	100
1578	G<471>	-6181.5	500	12	100
1579	G<469>	-6194.5	381	12	100
1580	G<467>	-6206.5	500	12	100
1581	G<465>	-6219.5	381	12	100
1582	G<463>	-6231.5	500	12	100
1583	G<461>	-6244.5	381	12	100
1584	G<459>	-6256.5	500	12	100
1585	G<457>	-6269.5	381	12	100
1586	G<455>	-6281.5	500	12	100
1587	G<453>	-6294.5	381	12	100
1588	G<451>	-6306.5	500	12	100
1589	G<449>	-6319.5	381	12	100
1590	G<447>	-6331.5	500	12	100
1591	G<445>	-6344.5	381	12	100
1592	G<443>	-6356.5	500	12	100
1593	G<441>	-6369.5	381	12	100
1594	G<439>	-6381.5	500	12	100
1595	G<437>	-6394.5	381	12	100
1596	G<435>	-6406.5	500	12	100
1597	G<433>	-6419.5	381	12	100
1598	G<431>	-6431.5	500	12	100
1599	G<429>	-6444.5	381	12	100
1600	G<427>	-6456.5	500	12	100
1601	G<425>	-6469.5	381	12	100
1602	G<423>	-6481.5	500	12	100
1603	G<421>	-6494.5	381	12	100
1604	G<419>	-6506.5	500	12	100
1605	G<417>	-6519.5	381	12	100
1606	G<415>	-6531.5	500	12	100
1607	G<413>	-6544.5	381	12	100
1608	G<411>	-6556.5	500	12	100
1609	G<409>	-6569.5	381	12	100
1610	G<407>	-6581.5	500	12	100
1611	G<405>	-6594.5	381	12	100
1612	G<403>	-6606.5	500	12	100
1613	G<401>	-6619.5	381	12	100
1614	G<399>	-6631.5	500	12	100


#	Pad	Х	Υ	W	Н
1615	G<397>	-6644.5	381	12	100
1616	G<395>	-6656.5	500	12	100
1617	G<393>	-6669.5	381	12	100
1618	G<391>	-6681.5	500	12	100
1619	G<389>	-6694.5	381	12	100
1620	G<387>	-6706.5	500	12	100
1621	G<385>	-6719.5	381	12	100
1622	G<383>	-6731.5	500	12	100
1623	G<381>	-6744.5	381	12	100
1624	G<379>	-6756.5	500	12	100
1625	G<377>	-6769.5	381	12	100
1626	G<375>	-6781.5	500	12	100
1627	G<373>	-6794.5	381	12	100
1628	G<371>	-6806.5	500	12	100
1629	G<369>	-6819.5	381	12	100
1630	G<367>	-6831.5	500	12	100
1631	G<365>	-6844.5	381	12	100
1632	G<363>	-6856.5	500	12	100
1633	G<361>	-6869.5	381	12	100
1634	G<359>	-6881.5	500	12	100
1635	G<357>	-6894.5	381	12	100
1636	G<355>	-6906.5	500	12	100
1637	G<353>	-6919.5	381	12	100
1638	G<351>	-6931.5	500	12	100
1639	G<349>	-6944.5	381	12	100
1640	G<347>	-6956.5	500	12	100
1641	G<345>	-6969.5	381	12	100
1642	G<343>	-6981.5	500	12	100
1643	G<341>	-6994.5	381	12	100
1644	G<339>	-7006.5	500	12	100
1645	G<337>	-7019.5	381	12	100
1646	G<335>	-7031.5	500	12	100
1647	G<333>	-7044.5	381	12	100
1648	G<331>	-7056.5	500	12	100
1649	G<329>	-7069.5	381	12	100
1650	G<327>	-7081.5	500	12	100
1651	G<325>	-7094.5	381	12	100
1652	G<323>	-7106.5	500	12	100
1653	G<321>	-7119.5	381	12	100
1654	G<319>	-7131.5	500	12	100
1655	G<317>	-7144.5	381	12	100
1656	G<315>	-7156.5	500	12	100
1657	G<313>	-7169.5	381	12	100
1658	G<311>	-7181.5	500	12	100
1659	G<309>	-7194.5	381	12	100
1660	G<307>	-7206.5	500	12	100
1661	G<305>	-7219.5	381	12	100
1662	G<303>	-7231.5	500	12	100
1663	G<301>	-7244.5	381	12	100
1664	G<299>	-7256.5	500	12	100
1665	G<297>	-7269.5	381	12	100
1666	G<295>	-7281.5	500	12	100
1667	G<293>	-7294.5	381	12	100
1668	G<291>	-7306.5	500	12	100
1669	G<289>	-7319.5	381	12	100
1670	G<287>	-7331.5	500	12	100
1671	G<285>	-7344.5	381	12	100
1672	G<283>	-7356.5	500	12	100
1673	G<281>	-7369.5	381	12	100
1674	G<279>	-7381.5	500	12	100

#	Pad	Х	Υ	W	Н
1675	G<277>	-7394.5	381	12	100
1676	G<275>	-7406.5	500	12	100
1677	G<273>	-7419.5	381	12	100
1678	G<271>	-7431.5	500	12	100
1679	G<269>	-7444.5	381	12	100
1680	G<267>	-7456.5	500	12	100
1681	G<265>	-7469.5	381	12	100
1682	G<263>	-7481.5	500	12	100
1683	G<261>	-7494.5	381	12	100
1684	G<259>	-7506.5	500	12	100
1685	G<257>	-7519.5	381	12	100
1686	G<255>	-7531.5	500	12	100
1687	G<253>	-7544.5	381	12	100
1688	G<251>	-7556.5	500	12	100
1689	G<249>	-7569.5	381	12	100
1690	G<247>	-7581.5	500	12	100
1691	G<245>	-7594.5	381	12	100
1692	G<243>	-7606.5	500	12	100
1693	G<241>	-7619.5	381	12	100
1694	G<239>	-7631.5	500	12	100
1695	G<237>	-7644.5	381	12	100
1696	G<235>	-7656.5	500	12	100
1697	G<233>	-7669.5	381	12	100
1698	G<231>	-7681.5	500	12	100
1699	G<229>	-7694.5	381	12	100
1700	G<227>	-7706.5	500	12	100
1701	G<225>	-7719.5	381	12	100
1702	G<223>	-7731.5	500	12	100
1703	G<221>	-7744.5	381	12	100
1704	G<219>	-7756.5	500	12	100
1705	G<217>	-7769.5	381	12	100
1706	G<215>	-7781.5	500	12	100
1707	G<213>	-7794.5	381	12	100
1708	G<211>	-7806.5	500	12	100
1709	G<209>	-7819.5	381	12	100
1710	G<207>	-7831.5	500	12	100
1711	G<205>	-7844.5	381	12	100
1712	G<203>	-7856.5	500	12	100
1713	G<201>	-7869.5	381	12	100
1714	G<199>	-7881.5	500	12	100
1715	G<197>	-7894.5	381	12 12	100
1716	G<195>	-7906.5	500		100
1717 1718	G<193> G<191>	-7919.5 -7931.5	381 500	12 12	100 100
1719	G<189>	-7931.5 -7944.5	381	12	100
1719	G<187>	-79 <del>44</del> .5	500	12	100
1721	G<185>	-7969.5	381	12	100
1721	G<183>	-7981.5	500	12	100
1723	G<181>	-7994.5	381	12	100
1723	G<179>	-8006.5	500	12	100
1725	G<177>	-8019.5	381	12	100
1726	G<175>	-8031.5	500	12	100
1727	G<173>	-8044.5	381	12	100
1728	G<171>	-8056.5	500	12	100
1729	G<169>	-8069.5	381	12	100
1730	G<167>	-8081.5	500	12	100
1731	G<165>	-8094.5	381	12	100
1732	G<163>	-8106.5	500	12	100
1733	G<161>	-8119.5	381	12	100
1734	G<159>	-8131.5	500	12	100
				_	

#	Pad	X	Υ	W	Н
1735	G<157>	-8144.5		12	
1736	G<155>	-8156.5	381 500	12	100 100
	G<153>			12	
1737 1738	G<151>	-8169.5 -8181.5	381 500	12	100 100
1739	G<149>	-8194.5	381	12	100
1740	G<149>	_		12	
1740	G<147>	-8206.5	500 381	12	100 100
1741	G<143>	-8219.5 -8231.5	500	12	100
1742	G<143>	-8244.5	381	12	100
1744	G<139>	-8256.5	500	12	100
1745	G<137>	-8269.5	381	12	100
1746	G<135>	-8281.5	500	12	100
1747	G<133>	-8294.5	381	12	100
1748	G<131>	-8306.5	500	12	100
1749	G<129>	-8319.5	381	12	100
1750	G<127>	-8331.5	500	12	100
1751	G<125>	-8344.5	381	12	100
1752	G<123>	-8356.5	500	12	100
1753	G<121>	-8369.5	381	12	100
1754	G<119>	-8381.5	500	12	100
1755	G<117>	-8394.5	381	12	100
1756	G<115>	-8406.5	500	12	100
1757	G<113>	-8419.5	381	12	100
1758	G<111>	-8431.5	500	12	100
1759	G<109>	-8444.5	381	12	100
1760	G<107>	-8456.5	500	12	100
1761	G<105>	-8469.5	381	12	100
1762	G<103>	-8481.5	500	12	100
1763	G<101>	-8494.5	381	12	100
1764	G<99>	-8506.5	500	12	100
1765	G<97>	-8519.5	381	12	100
1766	G<95>	-8531.5	500	12	100
1767	G<93>	-8544.5	381	12	100
1768	G<91>	-8556.5	500	12	100
1769	G<89>	-8569.5	381	12	100
1770	G<87>	-8581.5	500	12	100
1771	G<85>	-8594.5	381	12	100
1772	G<83>	-8606.5	500	12	100
1773	G<81>	-8619.5	381	12	100
1774	G<79>	-8631.5	500	12	100
1775	G<77>	-8644.5	381	12	100
1776	G<75>	-8656.5	500	12	100
1777	G<73>	-8669.5	381	12	100
1778	G<71>	-8681.5	500	12	100
1779	G<69>	-8694.5	381	12	100
1780	G<67>	-8706.5	500	12	100
1781	G<65>	-8719.5	381	12	100
1782	G<63>	-8731.5	500	12	100
1783	G<61>	-8744.5	381	12	100
1784	G<59>	-8756.5	500	12	100
1785	G<57>	-8769.5	381	12 12	100
1786	G<55>	-8781.5	500		100
1787	G<53>	-8794.5	381	12	100
1788	G<51>	-8806.5	500	12	100
1789 1790	G<49> G<47>	-8819.5	381	12 12	100 100
		-8831.5	500		
1791	G<45> G<43>	-8844.5	381	12 12	100
1792		-8856.5	500		100
1793 1794	G<41> G<39>	-8869.5	381	12 12	100
1794	G-38/	-8881.5	500	12	100

#	Pad	Х	Υ	W	Н
1795	G<37>	-8894.5	381	12	100
1796	G<35>	-8906.5	500	12	100
1797	G<33>	-8919.5	381	12	100
1798	G<31>	-8931.5	500	12	100
1799	G<29>	-8944.5	381	12	100
1800	G<27>	-8956.5	500	12	100
1801	G<25>	-8969.5	381	12	100
1802	G<23>	-8981.5	500	12	100
1803	G<21>	-8994.5	381	12	100
1804	G<19>	-9006.5	500	12	100
1805	G<17>	-9019.5	381	12	100
1806	G<15>	-9031.5	500	12	100
1807	G<13>	-9044.5	381	12	100
1808	G<11>	-9056.5	500	12	100
1809	G<9>	-9069.5	381	12	100
1810	G<7>	-9081.5	500	12	100
1811	G<5>	-9094.5	381	12	100
1812	G<3>	-9106.5	500	12	100
1813	G<1>	-9119.5	381	12	100
1814	GD<1>	-9131.5	500	12	100
1815	DUMMY	-9144.5	381	12	100
1816	DUMMY	-9156.5	500	12	100
1817	DUMMY	-9169.5	381	12	100

### **Output Pad Location**

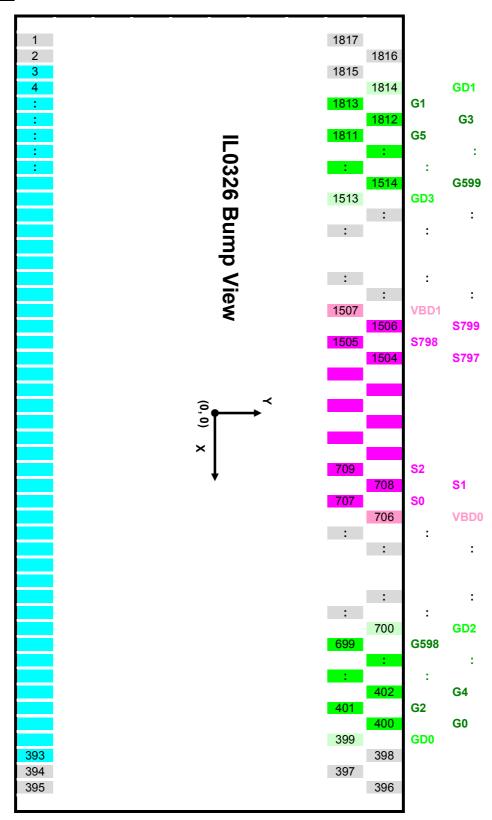



# **TRAY INFORMATION**

(TBD)