

Abandoned Farmstead - Barn, Silos & Sheds

Buildings & Civic Property · 2026-09-30

OVERALL CONDITION	15	10	4	1
CRITICAL	Findings	P1 Immediate	P2 Planned	P3 Monitor

Source footage	rural_farm_set
Footage length	Still images
Frames analysed	14
Raw observations	20 (0 rejected as likely false alarms)
Detection model	Claude Opus 5.5 (frames reviewed in a Claude Code session, not via API)
Triage model	TypeSafe Jev (jev-1.13.0)
Processing time	13.4 s

How urgent is each priority

P1	Immediate (within 24-72 h)
P2	Planned (within 30 days)
P3	Scheduled / monitor (next maintenance cycle)


1. Executive summary

An abandoned farmstead with a gambrel barn, three stave silos with metal domes, a free-standing brick silo and several open-sided sheds. The buildings are past routine repair and several are actively collapsing. The barn roof has large holes, sagging bays and a collapsed far end (F-08, F-07), with a loose metal sheet hanging inside (F-06). The roofless brick silo is leaning noticeably (F-02), and the sheds have collapsed with rusted roofing on the ground (F-09, F-01). Graffiti and a parked car show that people are coming onto the site (F-10), and a power pole with a transformer stands next to the collapsed sheds (F-03). The main risk is to people, not to the buildings: the priority is to keep everyone off the site and decide which structures to demolish.

Key risks

- Collapse of the leaning brick silo onto anyone nearby (F-02).
- Further roof collapse inside the barn and falling sheets (F-08, F-07, F-06).
- Trespassers entering dangerous structures (F-10).
- A possibly live electrical service next to demolition work (F-03).
- Loose sheets blowing off domes and sheds in high wind (F-11, F-13).

Findings by category

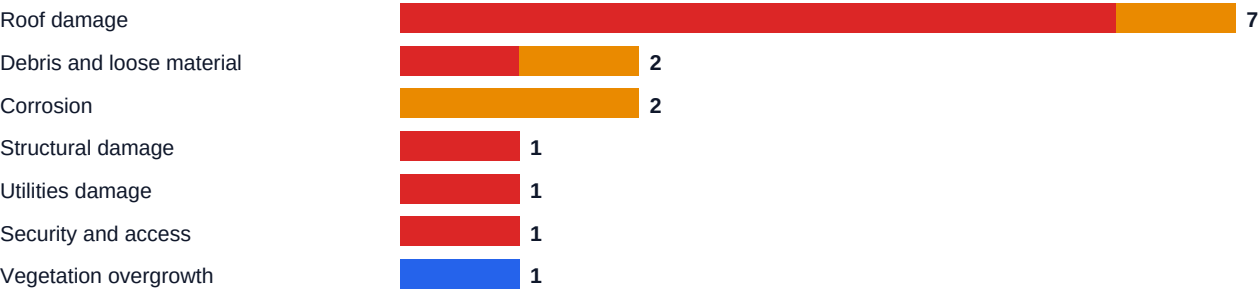

2. Action plan

Immediate (24-72 hours)

- Fence the whole farmstead and post danger signs; set a fall zone around the leaning silo (F-10, F-02).
- Keep everyone out of the barn and away from the sheds (F-08, F-09).
- Ask the utility whether the service at the pole is live and have it disconnected (F-03).

Next 30 days

- Structural engineer's assessment of every structure: stabilise, dismantle or demolish.
- Collect loose metal sheets and secure or remove loose dome panels (F-13, F-11).
- Board up the barn openings (F-05).

Next 90 days

- Carry out the demolition or stabilisation plan, starting with the leaning silo and collapsed sheds.
- If the stave silos are kept, clear the vines and recoat or replace the domes (F-15, F-14, F-12).

3. Findings register

All findings, most urgent first. Each is detailed with photos and repair steps in section 4.

ID	Time	Issue	Category	Severity	Priority	Action
F-01	still	Collapsed shed roof lying on the ground	roof damage	Critical (4.0)	P1	Keep out / make safe
F-02	still	Roofless brick silo leaning	structural damage	Critical (4.0)	P1	Keep out / make safe
F-03	still	Power pole with transformer next to derelict sheds	utilities damage	Critical (4.0)	P1	Keep out / make safe
F-04	still	Open top of roofless silo	roof damage	Critical (4.0)	P1	Keep out / make safe
F-05	still	Hayloft door missing and roof collapse visible inside	roof damage	Critical (4.0)	P1	Keep out / make safe
F-06	still	Loose metal sheet hanging from the rafters	debris and loose material	Critical (4.0)	P1	Keep out / make safe
F-07	still	Roof collapsed at far end of barn	roof damage	Critical (4.0)	P1	Keep out / make safe
F-08	still	Daylight through missing roof boards	roof damage	Critical (3.6)	P1	Keep out / make safe
F-09	still	Rusted and torn roofing on collapsed sheds	roof damage	Critical (3.5)	P1	Replace
F-10	still	Graffiti showing trespass on the site	security and access	Major (3.5)	P1	Keep out / make safe
F-11	still	Hole torn in silo dome	roof damage	Major (3.4)	P2	Repair
F-12	still	Rusted silo dome with open top hatch	corrosion	Major (3.2)	P2	Repair
F-13	still	Loose metal sheets lying in the field	debris and loose material	Major (2.9)	P2	Clean
F-14	still	Heavy rust on silo dome	corrosion	Major (2.7)	P2	Repair
F-15	still	Vines covering silos	vegetation overgrowth	Minor (1.4)	P3	Clean

4. Detailed findings

F-01 Collapsed shed roof lying on the ground

P1 · Immediate (within 24-72 h)



Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 1 frame(s))
Component	open-sided shed
Extent	1 shed
Category	roof damage (91% confidence)
Severity	Critical, score 3.98 / 4
Safety / environmental hazard	87% probability
Likelihood it is a real defect	95%
First action	Keep out / make safe: Keep people out and make the area safe now (evacuate, fence off, placard) because of danger to life or of collapse.
Crew	Roofing contractor + structural engineer
Severity spread (Jev)	0 Cosmetic1 Minor2 Moderate3 Major4 Critical

What we saw

This shed's roof has dropped at one end and rests on the ground at an angle.

Visual evidence: Red roof panel sloping from its posts down to the ground; posts leaning.

How to fix it

For this finding: Demolish or prop the shed; keep people and vehicles from under it.

Standard procedure

- 1 Keep people out of rooms under the damaged roof until an engineer or building official has checked it.
- 2 Make it weather-tight: cover openings with secured tarps or temporary sheeting (fixed to the structure, not weighed down loosely).
- 3 Have a structural engineer check rafters, trusses and connections under the damaged area before repair.
- 4 Replace damaged decking and roofing; upgrade fixings to current wind-load requirements.
- 5 Roof work needs fall protection (harness, anchors or edge protection).

References: International Existing Building Code (IEBC); ASCE 7 (wind loads); OSHA 29 CFR 1926.501 (fall protection)

F-02 Roofless brick silo leaning

P1 · Immediate (within 24-72 h)



Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 2 frame(s))
Component	free-standing brick silo in the field
Extent	1 silo, ~10 m tall
Category	structural damage (100% confidence)
Severity	Critical, score 4.00 / 4
Safety / environmental hazard	90% probability
Likelihood it is a real defect	90%
First action	Keep out / make safe: Keep people out and make the area safe now (evacuate, fence off, placard) because of danger to life or of collapse.
Crew	Structural engineer + building official; demolition or shoring contractor
Severity spread (Jev)	0 Cosmetic1 Minor2 Moderate3 Major4 Critical

What we saw

The roofless brick silo is clearly leaning off vertical.
Visual evidence: Brick cylinder visibly tilted relative to the level ground and fence line.

How to fix it

For this finding: Fence off a fall zone of at least the silo's height, keep everyone away, and get a structural engineer to decide on emergency bracing or controlled demolition.

Standard procedure

- 1 Cordon off a fall zone around the structure (at least its height) and post it as unsafe.
- 2 Get a structural engineer's rapid safety evaluation (inspected / restricted use / unsafe placard).
- 3 Shore or brace if the structure is to be saved; otherwise plan a controlled demolition.
- 4 Do not let anyone climb or enter until the engineer clears it.

References: ATC-45 (safety evaluation after windstorms and floods); FEMA P-2055 (post-disaster building safety evaluation); IEBC

F-03 Power pole with transformer next to derelict shedsP1 · Immediate (within 24-72 h)



Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 1 frame(s))
Component	utility pole in the field
Extent	1 pole
Category	utilities damage (91% confidence)
Severity	Critical, score 3.97 / 4
Safety / environmental hazard	80% probability
Likelihood it is a real defect	90%
First action	Keep out / make safe: Keep people out and make the area safe now (evacuate, fence off, placard) because of danger to life or of collapse.
Crew	Utility company / licensed electrician; tank inspector
Severity spread (Jev)	0 Cosmetic1 Minor2 Moderate3 Major4 Critical

What we saw

A power pole with a transformer stands close to the collapsed sheds. If the line is still live, it's a hazard for anyone clearing the site.

Visual evidence: Wooden pole with a pole-mounted transformer and lines, a few metres from the sheds.

How to fix it

For this finding: Ask the utility whether the service is live and have it disconnected before demolition or clearing.

Standard procedure

- 1 Treat all downed or leaning lines as live; keep people away and call the utility.
- 2 Have the utility or a licensed electrician make safe and restore service.
- 3 Inspect water tanks for shell, roof and foundation damage before refilling.

References: NFPA 70 (National Electrical Code); AWWA D100 / D103 (water storage tanks)

F-04 Open top of roofless silo

P1 · Immediate (within 24-72 h)



Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 1 frame(s))
Component	brick silo top
Extent	1 silo
Category	roof damage (55% confidence)
Severity	Critical, score 3.99 / 4
Safety / environmental hazard	88% probability
Likelihood it is a real defect	90%
First action	Keep out / make safe: Keep people out and make the area safe now (evacuate, fence off, placard) because of danger to life or of collapse.
Crew	Roofing contractor + structural engineer
Severity spread (Jev)	0 Cosmetic1 Minor2 Moderate3 Major4 Critical

What we saw

The brick silo has no roof; its open top collects rain and vines are growing over the rim, which loosens the brickwork.

Visual evidence: Open circular brick rim with vines across it, dark interior.

How to fix it


For this finding: Fence off a fall zone of at least the silo's height, keep everyone away, and get a structural engineer to decide on emergency bracing or controlled demolition.

Standard procedure

- 1 Keep people out of rooms under the damaged roof until an engineer or building official has checked it.
- 2 Make it weather-tight: cover openings with secured tarps or temporary sheeting (fixed to the structure, not weighed down loosely).
- 3 Have a structural engineer check rafters, trusses and connections under the damaged area before repair.
- 4 Replace damaged decking and roofing; upgrade fixings to current wind-load requirements.
- 5 Roof work needs fall protection (harness, anchors or edge protection).

References: International Existing Building Code (IEBC); ASCE 7 (wind loads); OSHA 29 CFR 1926.501 (fall protection)

F-05 Hayloft door missing and roof collapse visible insideP1 · Immediate (within 24-72 h)

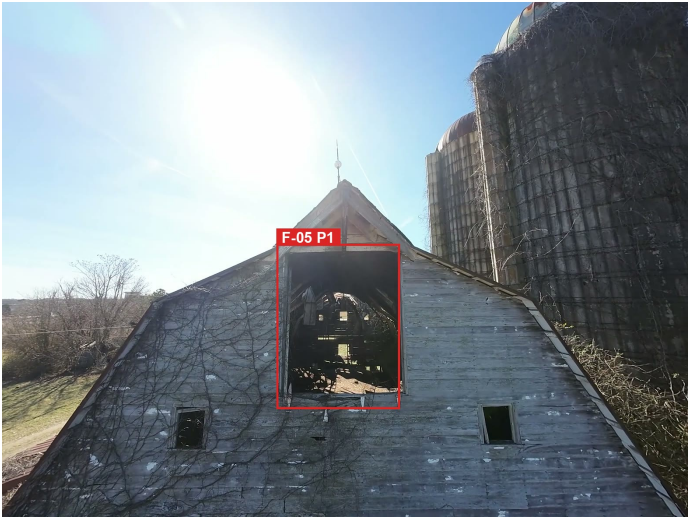

Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 1 frame(s))
Component	barn gable end
Extent	Gable end and interior roof
Category	roof damage (86% confidence)
Severity	Critical, score 3.95 / 4
Safety / environmental hazard	86% probability
Likelihood it is a real defect	93%
First action	Keep out / make safe: Keep people out and make the area safe now (evacuate, fence off, placard) because of danger to life or of collapse.
Crew	Roofing contractor + structural engineer
Severity spread (Jev)	0 Cosmetic1 Minor2 Moderate3 Major4 Critical

What we saw

The hayloft door is gone, and through the opening you can see collapsed roof framing inside. Two small windows lower down are broken out.

Visual evidence: Large dark opening at the top of the gable with broken timbers visible inside; two empty window frames below.

How to fix it

For this finding: Board up the openings to keep people and weather out; don't enter until the structure is assessed.

Standard procedure

- 1

Keep people out of rooms under the damaged roof until an engineer or building official has checked it.
- 2

Make it weather-tight: cover openings with secured tarps or temporary sheeting (fixed to the structure, not weighed down loosely).
- 3

Have a structural engineer check rafters, trusses and connections under the damaged area before repair.
- 4

Replace damaged decking and roofing; upgrade fixings to current wind-load requirements.
- 5

Roof work needs fall protection (harness, anchors or edge protection).

References: International Existing Building Code (IEBC); ASCE 7 (wind loads); OSHA 29 CFR 1926.501 (fall protection)

F-06 Loose metal sheet hanging from the rafters

P1 · Immediate (within 24-72 h)



Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 1 frame(s))
Component	barn roof interior
Extent	1 sheet
Category	debris and loose material (92% confidence)
Severity	Critical, score 4.00 / 4
Safety / environmental hazard	88% probability
Likelihood it is a real defect	88%
First action	Keep out / make safe: Keep people out and make the area safe now (evacuate, fence off, placard) because of danger to life or of collapse.
Crew	Debris removal crew
Severity spread (Jev)	0 Cosmetic1 Minor2 Moderate3 Major4 Critical

What we saw

A loose metal roof sheet is hanging down from the rafters and could fall on anyone below.
Visual evidence: Grey sheet hanging at an angle from the top-left rafters.

How to fix it

For this finding: Nobody should enter; remove the sheet from a safe position during make-safe work.

Standard procedure

- 1 Secure or remove loose sheet metal and debris that wind can pick up.
- 2 Clear debris from access routes, drains and around buildings.
- 3 Separate hazardous debris (asbestos-cement sheets, treated wood, chemicals) for proper disposal.

References: FEMA Public Assistance debris guidance; EPA asbestos (NESHAP) rules for demolition debris

F-07 Roof collapsed at far end of barn

P1 · Immediate (within 24-72 h)



Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 1 frame(s))
Component	barn roof, far end
Extent	Last few bays of the barn
Category	roof damage (100% confidence)
Severity	Critical, score 4.00 / 4
Safety / environmental hazard	91% probability
Likelihood it is a real defect	85%
First action	Keep out / make safe: Keep people out and make the area safe now (evacuate, fence off, placard) because of danger to life or of collapse.
Crew	Roofing contractor + structural engineer
Severity spread (Jev)	0 Cosmetic1 Minor2 Moderate3 Major4 Critical

What we saw

At the far end of the barn the roof has collapsed: rafters are broken and the roof is open to the sky.
Visual evidence: Broken rafters and boards hanging down, open sky and branches visible through the roof.

How to fix it

For this finding: Treat the barn as unsafe; structural engineer to decide on demolition.

Standard procedure

- 1 Keep people out of rooms under the damaged roof until an engineer or building official has checked it.
- 2 Make it weather-tight: cover openings with secured tarps or temporary sheeting (fixed to the structure, not weighed down loosely).
- 3 Have a structural engineer check rafters, trusses and connections under the damaged area before repair.
- 4 Replace damaged decking and roofing; upgrade fixings to current wind-load requirements.
- 5 Roof work needs fall protection (harness, anchors or edge protection).

References: International Existing Building Code (IEBC); ASCE 7 (wind loads); OSHA 29 CFR 1926.501 (fall protection)

F-08 Daylight through missing roof boardsP1 · Immediate (within 24-72 h)



Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 4 frame(s))
Component	barn roof from inside
Extent	Many gaps along the roof
Category	roof damage (100% confidence)
Severity	Critical, score 3.64 / 4
Safety / environmental hazard	57% probability
Likelihood it is a real defect	93%
First action	Keep out / make safe: Keep people out and make the area safe now (evacuate, fence off, placard) because of danger to life or of collapse.
Crew	Roofing contractor + structural engineer
Severity spread (Jev)	0 Cosmetic1 Minor2 Moderate3 Major4 Critical

What we saw

Inside the loft, daylight shows through large gaps where roof boards and sheets are missing. Rain is getting in and rotting the rafters.

Visual evidence: Bright patches of sky between the rafters and a sunlit pattern on the floor.

How to fix it

For this finding: Structural assessment of rafters for rot; re-roof only if the frame is sound.

Standard procedure

- 1 Keep people out of rooms under the damaged roof until an engineer or building official has checked it.
- 2 Make it weather-tight: cover openings with secured tarps or temporary sheeting (fixed to the structure, not weighed down loosely).
- 3 Have a structural engineer check rafters, trusses and connections under the damaged area before repair.
- 4 Replace damaged decking and roofing; upgrade fixings to current wind-load requirements.
- 5 Roof work needs fall protection (harness, anchors or edge protection).

References: International Existing Building Code (IEBC); ASCE 7 (wind loads); OSHA 29 CFR 1926.501 (fall protection)

F-09Rusted and torn roofing on collapsed shedsP1 · Immediate (within 24-72 h)



Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 2 frame(s))
Component	shed roofing
Extent	Several sheds
Category	roof damage (97% confidence)
Severity	Critical, score 3.52 / 4
Safety / environmental hazard	57% probability
Likelihood it is a real defect	96%
First action	Replace: The component is beyond repair and must be swapped out.
Crew	Roofing contractor + structural engineer
Severity spread (Jev)	0 Cosmetic1 Minor2 Moderate3 Major4 Critical

What we saw

The shed roofing is heavily rusted, and the sheets on the right are torn, folded and partly collapsed.
Visual evidence: Orange rust over the corrugated sheets; crumpled sheets and broken framing on the right.

How to fix it

For this finding: Remove the collapsed roofing; the sheds are beyond simple repair.

Standard procedure

- 1 Keep people out of rooms under the damaged roof until an engineer or building official has checked it.
- 2 Make it weather-tight: cover openings with secured tarps or temporary sheeting (fixed to the structure, not weighed down loosely).
- 3 Have a structural engineer check rafters, trusses and connections under the damaged area before repair.
- 4 Replace damaged decking and roofing; upgrade fixings to current wind-load requirements.
- 5 Roof work needs fall protection (harness, anchors or edge protection).

References: International Existing Building Code (IEBC); ASCE 7 (wind loads); OSHA 29 CFR 1926.501 (fall protection)

F-10 Graffiti showing trespass on the site

P1 · Immediate (within 24-72 h)



Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 1 frame(s))
Component	silos base
Extent	1 silo
Category	security and access (100% confidence)
Severity	Major, score 3.45 / 4
Safety / environmental hazard	63% probability
Likelihood it is a real defect	89%
First action	Keep out / make safe: Keep people out and make the area safe now (evacuate, fence off, placard) because of danger to life or of collapse.
Crew	Property owner / facilities team
Severity spread (Jev)	0 Cosmetic1 Minor2 Moderate3 Major4 Critical

What we saw

The silo is covered in graffiti, which shows people are getting onto the site despite the dangerous structures.
Visual evidence: Spray-painted tags on the lower silo wall.

How to fix it

For this finding: Fence the site and post warning signs; the collapsing structures make trespass dangerous.

Standard procedure

- 1 Secure openings and fence off unsafe or derelict buildings; post warning signs.
- 2 Clear blocked access roads for emergency vehicles.

References: IPMC section 301.3 (vacant structures)

F-11Hole torn in silo domeP2 · Planned (within 30 days)



Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 1 frame(s))
Component	left silo metal dome
Extent	1 panel, ~1 m
Category	roof damage (93% confidence)
Severity	Major, score 3.41 / 4
Safety / environmental hazard	46% probability
Likelihood it is a real defect	89%
First action	Repair: Fix the component in place (patch, recoat, re-torque, re-seal, re-route).
Crew	Roofing contractor + structural engineer
Severity spread (Jev)	0 Cosmetic1 Minor2 Moderate3 Major4 Critical

What we saw

A panel of the left silo's metal dome has torn open, leaving a hole at the edge of the dome.

Visual evidence: Dark gap with bent sheet edges where a dome panel has come away.

How to fix it

For this finding: Secure or remove loose dome panels before they blow off; if the silo stays, replace the damaged panels.

Standard procedure

- 1 Keep people out of rooms under the damaged roof until an engineer or building official has checked it.
- 2 Make it weather-tight: cover openings with secured tarps or temporary sheeting (fixed to the structure, not weighed down loosely).
- 3 Have a structural engineer check rafters, trusses and connections under the damaged area before repair.
- 4 Replace damaged decking and roofing; upgrade fixings to current wind-load requirements.
- 5 Roof work needs fall protection (harness, anchors or edge protection).

References: International Existing Building Code (IEBC); ASCE 7 (wind loads); OSHA 29 CFR 1926.501 (fall protection)

F-12Rusted silo dome with open top hatch

P2 · Planned (within 30 days)



Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 1 frame(s))
Component	silo dome
Extent	Whole dome
Category	corrosion (94% confidence)
Severity	Major, score 3.19 / 4
Safety / environmental hazard	28% probability
Likelihood it is a real defect	90%
First action	Repair: Fix the component in place (patch, recoat, re-torque, re-seal, re-route).
Crew	Roofing / metal cladding contractor
Severity spread (Jev)	0 Cosmetic1 Minor2 Moderate3 Major4 Critical

What we saw

This dome is heavily rusted and its top hatch is open or missing, letting rain straight into the silo.
Visual evidence: Rust-red dome with a black circular opening at the top.

How to fix it

For this finding: Close or cap the hatch; inspect and recoat or replace the dome.

Standard procedure

- 1 Check how much metal is left: probe rusted areas, look for holes and failed fasteners.
- 2 Surface rust: wire-brush, prime and recoat. Holes or thinned sheets: replace the sheets or panels.
- 3 Replace corroded fasteners and flashing so sheets can't lift in wind.

References: Manufacturer's coating and fastening specs; International Property Maintenance Code (IPMC)

F-13 Loose metal sheets lying in the field

P2 · Planned (within 30 days)



Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 1 frame(s))
Component	field next to the sheds
Extent	Several sheets
Category	debris and loose material (100% confidence)
Severity	Major, score 2.86 / 4
Safety / environmental hazard	42% probability
Likelihood it is a real defect	95%
First action	Clean: Remove dirt, debris, deposits, vegetation or spilled material; no component repair needed.
Crew	Debris removal crew
Severity spread (Jev)	0 Cosmetic1 Minor2 Moderate3 Major4 Critical

What we saw

Loose metal roofing sheets are lying in the grass. Strong wind can throw them.
Visual evidence: Grey sheet metal pieces on the ground away from any structure.

How to fix it

For this finding: Collect and stack or remove the loose sheets.


Standard procedure

- 1 Secure or remove loose sheet metal and debris that wind can pick up.
- 2 Clear debris from access routes, drains and around buildings.
- 3 Separate hazardous debris (asbestos-cement sheets, treated wood, chemicals) for proper disposal.

References: FEMA Public Assistance debris guidance; EPA asbestos (NESHAP) rules for demolition debris

F-14 Heavy rust on silo dome

P2 · Planned (within 30 days)

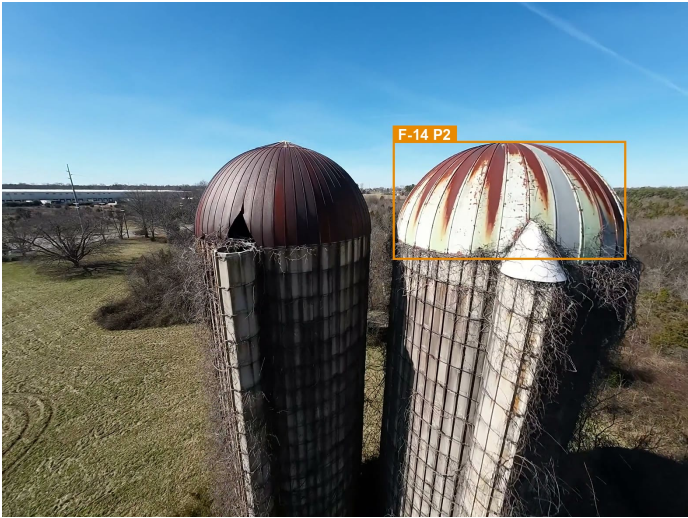

Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 1 frame(s))
Component	right silo metal dome
Extent	Whole dome
Category	corrosion (100% confidence)
Severity	Major, score 2.66 / 4
Safety / environmental hazard	21% probability
Likelihood it is a real defect	90%
First action	Repair: Fix the component in place (patch, recoat, re-torque, re-seal, re-route).
Crew	Roofing / metal cladding contractor
Severity spread (Jev)	0 Cosmetic1 Minor2 Moderate3 Major4 Critical

What we saw

The right silo's dome has heavy rust streaks running down most of its panels and the coating has failed.
Visual evidence: Orange rust runs between the ribs across the whole dome, bare metal showing.

How to fix it

For this finding: Check the dome for thinned or holed panels and loose fasteners; recoat or replace.


Standard procedure

- 1 Check how much metal is left: probe rusted areas, look for holes and failed fasteners.
- 2 Surface rust: wire-brush, prime and recoat. Holes or thinned sheets: replace the sheets or panels.
- 3 Replace corroded fasteners and flashing so sheets can't lift in wind.

References: Manufacturer's coating and fastening specs; International Property Maintenance Code (IPMC)

F-15 Vines covering silos

P3 · Scheduled / monitor (next maintenance cycle)

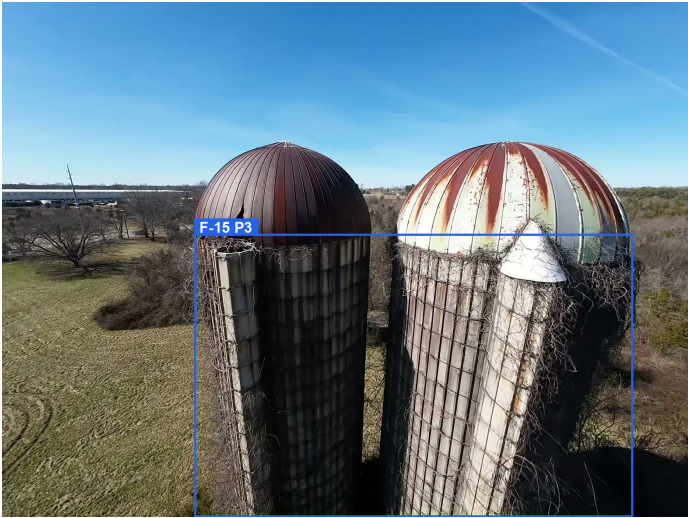

Full frame with approximate location



Zoomed detail

Timestamp	still (seen in 1 frame(s))
Component	both silos
Extent	Most of both silo walls
Category	vegetation overgrowth (100% confidence)
Severity	Minor, score 1.39 / 4
Safety / environmental hazard	14% probability
Likelihood it is a real defect	89%
First action	Clean: Remove dirt, debris, deposits, vegetation or spilled material; no component repair needed.
Crew	Grounds / arborist crew
Severity spread (Jev)	0 Cosmetic 1 Minor 2 Moderate 3 Major 4 Critical

What we saw

Vines have grown up the sides of both silos to the domes.

Visual evidence: Dense brown vine growth up the stave walls.

How to fix it

For this finding: Cut the vines at the base, let them die back, then remove them and inspect the stave walls and hoops underneath.

Standard procedure

- 1 Cut vines at the base and let them die back before pulling them off, so they don't tear cladding or mortar.
- 2 Remove trees and shrubs growing against or into the structure, including roots near foundations.
- 3 Inspect the surfaces underneath for damage and moisture.

References: IPMC (exterior property and structure)

5. Methodology and limitations

How this report was produced

- Frames were sampled from the footage (still images, 14 in total).
- Detection: each frame was examined by a vision-language model (Claude Opus 5.5 (frames reviewed in a Claude Code session, not via API)) that listed every visible defect with its location, extent and visual evidence. It did not assign severity.
- Triage: each observation was scored by TypeSafe Jev (jev-1.13.0), a System One model that returns typed answers with probabilities: defect category, severity on a 5-level rubric, first action, the probability that the defect is genuine, and the probability of an immediate safety or environmental hazard.
- Rules applied by code: observations with less than 35% probability of being genuine were dropped; P1 if expected severity is 3.5 or higher or hazard probability is 60% or higher, or the recommended action is shutdown and severity is 2.5 or higher; P2 if severity is 1.75 or higher; otherwise P3. Findings with less than 60% probability of being genuine are capped at P2 and marked 'verify on site'.
- The same defect seen in neighbouring frames was merged into one finding.
- Repair procedures come from a reviewed playbook for this asset type; the per-finding fix is model-generated.

Severity scale

- 0: Cosmetic: no functional impact, note for records only.
- 1: Minor: early-stage wear; no loss of function; fix at next scheduled maintenance.
- 2: Moderate: measurable degradation or loss of output; fix within 30-90 days.
- 3: Major: active damage or significant loss of function; fix within 7-30 days.
- 4: Critical: active leak, fire, structural failure risk or danger to people or environment; act immediately.

Limitations

- Only what is visible from the air is assessed. Internal corrosion, wall thickness, electrical faults and gas leaks without a visible sign cannot be detected from RGB footage.
- Hotspot findings need radiometric thermal footage; on RGB footage they are not reliable.
- Locations are approximate boxes on the frame, not GPS coordinates.
- AI findings can be wrong. Every P1 and P2 finding should be confirmed on site before work starts.

Image credits

- Footage: "Drone footage of a destroyed barn in an abandoned farm" (Pexels #15439362) and "Drone footage of an abandoned farm" (Pexels #15439355), Pexels License.