FRA Diagnostic Report

Generated: 2026-03-28 18:04:41

Field	Value
Fault assessment	Winding Deformation
Confidence (0–100)	52.8
Severity	High
Anomaly score (0–100)	100.0
Correlation (vs ref)	0.0960
Max deviation	43.87 dB

Single FRA (test)

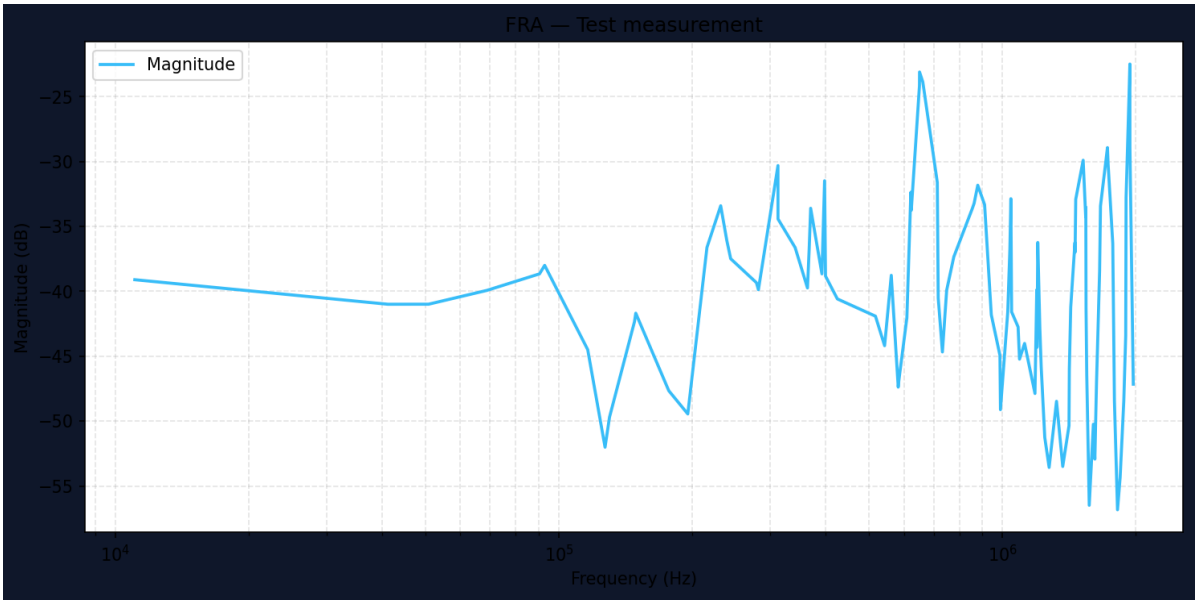

Comparison

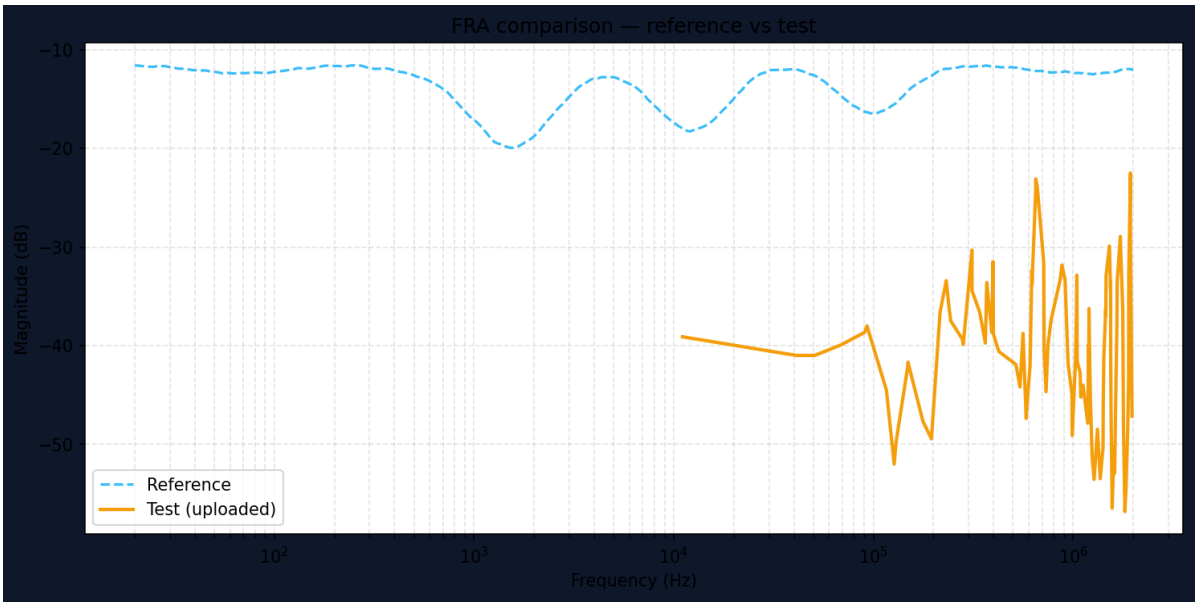

Difference map

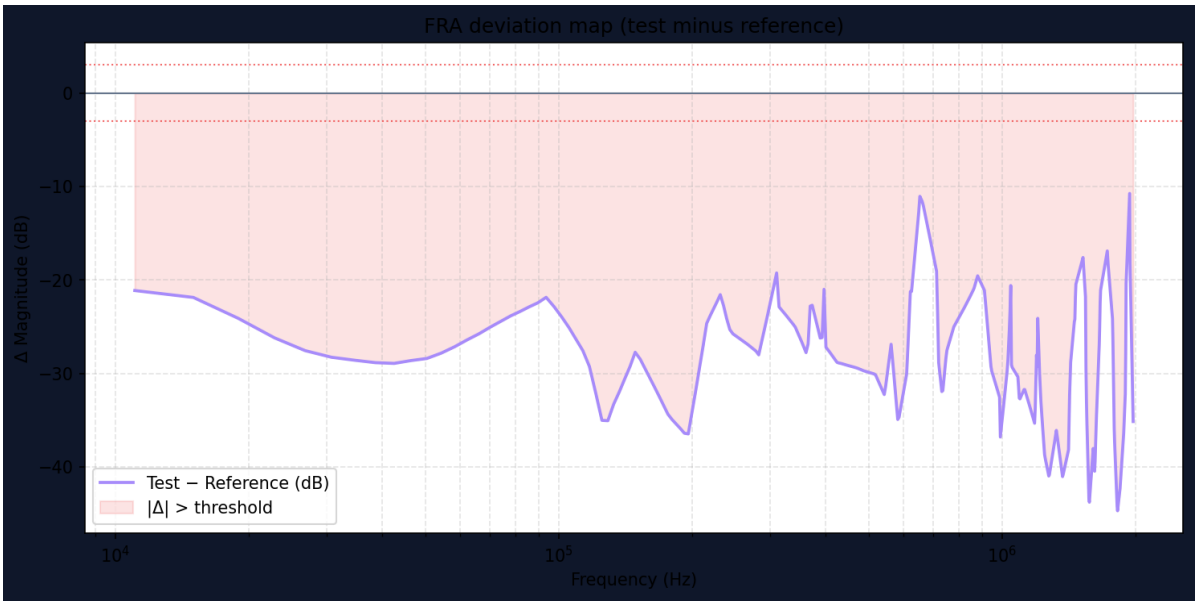

Recommendation

Significant deviation detected in mid-frequency range (10kHz–100kHz) suggesting axial winding displacement. Schedule internal inspection within 30 days. Reduce loading to 80% capacity until inspection is completed. Expert notes: Peak shift → possible winding deformation; High-frequency attenuation → possible insulation issue; Low-frequency energy deviation → possible core or clamping issue

Explanation

ML classifier: Winding Deformation (93% estimated class confidence). Statistical correlation vs reference: 0.158. IsolationForest anomaly score (0–100, higher=worse): 100.0. Rules: Peak shift → possible winding deformation | High-frequency attenuation → possible insulation issue | Low-frequency energy deviation → possible core or clamping issue | Broadband magnitude deviation vs reference