YICN Roofing

ROOF MEASUREMENT REPORT — 17158 Eastview Dr, Chagrin Falls, OH 44023, USA

STAFF ONLY — NO PRICING

August 6, 2026

B

PROJECT SUMMARY

Total Facets	—
Predominant Pitch	**6/12**
Roof Type	**Complex Hip**
Net Squares	**42.69 SQ**
Net Area	**4,268.731 sqft**
Squares @ 15% Waste	**49.09 SQ**
Measurement Source	**Google Solar API**
Confidence	B **79%**

MEASUREMENT BREAKDOWN (LINEAR FEET)

Ridge	**76.0 LF**
Hip	**115.0 LF**
Valley	**96.0 LF**
Rake	**32.0 LF**
Eave	**312.0 LF**
Sidewall Flashing	**29.0 LF**
Headwall / Apron	**12.0 LF**
Total Perimeter (Eave+Rake)	**344 LF**

SATELLITE VIEW



17158 Eastview Dr, Chagrin Falls, OH 44023, USA — Google satellite imagery © 2026


15 segments → complex_hip roof detected. Area: segment_sum. No calibration data yet — upload EagleView/Hover reports to improve accuracy.

Directional Street Views


17158 Eastview Dr, Chagrin Falls, OH 44023, USA

Street-level views to assess approach angle, gutter line, and obstructions. Click any photo to open in Google Maps.


NORTH (0°)

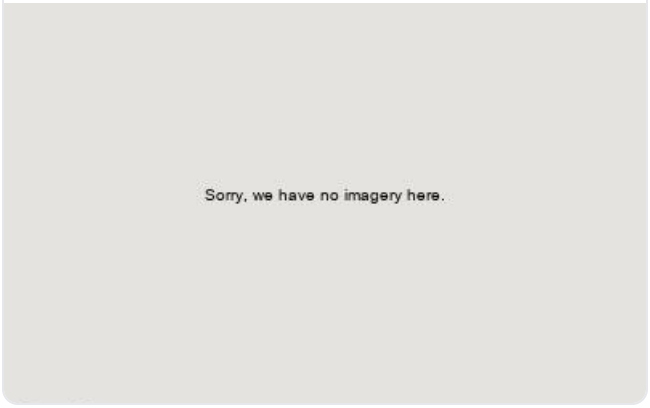


EAST (90°)

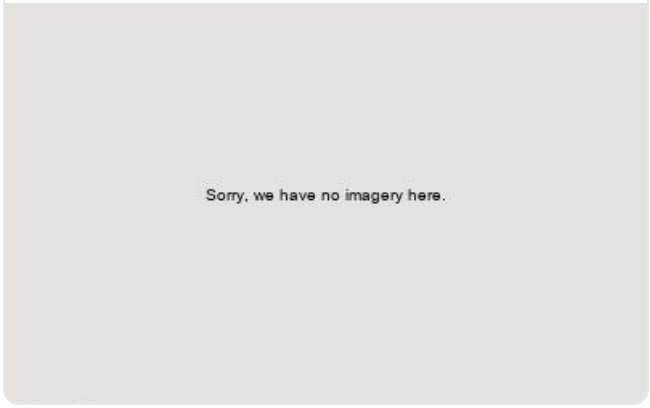

SOUTH (180°)

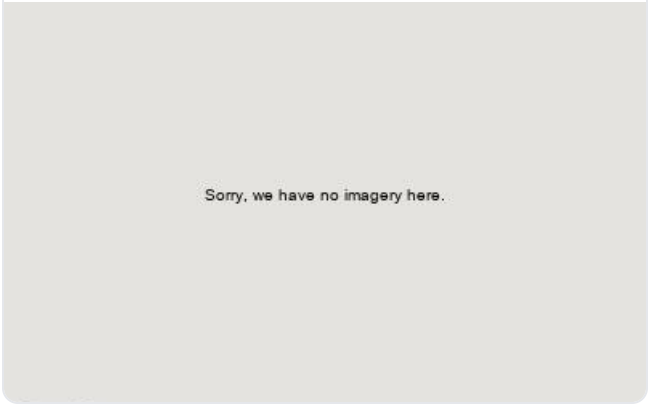

WEST (270°)

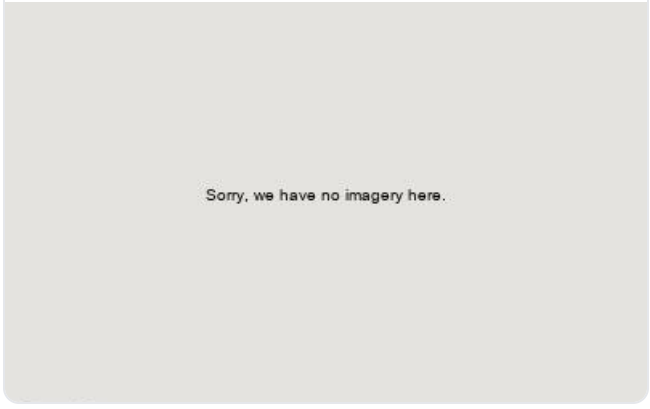

Waste Matrix & Linear Measurements

17158 Eastview Dr, Chagrin Falls, OH 44023, USA

WASTE CALCULATION — 4,268.731 SQFT BASE (HIGHLIGHTED = CURRENT 15% SETTING)

Measurement	0% sqft	0% SQ	7% sqft	7% SQ	10% sqft	10% SQ	12% sqft	12% SQ	14% sqft	14% SQ	17% sqft	17% SQ	22% sqft	22% SQ
Roof Area	4,269	42.7	4,568	45.7	4,696	47.0	4,781	47.8	4,866	48.7	4,994	49.9	5,208	52.1

LINEAR MEASUREMENTS

FEATURE	LENGTH (LF)	CONFIDENCE
Ridge	**76.0 LF**	56%
Hip	**115.0 LF**	51%
Valley	**96.0 LF**	54%
Rake	**32.0 LF**	54%
Eave	**312.0 LF**	62%
Sidewall Flash.	**29.0 LF**	51%
Headwall / Apron	**12.0 LF**	—

QUICK REFERENCE

Predominant Pitch	**6/12**
Roof Type	**Complex Hip**
Segments	**0**
Confidence	B
Eave + Rake (perimeter)	**344 LF**
Hip + Ridge (cap/vent)	**191 LF**

15 segments → complex_hip roof detected. Area: segment_sum. No calibration data yet — upload EagleView/Hover reports to improve accuracy.

Steep-Slope Material Quantities

17158 Eastview Dr, Chagrin Falls, OH 44023, USA

MEASUREMENT REPORT
Page 4 • August 6, 2026

Based on 42.69 SQ net area. Highlighted waste % = current setting (15%). All quantities rounded *up* to whole units. Verify with supplier before ordering.

Material	Unit	GAF Timberline HDZ				OC TruDef Duration				CertainTeed Landmark				Malark Vista Al		
		0%	7%	12%	17%	0%	7%	12%	17%	0%	7%	12%	17%	0%	7%	1
SHINGLES																
Shingles	bundle	129	138	144	150	129	138	144	150	129	138	144	150	143	153	1
SYNTHETIC UNDERLAYMENT																
Synthetic Underlayment (10 SQ/roll)	roll	5	5	5	5	5	5	5	5	5	5	5	5	5	5	
ICE & WATER SHIELD																
I&W 36" Perimeter (936 sqft)	roll	13	13	13	13	13	13	13	13	13	13	13	13	13	13	
I&W 18" Valleys (468 sqft)	roll	7	7	7	7	7	7	7	7	7	7	7	7	7	7	
ACCESSORIES (FIXED — NOT WASTE-SENSITIVE)																
Starter Strip	bundle	3	3	3	3	3	3	3	3	3	3	3	3	3	3	
Hip & Ridge Cap	bundle	6	6	6	6	6	6	6	6	6	6	6	6	6	6	
Eave Drip Edge (10 ft)	piece	32	32	32	32	32	32	32	32	32	32	32	32	32	32	
Rake Drip Edge (10 ft)	piece	4	4	4	4	4	4	4	4	4	4	4	4	4	4	
Valley Metal / W-Valley (10 ft)	piece	10	10	10	10	10	10	10	10	10	10	10	10	10	10	
Step Flashing 5×7	piece	116	116	116	116	116	116	116	116	116	116	116	116	116	116	1
Apron / Headwall Flashing (10 ft)	piece	2	2	2	2	2	2	2	2	2	2	2	2	2	2	
Ridge Vent (4 ft sections)	piece	19	19	19	19	19	19	19	19	19	19	19	19	19	19	
FASTENERS & SEALANTS																
Coil Nails (50 lb box)	box	3	4	4	4	3	4	4	4	3	4	4	4	3	4	
Plastic Cap Nails	box	3	3	3	3	3	3	3	3	3	3	3	3	3	3	
Roofing Caulk / Sealant	tube	5	5	5	5	5	5	5	5	5	5	5	5	5	5	

Material	Unit	GAF Timberline HDZ				OC TruDef Duration				CertainTeed Landmark				Malark Vista Al		
		0%	7%	12%	17%	0%	7%	12%	17%	0%	7%	12%	17%	0%	7%	1
Accessories (pipe boots, vents, etc.)	allow	—	—	—	—	—	—	—	—	—	—	—	—	—	—	

Formulas: Shingles = SQ × bundles-per-SQ (GAF/OC/CertainTeed: 3 bpSQ; Malarkey: 3.33 bpSQ). I&W 36" = eave LF × 3 ft ÷ 75 sqft/roll. I&W 18" = eave LF × 1.5 ft ÷ 75 sqft/roll. Step flashing = sidewall LF × 4 pcs. Ridge vent = ridge LF ÷ 4 ft/pc. Verify with your supplier — coverage can vary by product line.

Estimate Material List

17158 Eastview Dr, Chagrin Falls, OH 44023, USA

MEASUREMENT REPORT
Page 5 • August 6, 2026

12 line items from the active estimate at 15% waste. **STAFF USE ONLY — do not distribute to customer.**

#	Code	Description	Qty	Unit	Unit $	Total RCV
1	SID REM	Remove siding, vinyl or aluminum	18.78	SQ	$45.00	**$844.97**
2	SID VS	Vinyl siding, standard grade	18.78	SQ	$425.00	**$7,980.23**
3	SID J	J-channel, vinyl (Top)	161	LF	$3.50	**$563.50**
4	SID J	J-channel, vinyl (Bottom)	161	LF	$3.50	**$563.50**
5	SID OC	Outside corner, vinyl	40	LF	$4.25	**$170.00**
6	SID SS	Starter strips, vinyl (12 ft ea) — 161 LF ÷ 12	14	EA	$8.50	**$119.00**
7	WP	House wrap / weather barrier	18.78	SQ	$55.00	**$1,032.74**
8	COMPLETE_RENAIL	complete re-nail	4	EA	$21.00	**$84.00**
9	CAULK	Caulk, exterior grade (tube)	3	EA	$8.00	**$24.00**
10	EL BOX	Electrical box extension (light box)	1	EA	$15.00	**$15.00**
11	SID WB	Exterior water spigot / hose bib (cut-in & reconnect)	1	EA	$75.00	**$75.00**
12	HAUL_OFF	haul off)	1	EA	$589.38	**$589.38**
TOTAL						**$12,061.31**