111 Wandle Ave, Bedford, OH 44146, USA

PROPERTY SUMMARY

1,699 SF	17.0	19.5	5	2023
Total Area	Net Squares	Gross Squares +15% waste	Roof Facets	Imagery

DETACHED STRUCTURES

Structure Type	Roof Pitch	Area (SF)	Squares
Garage	Steep	600	6.0
Main Structure	—	1,099	11.0
Total (All Structures)		1,699	17.0

SATELLITE VIEW



- **F1** 496 SF · 9/12 · S
- **F2** 205 SF · 10/12 · N
- **F3** 170 SF · 4/12 · N
- **F4** 128 SF · 5/12 · S
- **F5** 100 SF · 3/12 · W


AI ROOF ASSESSMENT

complex	15%	200 hrs
COMPLEXITY	WASTE FACTOR	EST. LABOR

This roof spans approximately 1,699 square feet including a detached 600 SF steep-pitch garage. It features five facets with pitches up to 38°, creating moderate complexity and requiring careful waste and safety management. Attention to flashing at transitions and steep sections is critical.

111 Wandle Ave, Bedford, OH 44146, USA

ROOF PLAN DIAGRAM

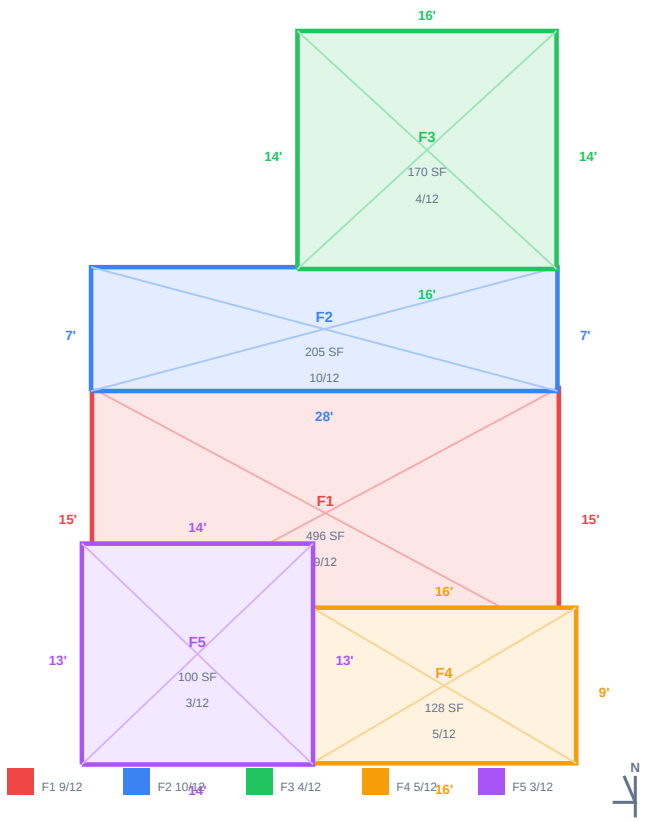

MEASUREMENTS

Total Roof Area	**1,699 sqft**
Total Roof Facets	**5 facets**
Predominant Pitch	**9/12**
Est. Total Eaves	**101 ft**
Est. Hips + Ridges	**59 ft**
Est. Total Rakes	**101 ft**
Total Squares	**17.0 sq**

WASTE FACTOR SCENARIOS

Waste %	0%	10%	12%	15%	17%	20%	22%
Area (sqft)	1,699	1,869	1,903	1,954	1,988	2,039	2,073
Squares	17.0	18.7	19.0	19.5	19.9	20.4	20.7

111 Wandle Ave, Bedford, OH 44146, USA

FACET BREAKDOWN

#	Pitch °	Pitch X/12	Net Area (SF)	Direction	Gross Sq (15% waste)
F1	37°	9/12	496	S	**5.70**
F2	38°	10/12	205	N	**2.36**
F3	20°	4/12	170	N	**1.95**
F4	23°	5/12	128	S	**1.47**
F5	14°	3/12	100	W	**1.15**

LINEAR MEASUREMENTS (SEGMENT GEOMETRY)

Measurement	Length (LF)	Method
Eave (Drip Edge)	94 LF	Segment geometry
Rake	69 LF	Segment geometry
Ridge	14 LF	Segment geometry
Hip	35 LF	Segment geometry
Valley	19 LF	Segment geometry
Perimeter	164 LF	Eave + Rake combined

ESX / Xactimate Export

Download the ESX file to import these measurements directly into Xactimate or XactAnalysis.

111 Wandle Ave, Bedford, OH 44146, USA

MATERIALS & COST ESTIMATE

Based on 1,699 SF net area · 15% waste factor applied · Prices are US market estimates

Category	Description	Qty	Unit
Shingles	Architectural Shingles (30yr)	19.5	squares
Underlayment	Synthetic Underlayment	20	squares
Ice & Water	Ice & Water Shield	4	squares
Decking	OSB Decking (7/16")	11	sheets
Ventilation	Ridge Vent	14	linear ft
Trim	Drip Edge (Aluminum)	163	linear ft
	Ridge Cap Shingles	49	linear ft
	Starter Strip	163	linear ft
Fasteners	Roofing Nails (1-3/4")	1	boxes
Flashing	Step Flashing (Aluminum)	30	linear ft
Sealant	Roofing Caulk / Sealant	4	tubes

Download Material List

Export your complete itemized material list as a spreadsheet from the Materials tab in ScopeFix AI.

111 Wandle Ave, Bedford, OH 44146, USA

WEATHER INTELLIGENCE — NOAA STORM EVENTS (2020–2025)

30	114	7	2.00"	75 mph
Hail Events (>=1")	Wind Events (>=55 mph)	Tornado Events	Largest Hail	Max Wind Speed

Storm Risk Rating: HIGH

High storm activity — strong documentation basis for insurance supplement.

HAIL HISTORY (>=1.00" | WITHIN 15 MI)

Date	Size (")	Distance	County / State	Summary
28-MAR-20 12:00:	**2.00**	13.9 mi	SUMMIT, OHIO	Trained spotter reported 2 diameter hail about 1.7 miles south-southeast of Hudson.
07-APR-20 22:12:	**2.00**	6 mi	CUYAHOGA, OHIO	Trained spotter reported ping pong ball to hen egg-size hail in Slavic Village (i.e. one mile ENE of
21-MAY-22 15:16:	**1.75**	12.1 mi	GEAUGA, OHIO	Golf ball-size hail in Novelty, about three-miles north of South Russell.
20-JUL-23 18:18:	**1.75**	11.3 mi	CUYAHOGA, OHIO	Hail up to golf ball-size in Parma Heights.
28-MAR-20 12:00:	**1.50**	13.6 mi	SUMMIT, OHIO	Social media report of ping pong ball-size hail 1.7 miles SSE of Hudson.
20-JUL-23 18:36:	**1.50**	3.4 mi	CUYAHOGA, OHIO	Hail up to ping pong ball-size in Valley View.
20-JUL-23 18:25:	**1.50**	6.9 mi	CUYAHOGA, OHIO	Hail up to ping pong ball-size in Seven Hills.

SIGNIFICANT WIND EVENTS (>=55 MPH | WITHIN 15 MI)

Date	Speed (mph)	Distance	County / State	Summary
06-AUG-24 15:04:	**75**	10.7 mi	CUYAHOGA, OHIO	Entire roof was blown-off a building at an auto wrecking facility at the corner of Storer Avenue and
06-AUG-24 15:04:	**75**	11.6 mi	CUYAHOGA, OHIO	Garages collapsed at Kingdale Apartments in Parma Heights. Entire roof of garages was blown-off and
06-AUG-24 15:24:	**75**	14.2 mi	LAKE, OHIO	Willoughby Hills Fire Department had a portion of its station's roof removed.
06-AUG-24 15:29:	**70**	13.7 mi	GEAUGA, OHIO	Extensive tree damage along Ferry Road in Chesterland.
31-MAR-26 16:31:	**70**	10.5 mi	CUYAHOGA, OHIO	Some windows blown-out at high-rise building at 9th Street and St. Clair Avenue in Cleveland.

TORNADO HISTORY (WITHIN 15 MI)

Date	Distance	County / State	Summary

111 Wandle Ave, Bedford, OH 44146, USA

Date	Distance	County / State	Summary
24-AUG-23 23:07:	2.4 mi	CUYAHOGA, OHIO	A tornado with estimated peak winds of 120 mph impacted portions of Warrensville Heights and Bedford Heights. This torna
24-AUG-23 22:59:	8.8 mi	CUYAHOGA, OHIO	A tornado with estimated peak winds of 110 mph occurred on the east side of Cleveland. This tornado began near East 71st
06-AUG-24 15:20:	9.4 mi	SUMMIT, OHIO	This tornado had peak intensity of EF1, estimated peak winds of 104 mph, and travelled generally southeastward during it
24-AUG-23 23:16:	9.7 mi	GEAUGA, OHIO	A tornado with estimated peak winds of 90 mph impacted Bainbridge. This tornado began in the western part of Laurel Spri
31-MAR-26 16:49:	13.7 mi	GEAUGA, OHIO	An EF1 tornado with estimated peak winds of 100-mph impacted the Chesterland area. Radar data indicate this was a rare a

Insurance Supplement Relevance

This property has experienced 30 hail event(s) >= 1" (largest: 2.00") and 114 wind event(s) >= 55 mph near this location since 2020. 7 tornado event(s) also recorded. NOAA federal data provides strong documentation for an insurance supplement claim.

DATA LIMITATIONS & DISCLAIMER

• NOAA Storm Events data is published with a 4–6 month lag. Events from the most recent months may not yet appear in this report.

• Only storm events with confirmed GPS coordinates are included. Many historical events lack coordinates and are not shown.

• A 15-mile search radius indicates proximity — it does not confirm damage occurred at this specific property.

• This report is for informational purposes only and is not a substitute for a professional roof inspection, engineering assessment, or insurance claim.