



# 3-Axis Magnetic Sensor Hybrid HMC2003

The Honeywell HMC2003 is a high sensitivity, three-axis magnetic sensor hybrid assembly used to measure low magnetic field strengths. Honeywell's most sensitive magneto-resistive sensors (HMC1001 and HMC1002) are utilized to provide the reliability and precision of this magnetometer design.

The HMC2003 interface is all analog with critical nodes brought out to the pin interfaces for maximum user flexibility. The internal excitation current source and selected gain and offset resistors, reduces temperature errors plus gain and offset drift. Three precision low-noise instrumentation amplifiers with 1kHz low pass filters provide accurate measurements while rejecting unwanted noise.



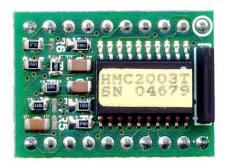




#### **FEATURES**

- 20-pin Wide DIP Footprint (1" by 0.75")
- Precision 3-axis Capability
- Factory Calibrated Analog Outputs
- ▶ 40 micro-gauss to ±2 gauss Dynamic Range
- Analog Output at 1 Volt/gauss (2.5V @ 0 gauss)
- Onboard +2.5 Volt Reference
- ▶ +6 to +15 Volt DC Single Supply Operation
- Very Low Magnetic Material Content
- ▶ -40° to 85°C Operating Temperature Range

## **BLOCK DIAGRAM**

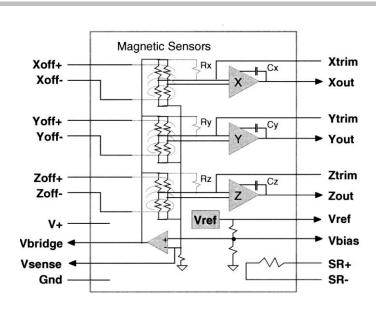

# **HMC2003**

# **SPECIFICATIONS**

Characteristics	Conditions	Min	Тур	Max	Units
Magnetic Field					
Sensitivity <sup>(2)</sup>		0.98	1	1.02	V/gauss
Null Field Output <sup>(2)</sup>		2.3	2.5	2.7	V
Resolution <sup>(3)</sup>			40		μgauss
Field Range <sup>(2)</sup>	Maximum Magnetic Flux Density	-2		2	gauss
Output Voltage(2)	Full Scale Range	3.92		4.08	V
Bandwidth <sup>(3)</sup>			1		kHz
Errors				1	1
Linearity Error <sup>(1, 2)</sup>	±1 gauss Applied Field Sweep <sup>1</sup> ±2 gauss Applied Field Sweep <sup>2</sup>		0.5 2	2	%FS
Hysteresis Error <sup>(2)</sup>	3 Sweeps across ±2 gauss		0.2		%FS
Repeatability Error <sup>(2)</sup>	3 Sweeps across ±2 gauss		0.2		%FS
Power Supply Effect <sup>(3)</sup>	PS Varied from 6 to 15V With ±1 gauss Applied Field Sweep			0.1	%FS
Offset Strap			·I		
Resistance <sup>(5)</sup>				10.5	ohms
Sensitivity <sup>(2)</sup>			47.5		mA/gauss
Current <sup>(3)</sup>				200	mA
Set/Reset Strap			1	1	-
Resistance <sup>(5)</sup>			4.5	6	ohms
Current <sup>(3)</sup>	2msec pulse, 1% duty cycle	2.0	3.2	4.5	amps
Tempcos			1	1	-
Field Sensitivity(3)			-600		ppm/°C
Null Field <sup>(3)</sup>	Set/Reset Not Used Set/Reset Used		±400 ±100		ppm/°C
Environments				1	1
Temperature <sup>(3)</sup>	Operating Storage	-40 -55	-	+85 +125	°C
Vibration <sup>(3)</sup>	-		2		g rms
Electrical			•	•	•
Supply Voltage <sup>(4)</sup>		6		15	VDC
Supply Current <sup>(2)</sup>				20	mA

<sup>(1)</sup> By Design

# **GENERAL DESCRIPTION**

<sup>(2)</sup> Tested in Production. Unless otherwise stated, test conditions are as follows: Power Supply = 12VDC, Ambient Temp = 25°C, Set/Reset switching is active except stated otherwise.

<sup>(3)</sup> Characterized

<sup>(4)</sup> Transient protection circuitry should be added across V+ and Gnd if an unregulated power supply is used.

<sup>(5)</sup> Tested in Production at the Sensor Level (HMC1001 and HMC1002)

<sup>\*</sup> Units: 1 gauss = 1 Oersted (in air) = 79.58 A/m = 10E5 gamma

# **HMC2003**


Honeywell's three axis magnetic sensor hybrid uses three permalloy magneto-resistive sensors and custom interface electronics to measure the strength and direction of an incident magnetic field. These sensors are sensitive to magnetic fields along the length, width, and height (X, Y, Z axis) of the 20-pin dual-in-line hybrid. Fields can be detected less than 40 microgauss and up to  $\pm 2$  gauss. Analog outputs are available for each X, Y and Z axis from the hybrid. With the sensitivity and linearity of this hybrid, changes can be detected in the earth's magnetic field to provide compass headings or attitude sensing. The high bandwidth of this hybrid allows for anomaly detection of vehicles, planes, and other ferrous objects at high speeds.


The hybrid is packaged on a small printed circuit board (1" by 0.75") and has an on-chip +2.5 voltage reference that operates from a single 6 to 15V supply. The hybrid is ideal for applications that require two- or three-axis magnetic sensing and have size constraints and need a magnetic transducer (magnetometer) front-end. Note that the hybrid's resistor values will vary, or an abscense of some resistor components, is likely due to individual factory calibration.

Integrated with the sensor elements composed of wheatstone bridge circuits, are magnetically coupled straps that replace the need for external field coils and provide various modes of operation. The Honeywell patented integrated field offset straps (Xoff+ and Xoff-, etc.) can be used electrically to apply local magnetic fields to the bridges to buck, or offset an applied incident field. This technique can be used to cancel unwanted ambient magnetic fields (e.g. hard-iron magnetism) or in a closed loop field nulling measurement circuit. The offset straps nominally provide 1 gauss fields along the sensitive axis per 48mA of offset current through each strap.

The HMC2003's magnetic sensors can be affected by high momentary magnetic fields that may lead to output signal degradation. In order to eliminate this effect, and maximize the signal output, a magnetic switching technique can be applied to the bridge using set/reset pins (SR+ and SR-) that eliminates the effect of past magnetic history. Refer to the application notes that provide information on set/reset circuits and operation.

## PINOUT DIAGRAM AND PACKAGE DRAWING

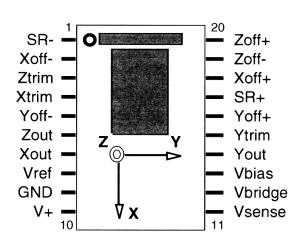

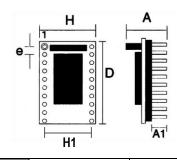

Symbol	Millimeters		Inches	
	Min	Max	Min	Max
Α	10.92	11.94	0.43	0.47
A1	2.92	3.42	0.115	0.135
D	25.91	27.30	1.02	1.075
е	2.41	2.67	0.095	0.105
Н	18.03	19.69	0.71	0.775
H1	15.11	15.36	0.595	0.605

## ORDER INFORMATION

Ordering Number	Product		
HMC2003	Three-Axis Magnetic Sensor Hybrid		




## Caution

This part is sensitive to damage by electrostatic discharge. Use ESD precautionary procedures when touching, removing or inserting.

**CAUTION: ESDS CAT. 1B** 

www.honeywell.com 3

# **HMC2003**

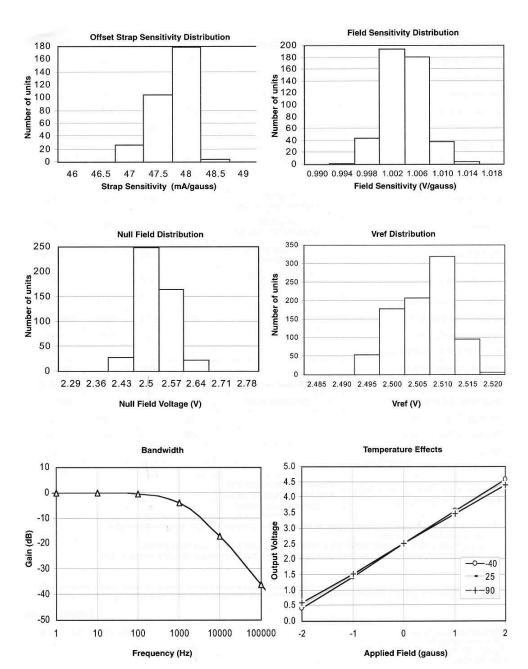

## FIND OUT MORE

For more information on Honeywell's Magnetic Sensors visit us online at www.magneticsensors.com or contact us at 800-323-8295.

The application circuits herein constitute typical usage and interface of Honeywell product. Honeywell does not warranty or assume liability of customerdesigned circuits derived from this description or depiction.

Honeywell reserves the right to make changes to improve reliability, function or design. Honeywell does not assume any liability arising out of the application or use of any product or circuit described herein; neither does it convey any license under its patent rights nor the rights of others.

Honeywell 12001 Highway 55 Plymouth, MN 55441 Tel: 800-323-8295 www.honeywell.com/magneticsensors Honeywell

PDS-42011 December 2017 ©2017 Honeywell International Inc.