



MFE SERVICES SDN. BHD. (952723-P)
No. 2339, Jalan Raja, Mukim Sungai Raya, 84300 Muar, Johor Darul Ta'zim.
Tel : 06-985 6988 / 985 8709 · Fax : 06-985 9806 · Email : mfetsb@gmail.com

Report No.	MFE/SR/2026/0918-01
Job Ref.	JOB-2026-0412
Issued	18 SEP 2026

FIRE SYSTEM SERVICE REPORT

FIRE FIGHTING & PROTECTION SYSTEM — MAINTENANCE, INSPECTION & TESTING

CLIENT	HOKUDEN (MALAYSIA) SDN. BHD.		
SITE / ADDRESS	ZONE 1 — LOT 12, JALAN PERINDUSTRIAN BUKIT PASIR, 84300 MUAR, JOHOR.		
TELEPHONE / FAX	06-986 1234 / 06-986 1235	CONTACT PERSON	MR. LIM WEI JIAN
DATE OF SERVICE	18 SEPTEMBER 2026	ARRIVAL / DEPARTURE	09:05 / 16:40
SERVICE CALL NO.	SC-26-0918	CONTRACT NO.	MFE/HKD/AMC/2026
FREQUENCY	QUARTERLY	SERVICE STATUS	☒ COMPLETED ☐ TO BE CONTINUED
TEST LEADER	MOHD HAFIZ BIN ISMAIL	TECHNICIANS	MOHD HAFIZ · TAN KAH SENG · RAJ KUMAR

FIRE FIGHTING & PROTECTION SYSTEMS SERVICED			
☒ Automatic Sprinkler System	☒ Hose Reel System	☒ Fire Alarm / Detector System	☐ Hydrant System
☒ Portable Fire Extinguisher	☐ Dry / Wet Riser System	☐ CO2 Fire Extinguisher System	☐ Wet Chemical System
☐ FM 200 System	☐ Smoke Ventilation System	☐ Fire Intercom System	☐ Fire Rated Roller Shutter

WE HEREBY CONFIRM THAT THE ATTACHED RECORDS ARE TRUE AND CORRECT AS AT THE TIME OF INSPECTION / TESTING.

SERVICED BY — MFE SERVICES SDN. BHD.	VERIFIED BY — MFE SERVICES SDN. BHD.	CONFIRMED BY — CUSTOMER
MOHD HAFIZ BIN ISMAIL Team: MOHD HAFIZ, TAN KAH SENG, RAJ KUMAR Signature · Date: 18 SEPTEMBER 2026	 Name, Signature & Company Stamp · Date:	 Name, Signature & Company Stamp · Date:

Customer Satisfaction / Comment	☐ Excellent	☐ Satisfactory	☐ Not Satisfactory	Comment:
---------------------------------	------------------------------------	---------------------------------------	---	----------

NOTE :-
1. All fire systems listed above were tested and inspected on the date of service. Detailed results are recorded on the following pages.
2. Should any abnormal condition occur which might cause further damage to the customer's systems or threaten human safety or the environment, the customer agrees to call MFE immediately for necessary action.
3. Rectification works, parts replacement, piping and wiring works found necessary during this service are quoted and charged separately.
4. MFE is not responsible for any area, room or device that was not made accessible for inspection or testing on the date of service.

S	SUMMARY OF TESTING One line per system inspected. The condition is the overall result of that system; details are on the page shown.	DATE OF SERVICE 18 SEPTEMBER 2026
----------	--	---

NO.	SYSTEM / TEST DESCRIPTION	LOCATION / UNIT	PAGE	FREQUENCY	CONDITION	MAIN FINDING
1	AUTOMATIC SPRINKLER SYSTEM	Pump Room, Block A · Zone: Zone 1	3	QUARTERLY	REFER DETAIL PAGE	Pump House — Battery In Good Serviceable: COMPLETE REPAIR — Battery 2 weak (11.2 V); replaced with 12 V 100 Ah on site.
2	HOSE REEL SYSTEM	All floors · Drum type: Swing type · 14 units	5	QUARTERLY	FAILED	Hose Reel Drum No. 7 (1/F Office Corridor) — Hose: NOT GOOD — Hose leaking at coupling. (+2 more)
3	FIRE ALARM / DETECTOR SYSTEM	Main Fire Alarm Panel — Guard House · 6 zones	7	QUARTERLY	GOOD CONDITIONS	—
4	PORTABLE FIRE EXTINGUISHER	Whole premises	9	QUARTERLY	GOOD CONDITIONS	—

CONDITION INDICATOR

GOOD CONDITIONS	All items in good working condition; system ready for use.
REFER DETAIL PAGE	Defect found and rectified / minor defect; system usable during a fire emergency. See detail page.
FAILED	Defect found that affects the system. Rectification required; see detail page.

RESULT SYMBOLS (DETAIL PAGES)

✓ GOOD	In good working condition / Baik
✗ NOT GOOD	In poor working condition / Tidak Memuaskan
○ COMPLETE REPAIR	Defect rectified on site / Siap Baik Pulih
– N/A	No need checking / Tidak Berkaitan

ADVICE TO CUSTOMER :-

1. Replace fire alarm panel and pump starter batteries every 2 years or when capacity test fails, using the same ampere-hour rating.
2. Do not block fire protection equipment, alarm devices, exit doors, fire lift lobbies, staircases or escape routes. Do not padlock exit doors.
3. Emergency lights and KELUAR signs must be kept in working condition.
4. Do not use fire system water (hose reel, hydrant, riser, fire tank) except for fire fighting.
5. Do not isolate or switch off any fire alarm panel, pump set or suppression panel without informing MFE.
6. After any renovation shut-down, ensure all control valves are returned to the OPEN position.
7. Refill or replace any portable fire extinguisher immediately after use.
8. Contact MFE at 06-985 6988 for any complaint about this service.

1

AUTOMATIC SPRINKLER SYSTEM

Pump Room, Block A · Zone: Zone 1

SYSTEM CONDITION

REFER DETAIL PAGE

• Do not close any main control valve. Valves are secured with MFE safety seals.

WATER TANK

NO	INSPECTION & TEST	RESULT	REMARKS
1	S.A.J Main Water Supply	✓ GOOD	
2	Water Level	✓ GOOD	Full
3	Automatic Refilling Facilities	✓ GOOD	
4	Drain Valve In Close Position And All Stop Valve In Open Position	✓ GOOD	

MAIN ALARM VALVE

NO	INSPECTION & TEST	REQ / UNIT	READING	RESULT
1	Breaching Inlet In Good Serviceable	-	-	✓ GOOD
2	Alarm Gong In Function	-	-	✓ GOOD
3	Water Supply Gauge	PSI	125	✓ GOOD
4	Installation Gauge	PSI	120	✓ GOOD
5	Flow Meter Valve Closed, All Other Valves Open	-	-	✓ GOOD

PUMP HOUSE

NO	INSPECTION & TEST	REQ / UNIT	READING	RESULT	REMARKS
1	Keep Clean In Pump House	-	-	✓ GOOD	
2	Manual Start Jockey Pump, Duty Pump & Stand-by Pump	-	-	✓ GOOD	
3	Jockey Pump Correct Cut In / Cut Out	PSI	110 / 140	✓ GOOD	
4	Correct Duty Pump Cut In	PSI	95	✓ GOOD	
5	Correct Stand-by Pump Cut In	PSI	80	✓ GOOD	
6	Stand-by Pump Water, Oil, Fuel, Belt and etc.	-	-	✓ GOOD	Diesel 3/4
7	Correct Operation Of Battery Charging Alternator	-	-	✓ GOOD	
8	Battery In Good Serviceable	-	-	○ COMPLETE REPAIR	Battery 2 weak (11.2 V); replaced with 12 V 100 Ah on site.
9	Pump Run / Phase Failure Alarm Signal To Main Alarm Panel	-	-	✓ GOOD	
10	Jockey, Duty And Stand-by Pump In Auto Start Position	-	-	✓ GOOD	
11	Test Valve In Close Position And All Gate Valve In Open Position	-	-	✓ GOOD	

1	AUTOMATIC SPRINKLER SYSTEM (continued) Pump Room, Block A · Zone: Zone 1	SYSTEM CONDITION REFER DETAIL PAGE
---	--	--

TEST RUN FIRE PUMP 30 MINUTES

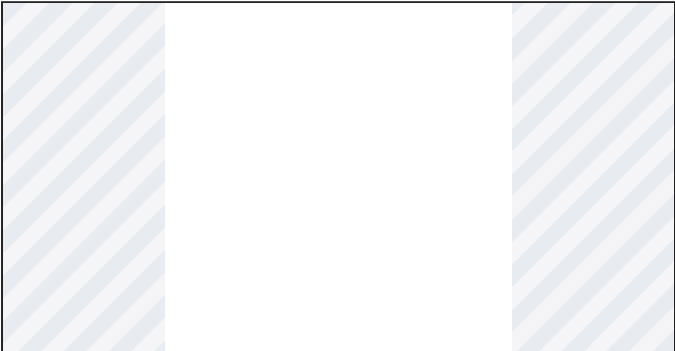
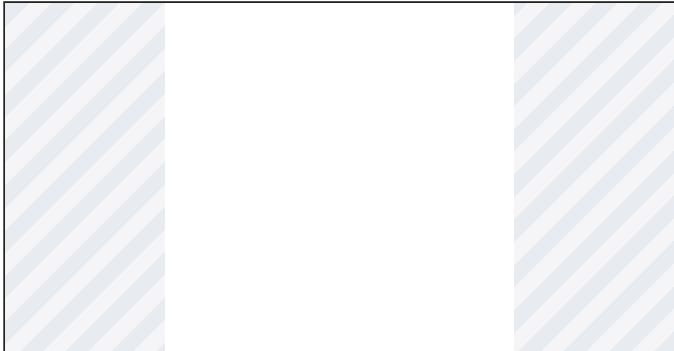
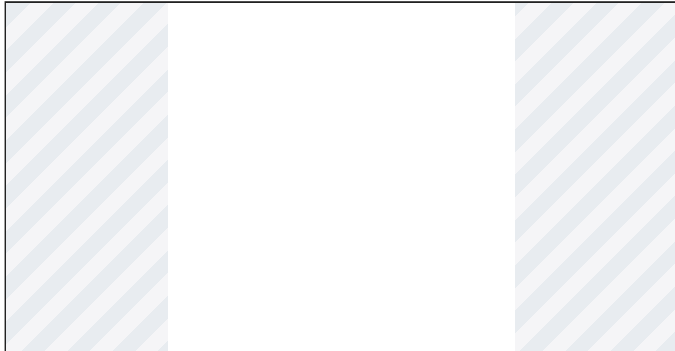
DESCRIPTION	REQ / UNIT	JOCKEY PUMP	DUTY PUMP	STAND-BY PUMP
Test Run Fire Pump 30 Minutes		✓ GOOD	✓ GOOD	✓ GOOD
Remarks		—	Ran 30 min, no abnormal noise.	Ran 30 min after battery change.

REMARK : 1. Pump House — Battery In Good Serviceable: COMPLETE REPAIR — Battery 2 weak (11.2 V); replaced with 12 V 100 Ah on site.

COMMENTS

Sprinkler installation in normal standby condition on departure. All valves sealed.

PHOTO EVIDENCE

		
1. Pump House — Battery In Good Serviceable — Replaced battery installed	2. Main Alarm Valve — Installation Gauge — 120 PSI	3. Pump House — Overall — Pump room on departure

INSPECTION DATE	18 SEPTEMBER 2026	INSPECTED BY	MOHD HAFIZ	TAN KAH SENG	RAJ KUMAR	
INITIAL						

2	HOSE REEL SYSTEM All floors · Drum type: Swing type · 14 units	SYSTEM CONDITION
		FAILED

WATER TANK

NO	INSPECTION & TEST	RESULT
1	S.A.J Main Water Supply	✓ GOOD
2	Water Level	✓ GOOD
3	Automatic Refilling Facilities	✓ GOOD
4	Drain Valve In Close Position And All Stop Valve	✓ GOOD

TEST RUN FIRE PUMP 30 MINUTES

DESCRIPTION	REQ / UNIT	DUTY PUMP	STAND-BY PUMP
Test Run Fire Pump 30 Minutes		✓ GOOD	✓ GOOD

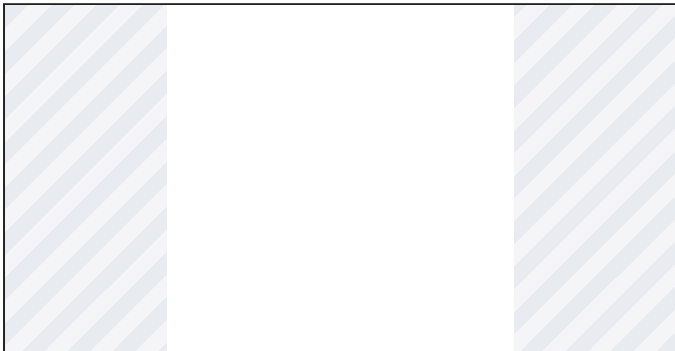
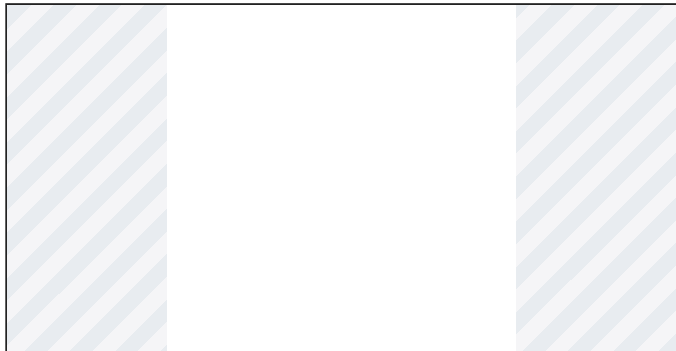
HOSE REEL DRUM

NO	LOCATION	DRUM	HOSE	NOZZLE	VALVE	NOZZLE BOX	REMARKS
1	G/F Main Entrance	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	
2	G/F Production Line A	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	
3	G/F Production Line B	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	- N/A	No nozzle box fitted
4	G/F Warehouse	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	
5	G/F Loading Bay	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	
6	1/F Lift Lobby	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	
7	1/F Office Corridor	✓ GOOD	✗ NOT GOOD	✓ GOOD	✓ GOOD	✓ GOOD	Hose leaking at coupling
8	1/F Store Room	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	
9	2/F Lift Lobby	✓ GOOD	✓ GOOD	○ COMPLETE REPAIR	✓ GOOD	✓ GOOD	Nozzle tightened
10	2/F Production	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	
11	2/F Canteen	✓ GOOD	✓ GOOD	✗ NOT GOOD	✓ GOOD	✓ GOOD	Nozzle missing
12	3/F Lift Lobby	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	
13	3/F Plant Room	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	
14	Roof Access	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	✓ GOOD	

2	HOSE REEL SYSTEM (continued) All floors · Drum type: Swing type · 14 units	SYSTEM CONDITION FAILED
---	--	-----------------------------------

REMARK : 1. Hose Reel Drum No. 7 (1/F Office Corridor) — Hose: NOT GOOD — Hose leaking at coupling. 2. Hose Reel Drum No. 11 (2/F Canteen) — Nozzle: NOT GOOD — Nozzle missing. 3. Hose Reel Drum No. 9 (2/F Lift Lobby) — Nozzle: COMPLETE REPAIR — Nozzle tightened.	PARTS / RECTIFICATION REQUIRED : 1. HOSE (30 M) X 1 2. NOZZLE X 1
--	--

COMMENTS

PHOTO EVIDENCE	
	
1. Drum No. 7 — Hose — Leak at coupling	2. Drum No. 11 — Nozzle — Nozzle missing

INSPECTION DATE	18 SEPTEMBER 2026	INSPECTED BY	MOHD HAFIZ	TAN KAH SENG	RAJ KUMAR	
INITIAL						

3	FIRE ALARM / DETECTOR SYSTEM										SYSTEM CONDITION		
	Main Fire Alarm Panel — Guard House · 6 zones										GOOD CONDITIONS		

- Do not isolate any switch at the control panel without permission.
- Do not replace batteries with a lower ampere-hour rating than the original.

DETECTOR TEST

ALARM ZONE	LOCATION	MANUAL CALL POINT			FLOW SWITCH			HEAT DETECTOR			SMOKE DETECTOR		
		N	T	I	N	T	I	N	T	I	N	T	I
Z-1	Guard House	✓	✓					✓	✓		✓	✓	
Z-2	G/F Production	✓	✓		✓	✓		✓	✓				
Z-3	G/F Warehouse	✓	✓		✓	✓		✓	✓				
Z-4	1/F Office	✓	✓								✓	✓	
Z-5	2/F Production	✓	✓		✓	✓		✓	✓				
Z-6	3/F Plant Room	✓	✓					✓	✓				

CHARGER & BATTERIES

NO	INSPECTION & TEST	REQ / UNIT	READING	RESULT
1	Main Supply	ON	ON	✓ GOOD
2	Battery	VDC	26.8	✓ GOOD
3	Charger	ON	ON	✓ GOOD

TIMER

NO	INSPECTION & TEST	REQ / UNIT	READING	RESULT
1	Timer for alarm ringing after flow switch detects signal	SECONDS	30	

MAIN FUNCTION KEY

NO	INSPECTION & TEST	RESULT
1	Main Alarm Reset	✓ GOOD
2	Lamp Test	✓ GOOD
3	Evacuate	✓ GOOD
4	A/C Supply	✓ GOOD
5	D/C Supply	✓ GOOD
6	SPKA System	– N/A
7	Alarm Lift Trip	✓ GOOD
8	Signal Gas Discharge	– N/A

ALARM BELL & MANUAL CALL POINT

NO	LOCATION	ALARM BELL	MANUAL CALL POINT	REMARKS
1	Guard House	✓ GOOD	✓ GOOD	
2	G/F Production (east / west)	✓ GOOD	✓ GOOD	

3	FIRE ALARM / DETECTOR SYSTEM (continued) Main Fire Alarm Panel — Guard House · 6 zones	SYSTEM CONDITION GOOD CONDITIONS
---	--	--

NO	LOCATION	ALARM BELL	MANUAL CALL POINT	REMARKS
3	G/F Warehouse	✓ GOOD	✓ GOOD	
4	1/F Office	✓ GOOD	✓ GOOD	
5	2/F Production	✓ GOOD	✓ GOOD	
6	3/F Plant Room	✓ GOOD	✓ GOOD	

REMARK : <i>No defects found.</i>

COMMENTS
Panel in normal condition on departure. No zone isolated.

INSPECTION DATE	18 SEPTEMBER 2026	INSPECTED BY	MOHD HAFIZ	TAN KAH SENG	RAJ KUMAR	
INITIAL						

4	PORTABLE FIRE EXTINGUISHER Whole premises	SYSTEM CONDITION GOOD CONDITIONS
---	---	--

QUANTITY SUMMARY

TYPE	QUANTITY
9 kg Dry Powder Fire Extinguisher	18 NOS
2 kg CO2 Portable Fire Extinguisher	6 NOS
Total Fire Extinguisher	24 NOS

REMARK : <i>No defects found.</i>

COMMENTS

Next refill / expiry date: 12 SEP 2027. All units pressure gauge in green zone, safety pins and seals intact.

INSPECTION DATE	18 SEPTEMBER 2026	INSPECTED BY	MOHD HAFIZ	TAN KAH SENG	RAJ KUMAR	
INITIAL						

— END OF REPORT —