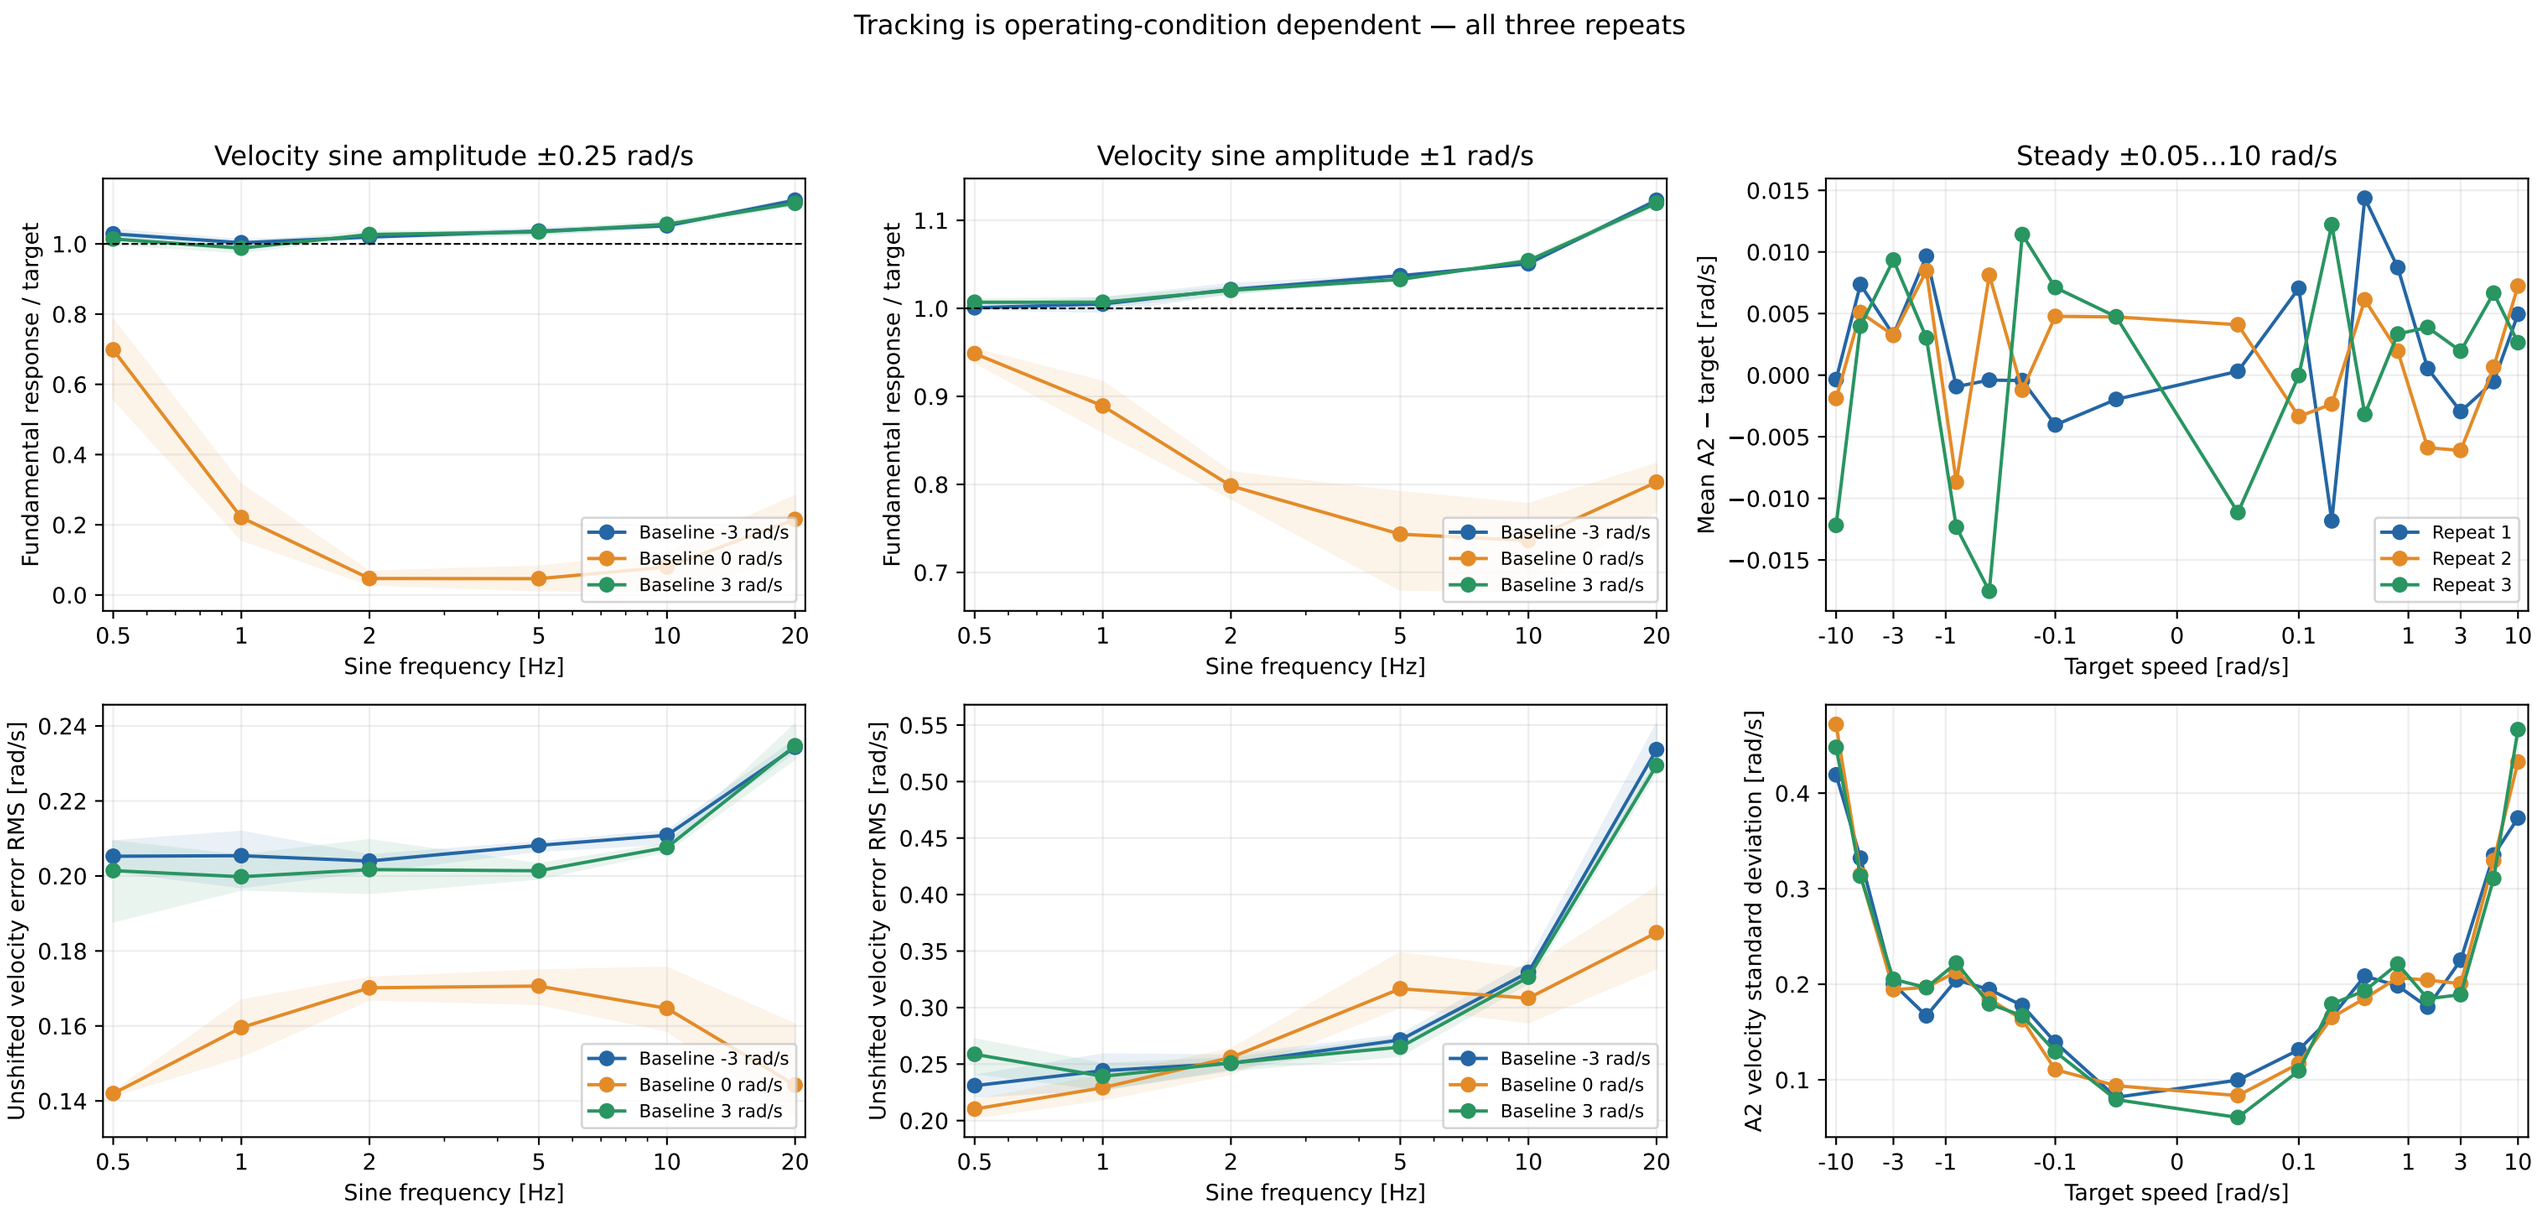
Tracking is operating-condition dependent — all three repeats
Velocity sine amplitude ±0.25 rad/s
Velocity sine amplitude ±1 rad/s
Steady ±0.05…10 rad/s
Fundamental response / target
Sine frequency [Hz]
Mean A2 − target [rad/s]
Target speed [rad/s]
Unshifted velocity error RMS [rad/s]
A2 velocity standard deviation [rad/s]
Baseline -3 rad/s
Baseline 0 rad/s
Baseline 3 rad/s
Repeat 1
Repeat 2
Repeat 3
Lines = mean of three trials; shading = trial range. Gains use actual held commands; RMS includes speed ripple and has no delay compensation.