Honeywell

ASDX Series Silicon Pressure Sensors

Low Pressure and Ultra-Low Pressure Analog Output, ±2% Total Error Band, 10 Inches H₂O to 100 psi



DESCRIPTION

The ASDX Series is a Silicon Pressure Sensor offering a ratiometric analog interface for reading pressure over the specified full scale pressure span and temperature range.

The ASDX is fully calibrated and temperature compensated for sensor offset, sensitivity, temperature effects and non-linearity using an on-board Application Specific Integrated Circuit (ASIC). Calibrated output values for pressure are updated at approximately 1 kHz.

The standard ASDX is calibrated over the temperature range of 0 $^{\circ}$ C to 85 $^{\circ}$ C [32 $^{\circ}$ F to 185 $^{\circ}$ F]. The sensor is characterized for operation from a single power supply of either 3.3 Vdc or 5.0 Vdc.

FEATURES

- Ratiometric 12-bit analog output
- Precision ASIC conditioning and temperature compensated over 0 °C to 85 °C [32 °F to 185 °F] temperature range
- Low operating voltage
- Absolute, differential and gage types
- Pressure ranges from 10 inches H₂0 to 100 psi
- Standard calibrations in inches H₂0, cm H₂0, psi, mbar, bar, kPa
- Total error band of ±2.0% of full scale span maximum
- RoHS compliant

These sensors are available to measure absolute, differential and gage pressures. The absolute versions have an internal vacuum reference and an output value proportional to absolute pressure. Differential versions allow application of pressure to either side of the sensing diaphragm. Gage versions are referenced to atmospheric pressure and provide an output proportional to pressure variations from atmosphere.

The ASDX Series sensors are intended for use with non-corrosive, non-ionic working fluids such as air and dry gases. They are designed and manufactured according to standards in ISO 9001.

POTENTIAL APPLICATIONS

- Flow calibrators
- Ventilation and air flow monitors
- Gas flow instrumentation
- Sleep apnea monitoring and therapy equipment
- Barometry
- Pneumatic controls
- HVAC

ASDX Series Silicon Pressure Sensors

Table 1. Absolute Maximum Ratings¹

| Parameter | Min | Max | Unit |
|--|-----------|---------------------------|---------|
| Supply voltage (V _{supply}) | -0.3 | 6.0 | Vdc |
| Voltage to any pin | -0.3 | V _{supply} + 0.3 | Vdc |
| ESD susceptibility (human body model) | 3 | - | kV |
| Storage temperature | -50 [-58] | 125 [257] | °C [°F] |
| Lead temperature (2 s to 4 s) | - | 250 [482] | °C [°F] |
| External capacitance between V _{supply} and ground ² | 100 | 470 | nF |

Table 2. Operating Specifications

| Parameter | Min. | Тур. | Max. | Unit |
|---|-------------------------------------|------------------|-----------|--------------------|
| Supply voltage: (V _{supply}) ³ | | | | |
| 3.3 Vdc | 3.0 | 3.34 | 3.6 | Vdc |
| 5.0 Vdc | 4.75 | 5.0 ⁴ | 5.25 | vuc |
| Sensors are either 3.3 Vdc or 5.0 Vdc per the order guide (see Figure 1). | | | | |
| Supply current | 1.5 | 2.5 | 3.5 | mA |
| Compensated temperature range ⁵ | 0 [32] | - | 85 [185] | °C [°F] |
| Operating temperature range ⁶ | -20 [-4] | - | 105 [221] | °C [°F] |
| Overpressure ⁷ | 2X operating pressure range minimum | | | |
| Burst pressure ⁸ | 3X operating pressure range minimum | | | |
| Startup time (power up to data ready) | - | - | 5 | ms |
| Response time | - | 1.0 | - | ms |
| Upper output clipping limit | 97.5 | - | - | Vsupply |
| Lower output clipping limit | - | - | 2.5 | Vsupply |
| Minimum load resistance | 5.0 | - | - | kOhm |
| Total error band ⁹ | - | - | 2.0 | %FSS ¹⁰ |
| Output resolution | 12 | - | - | bits |

Table 3. Environmental Specifications

| Parameter | Characteristic |
|-----------|-----------------------------|
| Humidity | 0% to 95% RH non-condensing |
| Vibration | 10 G at 20 Hz to 2000 Hz |
| Shock | 100 G for 11 ms |
| Life | 1 million cycles minimum |

Table 4. Wetted Materials¹¹


| Parameter | Port 1 (Pressure Port) ¹² | Port 2 (Reference Port) ¹² |
|-----------------------|--------------------------------------|---------------------------------------|
| Covers | glass-filled PBT | glass-filled PBT |
| Adhesives | silicone | silicone and epoxy |
| Electronic components | silicon and glass | silicon, glass, and gold |

Notes:

- Absolute maximum ratings are the extreme limits that the device will withstand without damage to the device.
- An external bypass capacitor is required across the supply voltage (Pins 1 and 3 see Figure 4) as close to the sensor supply pin as possible for correct sensor operation.
- Ratiometricity of the sensor (the ability of the output to scale to the input voltage) is achieved within the specified operating voltage for each option. Other custom supply voltages are available, please contact Honeywell Customer Service.
- 4. The sensor is not reverse polarity protected. Incorrect application of excitation voltage or ground to the wrong pin may cause electrical failure.
- 5. The compensated temperature range is the temperature range (or ranges) over which the sensor will produce an output proportional to pressure within the specified performance limits.
- 6. The operating temperature range is the temperature range over which the sensor will produce an output proportional to pressure but may not remain within the specified performance limits.
- Overpressure is the maximum pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product.
 Burst pressure is the maximum pressure that may be applied to any port of the product without causing escape of pressure media. Product
- Burst pressure is the maximum pressure that may be applied to any port of the product without causing escape of pressure media. Product should not be expected to function after exposure to any pressure beyond the burst pressure.
 Total error band is the maximum deviation in output from ideal transfer function over the entire compensated temperature and pressure range.
- Total error band is the maximum deviation in output from ideal transfer function over the entire compensated temperature and pressure range.
 Includes all errors due to offset, full scale span, pressure non-linearity, pressure hysteresis, repeatability, thermal effect on offset, thermal effect on span and thermal hysteresis. Specification units are in percent of full scale span (%FSS).
- 10. Full scale span (FSS) is the algebraic difference between the output signal measured at the maximum (Pmax.) and minimum (Pmin.) limits of the pressure range.
- 11. Consult Honeywell Customer Service for detailed material information.
- 12. For AC pressure port configuration, the "pressure" and "reference" ports are reversed.

Low and Ultra-Low Pressure Analog Output

Figure 1. Nomenclature and Order Guide

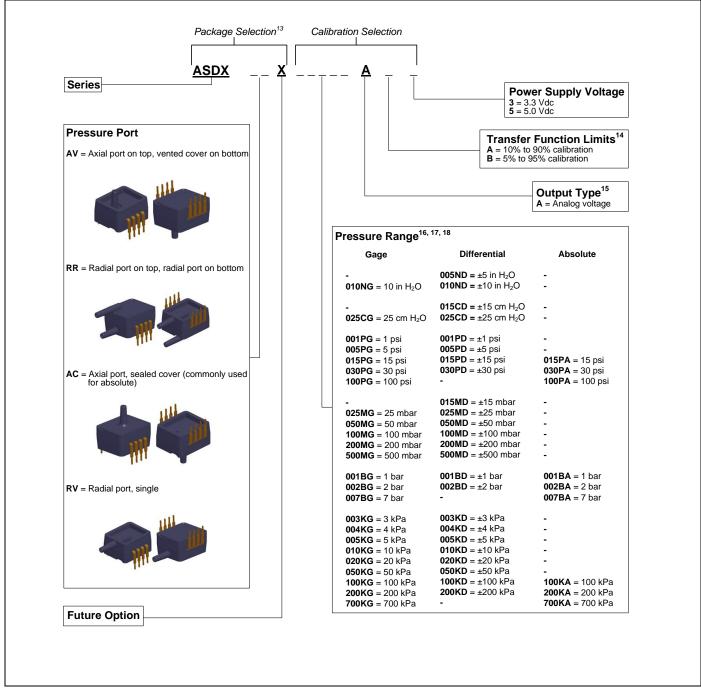

Notes:


- 13. Other package combinations are possible, please contact Honeywell Customer Service.
- 14. The transfer function limits define the output of the sensor at a given pressure input. By specifying the output signal at the maximum (Pmax.) and minimum (Pmin.) limits of the pressure range, the complete transfer curve for the sensor is defined. See Figure 2 for a graphical representation of each calibration.
- 15. For a digital output, please refer to the ASDX Digital Series.
- 16. Custom pressure ranges are available, please contact Honeywell Customer Service.
- 17. The pressure units (inches H₂0, cm H₂0, psi, mbar, bar, kPa) define the units used during calibration and in the application.
- 18. See Table 5 for an explanation of sensor types.

ASDX Series Silicon Pressure Sensors

Table 5. Sensor Types

| Туре | Description | |
|--------------|---|--|
| Absolute | Output is proportional to difference between applied pressure and built-in reference to vacuum (zero pressure). | |
| Gage | Output is proportional to difference between applied pressure and atmospheric (ambient) pressure. | |
| Differential | Output is proportional to difference between pressure applied to each of the pressure ports (Port 1 – Port 2). | |

Figure 2. Transfer Functions and Limits

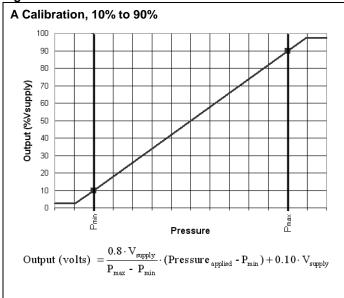


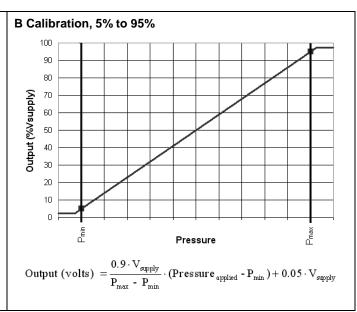


Figure 3. Completed Catalog Listing Example


ASDXAVX001PGAA3:

AV pressure port, 1 psi gage, analog output, 10% to 90% calibration at 3.3 Vdc operation.



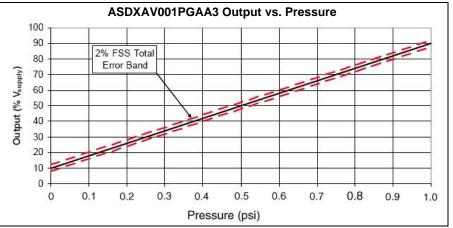

Low and Ultra-Low Pressure Analog Output



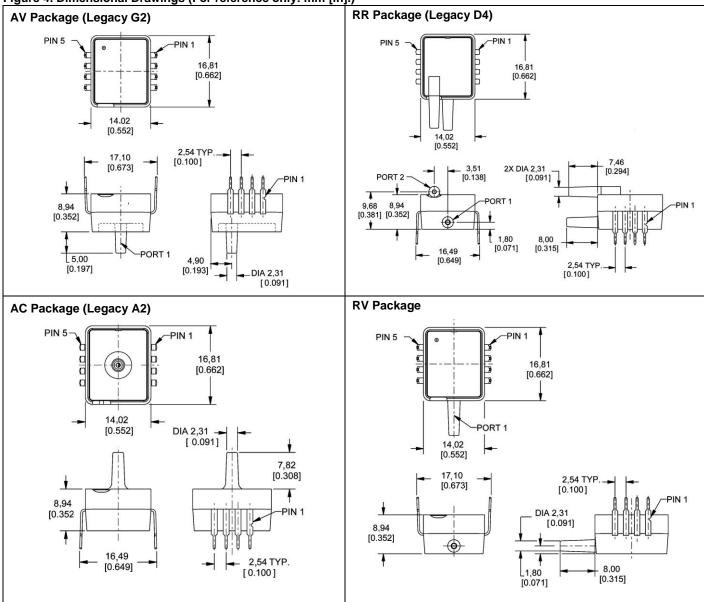


Table 7. Pinout

| Pin | Definition | Туре | Description |
|-----|------------|---------------|-----------------------------------|
| 1 | Vsupply | supply | power supply source |
| 2 | Vout | analog output | provides the analog output |
| 3 | GND | supply | power supply ground |
| 4 | N/C | not used | do not connect in the application |
| 5 | N/C | not used | do not connect in the application |
| 6 | N/C | not used | do not connect in the application |
| 7 | N/C | not used | do not connect in the application |
| 8 | N/C | not used | do not connect in the application |

WARNING

PERSONAL INJURY

DO NOT USE these products as safety or emergency stop devices or in any other application where failure of the product could result in personal injury.

Failure to comply with these instructions could result in death or serious injury.

WARRANTY/REMEDY

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgement or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items it finds defective. The foregoing is buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.

While we provide application assistance personally, through our literature and the Honeywell web site, it is up to the customer to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this printing. However, we assume no responsibility for its use.

WARNING

MISUSE OF DOCUMENTATION

- The information presented in this product sheet is for reference only. Do not use this document as a product installation guide.
- Complete installation, operation, and maintenance information is provided in the instructions supplied with each product.

Failure to comply with these instructions could result in death or serious injury.

SALES AND SERVICE

Honeywell serves its customers through a worldwide network of sales offices, representatives and distributors. For application assistance, current specifications, pricing or name of the nearest Authorized Distributor, contact your local sales office or:

E-mail: info.sc@honeywell.com

Internet: sensing.honeywell.com

Phone and Fax:

Asia Pacific +65 6355-2828; +65 6445-3033 Fax

Europe +44 (0) 1698 481481; +44 (0) 1698 481676 Fax

Latin America +1-305-805-8188; +1-305-883-8257 Fax USA/Canada +1-800-537-6945; +1-815-235-6847

+1-815-235-6545 Fax



