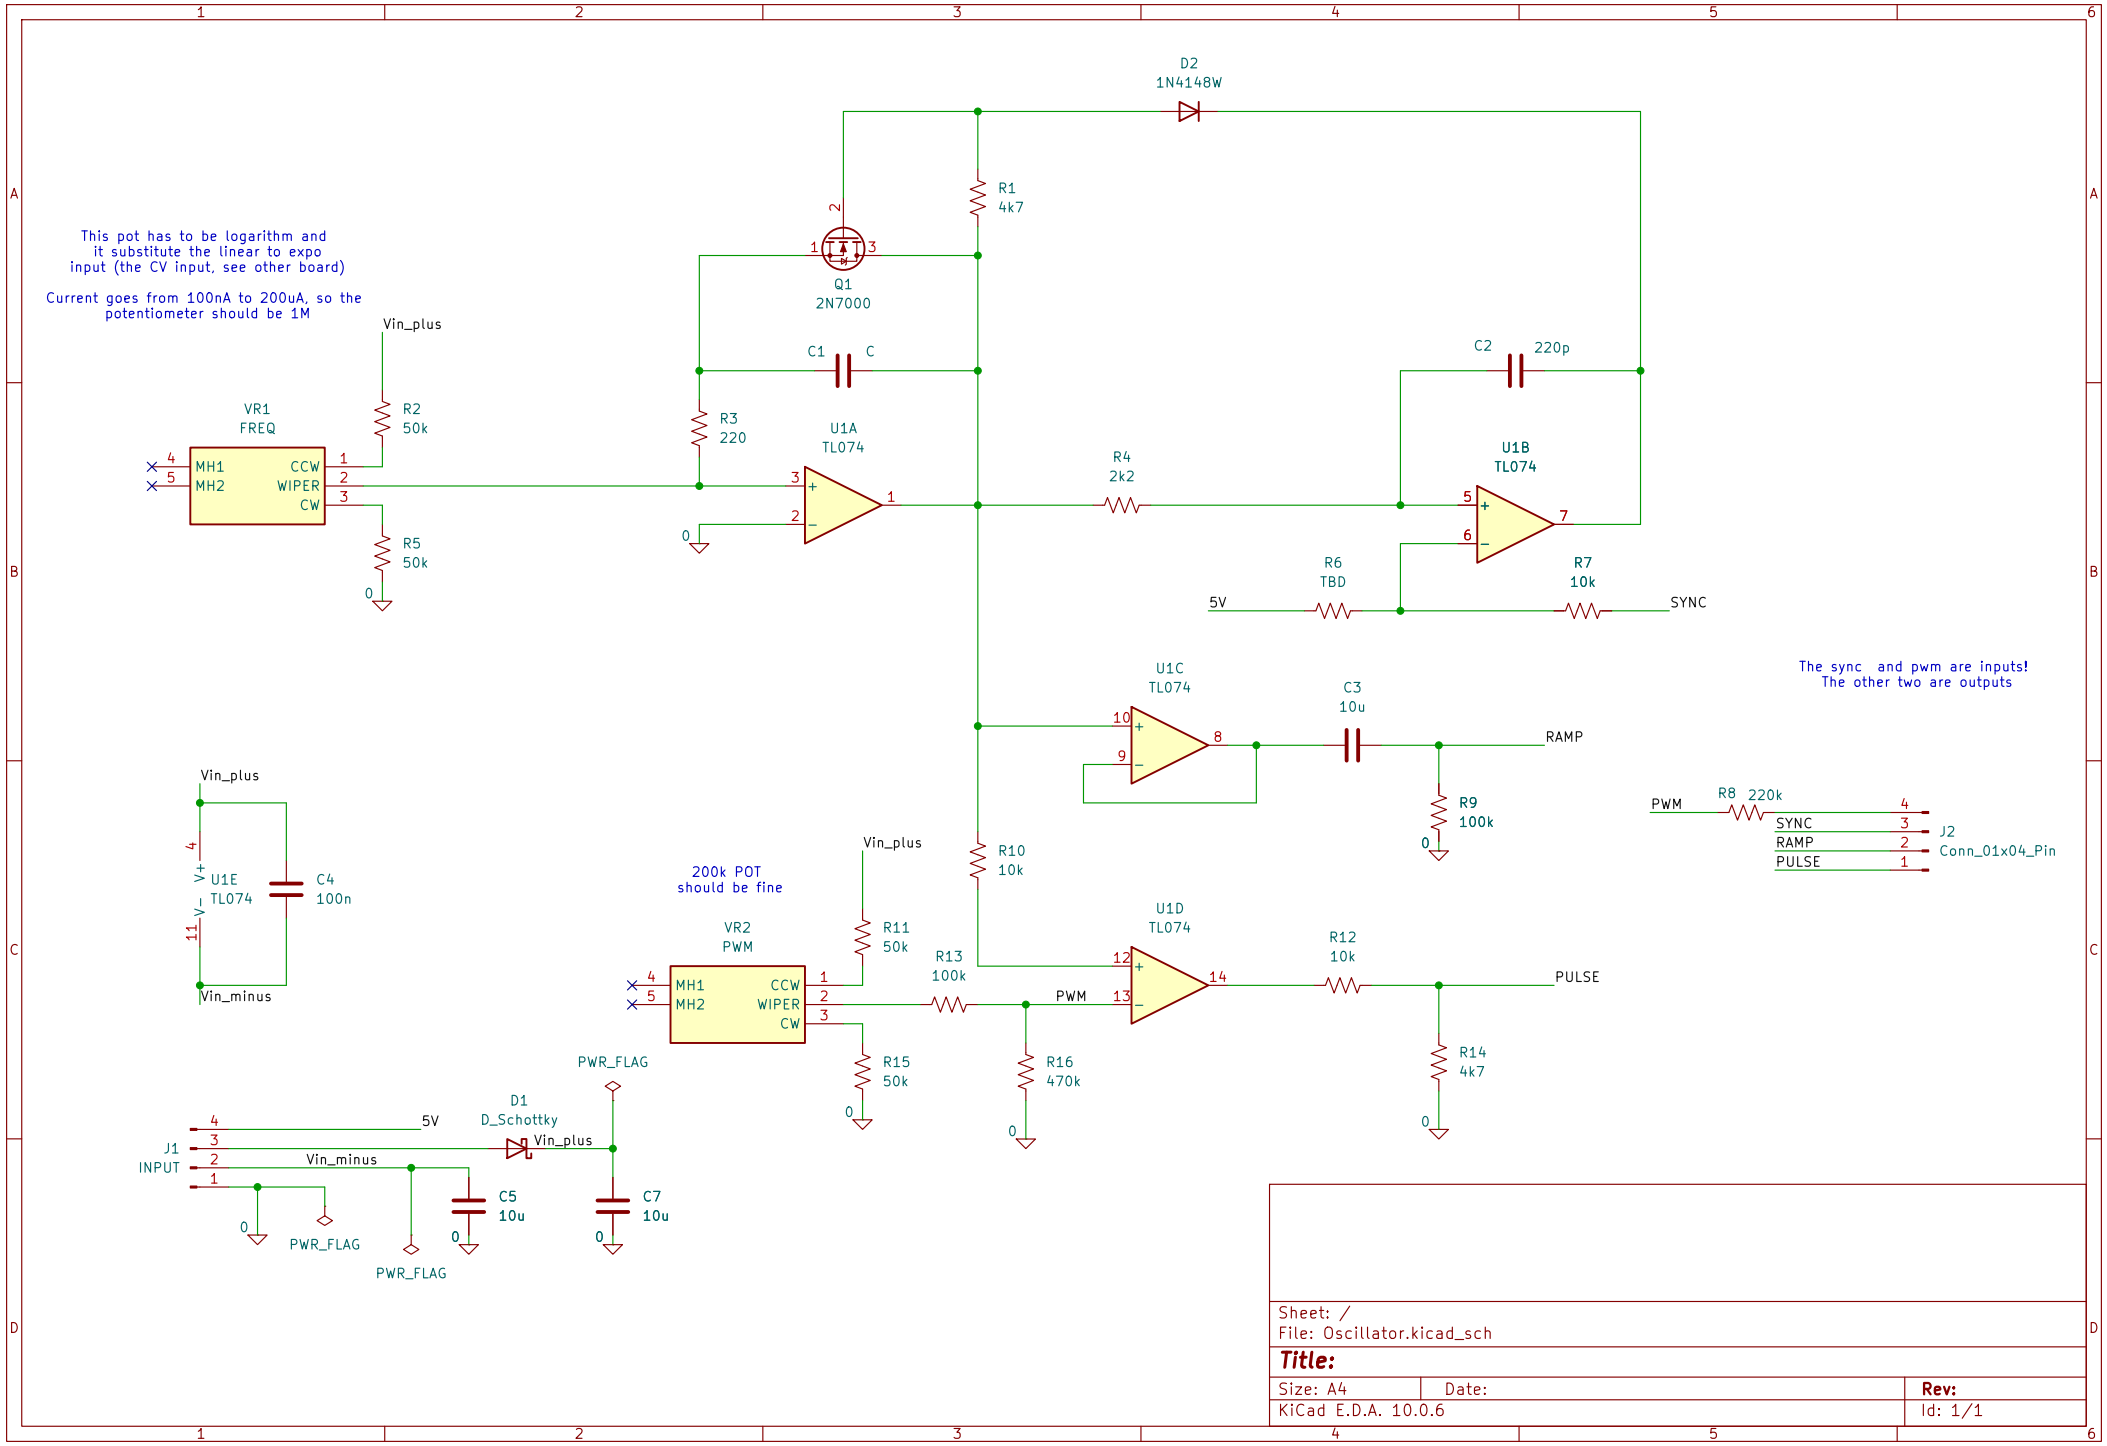

D2
1N4148W
R1
4k7
Q1
2N7000
This pot has to be logarithm and
it substitute the linear to expo
input (the CV input, see other board)
Current goes from 100nA to 200uA, so the
potentiometer should be 1M
Vin_plus
VR1
FREQ
R2
50k
R5
50k
C1
C
R3
220
U1A
TL074
C2
220p
U1B
TL074
R4
2k2
R6
TBD
R7
10k
5V
SYNC
U1C
TL074
C3
10u
RAMP
R9
100k
The sync and pwm are inputs!
The other two are outputs
PWM
R8
220k
SYNC
RAMP
PULSE
J2
Conn_01x04_Pin
Vin_plus
U1E
TL074
C4
100n
Vin_minus
200k POT
should be fine
VR2
PWM
Vin_plus
R11
50k
R10
10k
R13
100k
U1D
TL074
R12
10k
PULSE
R15
50k
R16
470k
R14
4k7
PWR_FLAG
D1
D_Schottky
J1
INPUT
5V
Vin_plus
Vin_minus
C5
10u
C7
10u
PWR_FLAG
PWR_FLAG
Sheet: /
File: Oscillator.kicad_sch
Title:
Size: A4
Date:
Rev:
KiCad E.D.A. 10.0.6
Id: 1/1