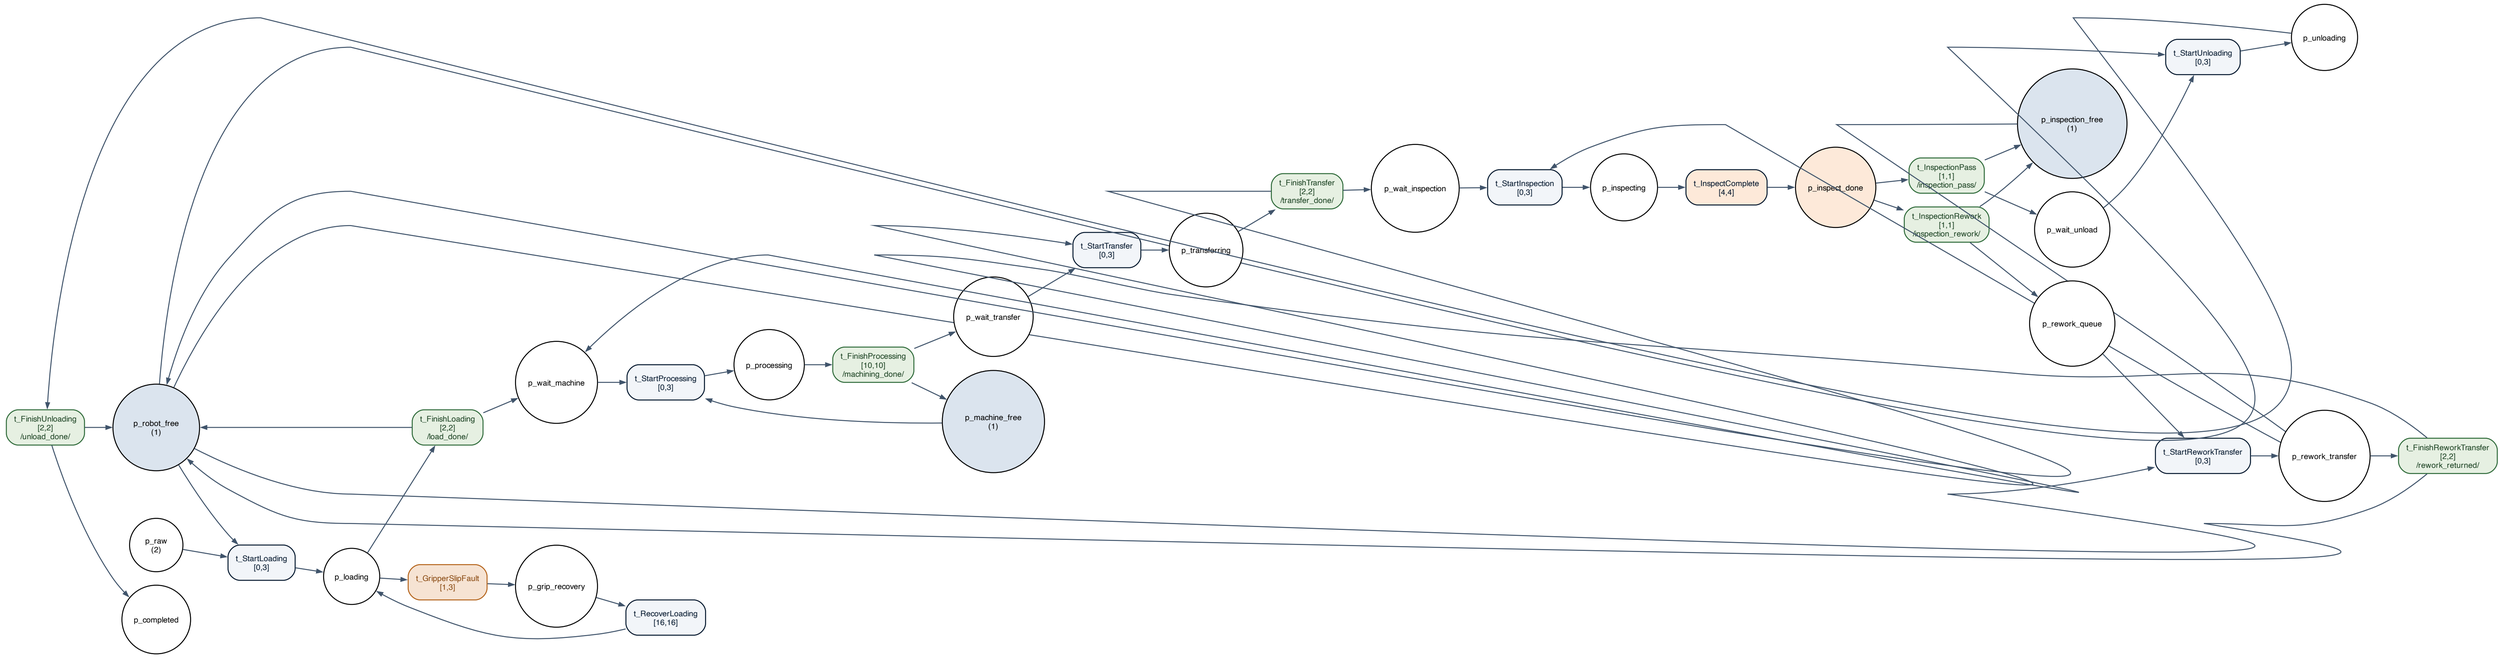
t_FinishUnloading
[2,2]
/unload_done/
p_robot_free
(1)
t_FinishLoading
[2,2]
/load_done/
p_wait_machine
t_StartProcessing
[0,3]
p_processing
t_FinishProcessing
[10,10]
/machining_done/
p_machine_free
(1)
p_wait_transfer
t_StartTransfer
[0,3]
p_transferring
t_FinishTransfer
[2,2]
/transfer_done/
p_wait_inspection
t_StartInspection
[0,3]
p_inspecting
t_InspectComplete
[4,4]
p_inspect_done
t_InspectionPass
[1,1]
/inspection_pass/
t_InspectionRework
[1,1]
/inspection_rework/
p_inspection_free
(1)
p_wait_unload
t_StartUnloading
[0,3]
p_unloading
p_rework_queue
t_StartReworkTransfer
[0,3]
p_rework_transfer
t_FinishReworkTransfer
[2,2]
/rework_returned/
p_raw
(2)
t_StartLoading
[0,3]
p_loading
t_GripperSlipFault
[1,3]
p_grip_recovery
t_RecoverLoading
[16,16]
p_completed