

PRODUCT DESCRIPTION


Modern Fiberglass is a ready-to-use fiberglass repair and reinforcement kit: a one-component liquid resin supplied together with woven glass-fibre cloth. The resin is based on one-component moisture-curing HydroCure Polymer technology powered by Covestro — no hardener, no mixing, no pot-life race. It wets the woven cloth until translucent, penetrates the weave and cures into a tough, flexible laminate that bonds to surfaces conventional resins struggle with — rigid plastics, glazed ceramic tile, concrete and existing fibreglass — and resists impact and structural movement without brittle failure.

KEY DATA


Chemistry	HydroCure moisture-curing polymer resin — powered by Covestro
Supplied form	One-component liquid resin + woven glass-fibre cloth (kit)
Mixing	None — ready to use. Stir briefly before use; reseal immediately after (moisture-sensitive)
Application	Brush. Prime the surface with a thin coat of resin, lay the cloth into the wet film, then work resin through the weave until the cloth turns translucent; press out air
System pairing	1 kg resin pairs with 1 m² woven cloth (0.5 kg : 0.5 m²)
Working time	Generous — slow cure by design; repositioning and re-wetting possible during application
Initial set	≥ 6 hours (6–12 h depending on temperature, humidity and build thickness)
Full service	24 hours
Adhesion	Concrete, render, ceramic incl. glazed tile, fibreglass/GRP, wood, metal, most rigid plastics — no abrasion required
Cured character	Tough, flexible laminate — absorbs impact and structural movement; no brittle failure
Colour / UV	Amber-clear. Prolonged UV exposure discolours the surface over time (strength unaffected) — topcoat recommended for exposed decorative work
VOC / odour	Low VOC · very low odour — suitable for enclosed working areas with normal ventilation
Packaging	Starter 0.5 kg + 0.5 m² cloth · Standard 1 kg + 1 m² cloth — metal tins

PERFORMANCE CHARACTER — TOUGHNESS & ADHESION

FLEXIBILITY — ELONGATION AT BREAK (typical values)

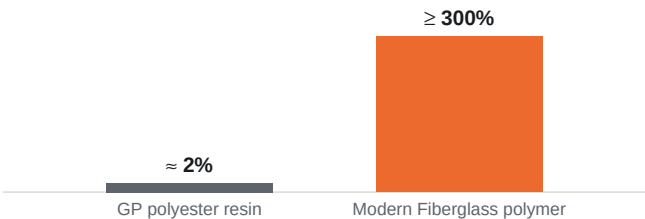

RELATIVE ADHESION BY SUBSTRATE (comparative, 0–5)

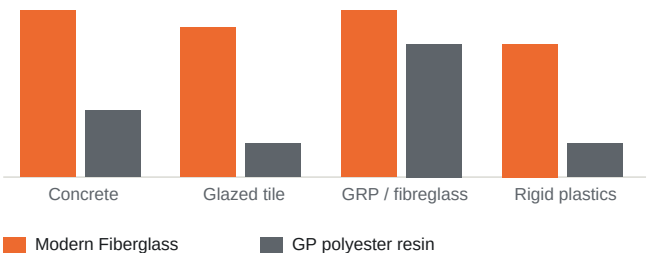

Typical / comparative values shown for guidance only — they characterise the chemistry class and do not constitute a specification.

APPLICATION NOTES

- Surface must be clean, sound and completely dry. Fill deep cracks and voids level first (e.g. with DeepStick) before laying the cloth system.
- Cut the cloth to overlap well beyond the damage. Prime the surface with resin, lay the cloth into the wet film, wet out until translucent, press out all air; edges must lie flat.
- For heavy-duty repairs apply a second cloth layer wet-on-wet — a two-layer laminate leaves durability concerns behind.
- For exposed exterior work where appearance matters, overcoat with paint or a coating system after full cure.

HEALTH & SAFETY

Uncured resin contains an aromatic isocyanate prepolymer and may cause skin and respiratory sensitisation. Wear protective gloves and eye protection; avoid skin contact with uncured material; ensure good ventilation when working in enclosed spaces. Fully cured material is inert. Keep uncured material away from children and animals.

STORAGE

Store in the original sealed tin in a dry place at 10–30 °C away from direct sunlight. The resin is moisture-sensitive — reseal the tin immediately after use. Shelf life 12 months unopened.