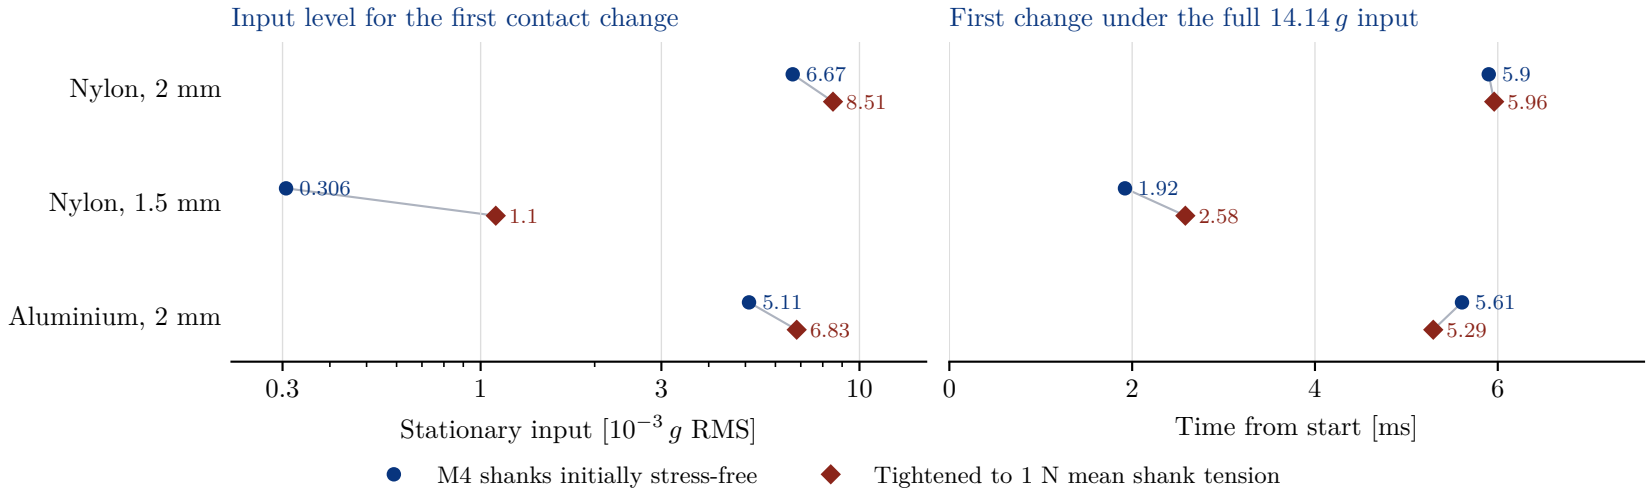

Input level for the first contact change
First change under the full 14.14 g input
Nylon, 2 mm
Nylon, 1.5 mm
Aluminium, 2 mm
6.67
8.51
0.306
1.1
5.11
6.83
5.9
5.96
1.92
2.58
5.61
5.29
0.3
1
3
10
0
2
4
6
Stationary input [10⁻³ g RMS]
Time from start [ms]
M4 shanks initially stress-free
Tightened to 1 N mean shank tension