


	INA188	LT1167AI	INA828	INA818	AD8422
Package	SOIC8	SOIC8	SOIC8	SOIC8	SOIC
Pinning	Same	Same	Same	Same	Different
Min. supply voltage	> 4V	> 4.6V	> 4.5 V	> 4.5 V	> 4.6V
GBW at G=1	0.6 MHz	1 MHz	2.0 MHz	2.0 MHz	2.2 MHz
Chopper	Yes	No	No	No	No
Input range	Good	Bad	Good	Good	Good

CIRCUIT CONFIGURATION


LT1167: Precision In-Amp

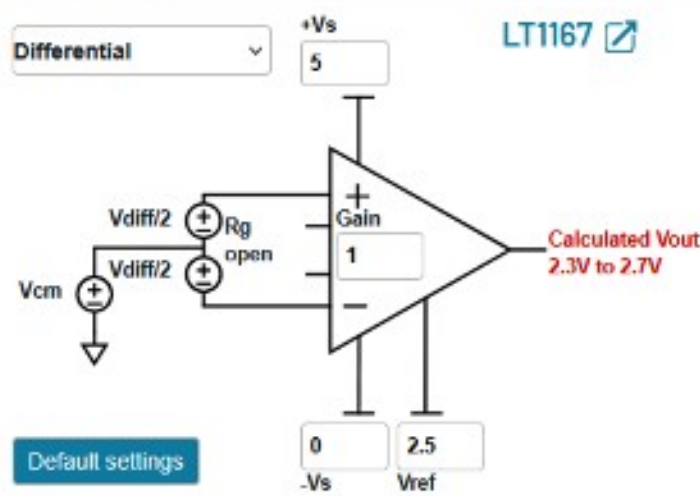

Input Signal


Vcm: 1.5 V to 1.75 V
Vdiff: -200m V to 200m V

- !** The LT1167 is not operating within the supply limits - the input voltage is exceeding the available supply. Try the following:
- reduce the input signal
 - increase the supply
 - change in amp: 10 parts recommended

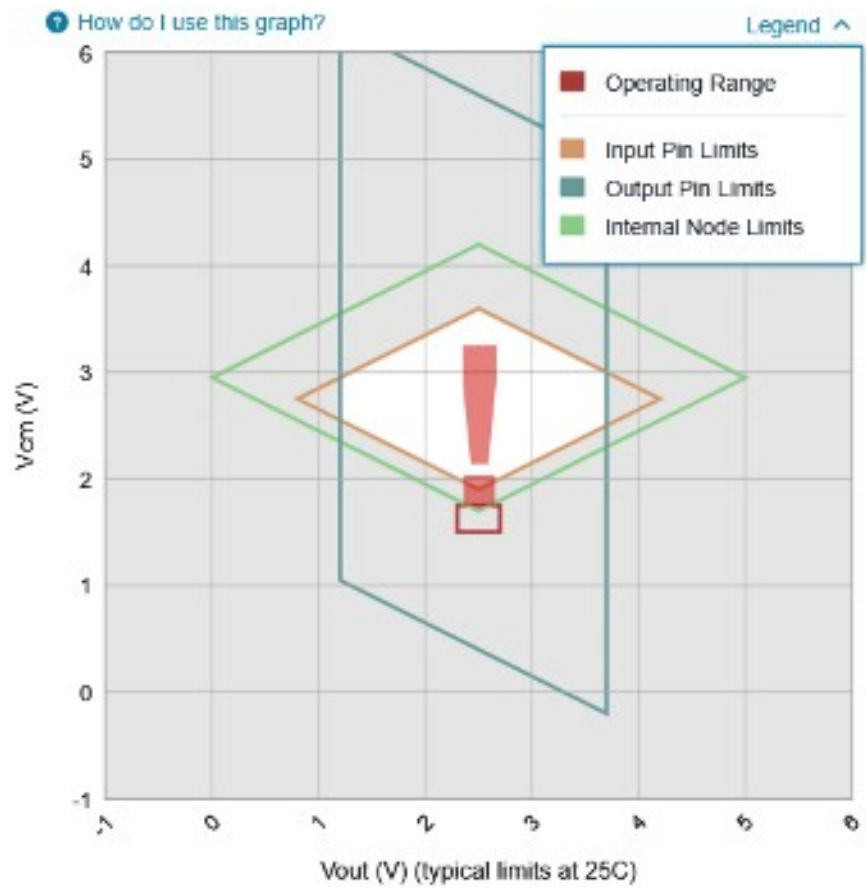


CIRCUIT CONFIGURATION

LT1167: Precision In-Amp

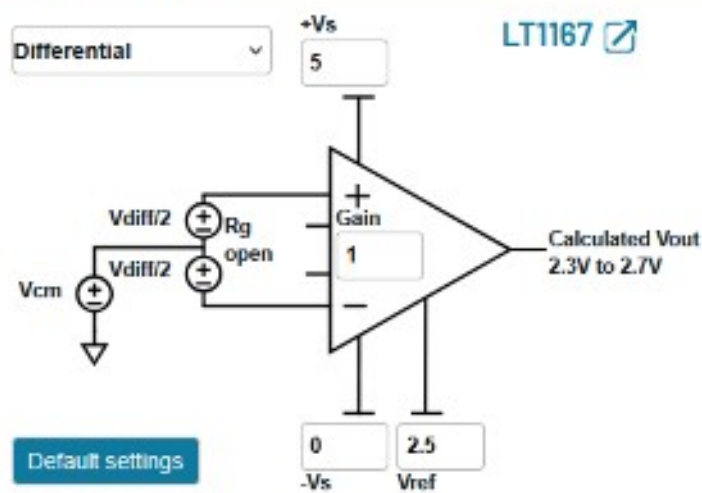


Input Signal

Vcm: 2.4 V to 2.6 V
Vdiff: -200m V to 200m V

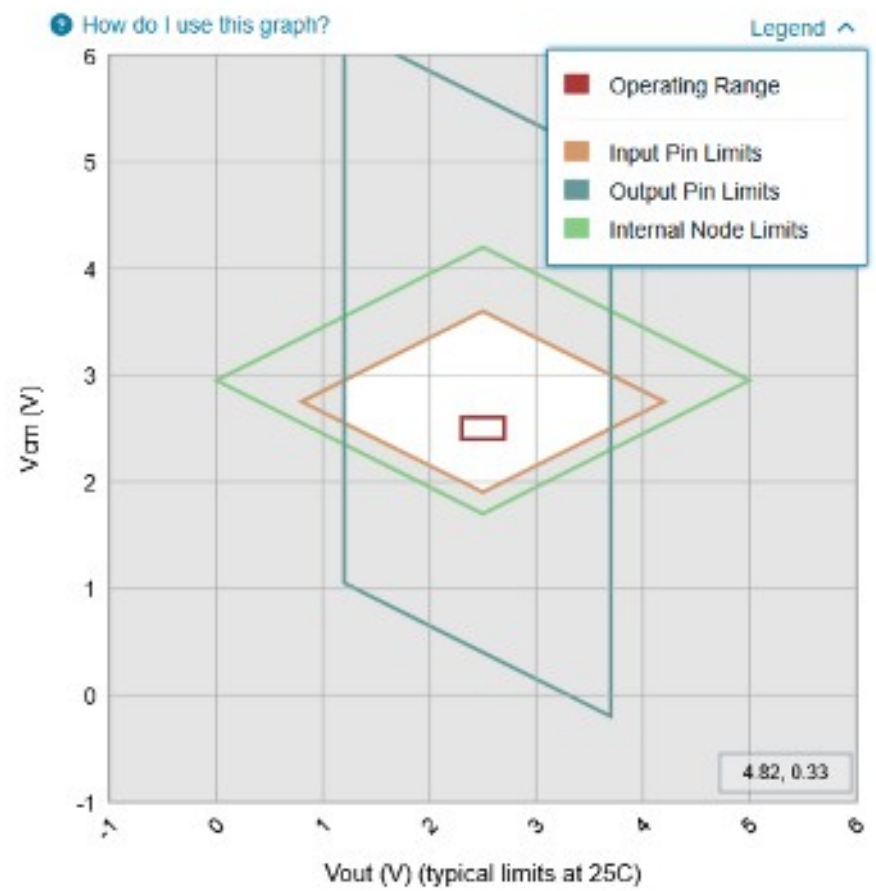

CIRCUIT CONFIGURATION

AD8422: High Performance Low Power Rail-to-Rail output In-Amp

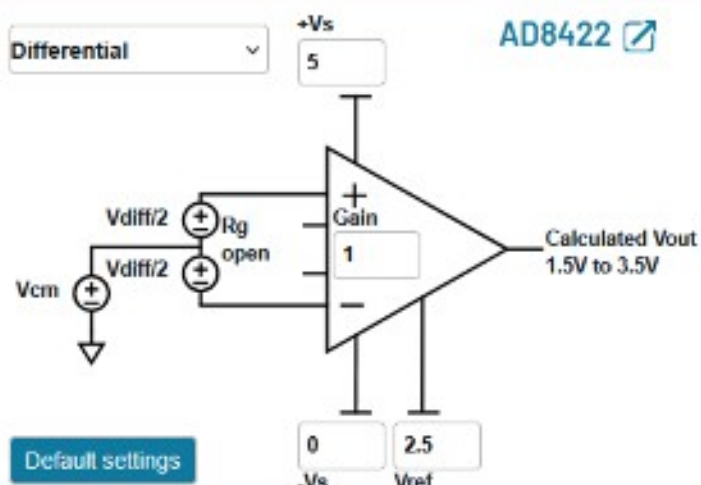

Input Signal

Vcm: 1.5 V to 1.7 V
Vdiff: -1 V to 1 V

