

K-3 Pre-Installation Procedures

This section describes how to prepare for installing the FastBack® Model 260E-G2. The following topics are discussed in this section:

- Load Data
- Foot Hole Pattern
- Drive Mounting Dimensions
- Structural Requirements
- Electrical Requirements
- Pneumatic Requirements

Load Data

Table 3-1 provides load data and shows the load point locations for a FastBack® Model 260E-G2.

260E FASTBACK LOADING DATA (ALL LOADS ARE PER CONVEYOR FOOT, 3 FEET PER CNVR.)								
UNIT SIZE	LOADING POINT SYMBOL	STATIC VERTICAL LOAD FRONT FOOT EACH (LBS)	STATIC VERTICAL LOAD BACK FOOT (LBS)	STATIC VERTICAL LOAD TOTAL (LBS)	DYNAMIC VERTICAL LOADING		DYNAMIC HORIZONTAL LOADING (FORWARD / AFT)	
					LBS.	FREQ. (HZ)	LBS.	FREQ. (HZ)
XL (LARGE) PAN WT. UP TO 270 LBS.	●	300	600	1200	±65	3.4	±45	3.4

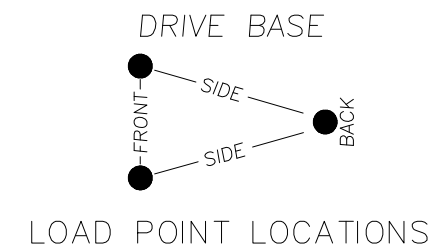


Table 3-1 – FastBack® Model 260E-G2 Load Data

K-3 – PRE-INSTALLATION PROCEDURES

FastBack® Model 260E-G2 Technical Manual

Foot Hole Pattern

Figure 3-1 shows the detail for the articulating feet used on the FastBack® Model 260E-G2.

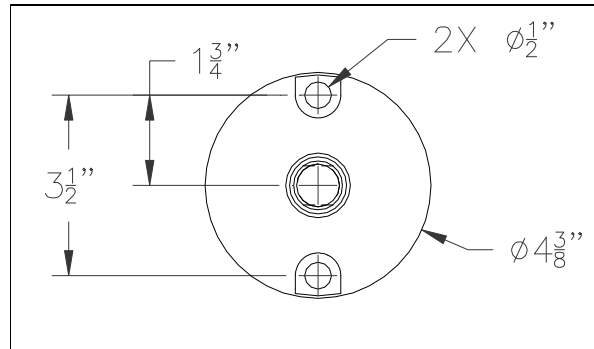


Figure 3-1 – Articulating Foot Detail

Drive Mounting Dimensions

Figure 3-2 shows the drive mounting dimensions for the FastBack® Model 260E-G2.

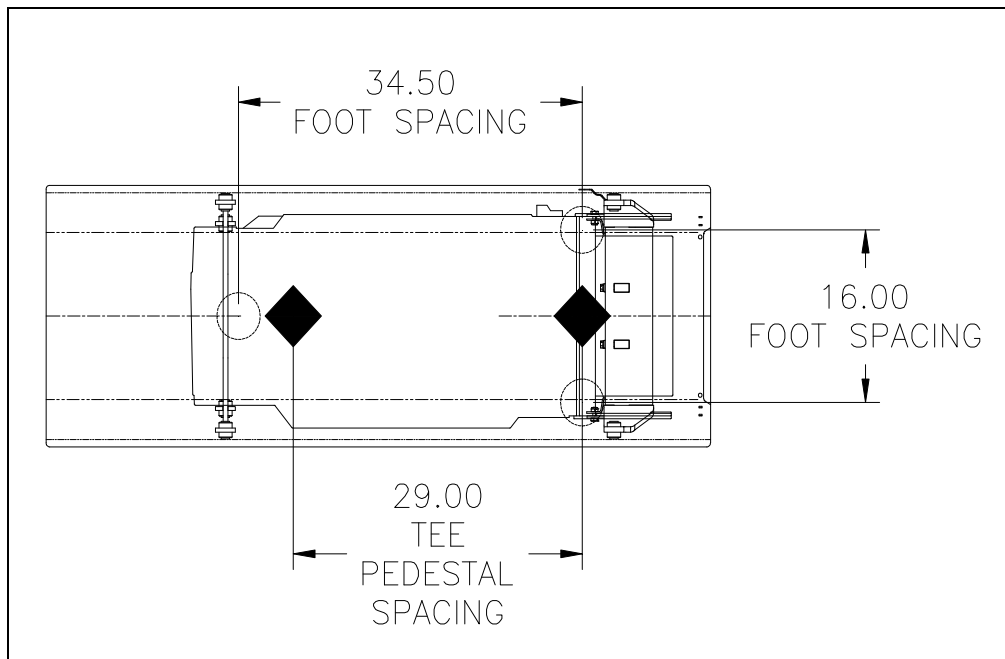


Figure 3-2 – FastBack® Drive Mounting Dimensions

K-3 – PRE-INSTALLATION PROCEDURES

FastBack® Model 260E-G2 Technical Manual

Structural Requirements

Heat and Control provides engineering services to design conveyor support platforms for the FastBack® Model 260E-G2. Below are general guidelines for designing an appropriate support platform.

- Every distribution line that includes a FastBack® Model 260E-G2 should have, as a best-design, a central spine, consisting of 6x6x1/4-inch [150x150x6 mm] tubular steel that runs down the center of the line, especially when T-Pedestals are used to elevate the conveyor. T-Pedestals should be welded to the 6x6x1/4-inch [150x150x6 mm] central spine as shown in Figure 3-3. When the FastBack® arrives, the articulating feet should be bolted to the T-Pedestals (see Section 4 – Installation Procedures).


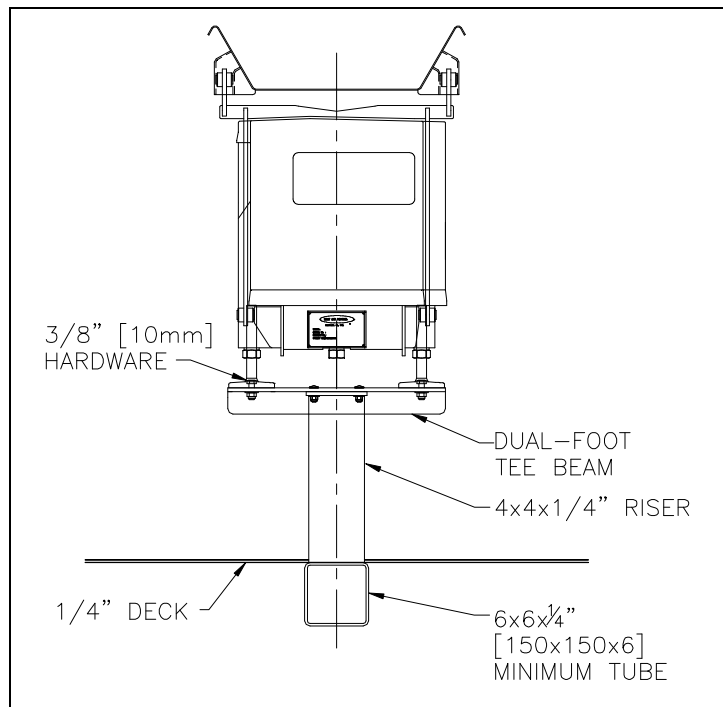


Figure 3-3 – T-Pedestal Welded to Central Spine



The dimensions above are minimum standards. Use of materials below these standards will cause increased vibration in the support structure, reducing efficiency and overall performance.

K-3 – PRE-INSTALLATION PROCEDURES

FastBack® Model 260E-G2 Technical Manual

- Use 3/8-inch [10 mm] hardware to bolt the articulating feet of the FastBack® Model 260E-G2 to the deck support structure. Figure 3-4 shows a typical T-Pedestal installation.

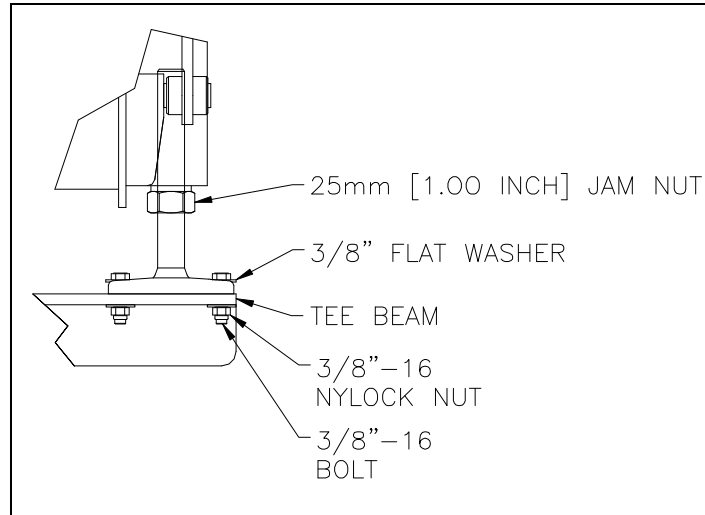


Figure 3-4 – Articulating Foot Hardware

- If the FastBack® Model 260E-G2 is to be placed directly on the deck, the articulating feet should be bolted through to a 4x4x1/4-inch [100x100x6 mm] piece of angle iron (or other structural equivalent) which is in-turn welded to the central spine described above (see Figure 3-5). **Do not bolt the FastBack® to the deck alone.** This will result in unacceptable vertical movement of the drive on top of the deck plate.

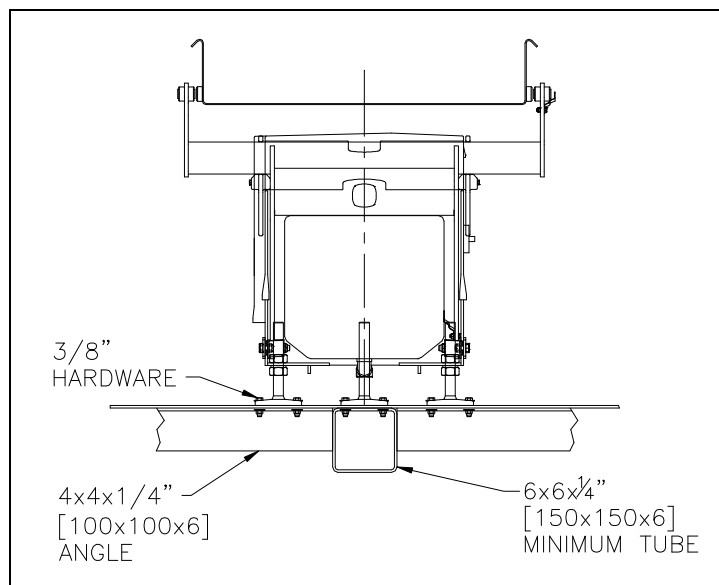


Figure 3-5 – Support Structure for Articulating Feet

K-3 – PRE-INSTALLATION PROCEDURES

FastBack® Model 260E-G2 Technical Manual

- When T-Pedestals are used to elevate the conveyor and the T-Pedestal height is over 18 inches [457.2 mm], a brace is required between the risers. Figure 3-6 shows the proper placement of a T-Pedestal assembly for a FastBack 260E-G2 drive unit with a remote idler arm.

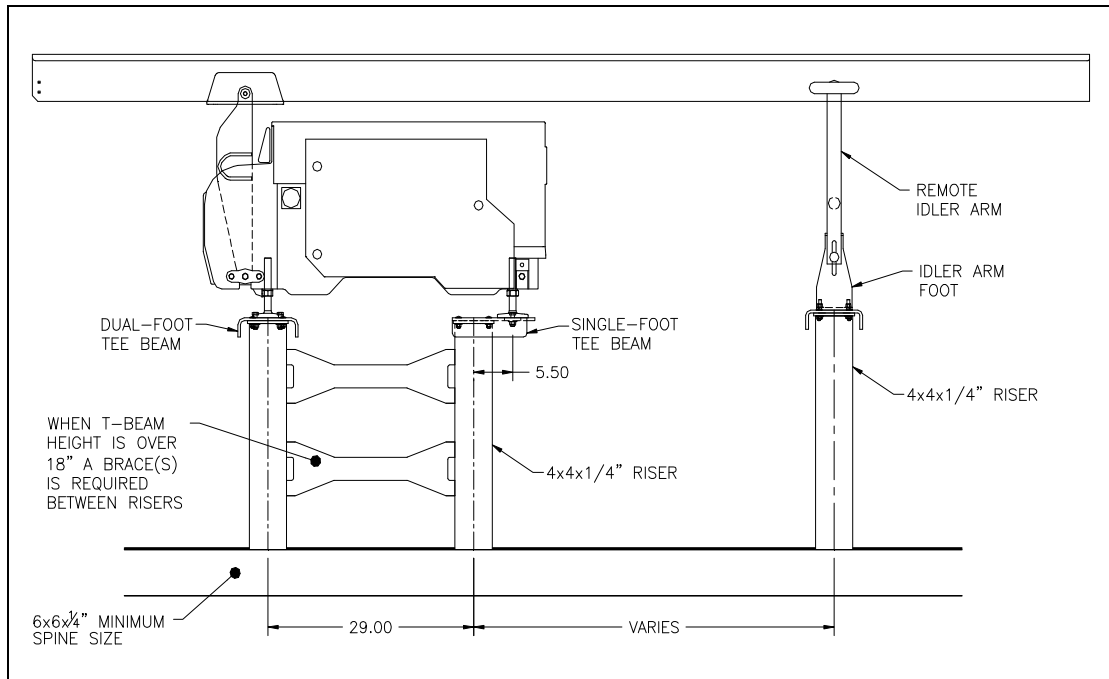


Figure 3-6 – Use of T-Pedestals to support a FastBack drive with remote idler arms



The dimensions above are minimum standards. Use of materials below these standards will cause increased vibration in the support structure, reducing efficiency and overall performance

K-3 – PRE-INSTALLATION PROCEDURES


FastBack® Model 260E-G2 Technical Manual

Electrical Requirements


Table 3-2 shows the power and control voltage requirements for the FastBack® Model 260E-G2.

Primary Power (Nominal)	Yaskawa V1000 Inverters	efector Photoeye	Hyde Park Ultrasonic Sensor	Solenoid Valves (Mac or SMC Brands)
3-phase 240 VAC 50-60 Hz 17.5-amp fusing	200-230 VAC 50-60 Hz 4.2 amp draw 15-amp fusing	24 V DC	10-24 VDC Only	24 VDC
3-phase 480 VAC 50-60 Hz 12-amp fusing	380-460 VAC 50-60 Hz 2.1 amp draw 10-amp fusing	2- or 3-wire sensor	3-wire sensor	

Table 3-2 – 260E-G2 Power and Control Voltage Requirements

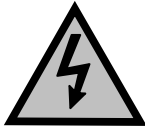

Do not run main power wires and control wires in the same conduit.



Always use flexible conduit to connect the FastBack® platform to the weigher platform. Do not use rigid conduit; this will transmit vibrations from the FastBack® to the weigher, which may decrease scale efficiency.

Pneumatic Requirements

Each gate requires a 0.5 cfm line that supplies clean, dry air at 60 psi. During installation, air flow at each flow control valve must be set at 30 psi. Section 4 – Installation Procedures describes this in more detail.