


NOTES:

- 1 ALL DIMENSIONS ARE IN INCHES.
2 ALL SHARP EDGES TO BE GROUND
SMOOTH AND FREE OF BURRS.

ITEM	DESCRIPTION	MATERIAL	QTY	UOM
0010	SHOULDER BOLT, 50E	30534498	1	EA
0020	BRG BALL, NICE#1623	20507368	2	EA
0030	SPROCKET, TMG BLT,GDYR#62420000018200	20509597	1	EA
0040	RETAINING RING, 5/8,MCCR#91590A126	20501415	1	EA
0050	WASHER FLAT, .66 X 1.75 X .135, SST	30534491	1	EA
0060	NUT, HEX NYLOCK JAM,5/8-18NF,T304	20509573	1	EA
0070	PIN, SPRING,1/4,MCCR#92373A365	20511740	1	EA
0080	PIN, SPRING,3/16,MCCR#92373A245	20512134	1	EA

2 BEARING MOUNTING INSTRUCTIONS:

- 1 REMOVE GREASE OR OIL FROM BEARING O.D.'S AND SPROCKET BORE WITH ACETONE OR OTHER CLEANER.
- 2 APPLY LOCTITE 7649, PRIMER N TO BEARING O.D.'S AND SPROCKET BORE AS DIRECTED, AND ALLOW PARTS TO DRY FOR AT LEAST 2 MINUTES.
- 3 ON ONE BEARING, APPLY A FINE BEAD OF LOCTITE 609, GENERAL PURPOSE RETAINING COMPOUND TO THE BEARING'S LEADING EDGE, AND SLIDE IT INTO THE SPROCKET BORE SO THE OUTER RACE IS FLUSH OR JUST BELOW THE FACE OF THE SPROCKET.
- 4 WIPE OFF ANY EXCESS RETAINING COMPOUND.
- 5 ALLOW THE PARTS TO SIT UNDISTURBED FOR AT LEAST 20 MINUTES BEFORE FLIPPING THEM OVER TO INSTALL THE SECOND BEARING.
- 6 REPEAT STEPS 3 AND 4 TO INSTALL THE SECOND BEARING.
- 7 ALLOW PARTS TO SIT OVER NIGHT BEFORE CONTINUING ASSEMBLY.
- 8 CHILL SHAFT WITH DRY ICE BEFORE INSTALLING IN BEARING BORES. BEARING CLOSEST TO STEP ON SHAFT TO BE FULLY SEATED AGAINST STEP.

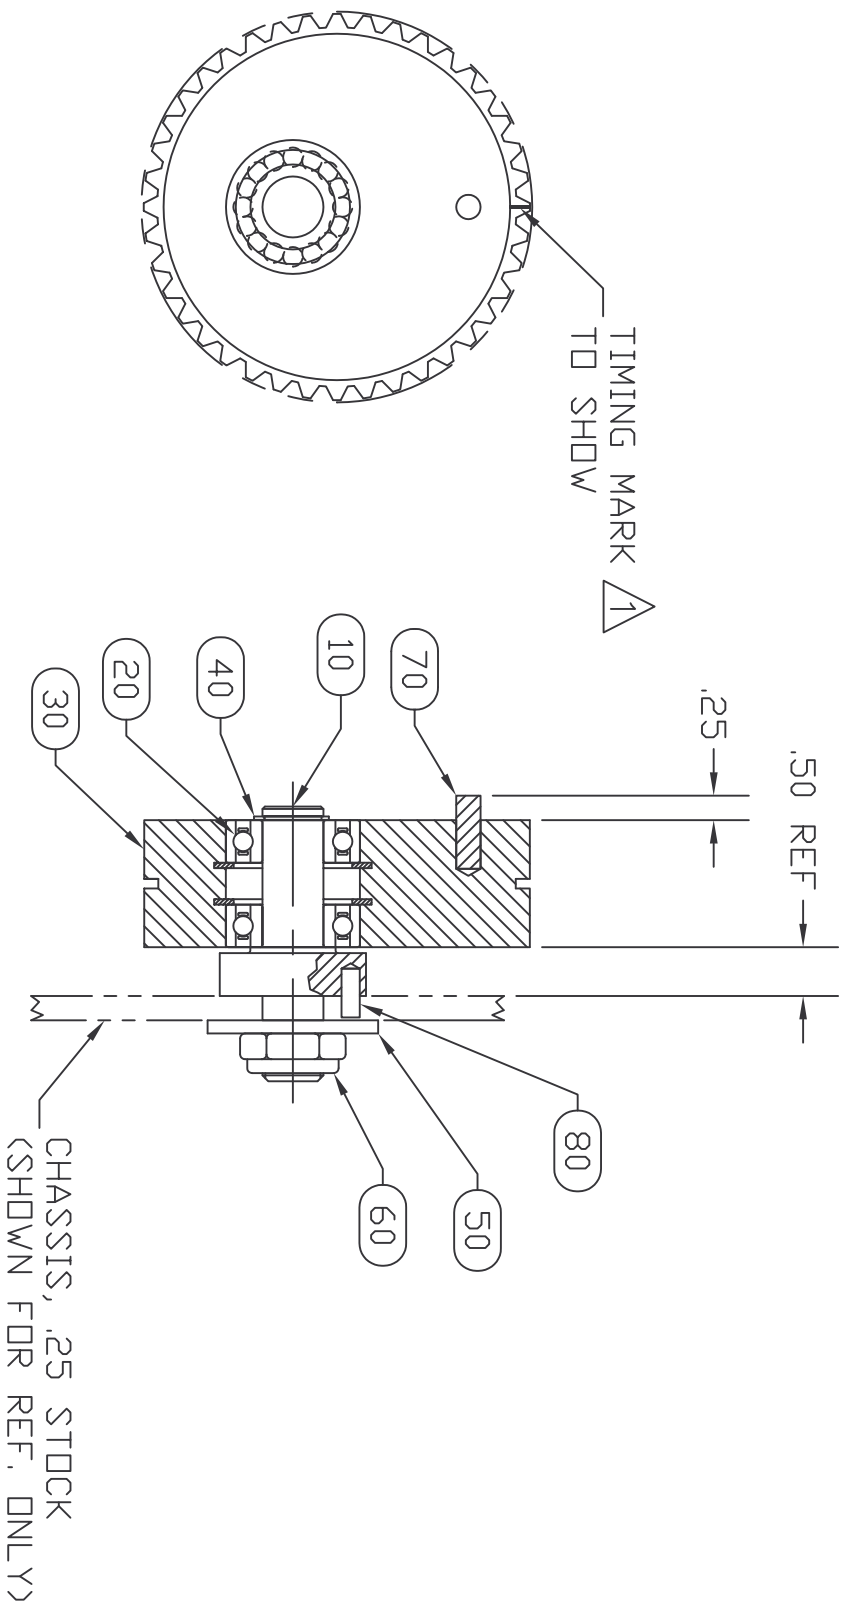

							SHEET
							1 OF 1
02	ADDED BEARING MOUNTING INSTRUCTIONS		10/28/02	TGK		SCALE	1:1
01	ADDED "TIMING MARK TO SHOW" NOTE		04/16/02	TGK			
REV.							
SD/LINE	DESCRIPTION	DATE	BY				
MODEL	HEAT AND CONTROL® 						
ISSUE DATE	THIS DRAWING IS SENT TO YOU SUBJECT TO RETURN UPON DEMAND, AND WITH THE UNDERSTANDING THAT IT IS NOT TO BE USED IN ANY WAY DETRIMENTAL TO OUR INTERESTS. ALL RIGHTS OF DESIGN OR INVENTION ARE RESERVED.						
PRODUCTION ORDER							

DRAWN	DLB	DATE	04/02/01	TITLE	SPROCKET ASSY, IDLER, 50E		
CHECKED	TGK	DATE	04/02/01	MATERIAL NR.	30550023		
APPROVED	KCP	DATE	04/02/01	OLD MATERIAL NR			
RAW MATERIAL NR				QTY	UDM	REV	02

UNLESS OTHERWISE SPECIFIED:		MACHINED FINISHES = .250 ∇	
X.XXXX = ±.0005	X.XXX = ±.015		
X.XXX = ±.005	XX = ±.030		
DRESS AND DEBURR ALL SHARP CORNERS AND EDGES		THREADS = CLASS 2 UNIFIED SERIES	
DO NOT SCALE DRAWING		FORMATT B R15	