
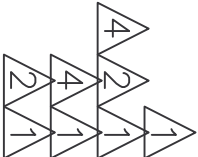


NOTES:

- 1 ALL DIMENSIONS ARE IN INCHES.
- 2 ALL SHARP EDGES TO BE GROUND SMOOTH AND FREE OF BURRS.

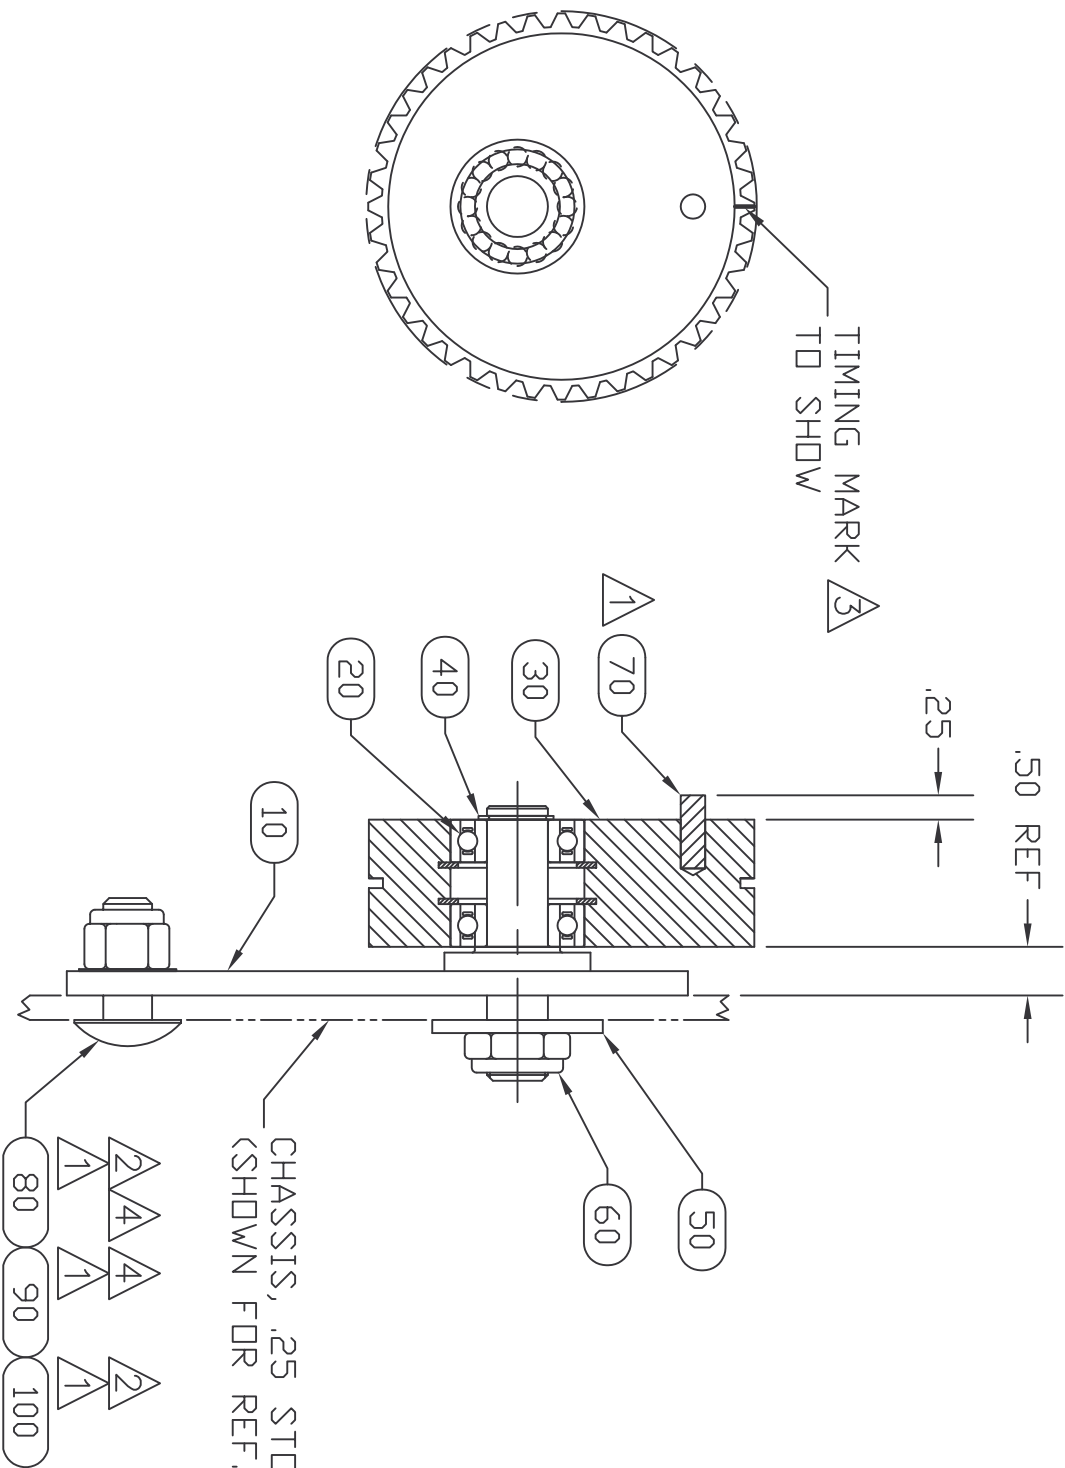

ITEM	DESCRIPTION	MATERIAL	QTY	UOM
0010	TENSIONER ARM WELD/ASSY, 50E	30549417	1	EA
0020	BRG BALL, NICE#1623	20507368	2	EA
0030	SPROCKET, TMG BLT,GD'YR#62420000018200	20509597	1	EA
0040	RETAINING RING, 5/8,MCCR#91590A126	20501415	1	EA
0050	WASHER FLAT, .66 X 1.75 X .135, SST	30534491	1	EA
0060	NUT, HEX NYLOCK JAM,5/8-18NF,T304	20509573	1	EA
0070	PIN, SPRING,1/4,MCCR#92373A365	20511740	1	EA
0080	BOLT, CARRIAGE,1/2-13NCx1-1/4,T304	20515719	1	EA
0090	SPRING, DISC,CURVED,MCCR#9716K88	20515720	1	EA
0100	NUT, HEX NYLOCK,1/2-13NC,T304	20004529	1	EA

BEARING MOUNTING INSTRUCTIONS:

- 1 REMOVE GREASE OR OIL FROM BEARING O.D.'S AND SPROCKET BORE WITH ACETONE OR OTHER CLEANER.
- 2 APPLY LOCTITE 7649, PRIMER N TO BEARING O.D.'S AND SPROCKET BORE AS DIRECTED, AND ALLOW PARTS TO DRY FOR AT LEAST 2 MINUTES.
- 3 ON ONE BEARING, APPLY A FINE BEAD OF LOCTITE 609, GENERAL PURPOSE RETAINING COMPOUND TO THE BEARING'S LEADING EDGE, AND SLIDE IT INTO THE SPROCKET BORE SO THE OUTER RACE IS FLUSH OR JUST BELOW THE FACE OF THE SPROCKET.
- 4 WIPE OFF ANY EXCESS RETAINING COMPOUND.
- 5 ALLOW THE PARTS TO SIT UNDISTURBED FOR AT LEAST 20 MINUTES BEFORE FLIPPING THEM OVER TO INSTALL THE SECOND BEARING.
- 6 REPEAT STEPS 3 AND 4 TO INSTALL THE SECOND BEARING.
- 7 ALLOW PARTS TO SIT OVER NIGHT BEFORE CONTINUING ASSEMBLY.
- 8 CHILL SHAFT WITH DRY ICE BEFORE INSTALLING IN BEARING BORES. BEARING CLOSEST TO STEP ON SHAFT TO BE FULLY SEATED AGAINST STEP.

04	ITEMS 80 & 90 WERE 20509251 & 20003987, ADDED BEARING MNTG. INSTR.	10/28/02	TGK	DRAWN	DATE	TITLE	SHEET
03	ADDED TIMING MARK TO SHOW NOTE	04/16/02	TGK	DLB	04/02/01	SPROCKET ASSY, TENSIONER, 50E	1 OF 1
02	UPDATED ITEMS #80 & #100, WERE #20512185 & #20000089	08/09/01	DLB	CHECKED	DATE		SCALE
01	ITEM #70 WAS ITEM #90, ADDED ITEMS #80, #90, #100	06/18/01	DLB	TGK	04/02/01	MATERIAL NR.	1:2
REV.	DESCRIPTION	DATE	BY	APPROVED	DATE	OLD MATERIAL NR	
SD/LINE	DESCRIPTION			RAW MATERIAL NR	RAW DESCRIPTION		QTY

MODEL	HEAT AND CONTROL	PROJECTION 3RD ANGLE
ISSUE DATE	THIS DRAWING IS SENT TO YOU SUBJECT TO RETURN UPON DEMAND, AND WITH THE UNDERSTANDING THAT IT IS NOT TO BE USED IN ANY WAY DEPENDENT, TO OUR INTERESTS. ALL RIGHTS OF DESIGN OR INVENTION ARE RESERVED.	
PRODUCTION ORDER	DO NOT SCALE DRAWING	FIRMAT B