


Parts List


SB-2 HD Main Assembly

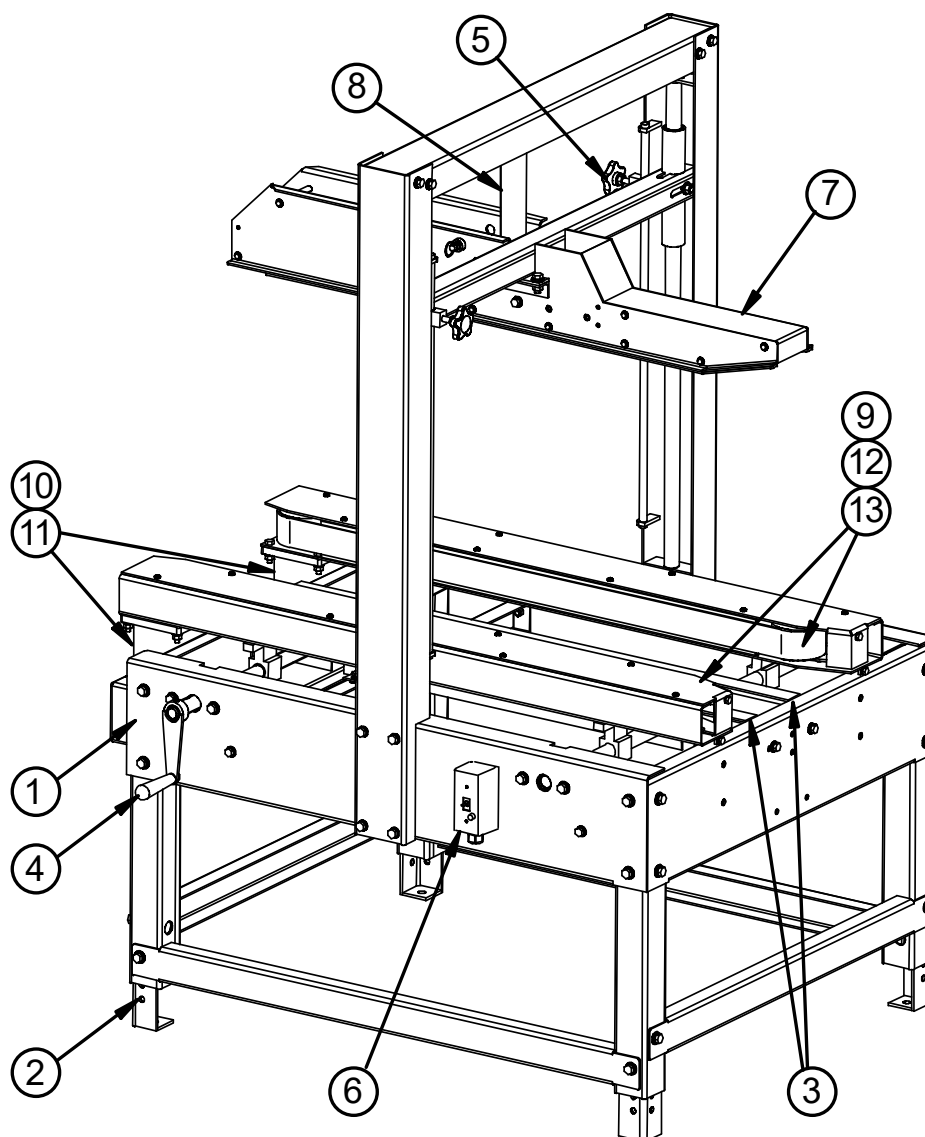

ITEM	DESCRIPTION	PAGE
1	Base Frame Assembly, Top	28
2	Base Frame Assembly, Bottom	29
3	Case Support Assembly	30
4	Width Adjustment Assembly	31
5	Vertical Column With Height Adjustment	32
6	Electrical Switch, Strain Relief & Column Attachment	33


ITEM	DESCRIPTION	PAGE
7	Upper Tape Head Seat Plunger Pin, CF Spring & Spacer	34
8	Upper Tape Head Seat to Column Assembly	35
9	Side Belt Frame, Idler Pulley, and Tension Brackets	36
10	Side Belt Motor, Motor Pulley, and Attaching Hardware	37
11	Side Belt Belts, Tensioning & Frame Attaching	38
12	Side Belt Belts, Tensioning & Frame Attaching Screws	39
13	Side Belt Cover & Cover Attaching Screws	40

Base Frame Assembly, Top

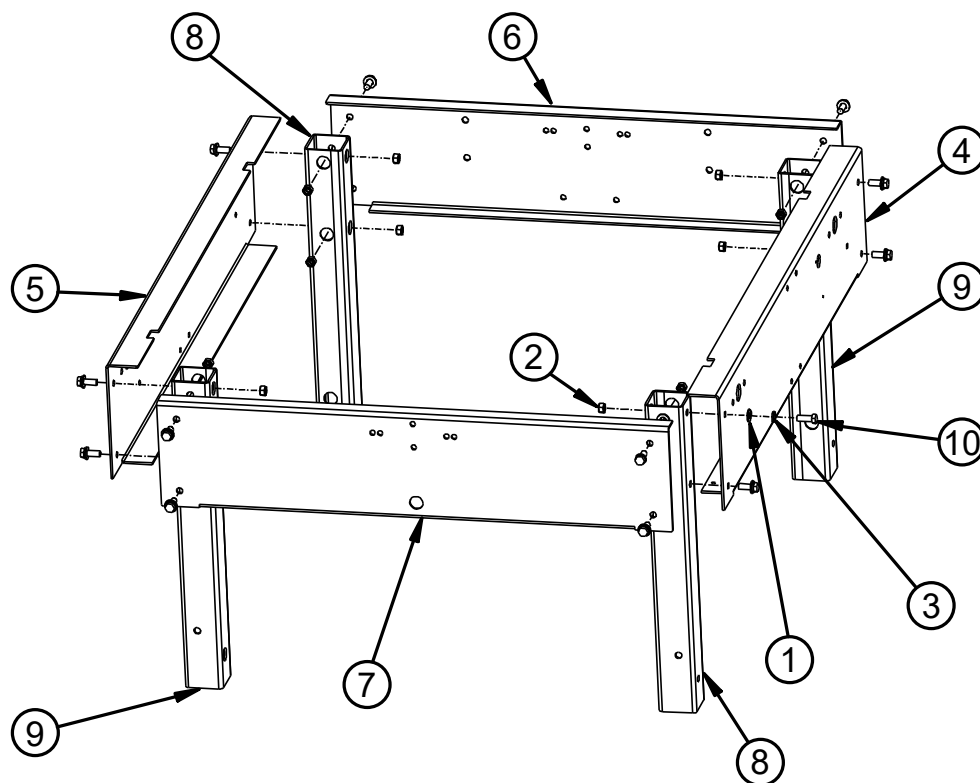


ITEM	PART NO.	DESCRIPTION	Q'TY
1	055029-022	WASHER – FLAT $\frac{3}{8}$ " ZINC	16
2	055307-062	NUT $\frac{3}{8}$ "-16 NI	16
3	055310-042	WASHER – SPLIT $\frac{3}{8}$ " NI	16
4	5000548	FAB – SIDE FRAME, LEFT, SB-2/3 HD	1
5	5000549	FAB – SIDE FRAME, RIGHT, SB-2/3 HD	1
6	5000550	FAB – FRONT FRAME	1
7	5000551	FAB – REAR FRAME	1
8	5000552	FAB – LEG, (R/L)	2
9	5000553	FAB – LEG LEFT REAR	2
10	5000791	SCREW – HH $\frac{3}{8}$ "-16 $\times$ 1" NI	16

Base Frame Assembly, Bottom

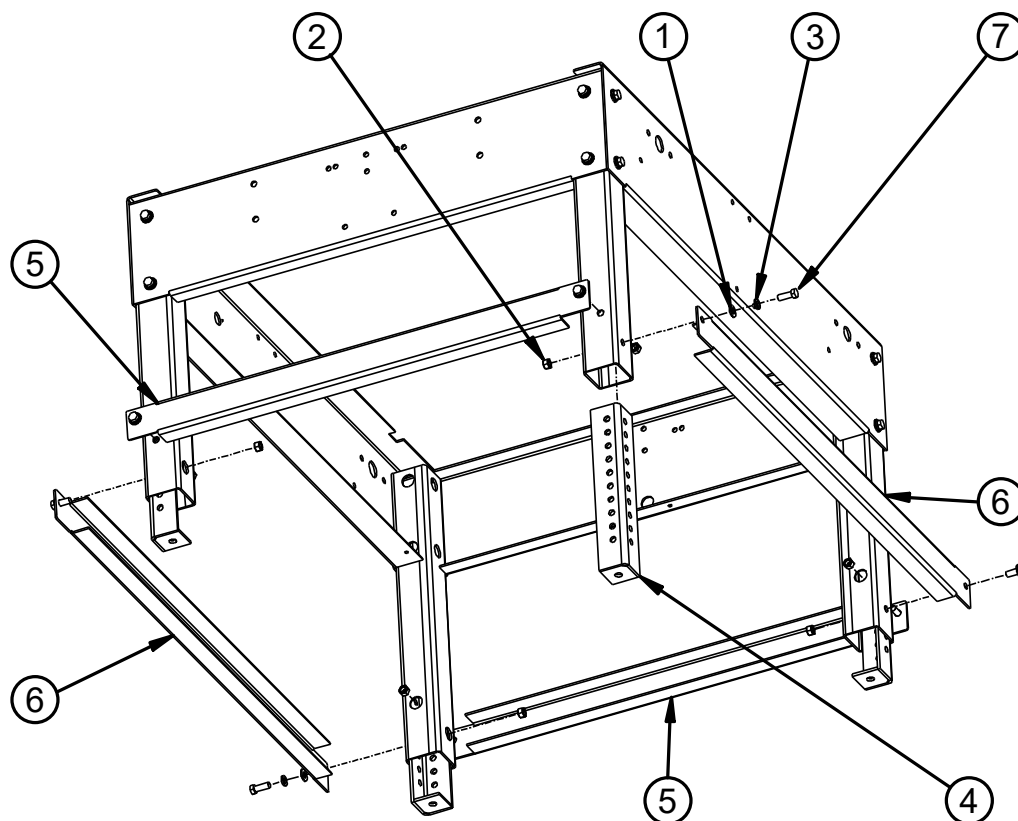


ITEM	PART NO.	DESCRIPTION	Q'TY
1	055029-022	WASHER – FLAT $\frac{3}{8}$ " ZINC	8
2	055307-062	NUT $\frac{3}{8}$ "-16 NI	8
3	055310-042	WASHER – SPLIT $\frac{3}{8}$ " NI	8
4	5000195	FAB/WELD – LEG EXTENSION	4
5	5000554	FAB – BRACE, FRONT	2
6	5000555	FAB – BRACE, SIDE	2
7	5000791	SCREW – HH $\frac{3}{8}$ "-16 $\times$ 1" NI	8

Case Support Assembly

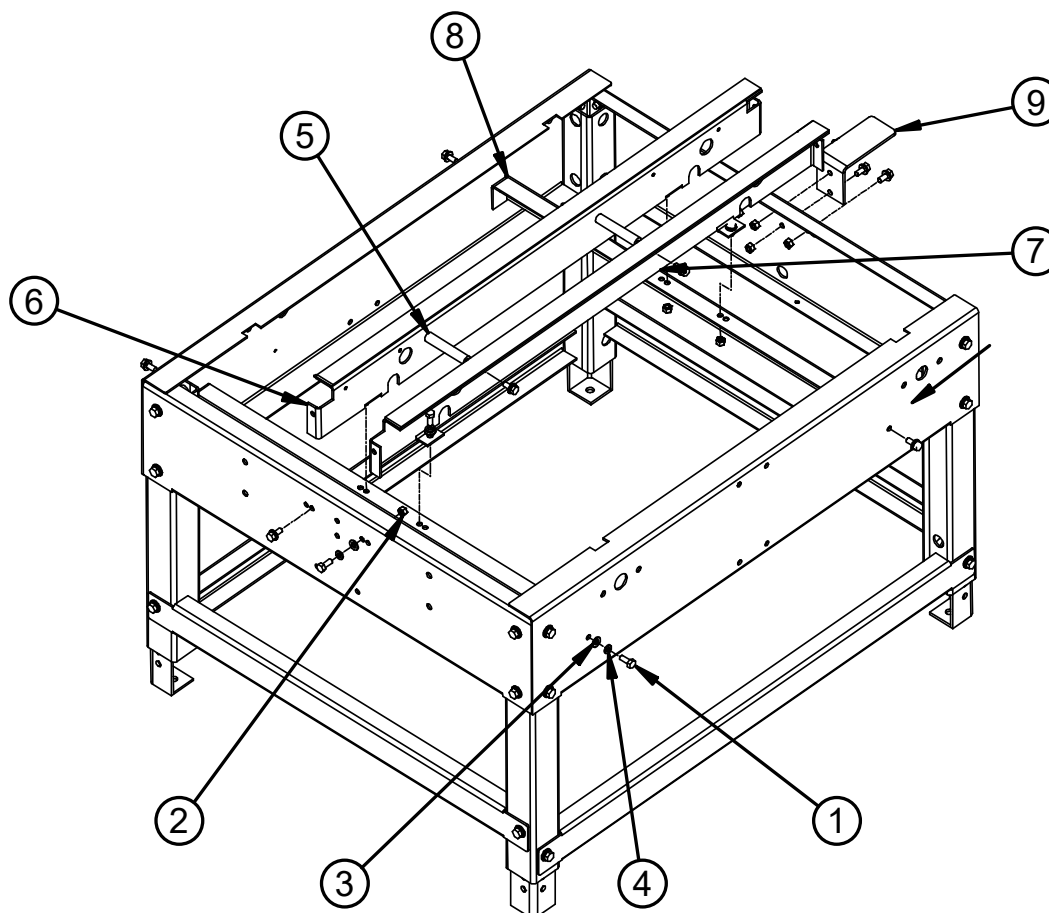


ITEM	PART NO.	DESCRIPTION	Q'TY
1	055293-056	SCREW – HH $\frac{5}{16}$ "-18 $\times$ $\frac{3}{4}$ " ZINC	18
2	055307-055	NUT $\frac{5}{16}$ "-18 ZINC	14
3	5000333	WASHER – FLAT $\frac{5}{16}$ " ZINC	18
4	5000339	WASHER – $\frac{5}{16}$ " SPLIT, ZINC	18
5	5000571	MACH – SHAFT, DRUM, $\frac{5}{8}$ O.D. $\times$ 3.375"	2
6	5000574	FAB/WELD – PRODUCT SUPPORT, LEFT	1
7	5000575	FAB/WELD – PRODUCT SUPPORT, RIGHT	1
8	5000576	FAB – FRAME BRACE	2
9	5000578	FAB – EXIT BRACKET, SB HD	1

Width Adjustment Assembly

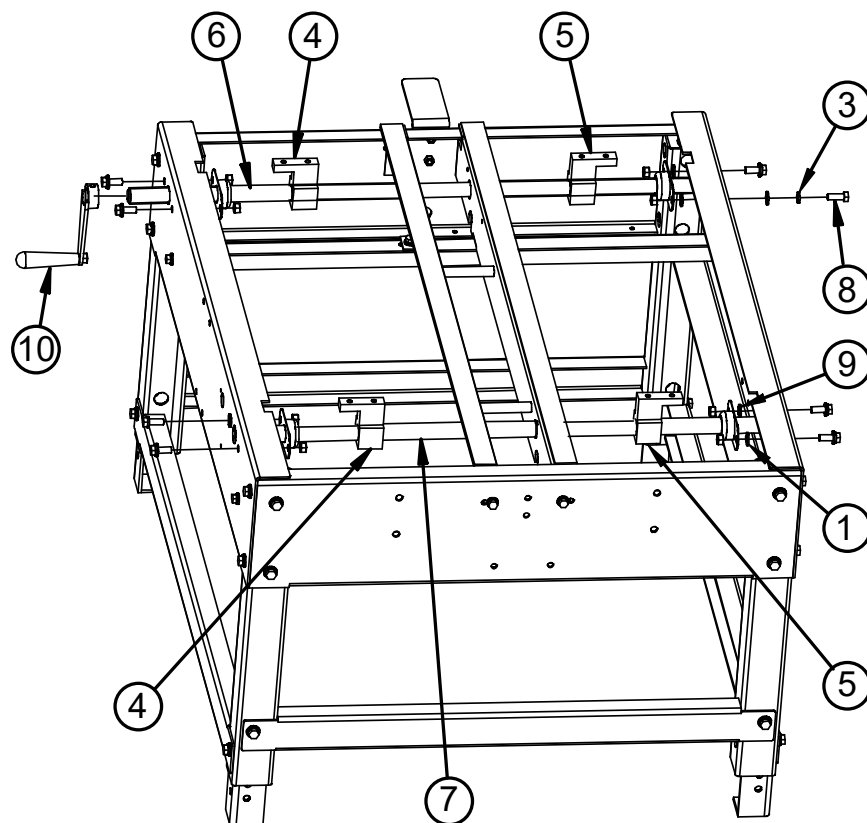


ITEM	PART NO.	DESCRIPTION	Q'TY
1	055029-022	WASHER – FLAT $\frac{3}{8}$ " ZINC	16
2	055307-062	NUT – HEX , $\frac{3}{8}$ "-16 NI	8
3	055310-042	WASHER – SPLIT $\frac{3}{8}$ " NI	8
4	5000542	FAB/WELD – LEAD NUT, LEFT THREAD	2
5	5000543	FAB/WELD – LEAD NUT, RIGHT THREAD	2
6	5000562	FAB – LEAD SCREW, MAIN	1
7	5000563	FAB – LEAD SCREW, IDLER	1
8	5000791	SCREW – HH, $\frac{3}{8}$ "-16 $\times$ 1" NI	8
9	5000605	BEARING, FLANGE	4
10	5000612	ASSEMBLY – HAND CRANK	1

Vertical Column With Height Adjustment

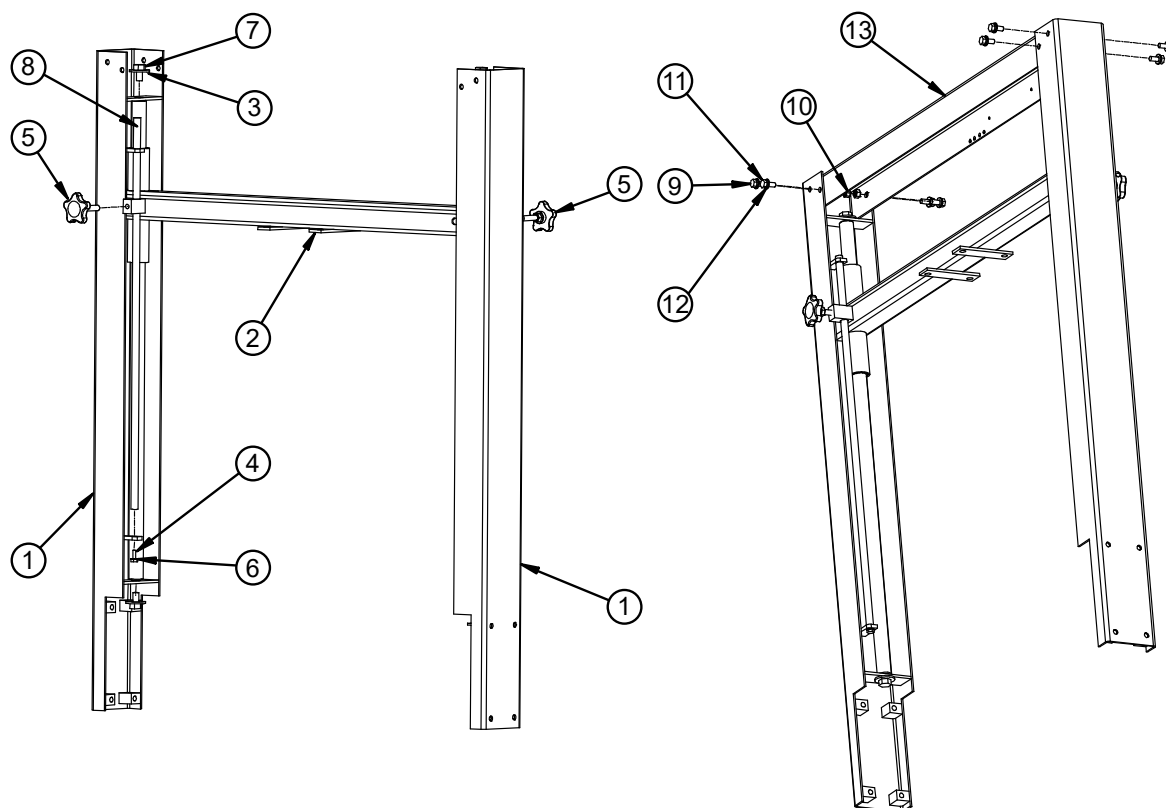


ITEM	PART NO.	DESCRIPTION	Q'TY
1	5000556	FAB – UPRIGHT, SB HD MAST	2
2	5001232	FAB/WELD – SB HD MAST CARRIAGE BEAM	1
3	055029-025	WASHER – FLAT 1/2" CS CAD	4
4	5000542	SCREW – HH, 1/4" 20 × 5/8" SST	2
5	5001284	ASSEMBLY – HAND KNOB	2
6	055455-014	WASHER – LOCK 1/4" EXT ZINC	2
7	5000338	SCREW – HH 1/2"-13 × 3/4" SAE 8	4
8	5000560	MACH – LOCK SHAFT	2
9	055293-056	SCREW – HH 5/16"-18 × 3/4" ZINC	8
10	055307-055	NUT – HEX 5/16"-18 ZINC	8
11	5000333	WASHER – FLAT 5/16" ZINC	8
12	5000339	WASHER – 5/16" SPLIT, ZINC	8
13	5000561	FAB – TOP BRACE	1

Electrical Switch, Strain Relief & Column Attachment

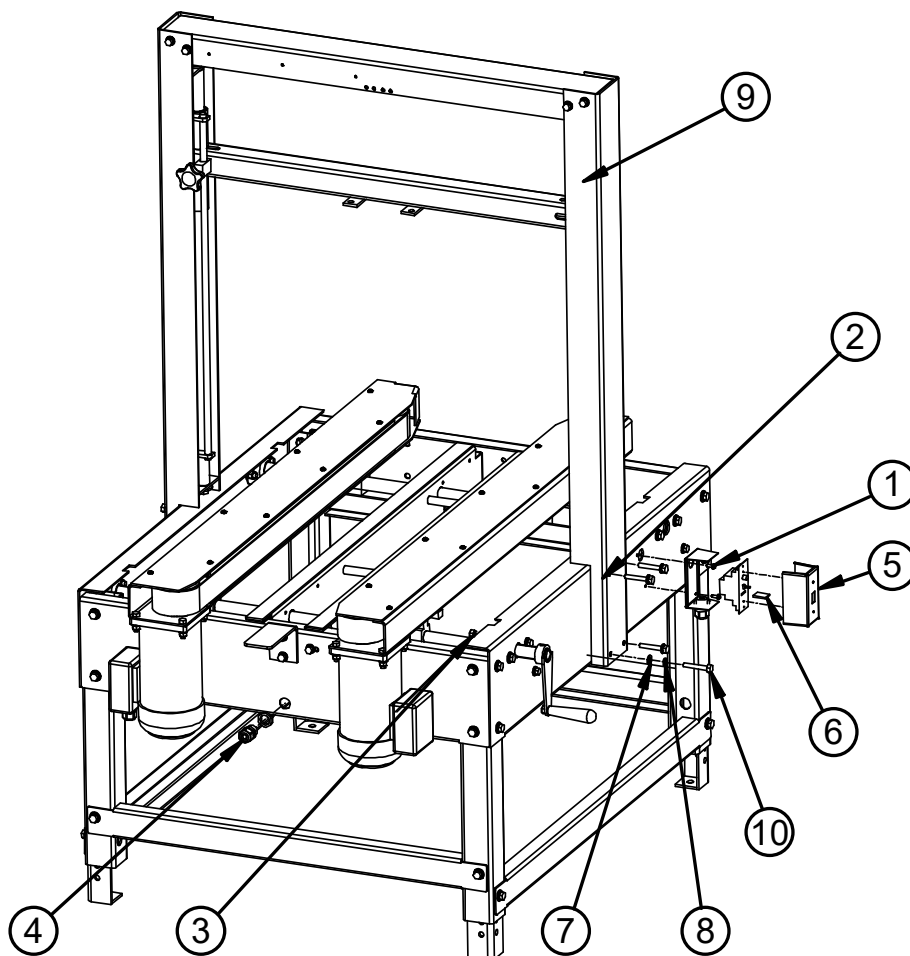


ITEM	PART NO.	DESCRIPTION	Q'TY
1	054979-123	SCREW – PH #10-32 × 0.5" PH SS SEMS – IN	2
2	054382-005	NUT – KEP #10-32 NC ZINC	2
3	055307-055	NUT – HEX, 5/16"-18 ZINC	8
4	1602253	STRAIN RELIEF, VECTOR	2
5	5001264	SWITCH MOTOR ON/OFF	1
6	5001265	FUSE– OVERLOAD 6A	1
7	5000333	WASHER – FLAT 5/16" ZINC	8
8	5000339	WASHER – 5/16" SPLIT ZINC	8
9	5000404	ASSEMBLY – HEAD LIFT, SB-2 HD	1
10	5000688	SCREW – HH 3/8"-10 × 2" NI	8

Upper Tape Head Seat Plunger Pin, CF Spring & Spacer

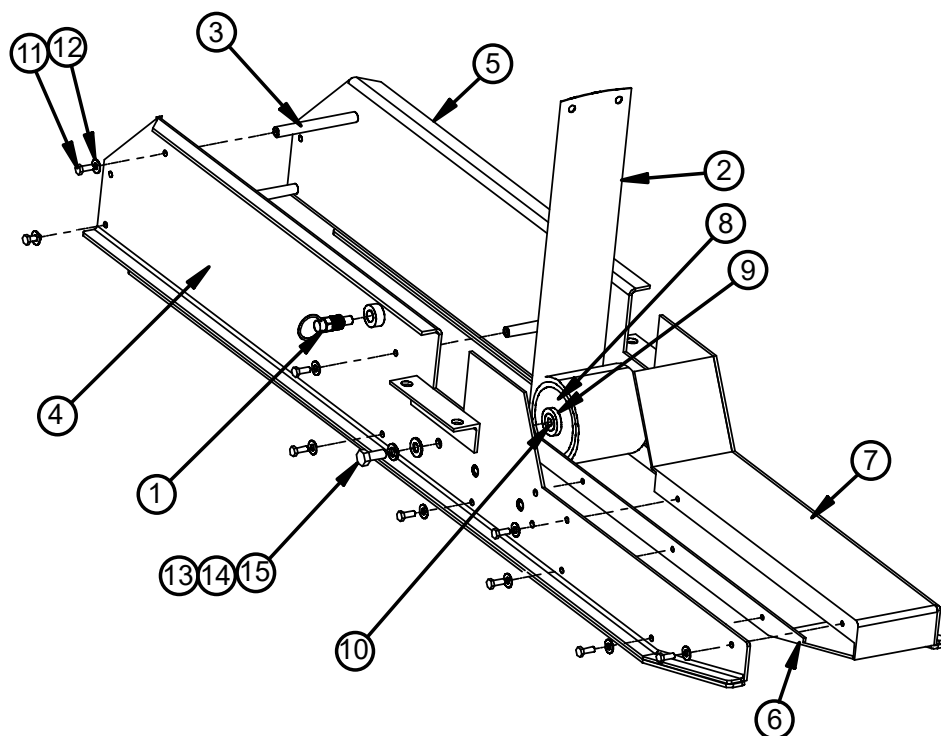


ITEM	PART NO.	DESCRIPTION	Q'TY
1	5000598	PLUNGER-RETRACTABLE	1
2	5000046	SPRING – CONSTANT FORCE 3" WIDE	1
3	5000227	MACH-SPACER, HEAD PLATES	3
4	5000566	FAB/WELD – HEAD FRAME WELDMENT, L	1
5	5000580	FAB/WELD – HEAD FRAME WELDMENT, R	1
6	5000573	FAB – FILL-IN PLATE, 2"	1
7	5000572	FAB – COVER PLATE, 2"	1
8	5000202	MACH – DRUM, CONST FORCE SPRING	1
9	5000930	WASHER, 1-3/8" OD × 5/8" ID, SS	4
10	5000571	MACH -SHAFT, DRUM, 5/8" OD × 3.375"	1
11	055293-025	SCREW – HH #10-32 × 1/2" ZINC	18
12	055029-011	WASHER – FLAT #10 CRS ZINC	18
13	055293-056	SCREW – HH 5/16"-18 × 3/4" ZINC	2
14	5000339	WASHER – 5/16" SPLIT, ZINC	2
15	5000333	WASHER – FLAT 5/16", ZINC	2

Upper Tape Head Seat to Column Assembly

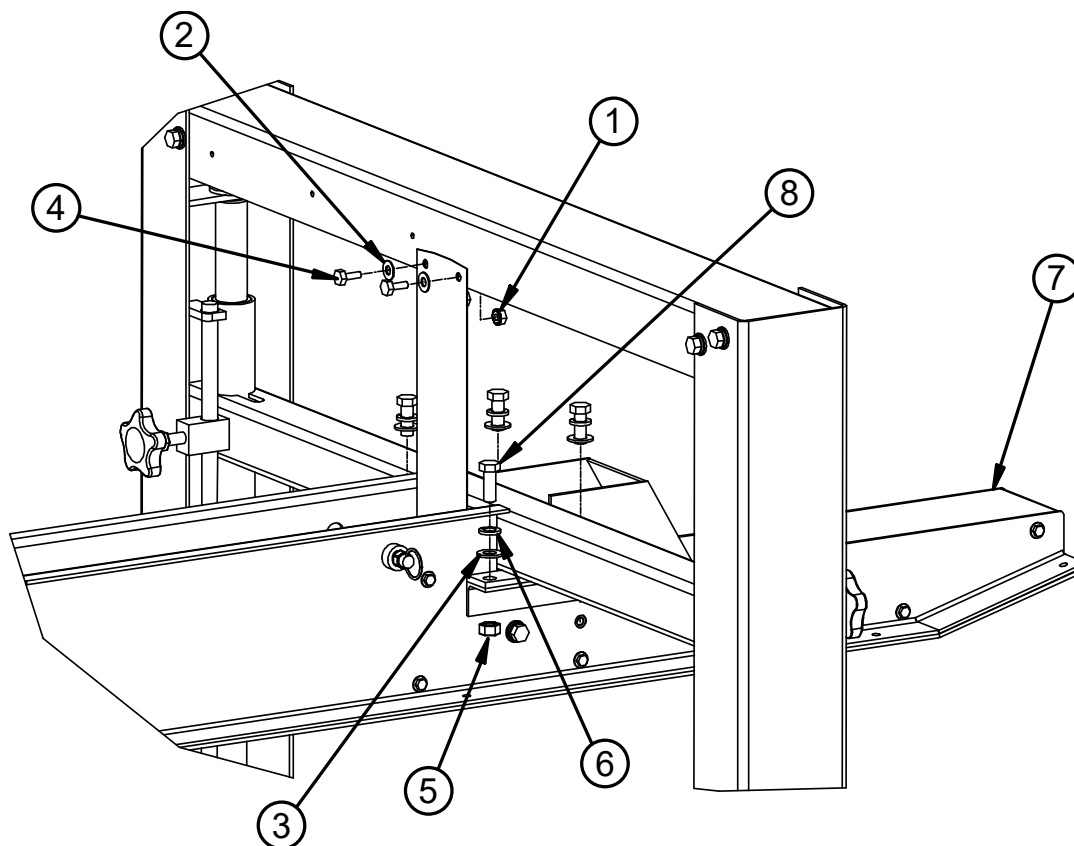

ITEM	PART NO.	DESCRIPTION	Q'TY
1	054982-006	NUT – KEP 1/4" -20 NC ZINC	2
2	055029-018	WASHER – FLAT 1/4" SST	2
3	055029-022	WASHER – FLAT 3/8" ZINC	4
4	055293-038	SCREW – HH 1/4"-20 × 5/8" SST	2
5	053307-062	NUT – HEX 3/8"-16 NI	4
6	055310-042	WASHER – SPLIT 3/8" NI	4
7	5000405	ASSEMBLY – HEAD, SB-2 HD	1
8	5000791	SCREW – HH 3/8"-16 × 1" NI	4


Side Belt Frame, Idler Pulley, and Tension Brackets

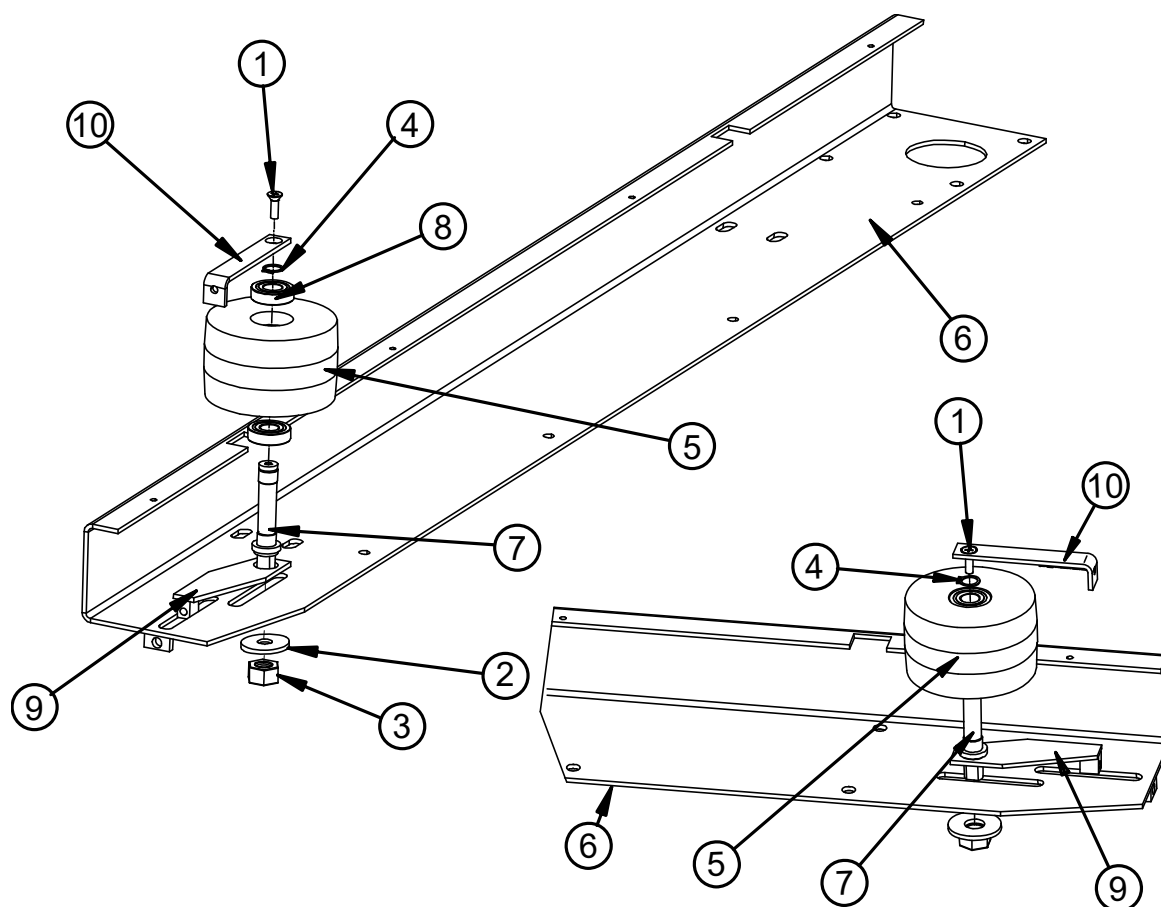

NOTE: Top illustration shows left-hand assembly; lower inset shows right-hand assembly.

ITEM	PART NO.	DESCRIPTION	Q'TY
1	055020-088	SCREW – FH, #10-32 × ½" SST, PH (82)	1
2	055029-025	WASHER – FLAT ½" CS ZINC	1
3	055307-069	NUT – HEX ½"-13 ZINC	1
4	5000340	RING, RETAINING, ⅜" SHAFT	1
5	5000419	MACH – SB IDLER ROLLER PULLEY	1
6-L	5000527	FAB – DRIVE FRAME, LEFT	1
6-R	5000528	FAB – DRIVE FRAME, RIGHT	1
7	5000533	MACH – SB IDLER ROLLER SHAFT	1
8	5000604	BEARING – SB IDLER ROLLER	2
9-L	5000702	FAB – BELT TENSIONING BRACKET, BOTTOM, LEFT	1
9-R	5000695	FAB – BELT TENSIONING BRACKET, BOTTOM, RIGHT	1
10	5000928	FAB – BELT TRACKING BRACKET, TOP	1


Side Belt Motor, Motor Pulley, and Attaching Hardware

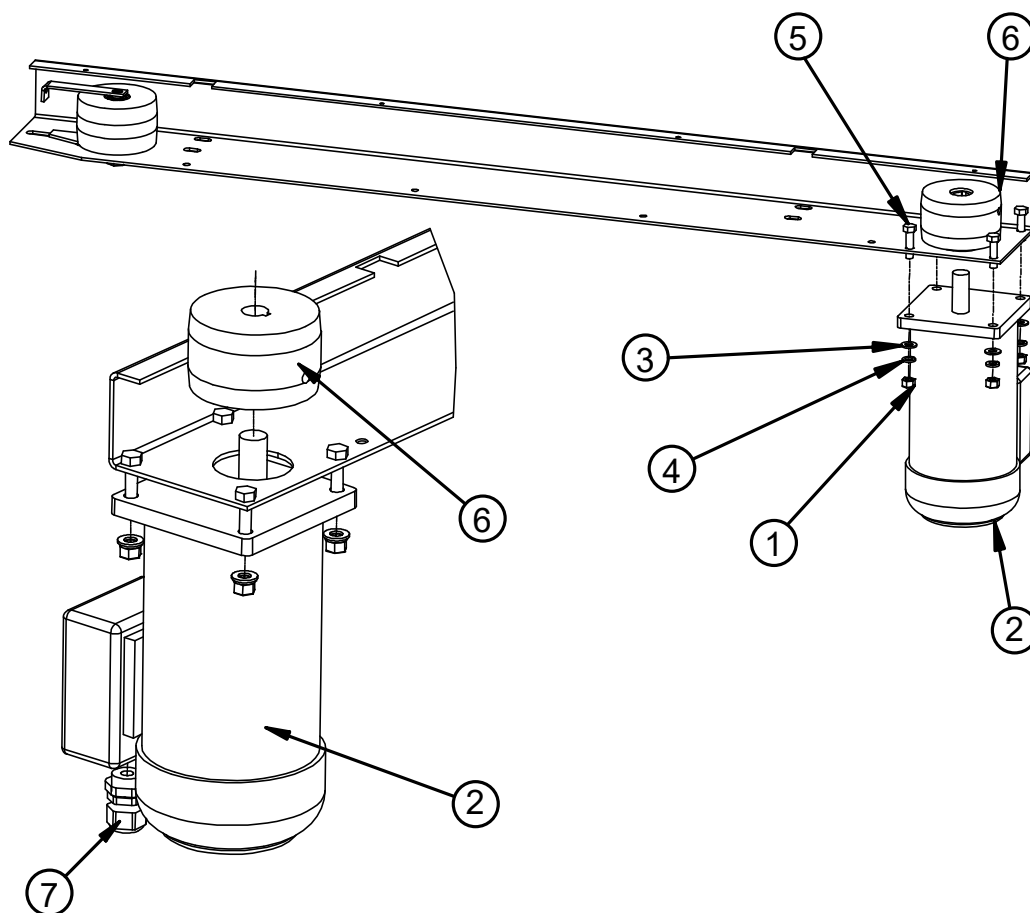

NOTE: Top illustration shows left-hand assembly; lower inset shows right-hand assembly.

ITEM	PART NO.	DESCRIPTION	Q'TY
1	055307-055	NUT – HEX, $\frac{5}{16}$ "-18 ZINC	4
2	5000311	SIDE BELT GEAR MOTOR	1
3	5000333	WASHER – FLAT $\frac{5}{16}$ ", ZINC	4
4	5000339	WASHER – $\frac{5}{16}$ " SPLIT, ZINC	4
5	5000803	SCREW – HH $\frac{5}{16}$ "-18 $\times$ 1- $\frac{1}{4}$ " SST	4
6	5000807	ASSEMBLY – SB DRIVE ROLLER	1
7	1602253	STRAIN RELIEF	1


Side Belt Guide Strips and Attaching Hardware

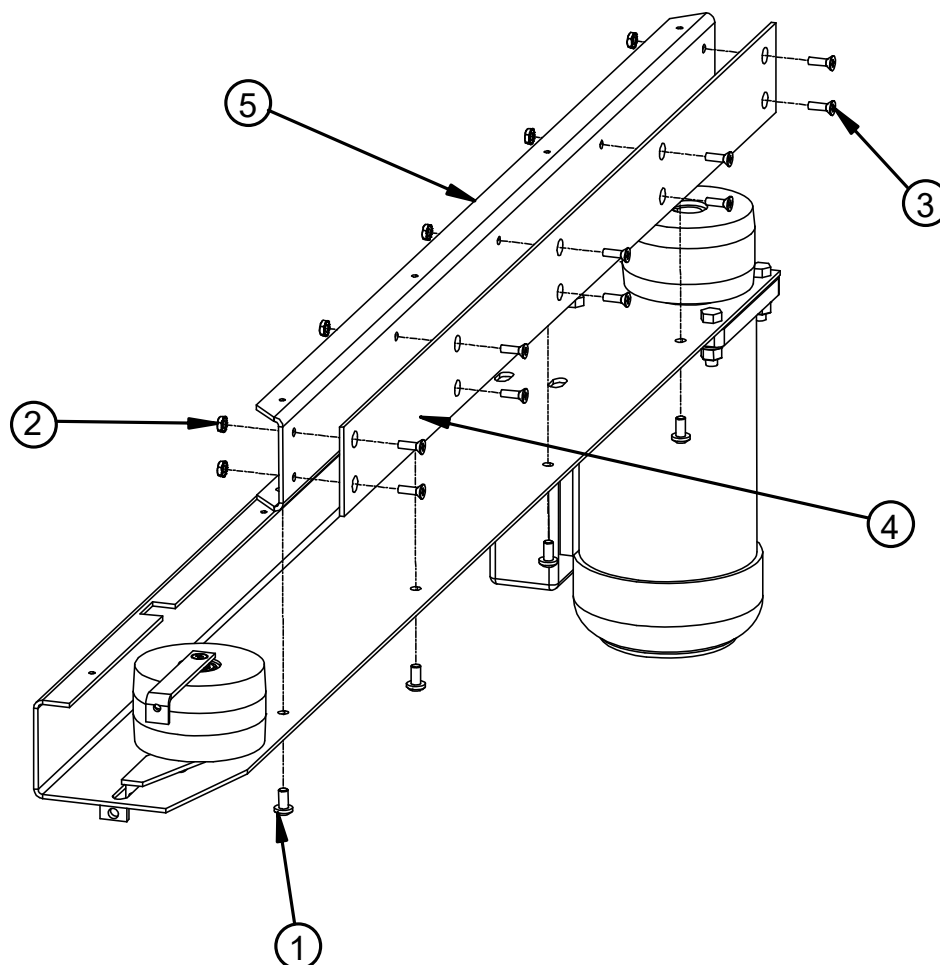

NOTE: Above illustration shows left-hand assembly; right-hand assembly is the mirror image.

ITEM	PART NO.	DESCRIPTION	Q'TY
1	054979-141	SCREW – PH ¼"-20 × ½" NI PH EXT	4
2	054982-005	NUT – KEP, #10-32 NC ZINC	10
3	055020-088	SCREW – FH, #10-32 × ½", SST, PH(82)	10
4	5000540	FAB – BELT STRIP	1
5	5000541	FAB – STRIP BRACKET	1


Side Belt Belts, Tensioning & Frame Attaching Screws

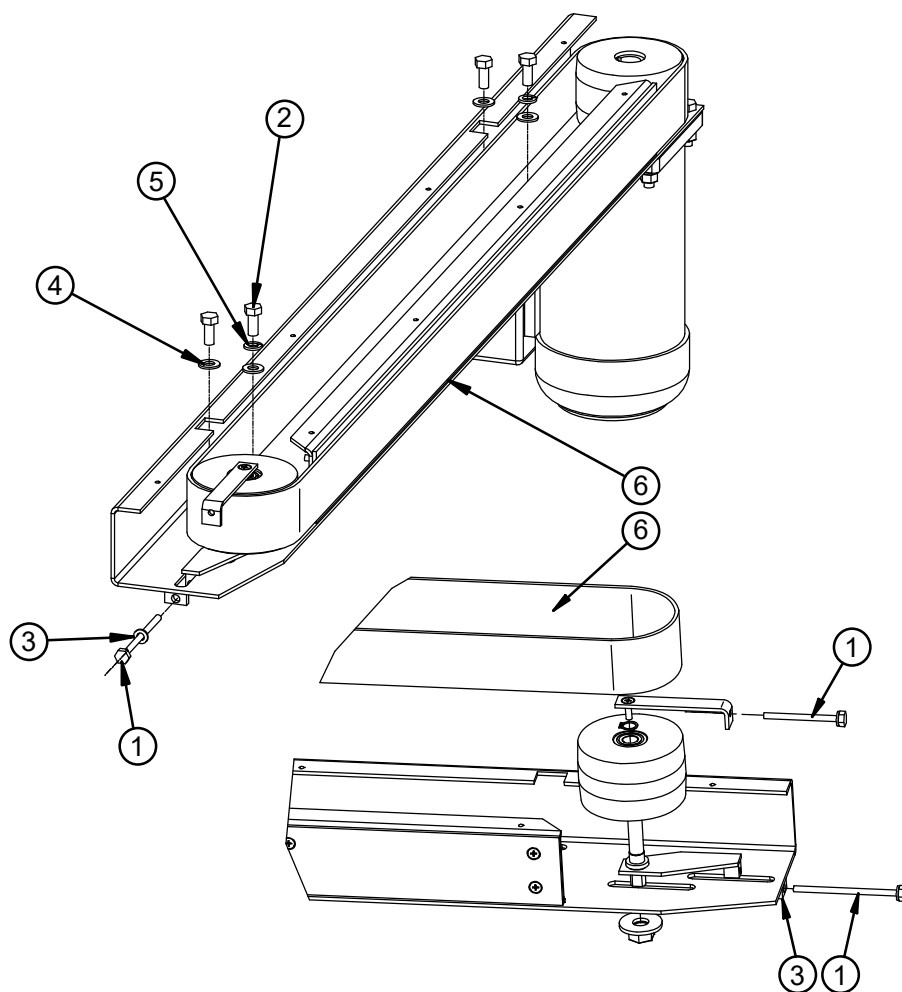

NOTE: Top illustration shows left-hand assembly; lower inset shows right-hand assembly.

ITEM	PART NO.	DESCRIPTION	Q'TY
1	055293-049	SCREW – HH 1/4"-20 x 3-1/2" TAP BOLT	1
2	055293-056	SCREW – HH 5/16"-18 x 3/4" ZINC	4
3	100694-001	WASHER – FLAT, M6, DIN 125 A	1
4	5000333	WASHER – FLAT 5/16", ZINC	4
5	5000339	WASHER – 5/16" SPLIT, ZINC	2
6	5000853	BELT (SET) – SIDE EZ SB	1

Side Belt Cover & Cover Attaching Screws

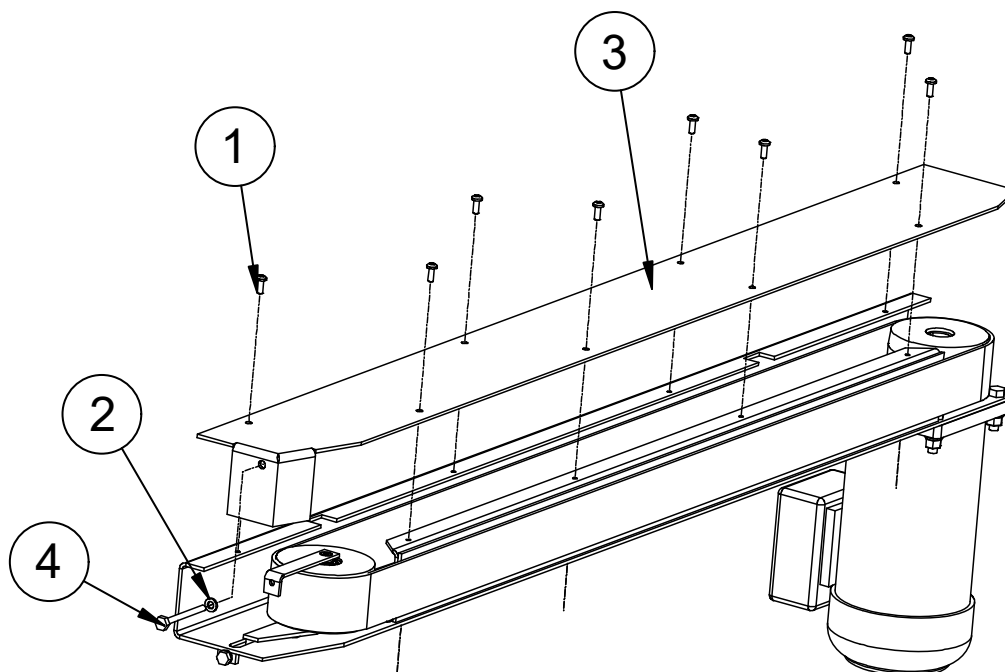

NOTE: Above illustration shows left-hand assembly; right-hand assembly is the mirror image.

ITEM	PART NO.	DESCRIPTION	Q'TY
1	059479-123	SCREW – PH #10-32 × ½ PH SS SEMS – IN	8
2	100694-001	SCREW – HH 5/16" -18 × ¾" ZINC	4
3-L	5000529	FAB – DRIVE COVER, LEFT	1
3-R	5000530	FAB – DRIVE COVER, RIGHT	1
4	5000804	SCREW – HH ¼"-20 × 3-½" TAP BOLT	4

Tape Head — Refer to Tape Head User Guide

Refer to the parts illustrations and listings in the Tape Head User Guide provided with the tape head for identification and part numbers of tape head parts.