

	TECHNICAL SUPPORT BULLETIN	Tech. Support Bulletin No. (NBSB-0071)
	<u>(Testing Laser Voltage From Back Panel)</u>	Page 1 of 3
		Products: Dimension
Revision	Description	Date
A	Initial Release – (John Tedesco)	(11/19/2009)

Subject: (Testing Laser Voltage from Back Panel)

System(s) Affected: (Dimension)

Action Category: (As Required)

Summary: (In some instances it is hard to determine if a laser is not turning on because of a scanner problem or a system problem. This test allows you to turn laser voltage on without a scanner and test that the logic from the back panel is working correctly)

Tools needed:

-Voltmeter

-Paperclip (homemade jumper)

Pinout:




1. Create a jumper from a paperclip
2. Jumper pin 2 to pin 10 on the dimension microscope connector
3. Test pin 17. Before you jumper pin 2 and 10 the voltage on pin 17 should be near 0V. After you jumper the voltage should be near 5V
4. make sure to apply enough force with your paperclip to ensure that pin 2 truly is connected to pin 10
5. Either controller chassis or the metal of the Z stage can be used as a reference ground for the voltmeter

	TECHNICAL SUPPORT BULLETIN	Tech. Support Bulletin No. (NBSB-0071)
	<u>(Testing Laser Voltage From Back Panel)</u>	Page 2 of 3
		Products: Dimension
Revision	Description	Date
A	Initial Release – (John Tedesco)	(11/19/2009)

6. It is highly likely that you will need an extra set of hands so grab an assistant for this if you can

Here is a pic of my big clumsy fingers jumpering pin 2 to pin 10. While you do this you have to check pin 17 for Voltage as described above.

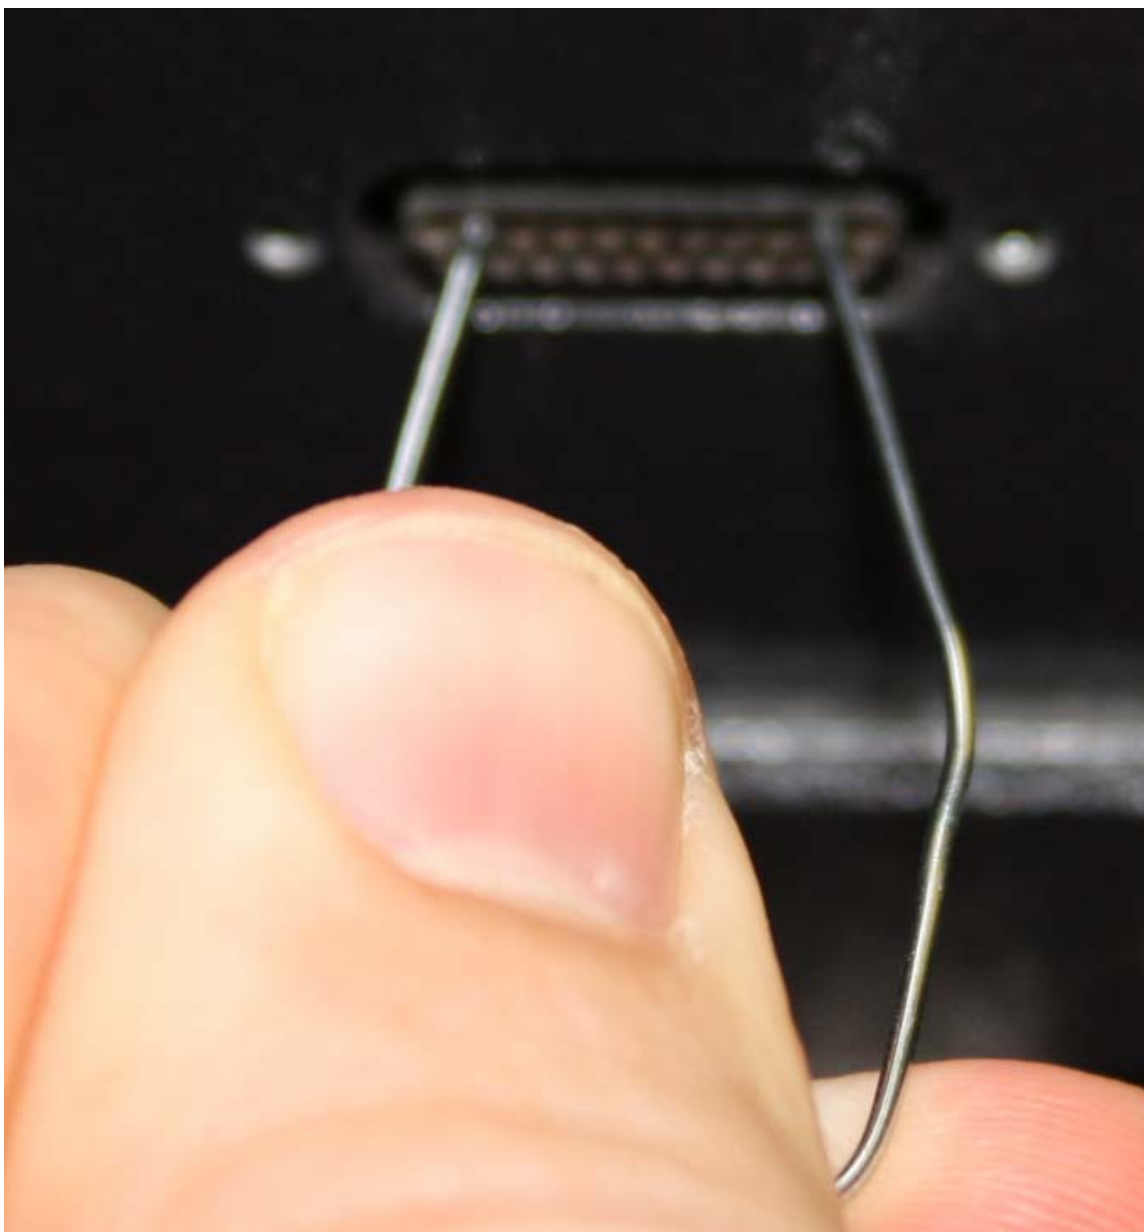

	TECHNICAL SUPPORT BULLETIN	Tech. Support Bulletin No. (NBSB-0071)
	<u><i>(Testing Laser Voltage From Back Panel)</i></u>	Page 3 of 3
		Products: Dimension
Revision	Description	Date
A	Initial Release – (John Tedesco)	(11/19/2009)