

UNIVERSITY OF ILLINOIS URBANA-CHAMPAIGN

SE 423: Introduction to Mechatronics

Lecture 12: IMU

Marius Juston

Monday, February 2nd, 2026

Review – 5-minute partner discussion

Talk to the person next to you and answer these review questions.

- To receive data, you must also ___ data.
- What is FIFO? Why is it used?
- What is the maximum size for the buffer's data in bits?
- What does SPICHAR = 0xF mean?
- What do absolute / incremental encoders measure? When do they fail at measuring travel distance?

Reminders

Office Hours:

- **Monday:** 4-6 PM, Neel
- **Tuesday:** 11-1 PM, Lakshmi
- **Tuesday:** 1-3 PM, Samuel
- **Tuesday:** 2-5 PM, Dan & Marius

Lab: Starting Lab 4 this week. This a 2-week lab!


Homeworks:

- Check-offs for homework 3 Ex 1, 2, 3 & 4 are due **March 10, 5PM (The end of office hours)**
- Check-offs for homework 3 Ex 5 are due **March 24, 5PM (The end of office hours)**
- Answers and code submissions for homework 3 are due **March 25, 9AM**


Questions?

Homework, Lab, LabVIEW?

Thank you to everyone that responded to my feedback form! There was a lot of great feedback that I will try to incorporate!

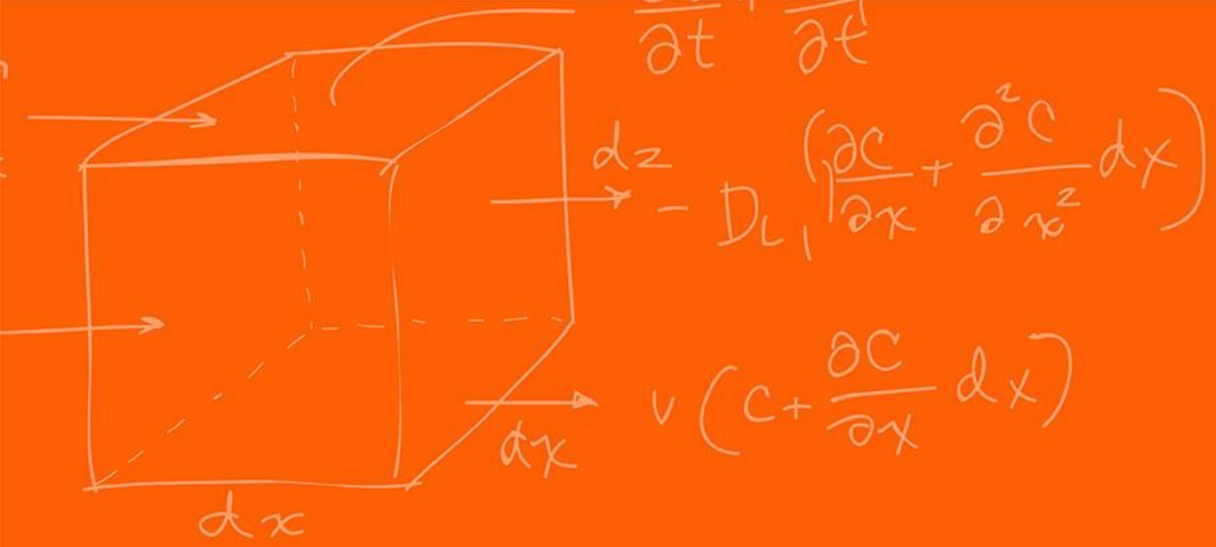




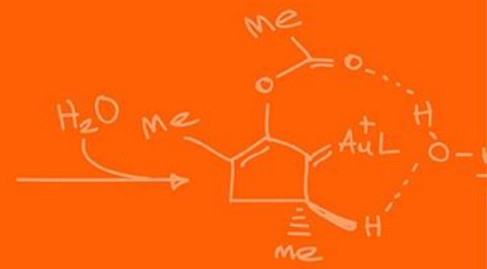



Accelerometer

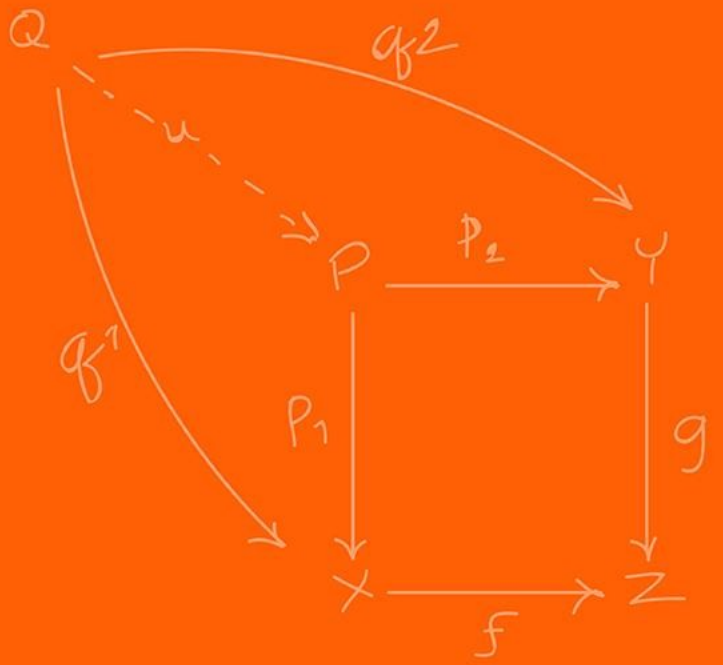

Accelerometer

We cannot and should not rely on a single sensor source (sensor fusion will be covered later), and sometimes we cannot attach encoders.

So, what can we do?

The goal is to measure direction and rotation. What is the most basic component that we can measure?

Forces!

How do calculate velocity and position from forces?


Accelerometer

A MEMS (Micro-Electro-Mechanical Systems) accelerometer measure linear acceleration.

Accelerometers work like a weight suspended by springs. When the mass is moved you measure the displacement, the springs bring it back to the center.

In chips, we use the change of capacitors. The capacitance is based on the distance between the 2 materials. So, the smaller the distance, the larger the returned capacitance.

You then measure this capacitance.

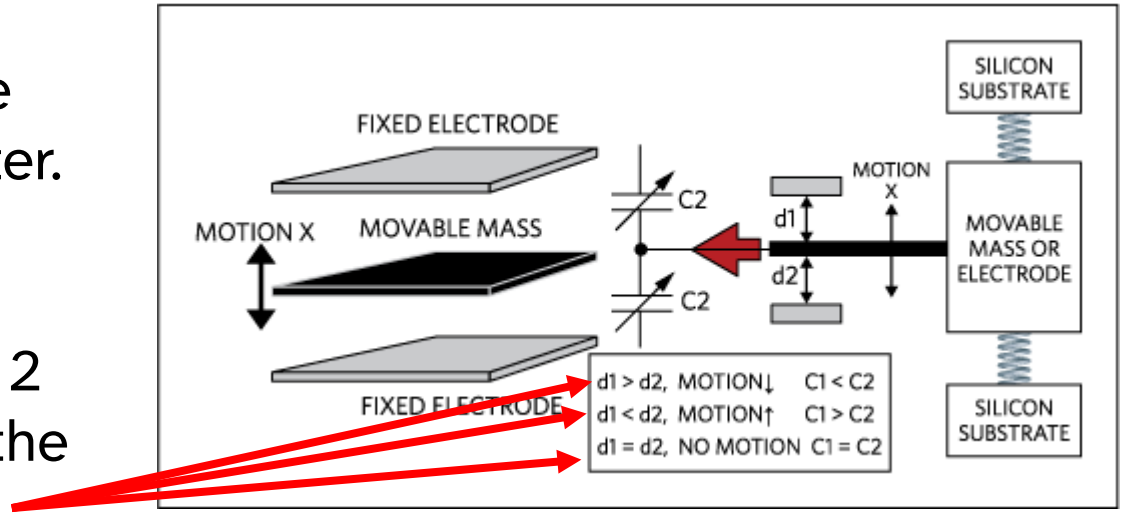

https://www.analog.com/cn/resources/technical-articles/accelerometer-and-gyroscopes-sensors-operation-sensing-and-applications.html

Accelerometer

Force causes a displacement of the mass which, in turn, causes a capacitance change.

Placing multiple electrodes in parallel allows for a larger capacitance, which will be more easily detected.

By calculating the difference between C_1 and C_2, we can derive the displacement of the mass and its direction.

Accelerometer

- Since we can measure the displacement and the system acts as a string we can do the following. We start with:

$$F = ma$$

The force from a spring is:

$$F = k\,\Delta x$$

Given that m, k are known (design choices), and Δx is measured from the capacitors, we get that:


$$F = ma = k\Delta x$$

$$a = \frac{k}{m}\Delta x$$


Accelerometer

You keep stacking these to remove the noise to get more accurate readings. In turn we get the following internal system. It is incredible how small these are!


How many axis can the following accelerometers measure?

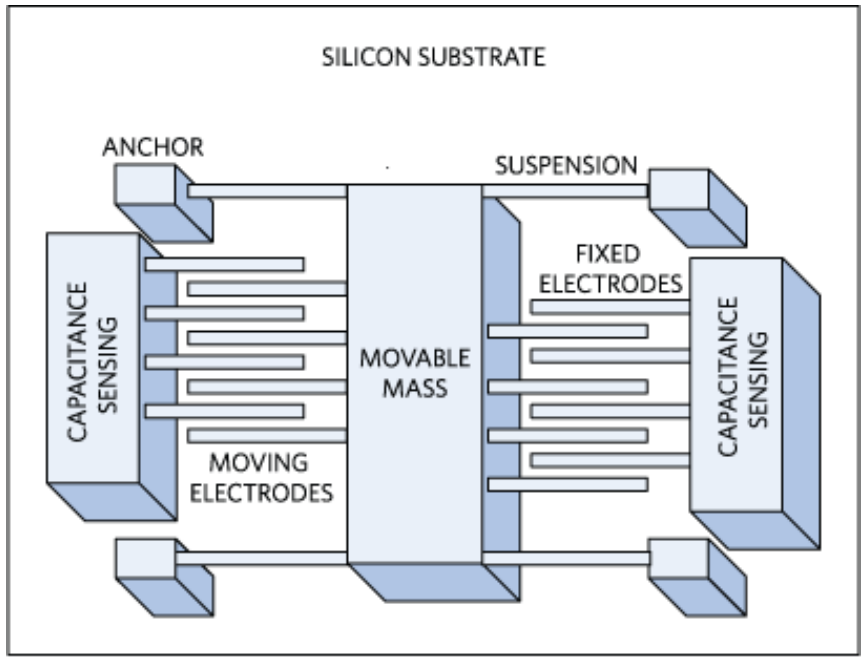

https://www.analog.com/cn/resources/technical-articles/accelerometer-and-gyroscopes-sensors-operation-sensing-and-applications.html

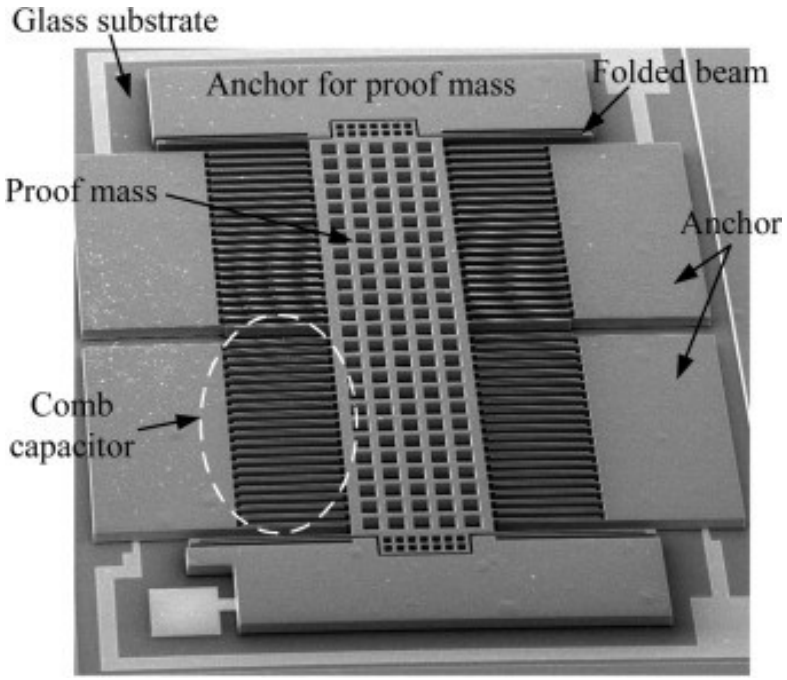

https://www.sciencedirect.com/science/article/pii/S0924424716300267

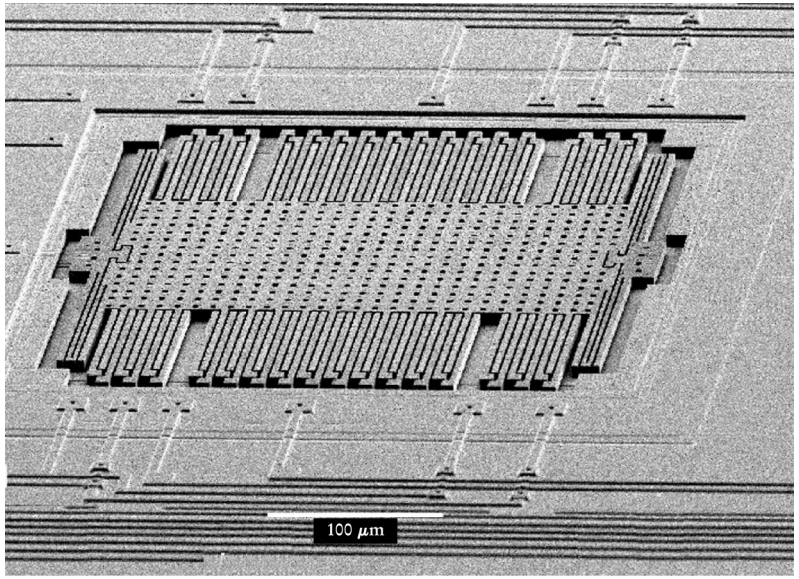


https://physicstoday.aip.org/features/the-little-machines-that-are-making-it-big


Accelerometer


Think of the z-axis as a trampoline!

What happens if you have too large of an acceleration (think of the combs)?

An accelerometer that is sitting still on a desk reads _g pointing upwards.
What if it gets dropped out of the window in a perfect vacuum?

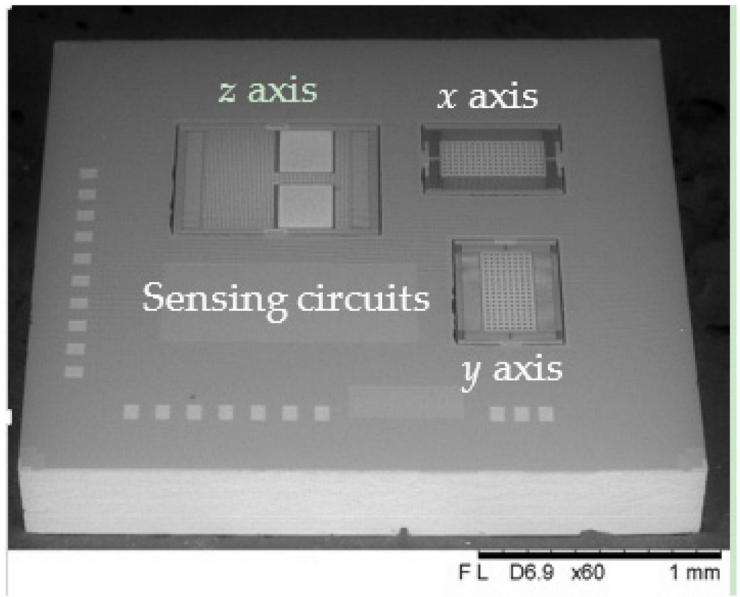


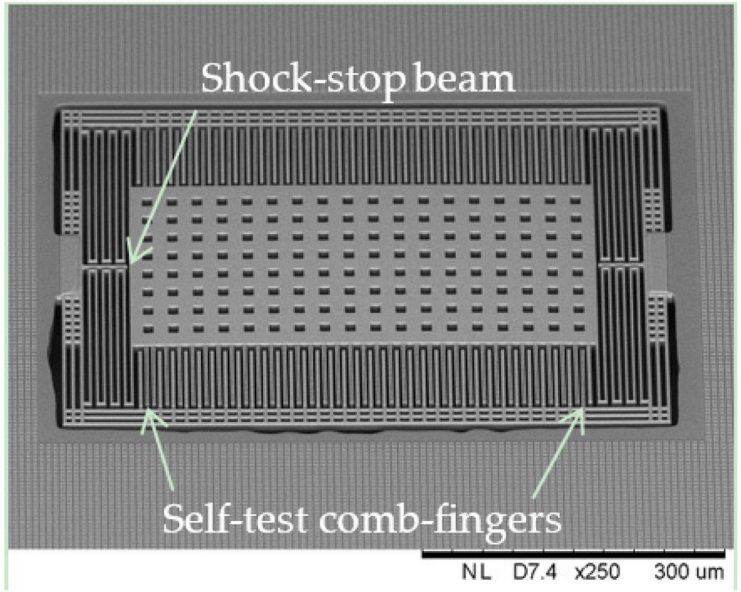


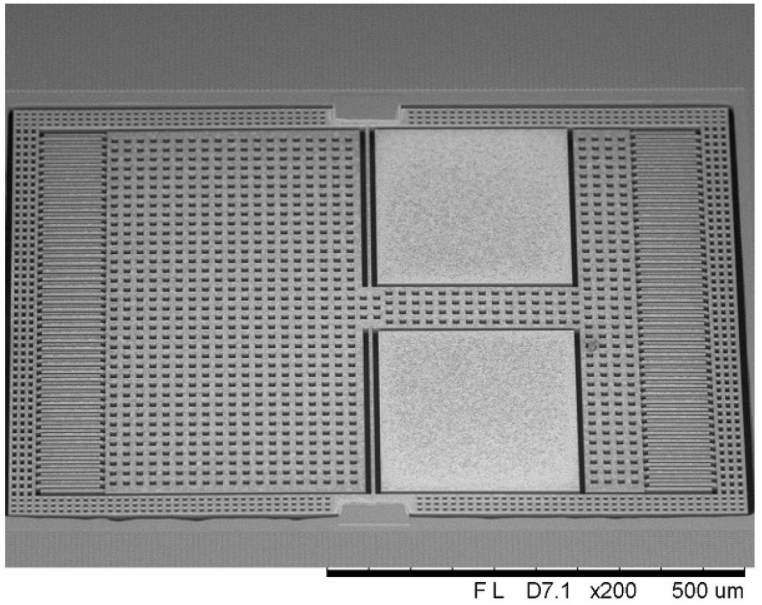


https://www.mdpi.com/2504-3900/1/4/337

Accelerometer

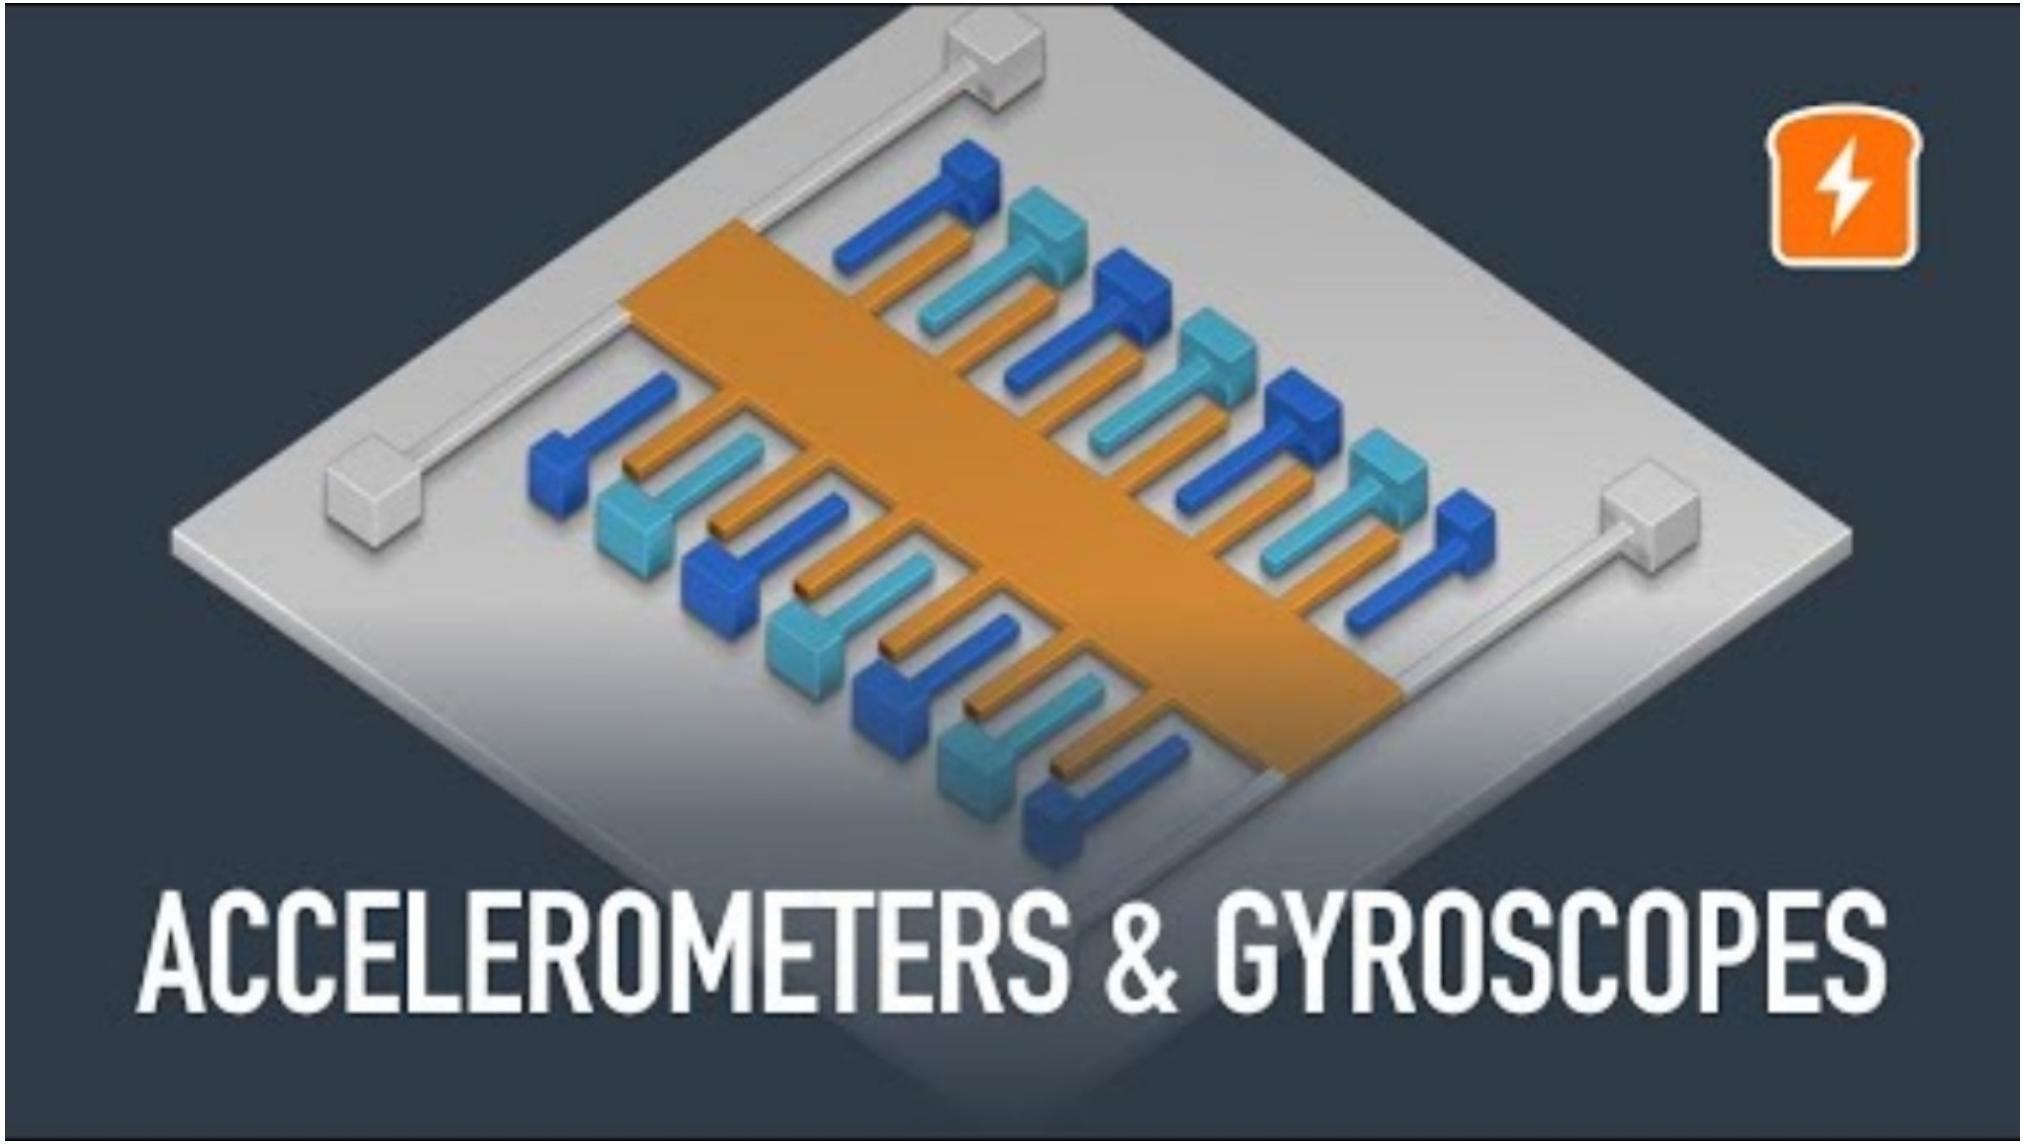

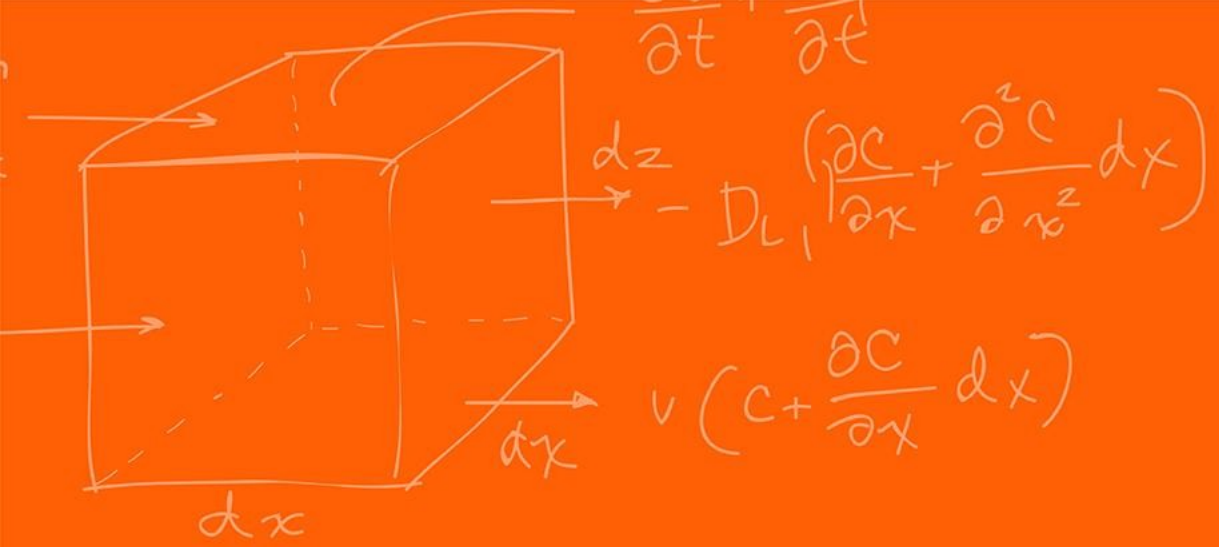




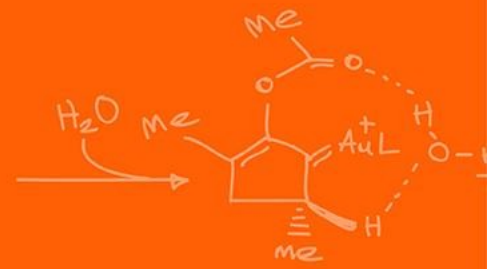



Gyroscope

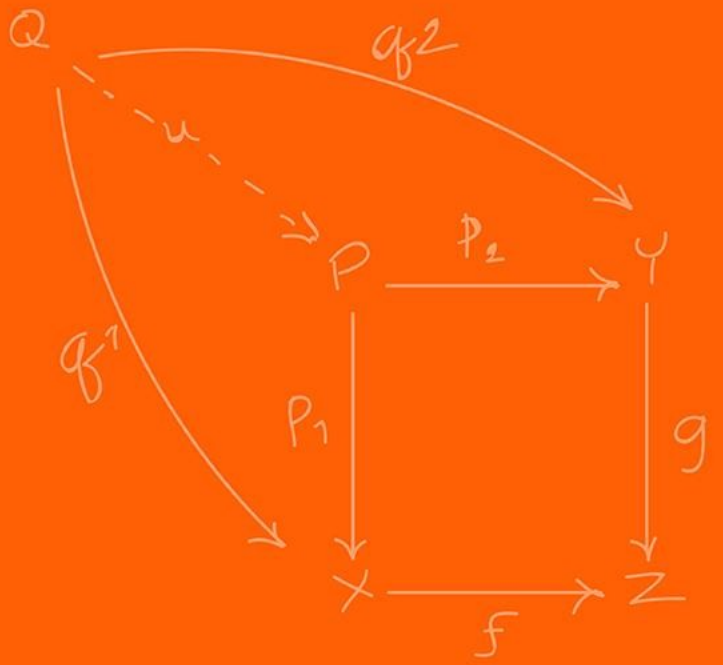

Gyroscope

- The accelerometer measures linear acceleration, which allows us to measure acceleration, velocity and displacement.


How many degrees of freedom are there in 3D?

$$(x, y, z, \theta_x, \theta_y, \theta_z)$$

How many does the accelerometer handle?


3: (x, y, z)

We are missing the angular DOF!

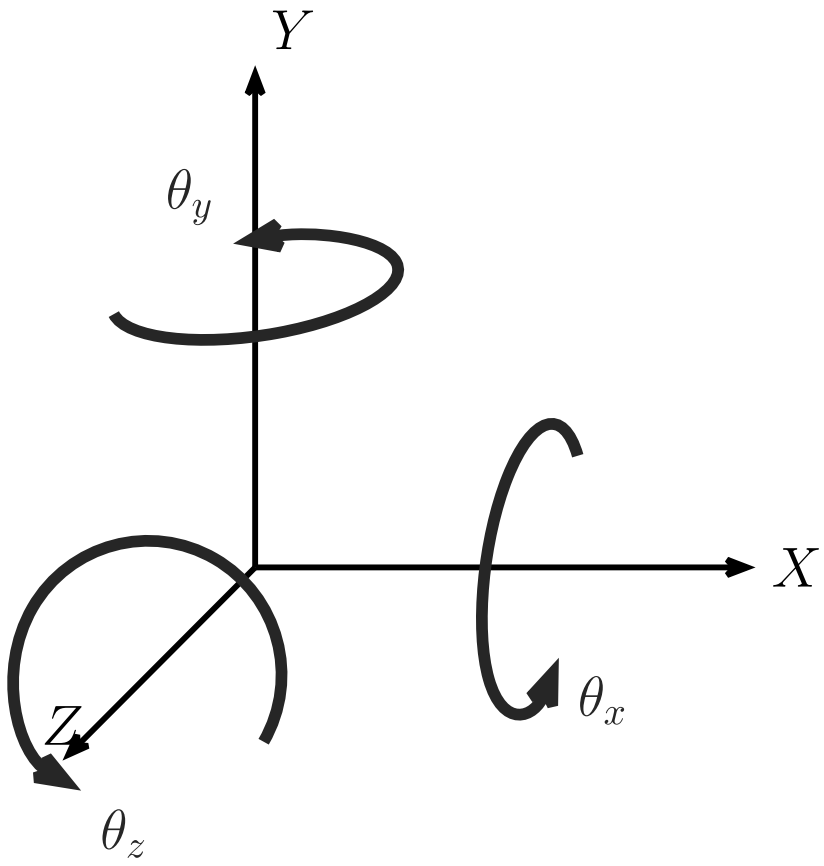

Gyroscope

A MEMS Gyroscope does not use a spinning wheel like classical mechanical gyroscopes. Similarly, you have a tiny mass that is moving when rotating. If the device start rotating, the moving mass experiences a sideways force.

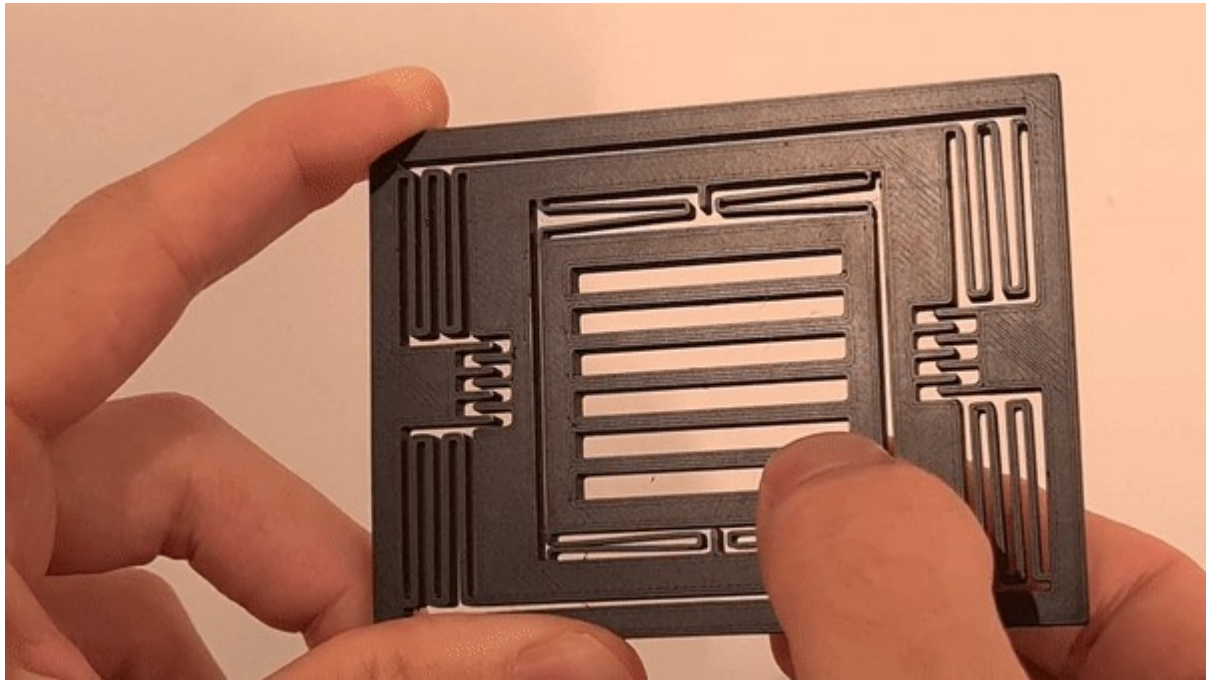

https://www.reddit.com/r/3Dprinting/comments/103v6ef/1001_3d_printed_mems_gyroscope/

Gyroscope

Very similar to accelerometers,

The mass sits between capacitors plates.

When the it moves sideways, capacitance changes.

This returns a displacement from which we can compute angular velocity.


Gyroscope

The device shown has 2 axis, the **Drive Axis** (x) and the **Sense Axis** (y).

The inner mass is electrically forced to vibrate continuously back and force along the x-axis at a resonant frequency ω_r. The instantaneous velocity is v.

When an angular velocity Ω_z, along the z-axis, is applied, the Coriolis force acting along the y-axis is generated.

$$F_C = -2m(\Omega_z \times v)$$

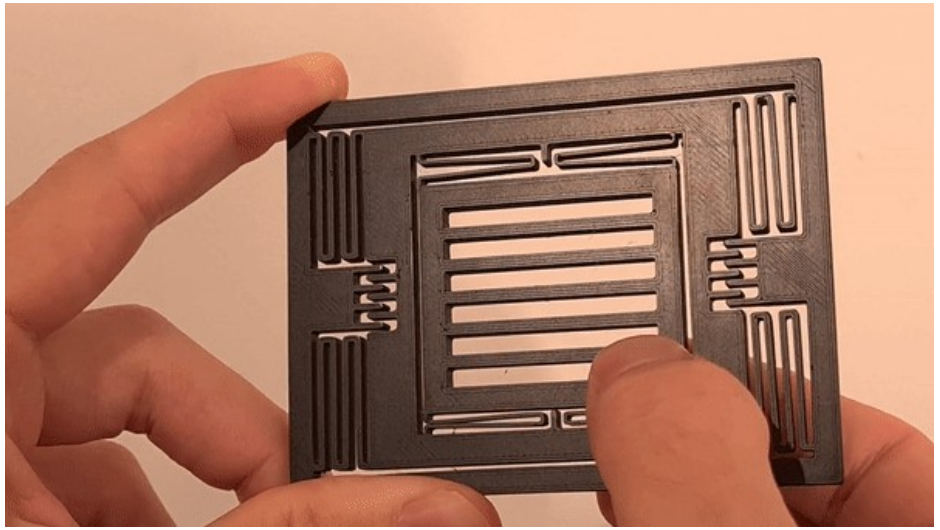

https://www.reddit.com/r/3Dprinting/comments/103v6ef/1001_3d_printed_mems_gyroscope/

Gyroscope

-

The Coriolis force pushes the mass along the y-axis.

Thus, to solve for angular velocity we again derive that:


$$F = k\Delta y = -2m(\Omega_z \times v)$$


$$\Omega_z = \frac{k\Delta y}{2m\,v}$$

We know the mass m, spring stiffness k, drive velocity v, so we just compute the displacement Δy to measure Ω_z.

Very similar to the accelerometer!

Gyroscope

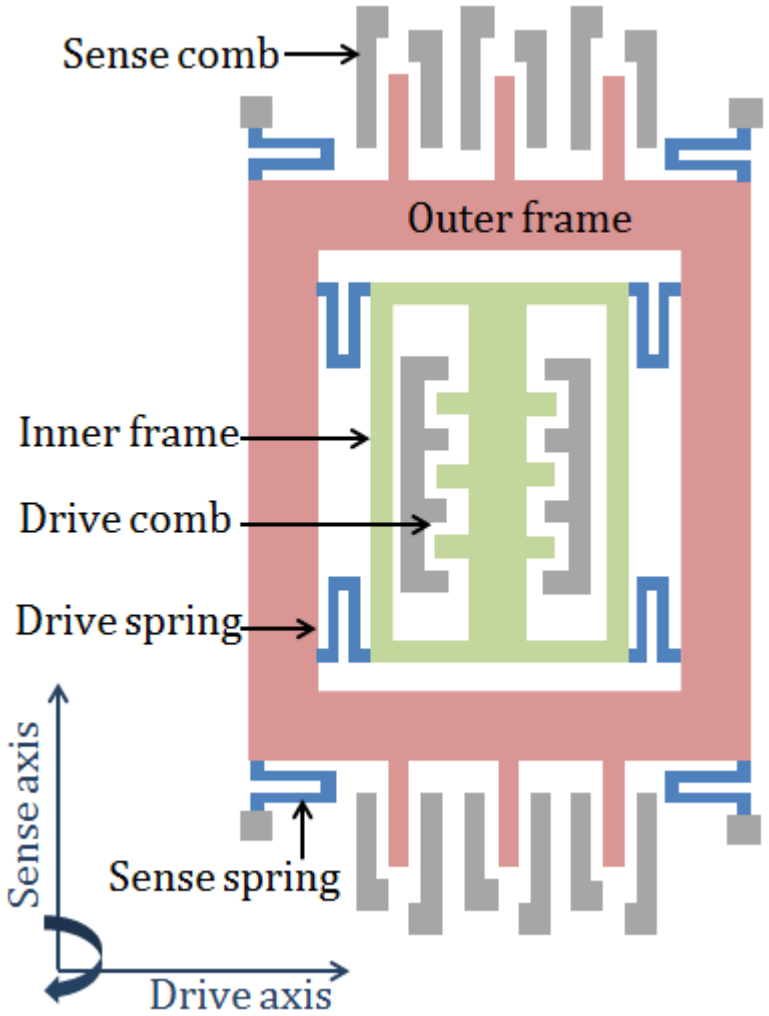


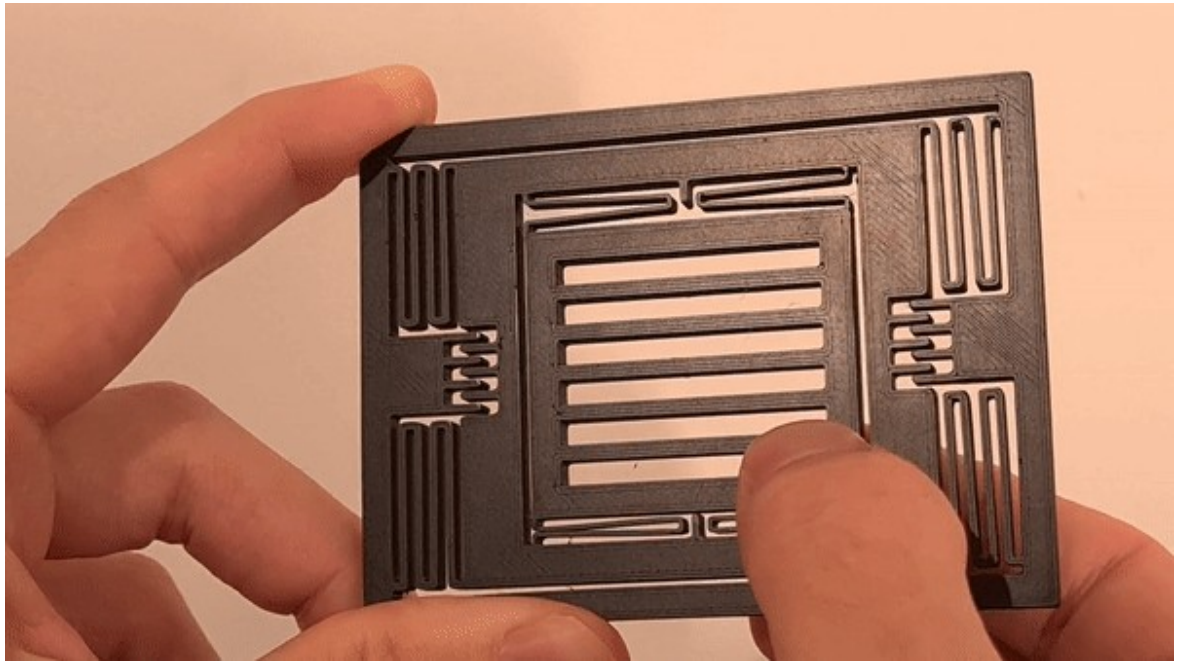


https://www.semanticscholar.org/paper/Modeling-and-simulation-of-the-MEMS-vibratory-Patel-McCluskey/8dec6605fc5b603df07d74f7b9eb6875b2c17c3a

https://www.reddit.com/r/3Dprinting/comments/103v6ef/1001_3d_printed_mems_gyroscope/

Gyroscope

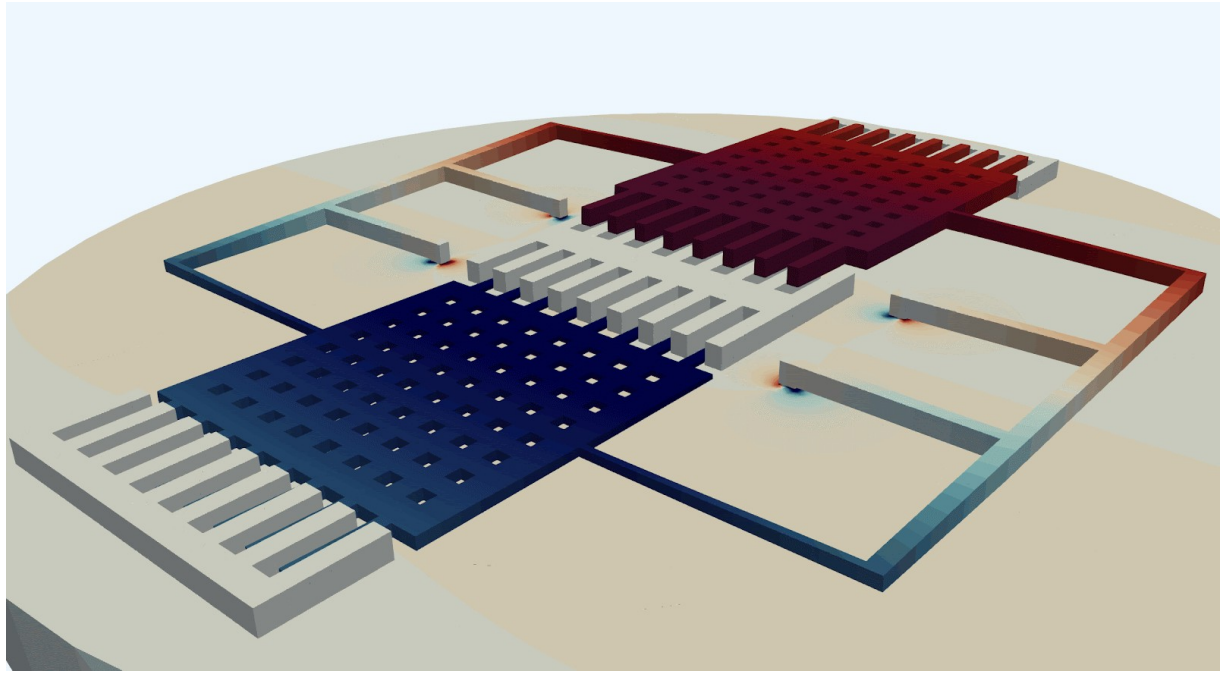


https://quanscient.com/blog/enhancing-mems-gyroscope-design

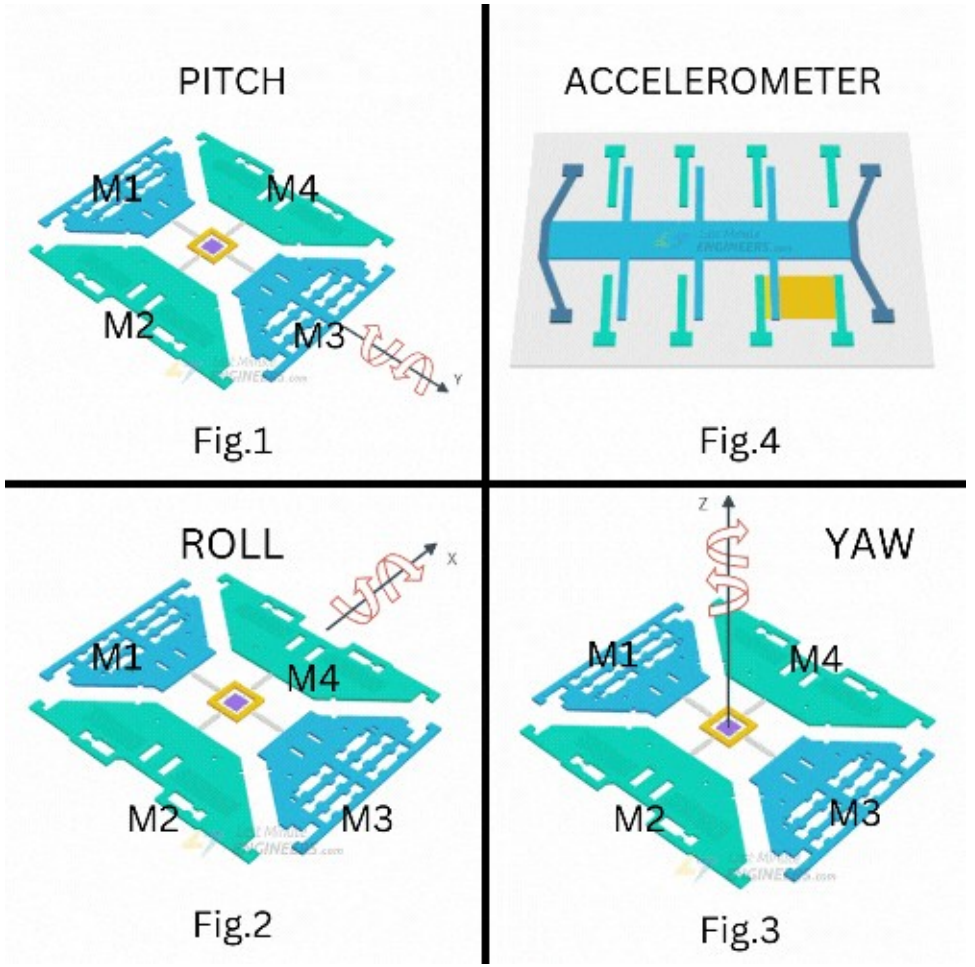

https://forum.arduino.cc/t/getting-started-with-the-mpu6050-beginner-friendly-guide-with-visual-explanations/1364064


Gyroscope

What is this? The gyros or accelerometers?

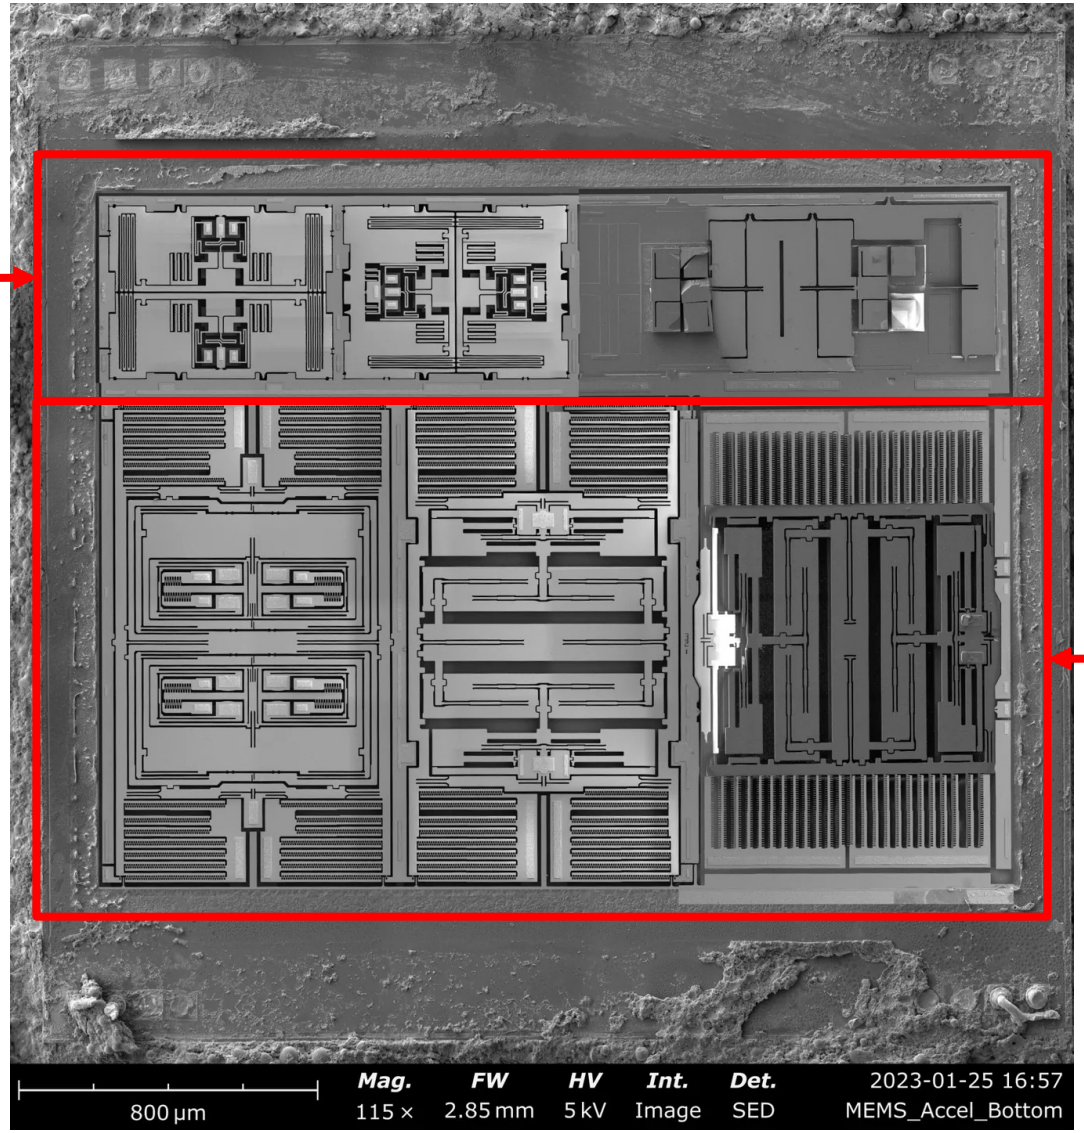


What is this? The gyros or accelerometers?

https://www.printables.com/model/413667-mems-model-six-axis-imu-device

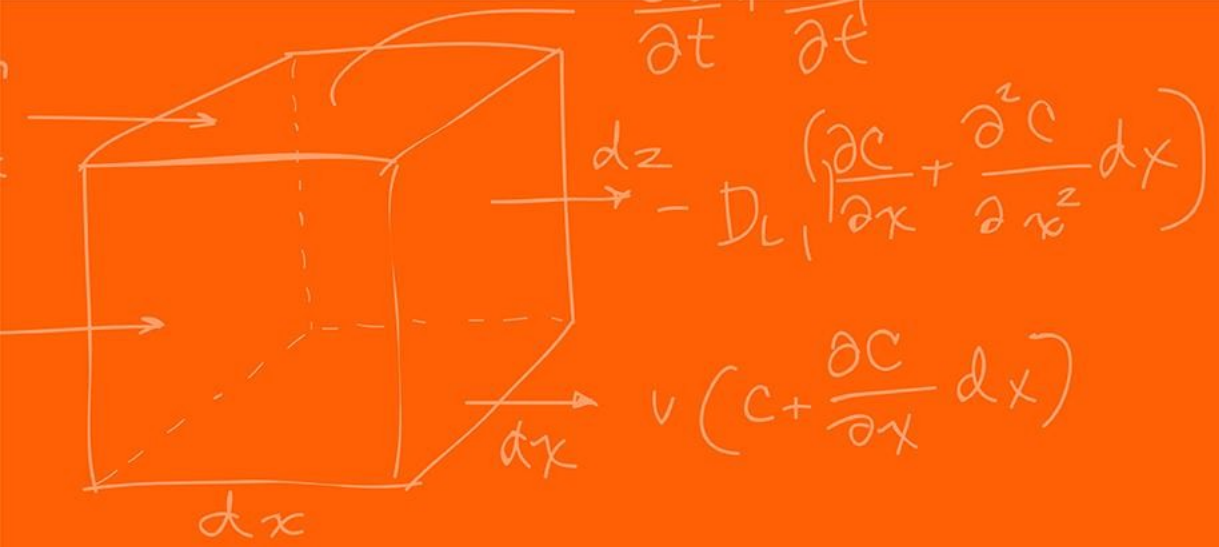




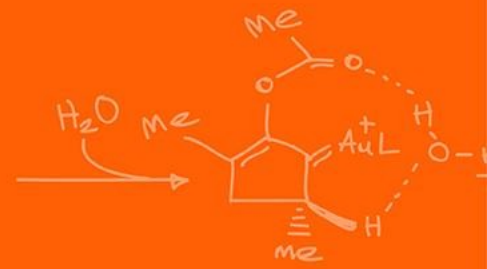



Magnetometer

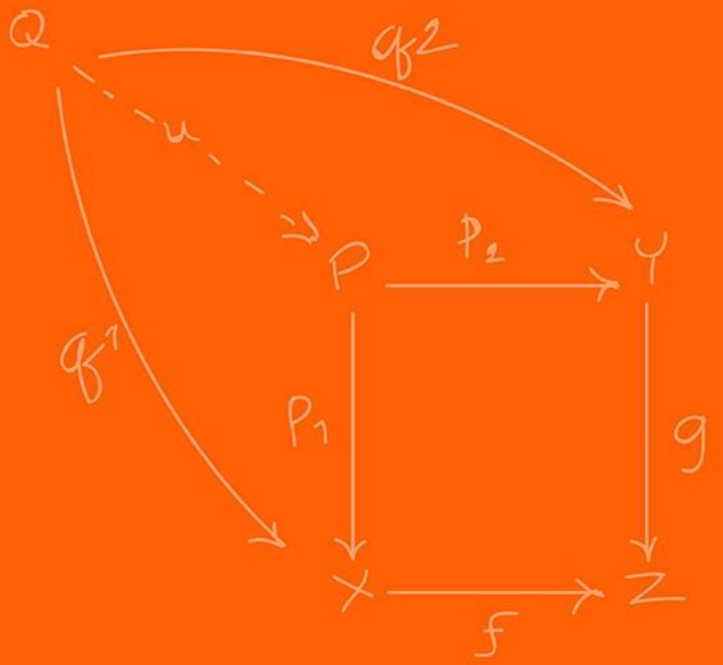

Magnetometer

What is a device that has been used for traveling for a very long time? That has helped sailors travel?


The compass!

The magnetometer acts as an absolute reference. It measures the strength and direction of the Earth's magnetic field, allowing the system to establish a global "North"

The more popular method uses the Hall Effect sensor to measure the magnetic field; however, next slide is a slightly different, method, and was chosen since it is more like the previous accelerometer and gyroscope sensors. Although they measure the same thing in the end!


Magnetometer


The magnetic field acts like a counterbalance and you measure the torque

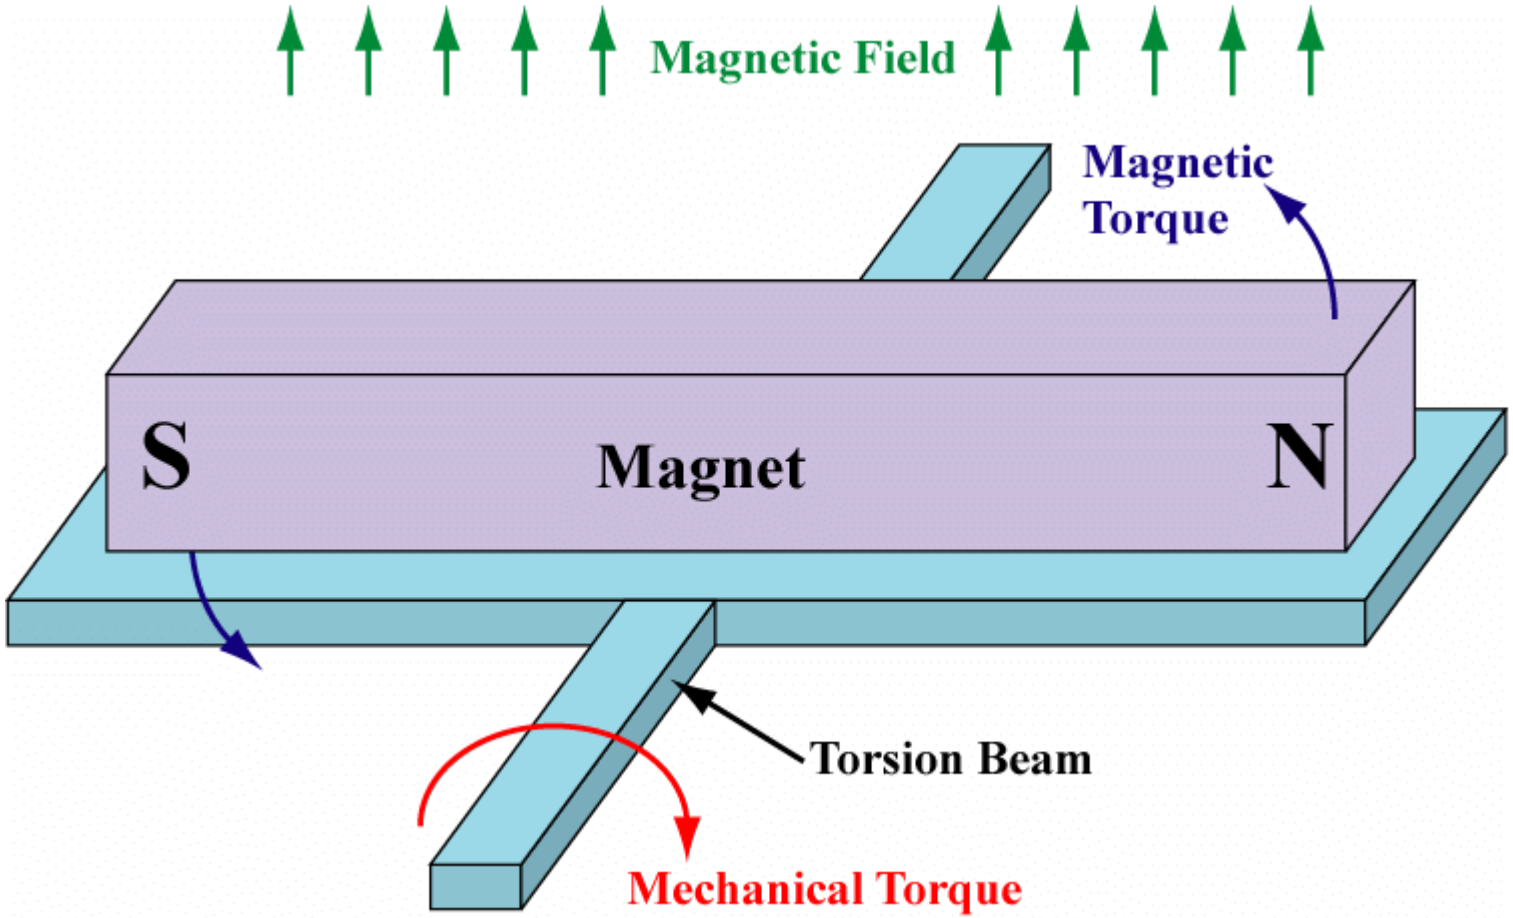


https://www.researchgate.net/figure/Illustration-of-a-ferromagnetic-MEMS-magnetometer-design_fig18_255663586

Magnetometer

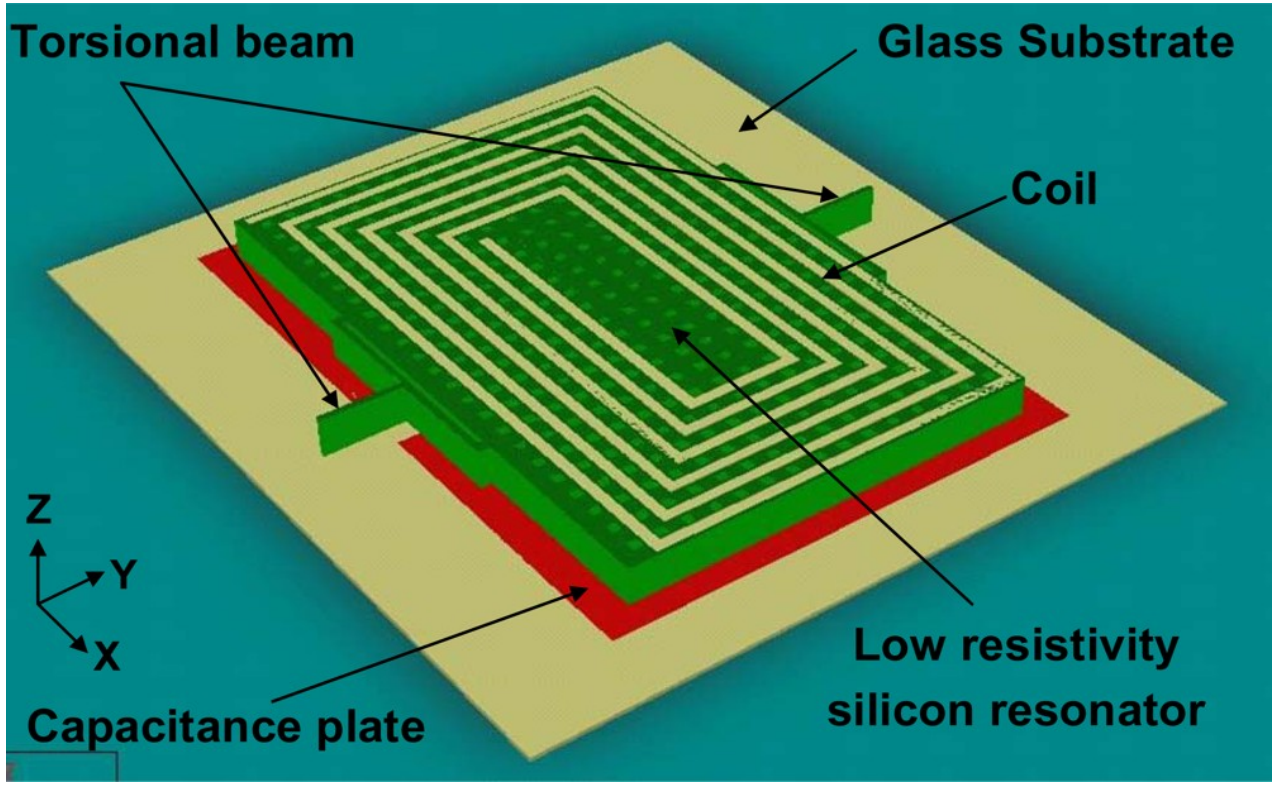


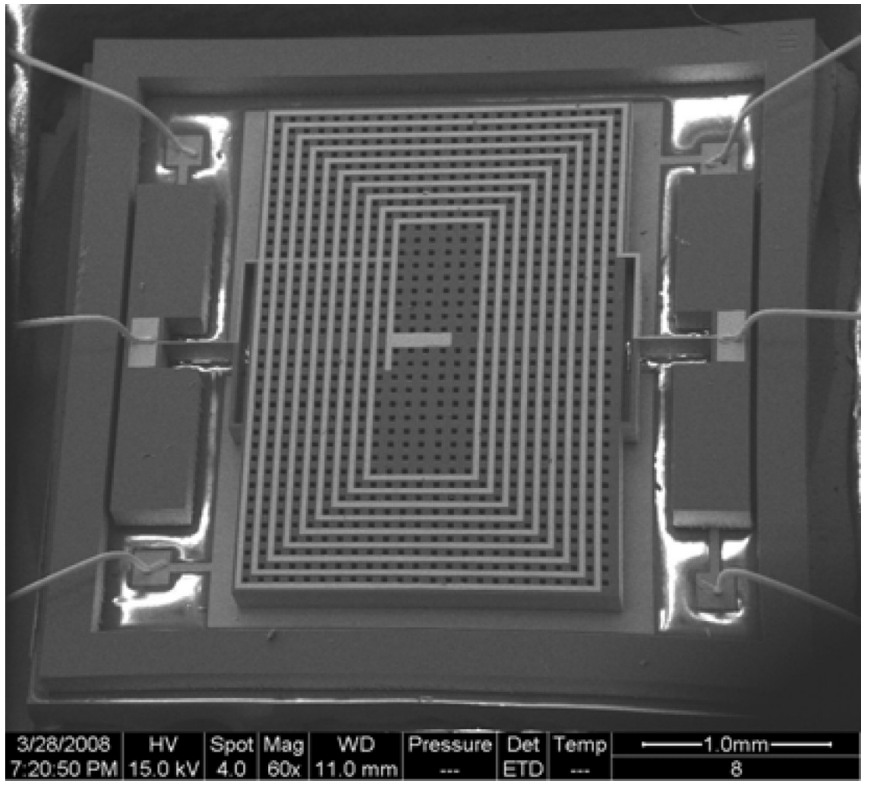

https://www.mdpi.com/1424-8220/9/9/6951

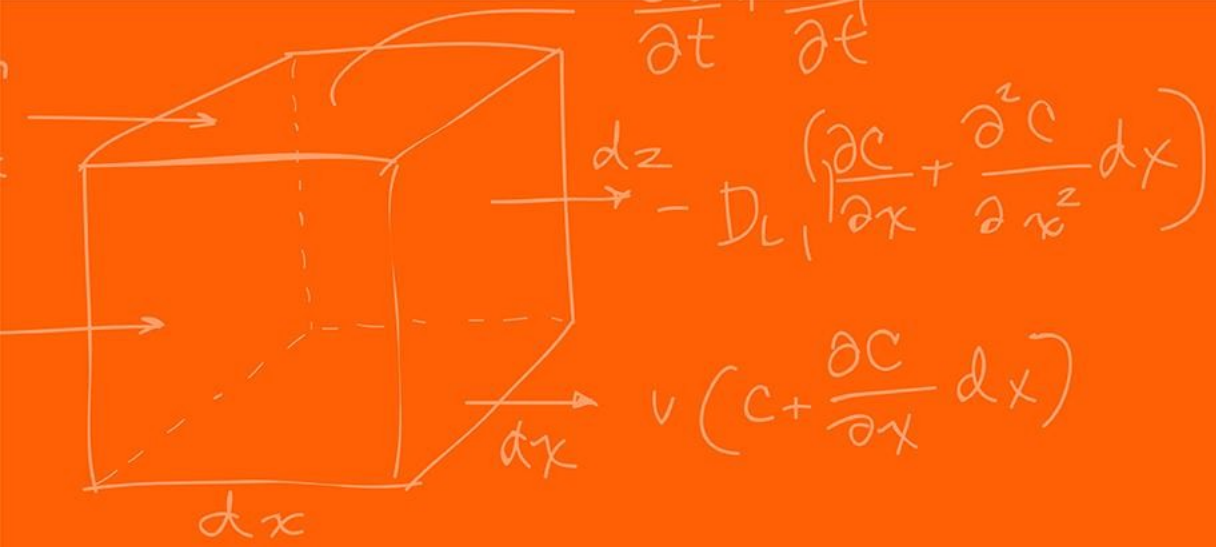




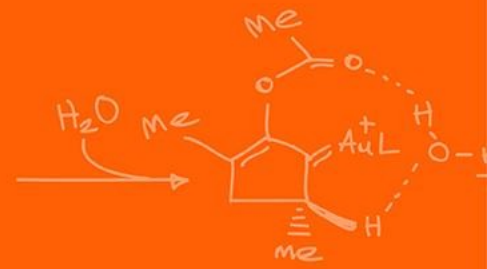

IMU



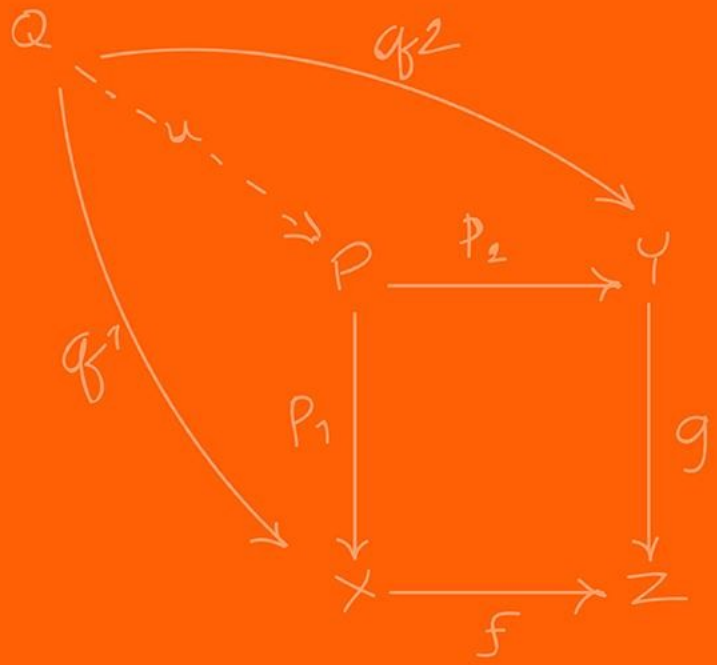

IMU

IMU – stands for Inertial Measurement Unit

Which is just a single chip that packages 3-axis accelerometers, 3-axis gyroscopes and a 3-axis magnetometer (sometimes).

Sometimes includes additional noise filtering, sensor fusion.

Allows to collect all the information about the robot’s inertial state.

IMU

We will specially be using the MPU-9250. This specifically contains a 3-axis accelerometer, 3-axis gyroscope and a 3-axis magnetometer.

There are multiple sensitivity levels that you can set the sensors:

- Gyroscope: ±250, ±500, ±1000, and ±2000 dps (degrees per second)
- Accelerometer: ±2g, ±4g, ±8g, and ±16g
- Magnetometer: ±4800μT (Tesla)

We can communicate to it through I2C at 400kHz or SPI at 1MHz (up to 20MHz).

These sensors are meant to be read extremely fast, why is that the case?
We need to integrate to get velocity and position so the smaller the dt the more accurate!

IMU

We will be communicating through SPI.


Each the returned results will be 16-bit signed integers. As such:

Acceleration X, Y, Z: [-32768, 32767] = [-4g, 4g]
Gyro X, Y, Z: [-32768, 32767] = [-250 dps, 250 dsp]

IMU

There are 2 components for this sensor, writing configurations vs reading data. This is encoded inside the SPI data. We separate the message into 2 8-bit parts.

The **address (top 8-bits)**: Says if we are trying to read/write and from where (accel vs gyro)
The **data (bottom 8-bits)**: what we are trying to send to write to that address (ignored if reading)

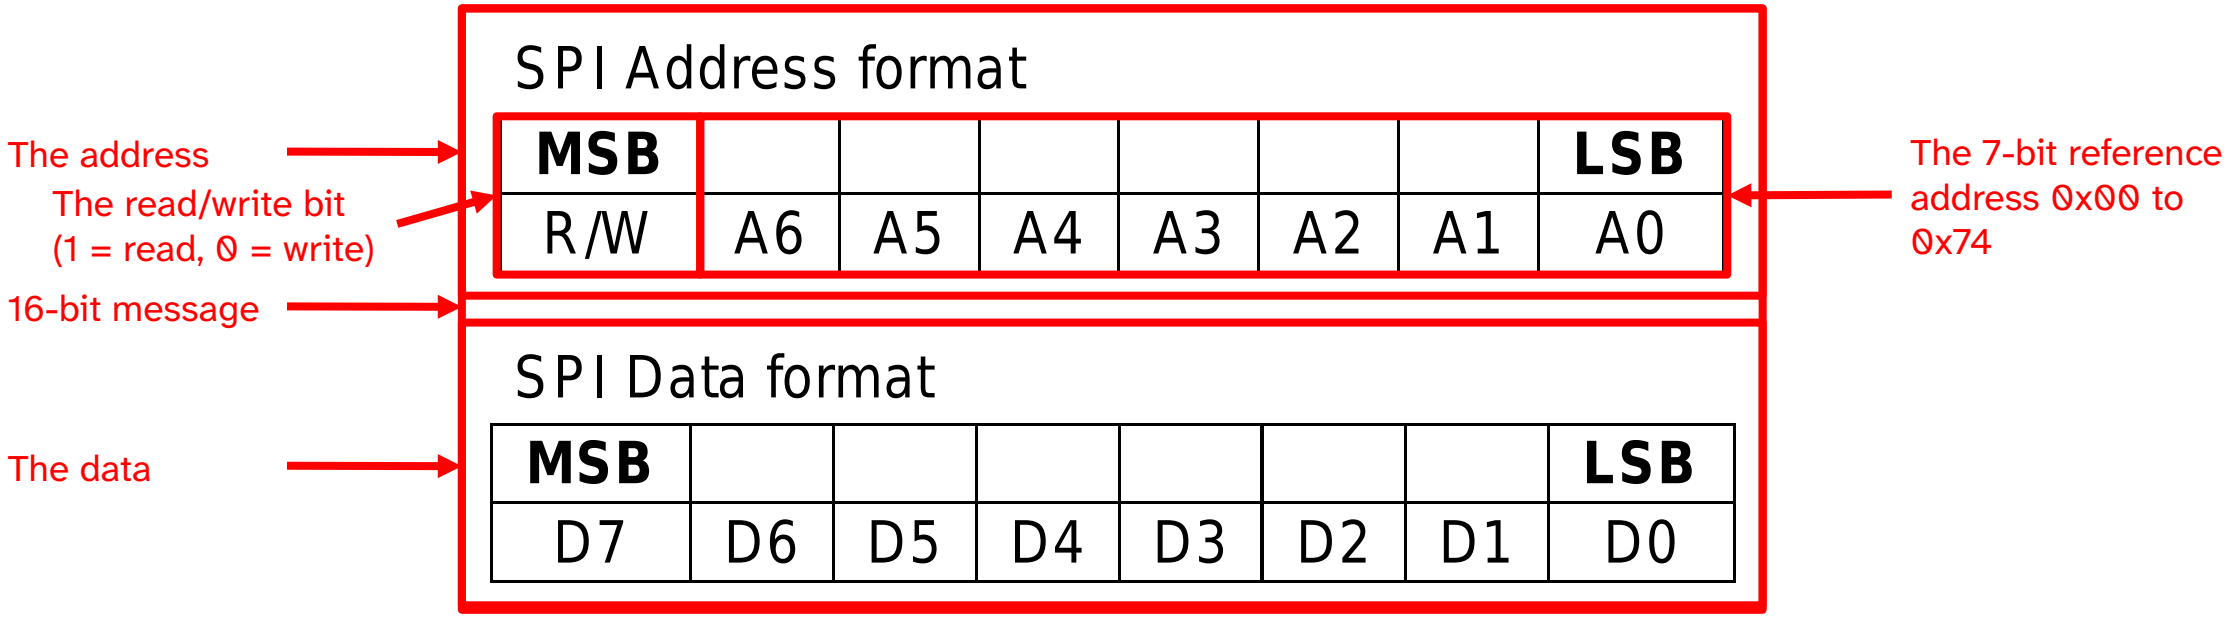

IMU

Addr (Hex)	Addr (Dec.)	Register Name	Serial I/F	Bit7	Bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
35	53	I2C_SLV4_DI	R	I2C_SLV4_DI[7:0]							
36	54	I2C_MST_STATUS	R	PASS_THROUGH	I2C_SLV4_DONE	I2C_LOST_ARB	I2C_SLV4_NACK	I2C_SLV3_NACK	I2C_SLV2_NACK	I2C_SLV1_NACK	I2C_SLV0_NACK
37	55	INT_PIN_CFG	R/W	ACTL	OPEN	LATCH_INT_EN	INT_ANYRD_2CLEAR	ACTL_FSYNC	FSYNC_INT_MODE_EN	BYPASS_EN	-
38	56	INT_ENABLE	R/W	-	WOM_EN	-	FIFO_OFLOW_EN	FSYNC_INT_EN	-	-	RAW_RDY_EN
3A	58	INT_STATUS	R	-	WOM_INT	-	FIFO_OFLOW_INT	FSYNC_INT	-	-	RAW_DATA_RDY_INT
3B	59	ACCEL_XOUT_H	R	ACCEL_XOUT_H[15:8]							
3C	60	ACCEL_XOUT_L	R	ACCEL_XOUT_L[7:0]							
3D	61	ACCEL_YOUT_H	R	ACCEL_YOUT_H[15:8]							
3E	62	ACCEL_YOUT_L	R	ACCEL_YOUT_L[7:0]							
3F	63	ACCEL_ZOUT_H	R	ACCEL_ZOUT_H[15:8]							
40	64	ACCEL_ZOUT_L	R	ACCEL_ZOUT_L[7:0]							
41	65	TEMP_OUT_H	R	TEMP_OUT_H[15:8]							
42	66	TEMP_OUT_L	R	TEMP_OUT_L[7:0]							
43	67	GYRO_XOUT_H	R	GYRO_XOUT_H[15:8]							
44	68	GYRO_XOUT_L	R	GYRO_XOUT_L[7:0]							
45	69	GYRO_YOUT_H	R	GYRO_YOUT_H[15:8]							
46	70	GYRO_YOUT_L	R	GYRO_YOUT_L[7:0]							
47	71	GYRO_ZOUT_H	R	GYRO_ZOUT_H[15:8]							
48	72	GYRO_ZOUT_L	R	GYRO_ZOUT_L[7:0]							
49	73	EXT_SENS_DATA_00	R	EXT_SENS_DATA_00[7:0]							
4A	74	EXT_SENS_DATA_01	R	EXT_SENS_DATA_01[7:0]							
4B	75	EXT_SENS_DATA_02	R	EXT_SENS_DATA_02[7:0]							
4C	76	EXT_SENS_DATA_03	R	EXT_SENS_DATA_03[7:0]							
4D	77	EXT_SENS_DATA_04	R	EXT_SENS_DATA_04[7:0]							

The address

If you can read / write to this address

Data is split into 8-bit high and low bits

IMU

As you previously saw we want to write 16-bits of data and potentially read 16-bits at a time to reduce the complexity of having to bit shift the high and low bits into the same variable.

To do this what would we need to set SPICHAR to?

`0xA` `0x11` `0xF` `0x8`

IMU

When writing configuration to the MPU board, such as the accelerometer X offset (initial bias)

```
GpioDataRegs.GPCCLEAR.bit.GPIO66 = 1;   // Start SPI
// 0x77 = 0111 0111 is this read or writing?
SpibRegs.SPITXBUF = (0x7700 | 0x00EB);  // Address + data
while(SpibRegs.SPIFFRX.bit.RXFFST !=1); // Waiting for
response
GpioDataRegs.GPCSET.bit.GPIO66 = 1;     // Disable SPI
temp = SpibRegs.SPIRXBUF;               // Read value even
though not needed
DELAY_US(10);  // Delay a bit before issuing another MPU-9250
SPI transfer
```

IMU

What if we want to write multiple pieces of data at once?

```
GpioDataRegs.GPCCLEAR.bit.GPIO66 = 1;
SpibRegs.SPITXBUF = (0x1900 | 0x0013);  // One write
SpibRegs.SPITXBUF = (0x0200 | 0x0000);  // Second write
while(SpibRegs.SPIFFRX.bit.RXFFST !=2); // Wait that both have been sent
GpioDataRegs.GPCSET.bit.GPIO66 = 1;
temp = SpibRegs.SPIRXBUF;  // Read value even though not needed
temp = SpibRegs.SPIRXBUF;  // Read second value even though not needed
DELAY_US(10);  // Delay a bit before issuing another MPU-9250 SPI transfer
```

What is the maximum number of writes at a time?

The maximum size of the TX/RX FIFO is 16!

IMU

When explicitly wanting to read the data, especially if there is a lot we want to read, accel X, Y, Z, gyro X, Y, Z, each of them having a high and low address. Is there a smart way of doing this?

Yes!

This MPU you send an address that you want to **start** reading from. If you continue to give it clock cycles it will just **continue down to the next address** and read down!

Allows us to read the 16-bit data into a single 16-bit read!

IMU

Addr (Hex)	Addr (Dec.)	Register Name	Serial I/F	Bit7	Bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
35	53	I2C_SLV4_DI	R	I2C_SLV4_DI[7:0]							
36	54	I2C_MST_STATUS	R	PASS_THROUGH	I2C_SLV4_DONE	I2C_LOST_ARB	I2C_SLV4_NACK	I2C_SLV3_NACK	I2C_SLV2_NACK	I2C_SLV1_NACK	I2C_SLV0_NACK
37	55	INT_PIN_CFG	R/W	ACTL	OPEN	LATCH_INT_EN	INT_ANYRD_2CLEAR	ACTL_FSYNC	FSYNC_INT_MODE_EN	BYPASS_EN	-
38	56	INT_ENABLE	R/W	-	WOM_EN	-	FIFO_OFLOW_EN	FSYNC_INT_EN	-	-	RAW_RDY_EN
3A	58	INT_STATUS	R	-	WOM_INT	-	FIFO_OFLOW_INT	FSYNC_INT	-	-	RAW_DATA_RDY_INT
3B	59	ACCEL_XOUT_H	R	ACCEL_XOUT_H[15:8]							
3C	60	ACCEL_XOUT_L	R	ACCEL_XOUT_L[7:0]							
3D	61	ACCEL_YOUT_H	R	ACCEL_YOUT_H[15:8]							
3E	62	ACCEL_YOUT_L	R	ACCEL_YOUT_L[7:0]							
3F	63	ACCEL_ZOUT_H	R	ACCEL_ZOUT_H[15:8]							
40	64	ACCEL_ZOUT_L	R	ACCEL_ZOUT_L[7:0]							
41	65	TEMP_OUT_H	R	TEMP_OUT_H[15:8]							
42	66	TEMP_OUT_L	R	TEMP_OUT_L[7:0]							
43	67	GYRO_XOUT_H	R	GYRO_XOUT_H[15:8]							
44	68	GYRO_XOUT_L	R	GYRO_XOUT_L[7:0]							
45	69	GYRO_YOUT_H	R	GYRO_YOUT_H[15:8]							
46	70	GYRO_YOUT_L	R	GYRO_YOUT_L[7:0]							
47	71	GYRO_ZOUT_H	R	GYRO_ZOUT_H[15:8]							
48	72	GYRO_ZOUT_L	R	GYRO_ZOUT_L[7:0]							
49	73	EXT_SENS_DATA_00	R	EXT_SENS_DATA_00[7:0]							
4A	74	EXT_SENS_DATA_01	R	EXT_SENS_DATA_01[7:0]							
4B	75	EXT_SENS_DATA_02	R	EXT_SENS_DATA_02[7:0]							
4C	76	EXT_SENS_DATA_03	R	EXT_SENS_DATA_03[7:0]							
4D	77	EXT_SENS_DATA_04	R	EXT_SENS_DATA_04[7:0]							

Start reading (sent 8-bit start address)

Continue reading 16-bits

Continue reading 16-bits

Continue reading 16-bits

IMU

```
// Code inside CPU Timer 0
GpioDataRegs.GPCCLEAR.bit.GPIO66 = 1;
SpibRegs.SPIFFRX.bit.RXFFIL = 3;
// 0x8 = 1000 = read
// 0x3C = address to read from
SpibRegs.SPITXBUF = ((0x8000) |
(0x3C00));
SpibRegs.SPITXBUF = 0; // 0x0000
continue
SpibRegs.SPITXBUF = 0; // 0x0000
continue
```

```
int16_t dummy= 0;
int16_t accelYraw = 0;
int16_t accelZraw = 0;
float accelYreading = 0;
float accelZreading = 0;
__interrupt void SPIB_isr(void){
    GpioDataRegs.GPCSET.bit.GPIO66 = 1; // Stop SPI transmit
    dummy = SpibRegs.SPIRXBUF; // reads from 0x3C Accel x low only
    accelYraw = SpibRegs.SPIRXBUF; // reads 0x3D | 0x3E = Accel y
out
    accelZraw = SpibRegs.SPIRXBUF; // reads 0x3F | 0x40 = Accel z
out
    accelYreading = accelYraw*4.0/32767.0;
    accelZreading = accelZraw*4.0/32767.0;
    SpibRegs.SPIFFRX.bit.RXFFOVFCLR=1;  // Clear Overflow flag
    SpibRegs.SPIFFRX.bit.RXFFINTCLR=1;  // Clear Interrupt flag
    PieCtrlRegs.PIEACK.all = PIEACK_GROUP6;
}
```

IMU


Addr (Hex)	Addr (Dec.)	Register Name	Serial I/F	Bit7	Bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
35	53	I2C_SLV4_DI	R	I2C_SLV4_DI[7:0]							
36	54	I2C_MST_STATUS	R	PASS_THROUGH	I2C_SLV4_DONE	I2C_LOST_ARB	I2C_SLV4_NACK	I2C_SLV3_NACK	I2C_SLV2_NACK	I2C_SLV1_NACK	I2C_SLV0_NACK
37	55	INT_PIN_CFG	R/W	ACTL	OPEN	LATCH_INT_EN	INT_ANYRD_2CLEAR	ACTL_FSYNC	FSYNC_INT_MODE_EN	BYPASS_EN	-
38	56	INT_ENABLE	R/W	-	WOM_EN	-	FIFO_OFLOW_EN	FSYNC_INT_EN	-	-	RAW_RDY_EN
3A	58	INT_STATUS	R	-	WOM_INT	-	FIFO_OFLOW_INT	FSYNC_INT	-	-	RAW_DATA_RDY_INT
3B	59	ACCEL_XOUT_H	R	ACCEL_XOUT_H[15:8]							
3C	60	ACCEL_XOUT_L	R	ACCEL_XOUT_L[7:0]							
3D	61	ACCEL_YOUT_H	R	ACCEL_YOUT_H[15:8]							
3E	62	ACCEL_YOUT_L	R	ACCEL_YOUT_L[7:0]							
3F	63	ACCEL_ZOUT_H	R	ACCEL_ZOUT_H[15:8]							
40	64	ACCEL_ZOUT_L	R	ACCEL_ZOUT_L[7:0]							
41	65	TEMP_OUT_H	R	TEMP_OUT_H[15:8]							
42	66	TEMP_OUT_L	R	TEMP_OUT_L[7:0]							
43	67	GYRO_XOUT_H	R	GYRO_XOUT_H[15:8]							
44	68	GYRO_XOUT_L	R	GYRO_XOUT_L[7:0]							
45	69	GYRO_YOUT_H	R	GYRO_YOUT_H[15:8]							
46	70	GYRO_YOUT_L	R	GYRO_YOUT_L[7:0]							
47	71	GYRO_ZOUT_H	R	GYRO_ZOUT_H[15:8]							
48	72	GYRO_ZOUT_L	R	GYRO_ZOUT_L[7:0]							
49	73	EXT_SENS_DATA_00	R	EXT_SENS_DATA_00[7:0]							
4A	74	EXT_SENS_DATA_01	R	EXT_SENS_DATA_01[7:0]							
4B	75	EXT_SENS_DATA_02	R	EXT_SENS_DATA_02[7:0]							
4C	76	EXT_SENS_DATA_03	R	EXT_SENS_DATA_03[7:0]							
4D	77	EXT_SENS_DATA_04	R	EXT_SENS_DATA_04[7:0]							

```
SpibRegs.SPITXBUF = ((0x8000) |
(0x3C00));
SpibRegs.SPITXBUF = 0; // 0x0000
continue
SpibRegs.SPITXBUF = 0; // 0x0000
continue
```

SPI


Polarity	Phase
0	0
0	1
1	0
1	1

Figure 18-7. SPICLK Signal Options

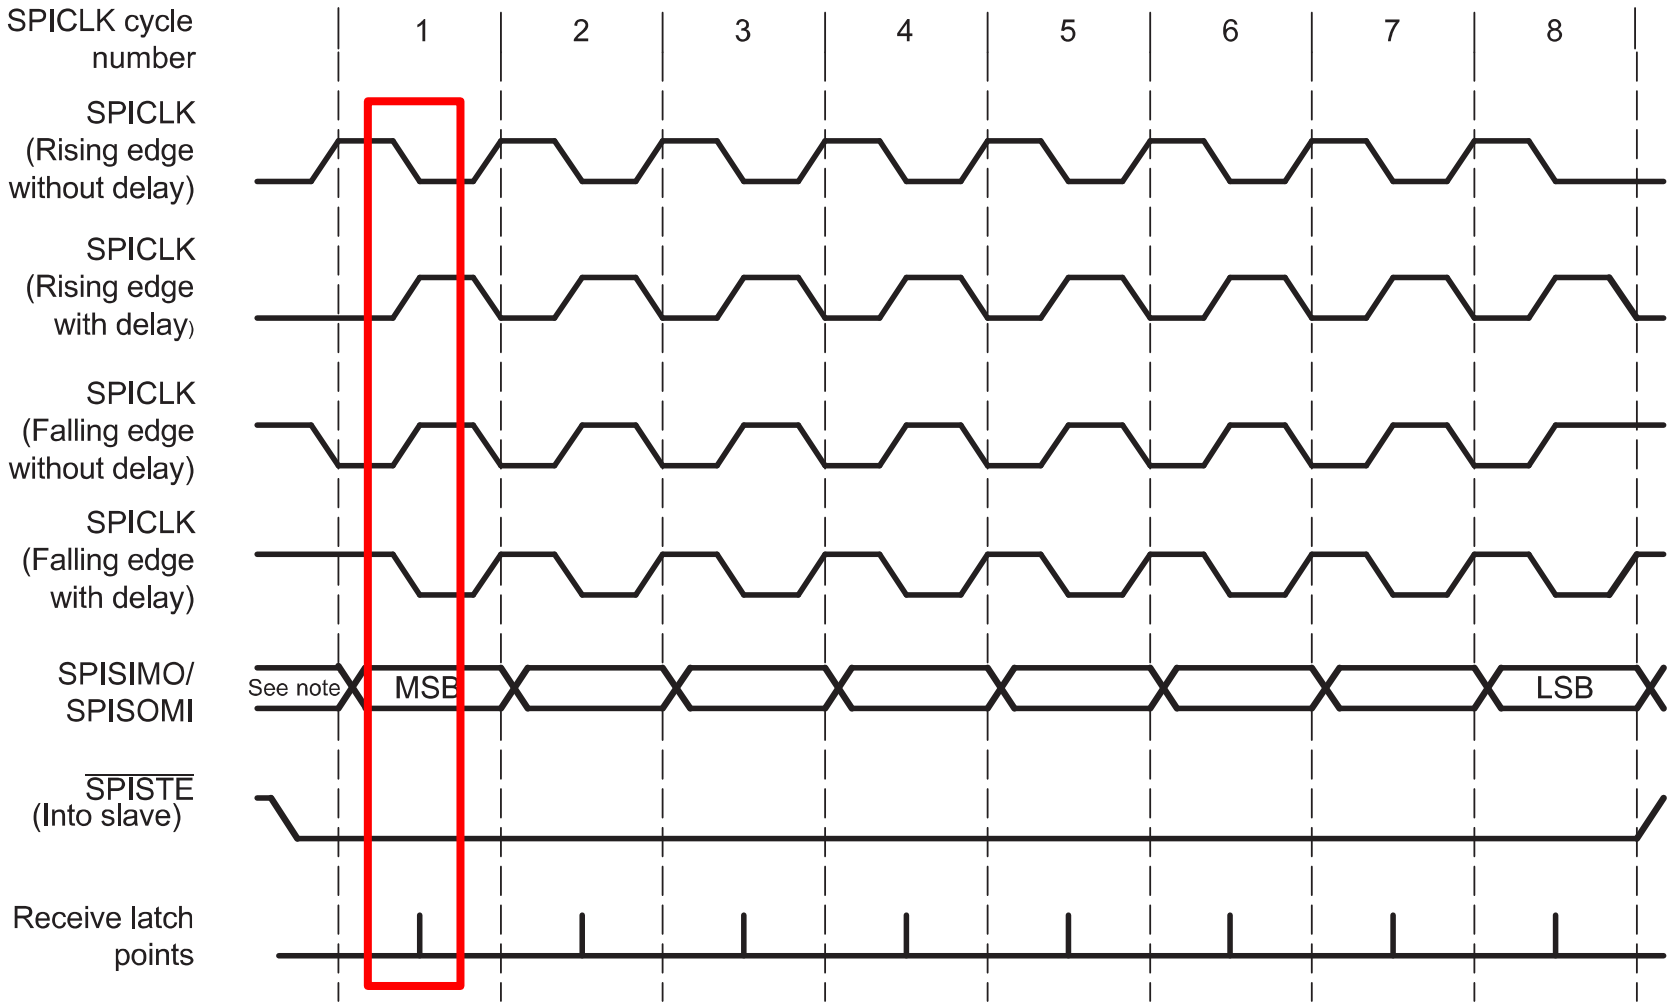


Note: Previous data bit


IMU

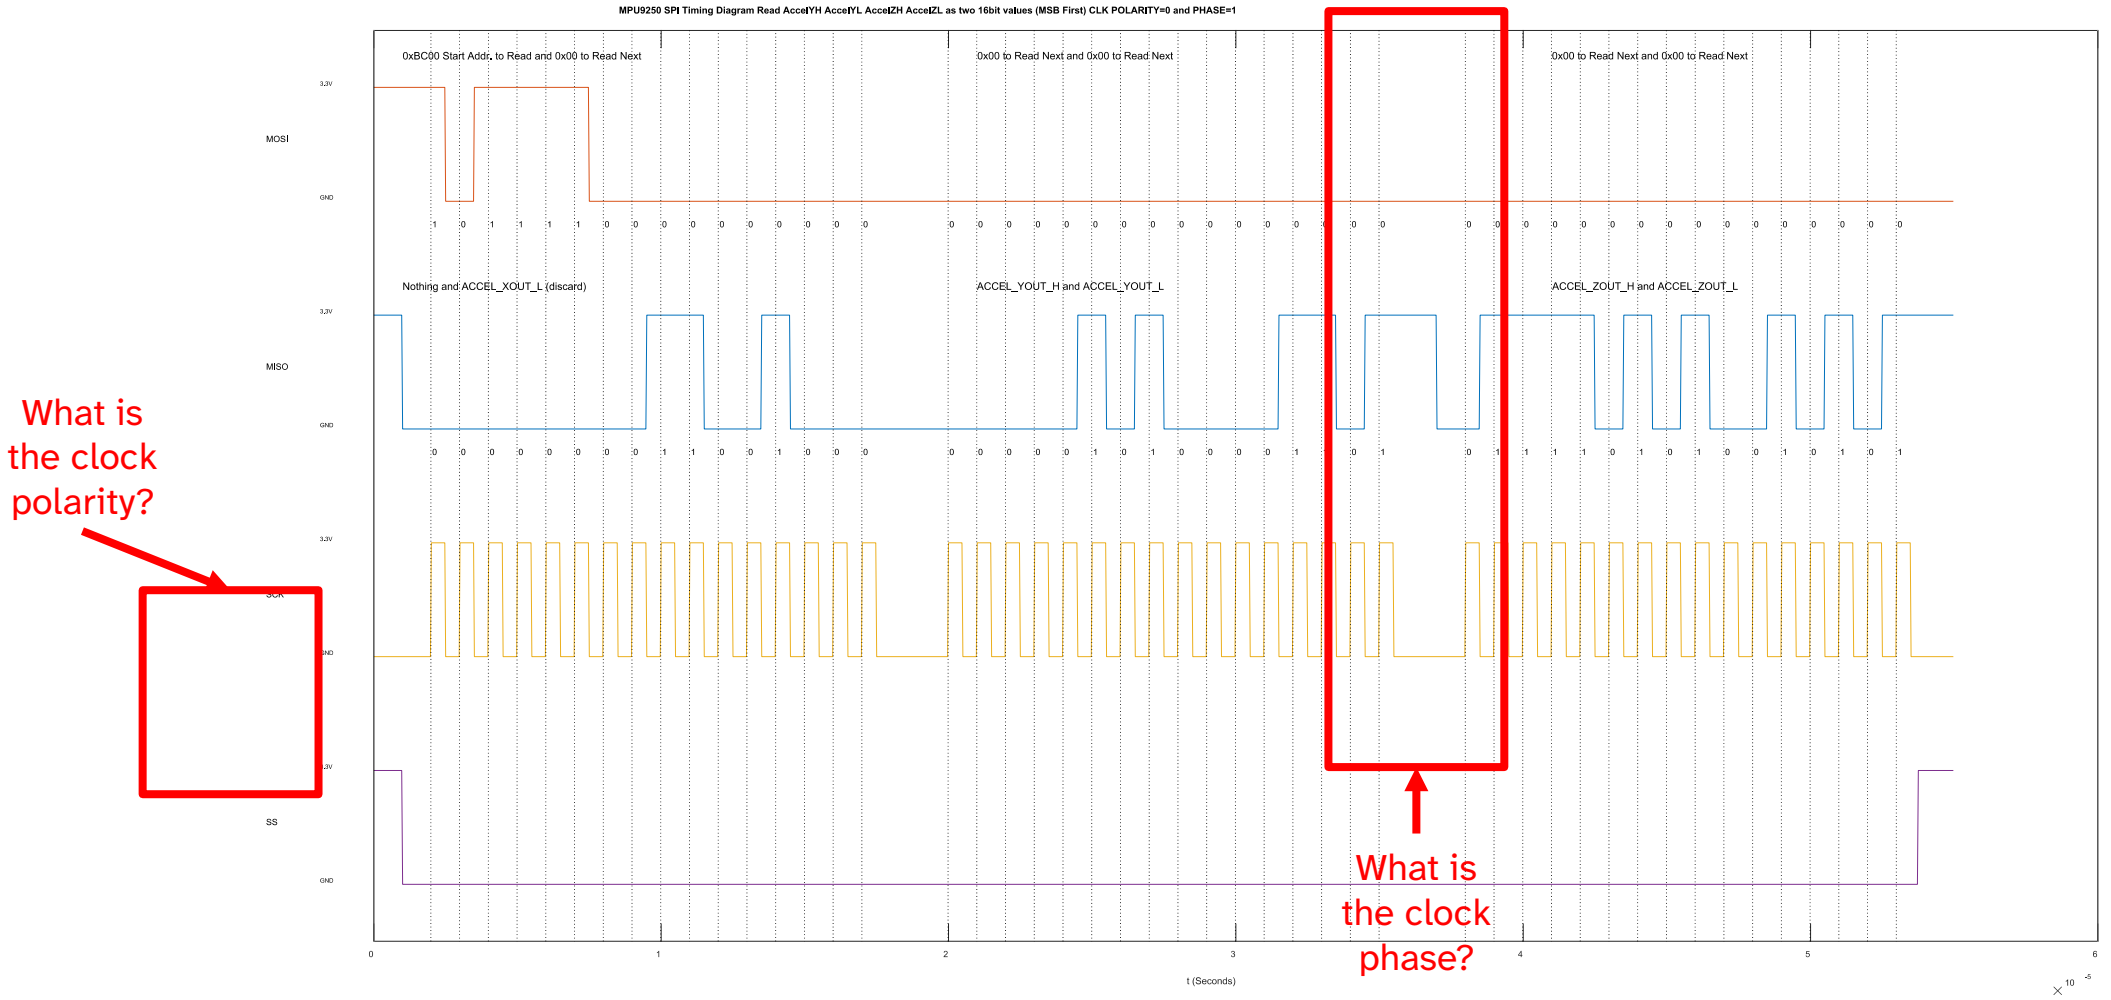
MPU9250 SPI Timing Diagram Read AccelYH AccelYL AccelZH AccelZL as two 16bit values (MSB First) CLK POLARITY=0 and PHASE=1
0xBC00 Start Addr. to Read and 0x00 to Read Next
0x00 to Read Next and 0x00 to Read Next
0x00 to Read Next and 0x00 to Read Next
MOSI
3.3V
GND
Nothing and ACCEL_XOUT_L (discard)
ACCEL_YOUT_H and ACCEL_YOUT_L
ACCEL_ZOUT_H and ACCEL_ZOUT_L
MISO
3.3V
GND
3.3V
SCK
GND
3.3V
SS
GND
What is the clock polarity?
What is the clock phase?
0
1
2
3
4
5
6
t (Seconds)
-5
10

Questions?

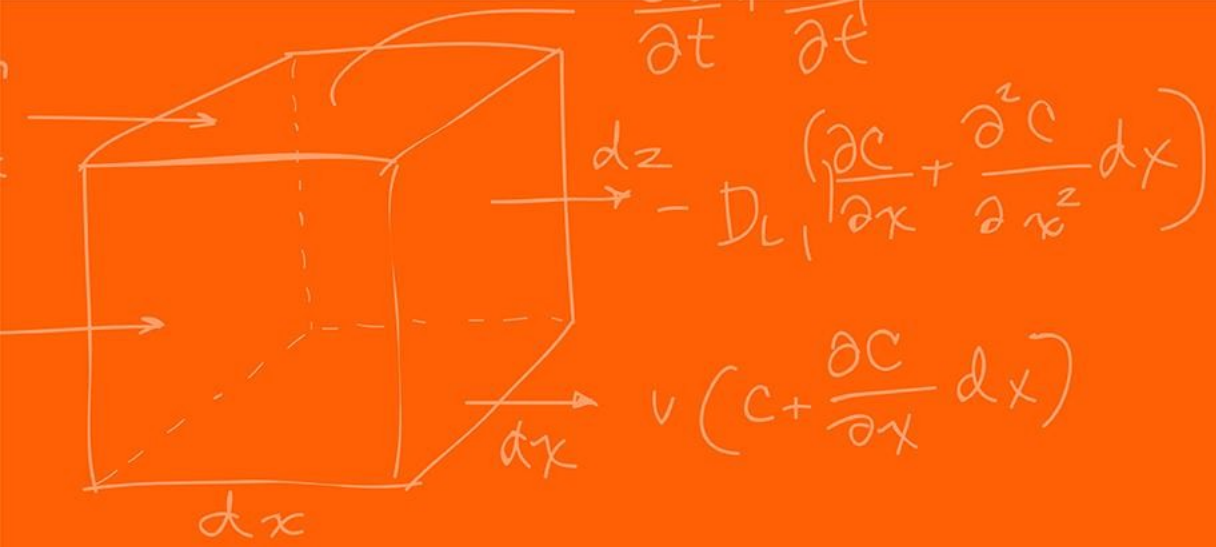



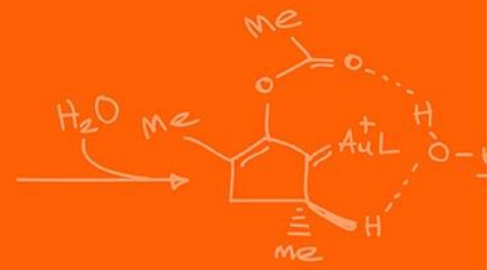



The Grainger College of Engineering

UNIVERSITY OF ILLINOIS URBANA-CHAMPAIGN

