



Test Report

Test Started: 2022-02-15 08:59:56

Test Run Time: 9.91s **Test Status:** Fail

Test Profile: C-C / SS Gen 1 / 3A handpiece

Dental Wings handpiece USB C-C cable test

Error Summary

Cont Orientation Sanity Sig Int Missing SI Result

E-Marker

"D" Port "U" Port

SOP' Data	
SOP' Controller Not Found	

SOP' Data
SOP' Controller Not Found

Continuity

Connector Orientation			
Port	Connector Type	Orientation	
"U" Port	USB 3.1 Type-C	Normal	
"D" Port	USB 3.1 Type-C	Normal	

V _{BUS} Voltage Reference			
	Voltage	Valid Range	
•	4.76 V	4.75 - 5.10 V	

Power Shorts		
	Wires	Shorts
•	V _{BUS} to GND	None
•	CC to GND	None
•	CC to V _{BUS}	None

Physical Wiring		
"D" Port Pin	"U" Port Pin	
DM1	No Connection	
DP1	No Connection	
DM2	No Connection	
DP2	No Connection	
SBU1	No Connection	

Functional Signals		
Wire	Present	
CC	Present	
V_{CONN}	Absent	
V _{CONN} Thru	Absent	
SBU	Absent	
DP/DM1	Absent	

10.2.15.33/result/36

	"D" Port Pin	"U" Port Pin
	SBU2	No Connection
•	TX1	RX1
•	RX1	TX1

	Wire	Present
	DP/DM2	Absent
	SOP'	Absent
	SOP"	Absent
•	TX1	Present
•	RX1	Present
	TX2	Absent
	RX2	Absent

DC Resistance


Powe	er Wires		
	Wire	Measured Value	Maximum
•	GND	59.61 mΩ	83.00 mΩ
~	V_{BUS}	98.81 mΩ	167.00 mΩ


GND	Pins		
	Pin	Measured Value	Maximum
•	U-A1	8.24 mΩ	40.00 mΩ
•	U-A12	7.08 mΩ	40.00 mΩ
•	U-B1	6.02 mΩ	40.00 mΩ
•	U-B12	4.43 mΩ	40.00 mΩ
•	D-A1	5.91 mΩ	40.00 mΩ
•	D-A12	6.52 mΩ	40.00 mΩ
•	D-B1	5.49 mΩ	40.00 mΩ
•	D-B12	4.55 mΩ	40.00 mΩ

V _{BUS}	V _{BUS} Pins		
	Pin	Measured Value	Maximum
•	U-A9	10.45 mΩ	40.00 mΩ
~	U-B4	6.21 mΩ	40.00 mΩ
~	U-B9	4.65 mΩ	40.00 mΩ
~	U-A4	6.30 mΩ	40.00 mΩ
~	D-A9	6.66 mΩ	40.00 mΩ
~	D-B4	9.36 mΩ	40.00 mΩ
~	D-B9	6.45 mΩ	40.00 mΩ
•	D-A4	5.06 mΩ	40.00 mΩ

Signal Integrity

10.2.15.33/result/36 2/3

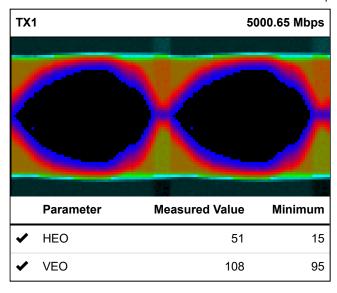

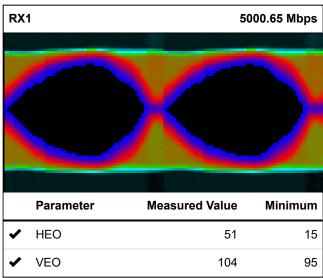

Equipment

Device Information		
Name	Value	
Promira Serial Platform Serial Number	2416-629406	
Advanced Cable Tester Serial Number	2468-197299	
Hardware Version	0.93	
Firmware Version	1.13	
Web Version	1.13	

Connector Test & Insertion Counts		
Port	Connector	Counts
Upstream	USB 3.1 Type-C	246
Downstream	USB 3.1 Type-C	215
Upstream Adapter	None	
Downstream Adapter	None	

Copyright © 2017 Total Phase, Inc. (https://www.totalphase.com/) All rights reserved.

10.2.15.33/result/36