



## **Test Report**

Test Started: 2022-02-15 08:58:14

**Test Run Time:** 9.88s **Test Status:** Fail

Test Profile: C-C / SS Gen 1 / 3A handpiece

Dental Wings handpiece USB C-C cable test

## **Error Summary**

Cont Orientation Sanity

Sig Int

Missing SI Result

#### E-Marker

"D" Port

SOP' Data
SOP' Controller Not Found

"U" Port

SOP' Data
SOP' Controller Not Found

## Continuity

Connector Orientation			
Port	Connector Type	Orientation	
"U" Port	USB 3.1 Type-C	Normal	
"D" Port	USB 3.1 Type-C	Normal	

V <sub>BUS</sub> Voltage Reference			
	Voltage	Valid Range	
•	4.75 V	4.75 - 5.10 V	

Power Shorts		
	Wires	Shorts
•	V <sub>BUS</sub> to GND	None
•	CC to GND	None
•	CC to V <sub>BUS</sub>	None

Physical Wiring		
"D" Port Pin	"U" Port Pin	
DM1	No Connection	
DP1	No Connection	
DM2	No Connection	
DP2	No Connection	
SBU1	No Connection	

Functional Signals		
Wire	Present	
CC	Present	
$V_{CONN}$	Absent	
V <sub>CONN</sub> Thru	Absent	
SBU	Absent	
DP/DM1	Absent	

10.2.15.33/result/34

	"D" Port Pin	"U" Port Pin
	SBU2	No Connection
•	TX1	RX1
-	RX1	TX1

Wire	Present
DP/DM2	Absent
SOP'	Absent
SOP"	Absent
✓ TX1	Present
✓ RX1	Present
TX2	Absent
RX2	Absent

#### **DC Resistance**


Power Wires			
	Wire	Measured Value	Maximum
•	GND	61.29 mΩ	83.00 mΩ
~	$V_{BUS}$	98.99 mΩ	167.00 mΩ


GND	GND Pins		
	Pin	Measured Value	Maximum
•	U-A1	8.41 mΩ	40.00 mΩ
•	U-A12	7.06 mΩ	40.00 mΩ
•	U-B1	5.95 mΩ	40.00 mΩ
•	U-B12	4.32 mΩ	40.00 mΩ
•	D-A1	5.87 mΩ	40.00 mΩ
•	D-A12	6.25 mΩ	40.00 mΩ
•	D-B1	5.35 mΩ	40.00 mΩ
•	D-B12	4.64 mΩ	40.00 mΩ

V <sub>BUS</sub> Pins			
	Pin	Measured Value	Maximum
•	U-A9	10.62 mΩ	40.00 mΩ
•	U-B4	5.85 mΩ	40.00 mΩ
•	U-B9	4.99 mΩ	40.00 mΩ
•	U-A4	7.16 mΩ	40.00 mΩ
•	D-A9	6.92 mΩ	40.00 mΩ
•	D-B4	9.38 mΩ	40.00 mΩ
•	D-B9	6.96 mΩ	40.00 mΩ
•	D-A4	5.18 mΩ	40.00 mΩ

# Signal Integrity

10.2.15.33/result/34 2/3

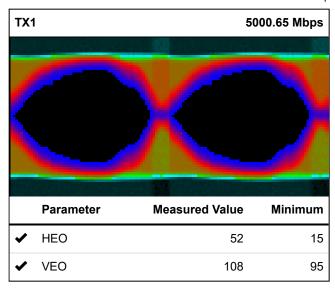

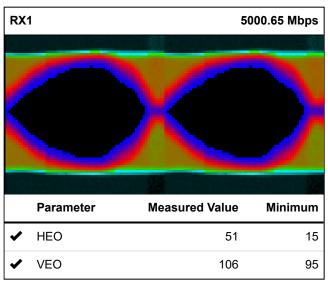

## **Equipment**

Device Information		
Name	Value	
Promira Serial Platform Serial Number	2416-629406	
Advanced Cable Tester Serial Number	2468-197299	
Hardware Version	0.93	
Firmware Version	1.13	
Web Version	1.13	

Connector Test & Insertion Counts			
Port Connector Counts			
Upstream	USB 3.1 Type-C	244	
Downstream	USB 3.1 Type-C	213	
Upstream Adapter	None		
Downstream Adapter	None		

Copyright © 2017 Total Phase, Inc. (https://www.totalphase.com/) All rights reserved.

10.2.15.33/result/34 3/3