SFM2200-010-00002DY

Schematic for Motor Installation

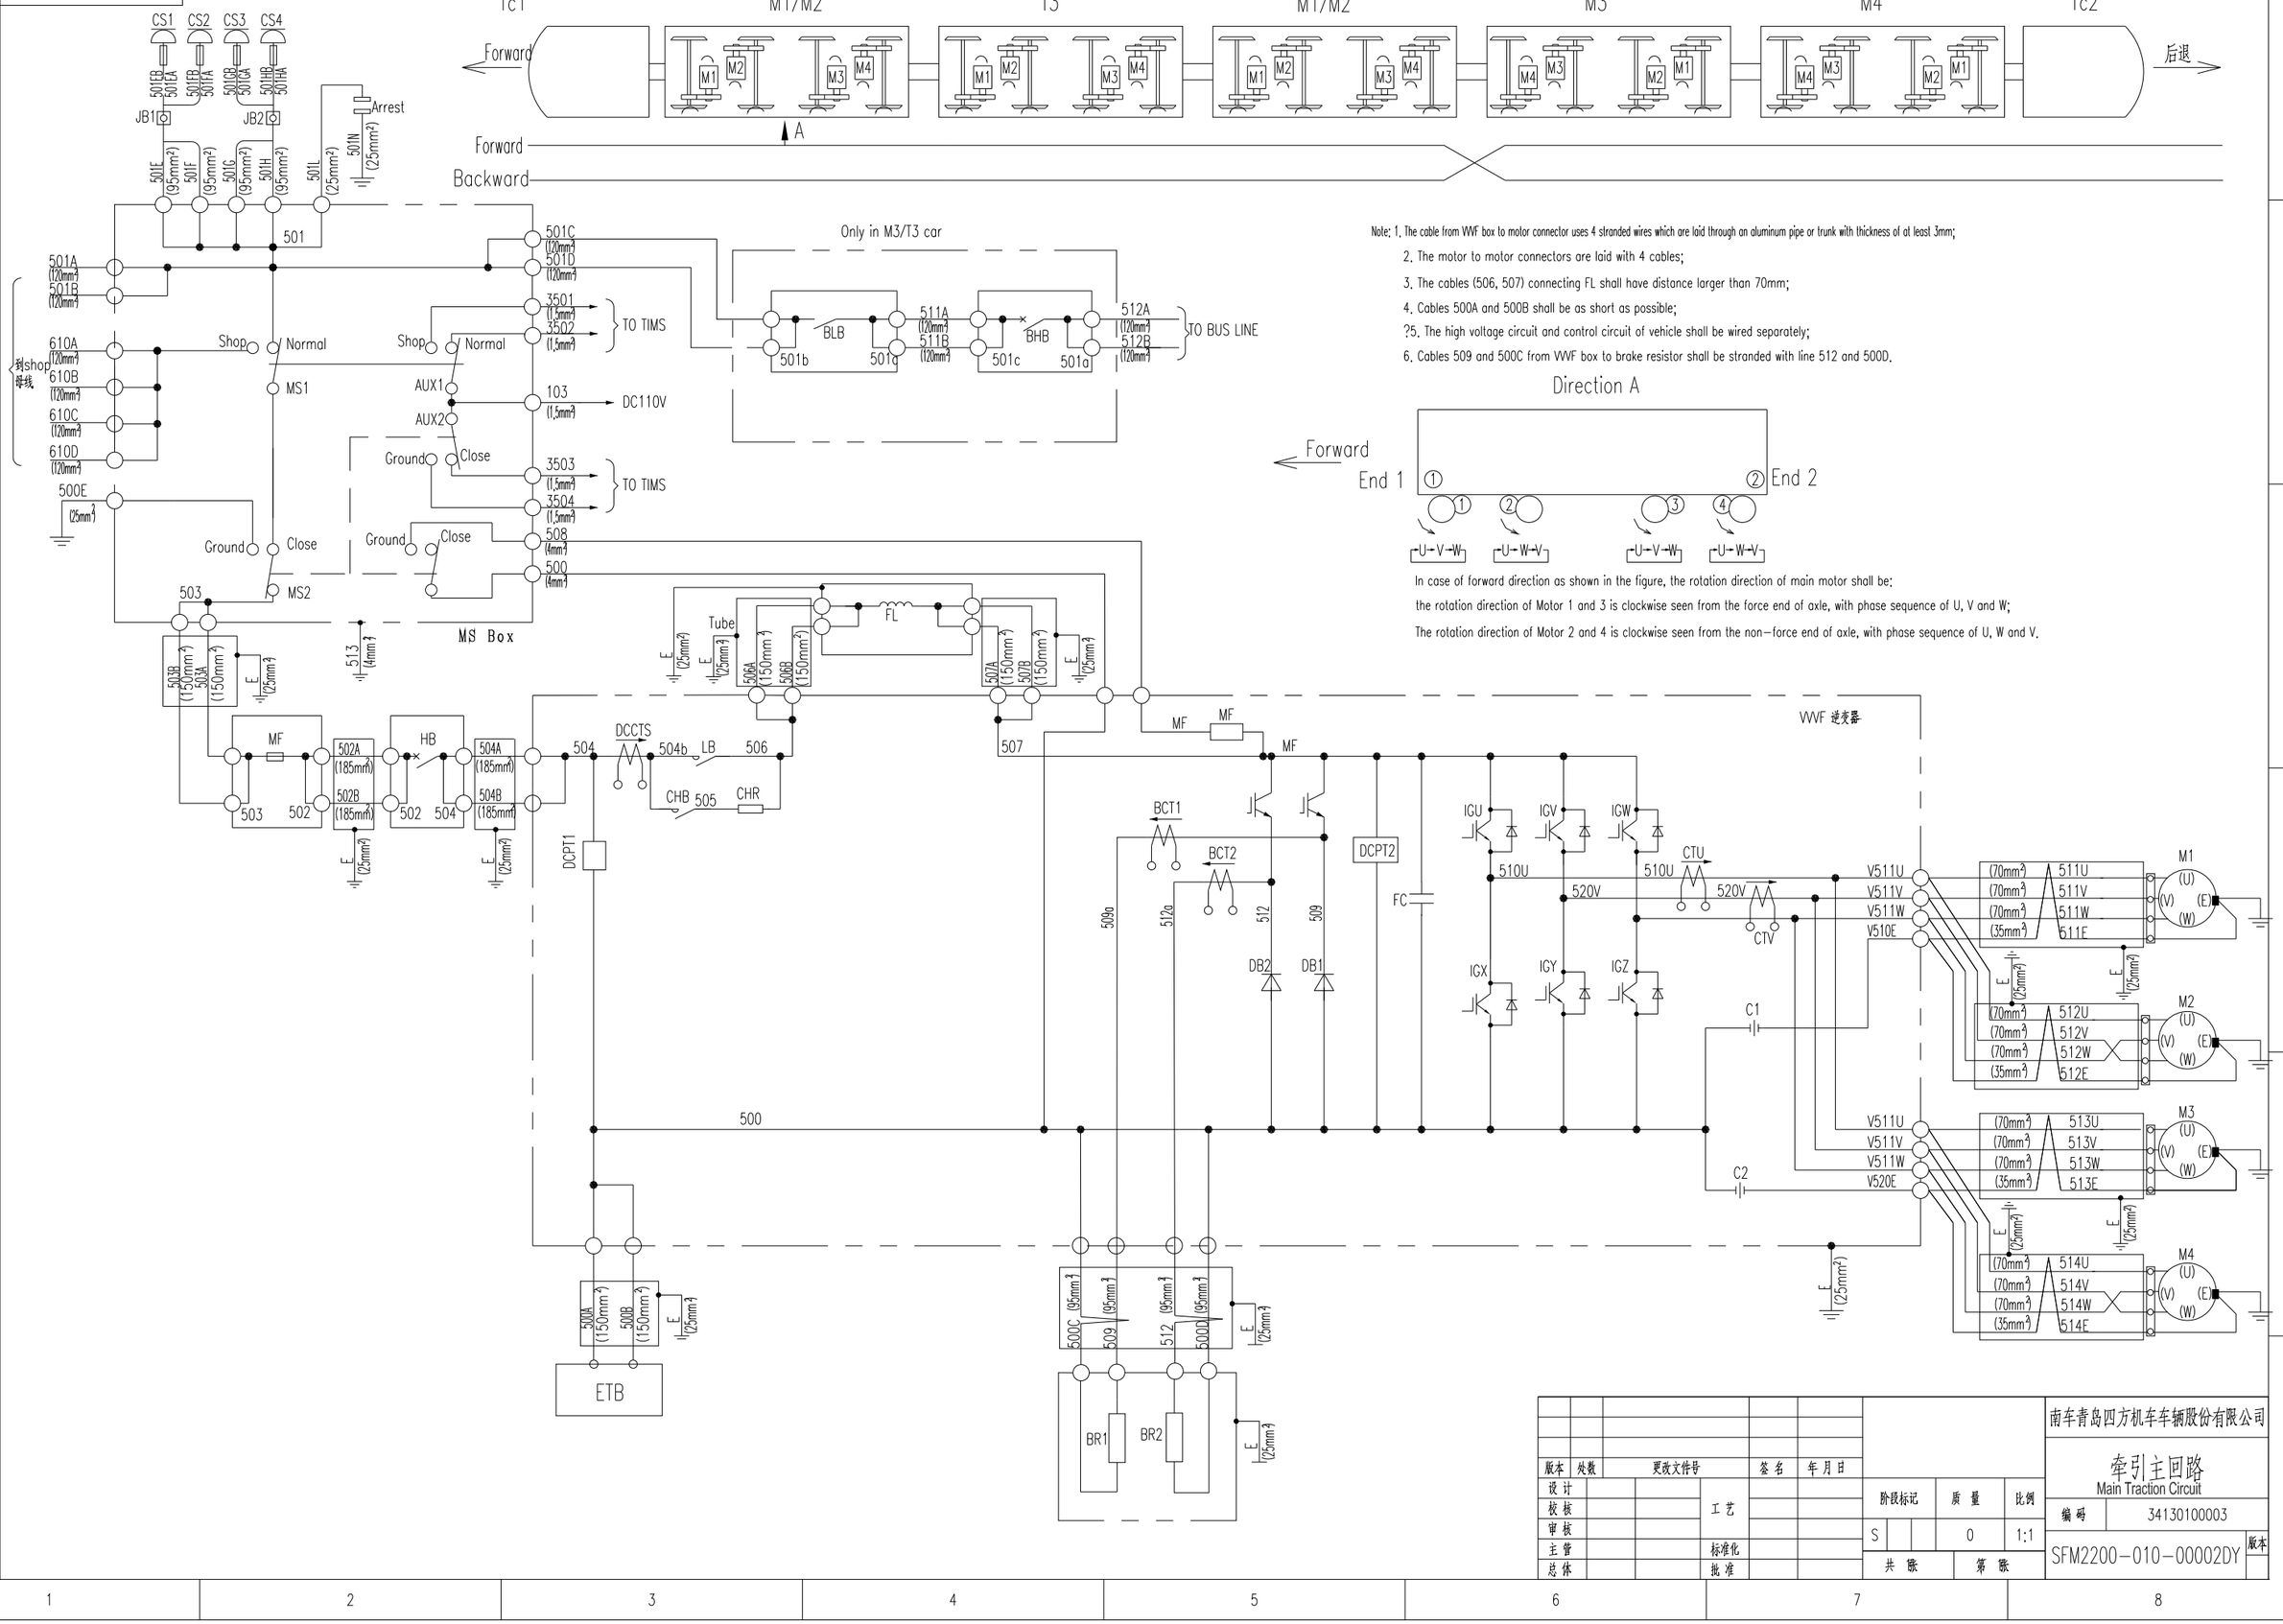

Note: 1. The cable from VWF box to motor connector uses 4 stranded wires which are laid through an aluminum pipe or trunk with thickness of at least 3mm;

2. The motor to motor connectors are laid with 4 cables;

3. The cables (506, 507) connecting FL shall have distance larger than 70mm;

4. Cables 500A and 500B shall be as short as possible;

?5. The high voltage circuit and control circuit of vehicle shall be wired separately;

6. Cables 509 and 500C from VWF box to brake resistor shall be stranded with line 512 and 500D.

Direction A

In case of forward direction as shown in the figure, the rotation direction of main motor shall be:

the rotation direction of Motor 1 and 3 is clockwise seen from the force end of axle, with phase sequence of U, V and W;

The rotation direction of Motor 2 and 4 is clockwise seen from the non-force end of axle, with phase sequence of U, W and V.

版本	处数	更改文件号		签名	年月日
设计			工艺		
校核					
审核					
主管			标准化		
总体			批准		

阶段标记	质量	比例
S	0	1:1
共 张	第 张	

南车青岛四方机车车辆股份有限公司

牵引主回路
Main Traction Circuit

编码	34130100003
SFM2200-010-00002DY	版本