2213/2215 REPLACEABLE CABINET FOOT (cont.)

The new part can be installed by placing a hex driver or similar tool into the hole in the foot and pushing the foot into the cabinet. Be sure to support the cabinet so it will not be bent.

 W^2 Issue 13-2

2215 ALTERNATE SWEEP BOARD SHIELD REMOVED

RE: FIG 2 - 15 S/N B027295

The A13 Alternate Sweep board shield has been removed from all 2215 scopes above the listed serial number. It has been determined that it was not needed for either electrical or mechanical reasons.

Use of the shield in units below this serial number is optional.


 W^2 Issue 13-1


4006/4010/402X/405X CHERRY KEYSWITCH REPLACEMENT

The late style cherry keyswitch, with the expanding mounting tabs, is difficult to remove from the keyboard without first cutting the mounting tabs off.

Older keyswitches have bumps, rather than locking expanding tabs; therefore, do not require cutting.

It has been found that the X-acto blade #11, 002-1040-00, with the long straight edge, works quite well in cutting the cherry keyswitch tabs. Insert blade in keyboard as pictured and cut off tab.

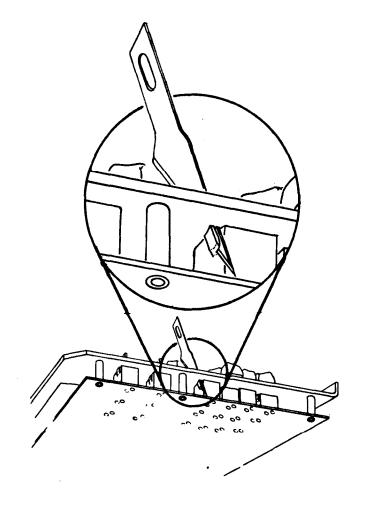

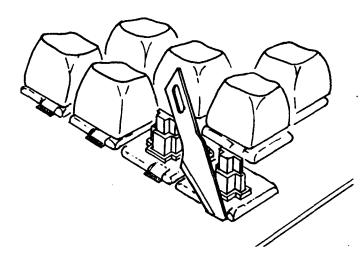

w² Issue 12-25