PTC - Avenida D. Manuel I
Zona Industrial de Ovar
3880-109 OVAR

YAZAKI
PORTO TECHNICAL CENTRE

# APPLICATOR VALIDATION REPORT

**(Spec. YEL-RP-02-0004)**

| Applicator Serial Nº |
|---|
| 2405E024 |

***TOOLS MANAGEMENT INFORMATION ---> TOOL Nº 7116-1282 * SEQUENCE Nº*** 9

| Validation Terminal Nº | Accessory | Applicator Type | Purchasing Order Nº | Project / Model |
|---|---|---|---|---|
| **7116-1282** | ***** | **MXSR** | **YSD-4514155672** | **MEL TRUCK BEV** |

**Applicable Terminals for this Tool:**

| 7116-1282 | | | | |
|---|---|---|---|---|

| Anvil | | | Wire Crimper | | | Insulation Crimper | | |
|---|---|---|---|---|---|---|---|---|
| 7116-1282XA | | (N) | 7116-1282XWW | | (1) | 7116-1282XIW | | (3) |
| *CW (c)* | 2,29 | *CW (i)* 2,59 | *CW* | 2,29 | | *CW* | 2,59 | |

## 1 - VISUAL / MEASURED CHECK ITEMS


| | | | Spec. (*) | Value (**) | | | |
|---|---|---|---|---|---|---|---|
| | The two sides of the insulation grips are in the correct position. | O | 0~0.40mm<br>0.15~0.65mm | -<br>0.39 | | The Bell Mouth is within the spec.**(*)** | O |
| | Not found any Bell Mouth in the insulation area. | O | 0~0.30mm | 0.12 | | The dimension of the cutting carrier is within the spec.**(*)** | O |
| | The lance height and shape are not deformed. | O | 3º<br>3º | -<br>0.3 | | Bend up and Bend down are within the criteria**(*)** | O |
| | Not found any burr in the cutting carrier. | O | 0~1.50mm | 0.69 | | The exposed conductor is within the spec.(*) | O |
| | Not found any crack in the terminal. | O | 5º | 0.6 | | The terminal is not bent sideway, look-king from the top**(*)** | O |
| | The wire barrel is free from major burrs. | O | 3º | 0.4 | | The body of the terminal is not twisted**(*)** | O |

**O** - ok **X** - ng **NA** - not aplicable

**(*)** - Specified on Crimping Spec. **(**)** - Measured Value(From Lower Wire Kind&Size Sample)

| **LOWER** WIRE KIND & SIZE | **UPPER** WIRE KIND & SIZE |
|---|---|

## 2 - MICRO CUT SAMPLES

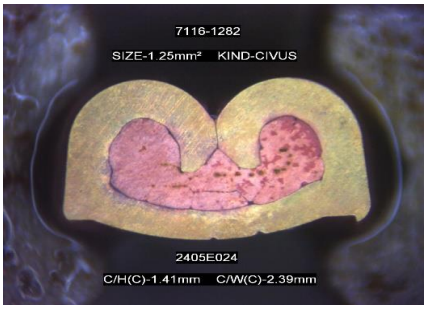


## 3 - CRIMPING HEIGHT STABILITY

| | NOMINAL | AVERAGE | Cmk | | NOMINAL | AVERAGE | Cmk |
|---|---|---|---|---|---|---|---|
| mm | 1,4 | 1,41 | 2,77 | mm | NA | | |
| | **+/-0.05** | | | | **+/-NA** | | |

**REMARKS:**

Aplicable wire range 0.50mm~1.25mm².
The wire size 0.50mm²/0.75mm is not recommended due to crimping microcut conditions.
Section 0.85mm² is not prepared due the miss wire samples.

**EVALUATION DECISION**

SUITABLE [X] FOR USE IN PRODUCTION
NOT SUITABLE [ ]

| APPROVED (Section Chief) 3485 | CHECKED (Operator) 44 | PREPARED (Operator) nº 5061 |
|---|---|---|
| Date: 2025/fev/12 | Date: 2025/jan/28 | Date: 2025/jan/27 |

YAZAKI
PORTO TECHNICAL CENTRE

# APPLICATOR VALIDATION REPORT

| Applicator Serial Nº |
|---|
| 2405E024 |

## LOWER WIRE KIND & SIZE

| | | | |
|---|---|---|---|
| Wire kind: | CIVUS | | |
| Wire size: | 1,25 | | $mm^2$ |
| Nominal Cr. Height: | 1,4 | 3,8 | mm |
| +/- | 0,05 | 0,1 | mm |

| Sample number | Crimp height WIRE (mm) | Crimp height INSULATION (mm) |
|---|---|---|
| 1 | 1,406 | 3,807 |
| 2 | 1,402 | 3,801 |
| 3 | 1,410 | 3,806 |
| 4 | 1,405 | 3,821 |
| 5 | 1,407 | 3,817 |
| 6 | 1,414 | 3,801 |
| 7 | 1,400 | 3,816 |
| 8 | 1,407 | 3,804 |
| 9 | 1,404 | 3,817 |
| 10 | 1,406 | 3,804 |
| 11 | 1,408 | 3,799 |
| 12 | 1,416 | 3,819 |
| 13 | 1,415 | 3,816 |
| 14 | 1,407 | 3,811 |
| 15 | 1,406 | 3,820 |
| 16 | 1,404 | 3,809 |
| 17 | 1,412 | 3,799 |
| 18 | 1,409 | 3,816 |
| 19 | 1,412 | 3,820 |
| 20 | 1,415 | 3,811 |
| 21 | 1,416 | 3,807 |
| 22 | 1,410 | 3,807 |
| 23 | 1,408 | 3,822 |
| 24 | 1,406 | 3,810 |
| 25 | 1,405 | 3,807 |
| 26 | 1,407 | 3,808 |
| 27 | 1,410 | 3,798 |
| 28 | 1,402 | 3,814 |
| 29 | 1,403 | 3,799 |
| 30 | 1,413 | 3,810 |
| 31 | 1,417 | 3,807 |
| 32 | 1,412 | 3,808 |
| 33 | 1,416 | 3,798 |
| 34 | 1,407 | 3,802 |
| 35 | 1,411 | 3,799 |
| 36 | 1,406 | 3,803 |
| 37 | 1,412 | 3,811 |
| 38 | 1,406 | 3,806 |
| 39 | 1,402 | 3,815 |
| 40 | 1,400 | 3,822 |
| 41 | 1,413 | 3,820 |
| 42 | 1,401 | 3,820 |
| 43 | 1,400 | 3,802 |
| 44 | 1,417 | 3,813 |
| 45 | 1,412 | 3,818 |
| 46 | 1,407 | 3,818 |
| 47 | 1,407 | 3,811 |
| 48 | 1,416 | 3,799 |
| 49 | 1,413 | 3,815 |
| 50 | 1,415 | 3,813 |
| Average | 1,41 | 3,81 |
| Cmk | 2,77 | 4,04 |

## UPPER WIRE KIND & SIZE

| | | | | |
|---|---|---|---|---|
| Wire kind: | NA | + | NA | |
| Wire size: | NA | + | NA | $mm^2$ |
| Nominal Cr. Height: | NA | | NA | mm |
| +/- | NA | | NA | mm |

| Sample number | Crimp height WIRE (mm) | Crimp height INSULATION (mm) |
|---|---|---|
| 1 | | |
| 2 | | |
| 3 | | |
| 4 | | |
| 5 | | |
| 6 | | |
| 7 | | |
| 8 | | |
| 9 | | |
| 10 | | |
| 11 | | |
| 12 | | |
| 13 | | |
| 14 | | |
| 15 | | |
| 16 | | |
| 17 | | |
| 18 | | |
| 19 | | |
| 20 | | |
| 21 | | |
| 22 | | |
| 23 | | |
| 24 | | |
| 25 | | |
| 26 | | |
| 27 | | |
| 28 | | |
| 29 | | |
| 30 | | |
| 31 | | |
| 32 | | |
| 33 | | |
| 34 | | |
| 35 | | |
| 36 | | |
| 37 | | |
| 38 | | |
| 39 | | |
| 40 | | |
| 41 | | |
| 42 | | |
| 43 | | |
| 44 | | |
| 45 | | |
| 46 | | |
| 47 | | |
| 48 | | |
| 49 | | |
| 50 | | |
| Average | | |
| Cmk | | |

**Acceptance criteria: Cmk>= 2,0**


**END**

# 04 APPLICATOR CONSUMABLE PARTS LIST ／ 04 アプリケーター 消耗部品表

| PRODUCT No. 製品番号 | C0100-0363 | TERMINAL No. 端子品番 | 7116-1282 |
|---|---|---|---|

| Common PN 共通品番 | 7116-1289 | – | – | – |
|---|---|---|---|---|
| | – | – | | |

Rev.1

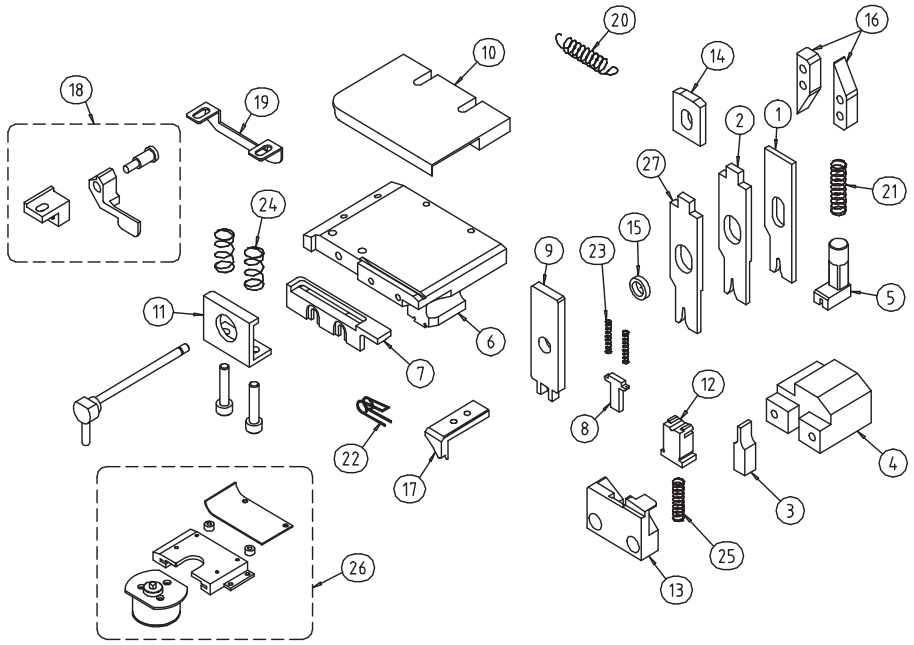


| No, | PARTS No, 部品番号 | DRW No, 図番 | PARTS NAME 部品名称 | No, | PARTS No, 部品番号 | DRW No, 図番 | PARTS NAME 部品名称 |
|---|---|---|---|---|---|---|---|
| 1 | 7116-1282XWW ⑤ | | WIRE CRIMPER ワイヤークリンパー | 17 | 48A47013 | 001 | FEEDING CLAW 送り爪 |
| 2 | 7116-1282XIW ④ | | INSULATION CRIMPER インシュレーションクリンパー | 18 | 48A19100 | 005 | WIRE STOPPER Assy 電線ストッパー アッシー |
| 3 | 7116-1282XA | | ANVIL アンビル | 19 | 48A19047 | 002 | TERMINAL SCRAPER 端子掻き落とし |
| 4 | 7116-1282XJE | | ANVIL HOLDER アンビルホルダー | 20 | 48A47031 | | RETURN SPRING 戻しスプリング |
| 5 | 7116-1282XYY | | SUPPORTING STOPPER サポーティングストッパー | 21 | 48A47032 | 001 | SUPPORTING STOPPER SPRING サポーティングストッパースプリング |
| 6 | 7116-1282XYB | | BASE ベース | 22 | 48A19017 | 003 | FEEDING CLAW SPRING 送り爪スプリング |
| 7 | 7116-1282XYH | | TERMINAL GUIDE PLATE B ターミナルガイドプレートB | 23 | 48A19023 | 002 | WIRE HOLDER SPRING 電線押さえスプリング |
| 8 | 48A47016 | 003 | WIRE HOLDER 電線押さえ | 24 | 48A19074 | | TERMINAL HOLDER SPRING ターミナル押さえスプリング |
| 9 | 48A47017 | 004 ② | CUTTING PUNCH & WIRE HOLDER 切断ポンチ兼電線押さえホルダー | 25 | 48A19050 | | SHEARBLADE SPRING シャープレードスプリング |
| 10 | 48A47020 | A05 | TERMINAL GUIDE PLATE A ターミナルガイドプレートA | 26 | 48A19999 | | TERMINAL OIL UNIT ターミナル塗油ユニット |
| 11 | 48A47022 | 001 | TERMINAL HOLDER ターミナル押さえ | | 7116-1281XKP | | BRACKET ブラケット |
| 12 | 48A47024 | 001 | SHEARBLADE シャープレード | 27 | | | ~~STABILIZER CRIMPER スタビライザークリンパー~~ |
| 13 | 48A47025 | 001 | OUTER SHEARBLADE アウターシャープレード | 〈OPTION オプション〉 | | | |
| 14 | 48A19007 | 012 | INSULATION ADJUSTING PIECE インシュレーション調整コマ | 13 | 48A47025 | 101 | OUTER SHEARBLADE アウターシャープレード |
| 15 | 48A19019 | 017 ③ | BUSH ブッシュ | 14 | 48A47042 | -002 | INSULATION ADJUSTING PIECE(MECAL) インシュレーション調整コマ(メカル) |
| 16 | 48A47014 | 005 ① | FEEDING CAM 送りカム | | | | |

| MARK 記号 | DATE 日付 | REVISION RECORD 改訂記録 | No. 番号 | CHECKED 点検 | APPROVED 承認 | DESIGNED 設計 |
|---|---|---|---|---|---|---|
| ⑤ | 2024/5/14 | XW→XWW | C24E036 | S.KAWAMORI | | |
| ④ | 2011/12/15 | XI→XIW | 11L-061 | Y.NOZAWA | | |
| ③ | 2010/6/2 | 019→017 | 10E-044 | Y.YAGI | | |
| ② | 2008/1/16 | 003→004 | QX7 | T,Suzuki | | |
| ① | 2007/8/23 | 001→005 | QX7 | T,Suzuki | K,Hiraguchi | T,Suzuki |
| | | | | | 2007/7/18 | 2007/7/18 |

APPRICATION POST 申請部署: HIB

DESIGNED DATE 設計日: 2007/7/18

REVISED

ISSUED 発行

ISSUE
2024/06/05
YAZAKI PARTS CO.LTD HAIBARA OFFICE