




SERVICE BULLETIN

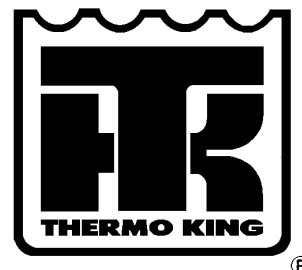

SUBJECT: Flashing MP-3000 Software in AFAM+ Units

BULLETIN NO: C 056


DATE: October 17, 2002

A set of new procedures has been established when Flashloading a new version of software into an MP3000 type controller with the AFAM+ option installed.

Upon completion of the Flashload, the controller will initiate an 'Auto Configuration' for the unit. This feature will detect which components the unit has or does not have to set the right component configuration for that particular unit.

Because the communication for the gas analyzer to the controller is interconnected with the data retrieval port via the AFAM expansion module on the Main Relay Board (MRB) in the RS232 ports, there are no gas analyzer readings sent to the controller if the data retrieval port on the side of the control box has a cable plugged into it.

AFAM Option Expansion Module

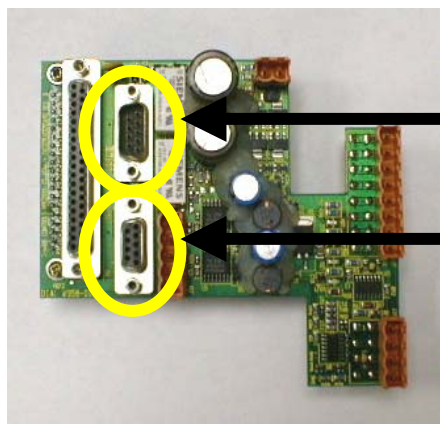

Cable to Data Retrieval port

Cable to Controller Serial port

Procedure

1. Connect unit to main power supply
 2. Turn unit ON / OFF switch to the OFF position
 3. Press and hold the '7' and 'ESC' and turn the ON / OFF switch to the ON position
 4. Plug cable from computer or Logman into the data retrieval port on the side of the control box
 5. Begin the software flashloading
 6. When the software flashload is completed, **IMMEDIATELY** unplug the cable connected from the computer or Logman to the data retrieval port. This **MUST** be done before the 'Auto Configuration' begins
- NOTE: If the cable remains connected to the data retrieval port, the 'Auto Configuration' feature will NOT find the gas analyzer. If this occurs, you will have to manually configure the gas analyzer (AFAM+) in the 'Configuration' menu of the controller**
7. To verify the unit has properly configured the gas analyzer, enter the 'DATA' menu and see if O2 and CO2 are listed. If they are, it has configured properly. If not, perform an 'Auto Config' manually.

NOTE: There may be no value shown for the O2 or CO2 until the unit has been ON for up to 15 minutes. This is normal.

MGR



SALES



SERVICE



PARTS

