Limited Hazardous Materials Survey Report

Pierce County- County City Building 1st Floor Door Widening
930 Tacoma Avenue South,
Tacoma, Washington 98402

Prepared for:
Pierce County Facilities Management
1501 Market Street Suite 100
Tacoma, Washington 98402

April 25, 2025
PBS Project PIE019-25006863

PBS
AN APEX COMPANY
214 E GALER STREET, SUITE 300
SEATTLE, WA 98102
206.233.9639 MAIN
866.727.0140 FAX
PBSUSA.COM

Table of Contents

1 INTRODUCTION 1
1.1 Project Background 1
1.2 Building Description 1
1.3 Survey Process 1
2 FINDINGS 1
2.1 Asbestos-Containing Materials (ACMs) 1
2.2 Lead-Containing Paint 2
3 RECOMMENDATIONS 2
3.1 Asbestos-Containing Materials (ACMs) 2
3.2 Lead-Containing Paint 3

Supporting Data

APPENDICES

Appendix A: Sample Location Diagram

Appendix B: Photo Documentation

Appendix C: PLM Bulk Sampling Information
PLM Bulk Sample Inventory
PLM Bulk Sample Chain of Custody Documentation
PLM Bulk Sample Laboratory Data Sheets

Appendix D: AA Lead Paint Chip Sampling Information
AA Lead Paint Chip Sample Inventory
AA Lead Paint Chip Chain of Custody Documentation
AA Lead Paint Chip Laboratory Data Sheets

Appendix E: Certifications

© 2025 PBS Engineering and Environmental LLC

1 INTRODUCTION

1.1 Project Background

PBS Engineering and Environmental LLC (PBS) performed a hazardous materials survey of the County City Building located in Tacoma, Washington, in conjunction with the planned Door Widening Project at the 1st floor lobby. The intent of this investigation is to ensure that Pierce County is in compliance with applicable regulatory requirements that a "good faith inspection" for asbestos-containing materials (ACMs) be performed prior to renovation activities.

Based on discussions to date, and drawing markups with work locations provided by Pierce County, PBS understands the scope of work to be limited to the 1st Floor Northeast Lobby area and the adjacent hallway leading to the freight elevator. At the request of Pierce County, all accessible areas associated with the project were inspected for the presence of asbestos-containing materials (ACMs) and lead-containing paint (LCP).

1.2 Building Description

The County-City Building is a multi-story metal-framed structure. Survey scope includes the 1st Floor northwest lobby and adjacent hallway leading to the freight elevator. Interior finishes in the area included in the work generally consist of terrazzo and stone tile flooring, stone wall paneling, gypsum wallboard and plaster walls and ceilings.

1.3 Survey Process

Accessible areas included in the project scope were inspected by Asbestos Hazard Emergency Response Act (AHERA) Certified Building Inspector Cameron Budnick (Cert. No. IRO-24-9630B, Exp. 9/24/2025) on April 16th, 2025. PBS endeavored to inspect all accessible areas of the scope of work. Inaccessible areas consist of those requiring fall protection or confined space entry protocols in order to gain access.

All suspect asbestos samples were assigned a unique identification number and transmitted for analysis to NVL Labs, Inc (NVLAP 102036-0) in Seattle, Washington under chain-of-custody protocols. Samples were analyzed according to Environmental Protection Agency (EPA) Method 600R-93/116 using polarized light microscopy (PLM), which has a reliable limit of quantification of 1% asbestos by volume. Information regarding the type and location of sampled materials can be found on the attached PLM sample inventory in Appendix B.

2 FINDINGS

2.1 Asbestos-Containing Materials (ACMs)

Regulated asbestos-containing building materials are defined by EPA as containing greater than 1% asbestos by weight.

- **None** of the sampled materials were found to contain detectible levels of asbestos by laboratory analysis.

The following materials were sampled and **did not contain** detectable concentrations of asbestos:

- Plaster walls – Throughout freight elevator hallway
- Gypsum wallboard – Freight elevator hallway at wall for window installation and wall for demolition
- 4" black cove base with tan mastic – Freight elevator hallway
- Plaster coating over gypsum wallboard – Freight elevator hallway at walls for window installation and for demolition

- Stone wall paneling with white mastic – 1st floor lobby, south wall
- Terrazzo flooring – 1st floor lobby, outside room 136
- 1' red speckle stone floor tile – Freight elevator hallway
- Tan trim sealant at wall-to-floor junction – 1st floor lobby at entrance to freight elevator corridor

For a complete listing of representative bulk sampling and associated laboratory analysis, refer to Appendix C.

Homogeneous Sampling Areas; The following table summarizes the homogenous sampling area (HSA) codes corresponding with representative bulk sampling and associated laboratory analyses included under Appendix C.

Table 1. Homogenous Sampling Areas

HSA CODE:	DESCRIPTION:
HPL1	Hard Plaster Walls and Ceilings
GWB1	Gypsum Wallboard with Joint Compound
CBM1	Black cove base with tan mastic
ACP1	Decorative plaster skim on GWB1
OTH1	Stone wall paneling with white mastic
OTH2	Terrazzo flooring
OTH3	Red speckle stone floor tile
OTH4	Tan thin sealant at floor-to-wall junction

2.2 Lead-Containing Paint

One (1) representative painted coatings were sampled for lead content. The samples were assigned unique identification numbers and transmitted to NVL Laboratories, Inc., (AIHA IH #101861) under chain-of-custody protocols for analysis using flame atomic absorption.

Lead was **not** detected in the painted coatings sampled as part of this investigation.

Samples determined **not** contain lead above the analytical limit of detection include:

- White paint on plaster wall – Freight elevator corridor

For a complete listing of representative lead sampling, associated laboratory analysis documentation, and previous data, refer to Appendix D.

3 RECOMMENDATIONS

3.1 Asbestos-Containing Materials (ACMs)

ACMs were not identified at the project site and limited to the areas surveyed.

The possibility exists that suspect ACMs may be present in equipment, wall, and ceiling cavities, included in the scope of the work or in areas of the campus not included in the work scope. These may include, but are not limited to waterproofing membranes, vapor barriers, internal gaskets, pipe insulation, piping materials, caulking and sealants of HVAC equipment, internal mechanical components, and construction adhesives and wall mastics. In the event that suspect ACMs are uncovered during construction, contractors should stop work immediately and inform the owner promptly for confirmation testing. All untested materials should be presumed asbestos-containing or tested for asbestos content prior to impact.

Additional suspect-ACMs may be present in concealed spaces. Caution should always be exercised during selective demolition to prevent impact of suspect-ACMs. All suspect ACMs should be presumed asbestos-containing until properly sampled and analyzed.

3.2 Lead-Containing Paint

Representative painted coatings were found not to contain lead. Impact of painted surfaces with detectable concentrations of lead requires construction activities to be performed according to Washington Administrative Code (WAC) 296-155-176,

Painted coatings may exist in inaccessible areas of the work area or in secondary coatings. Any previously unidentified painted coatings not sampled should be considered lead containing until sampled and proven otherwise.

Report prepared by:



Cameron Budnick
AHERA Building Inspector
Cert. # IRO-24-9630B Exp. 9/24/2025

Reviewed by:




Ryan Hunter
Sr. Project Manager

Appendix A

Sample Location Diagram

PBS Engineering and Environmental
Hazardous Materials Sample Locations
PBS Project # PIE019-0418021-25006863
04/25/2025

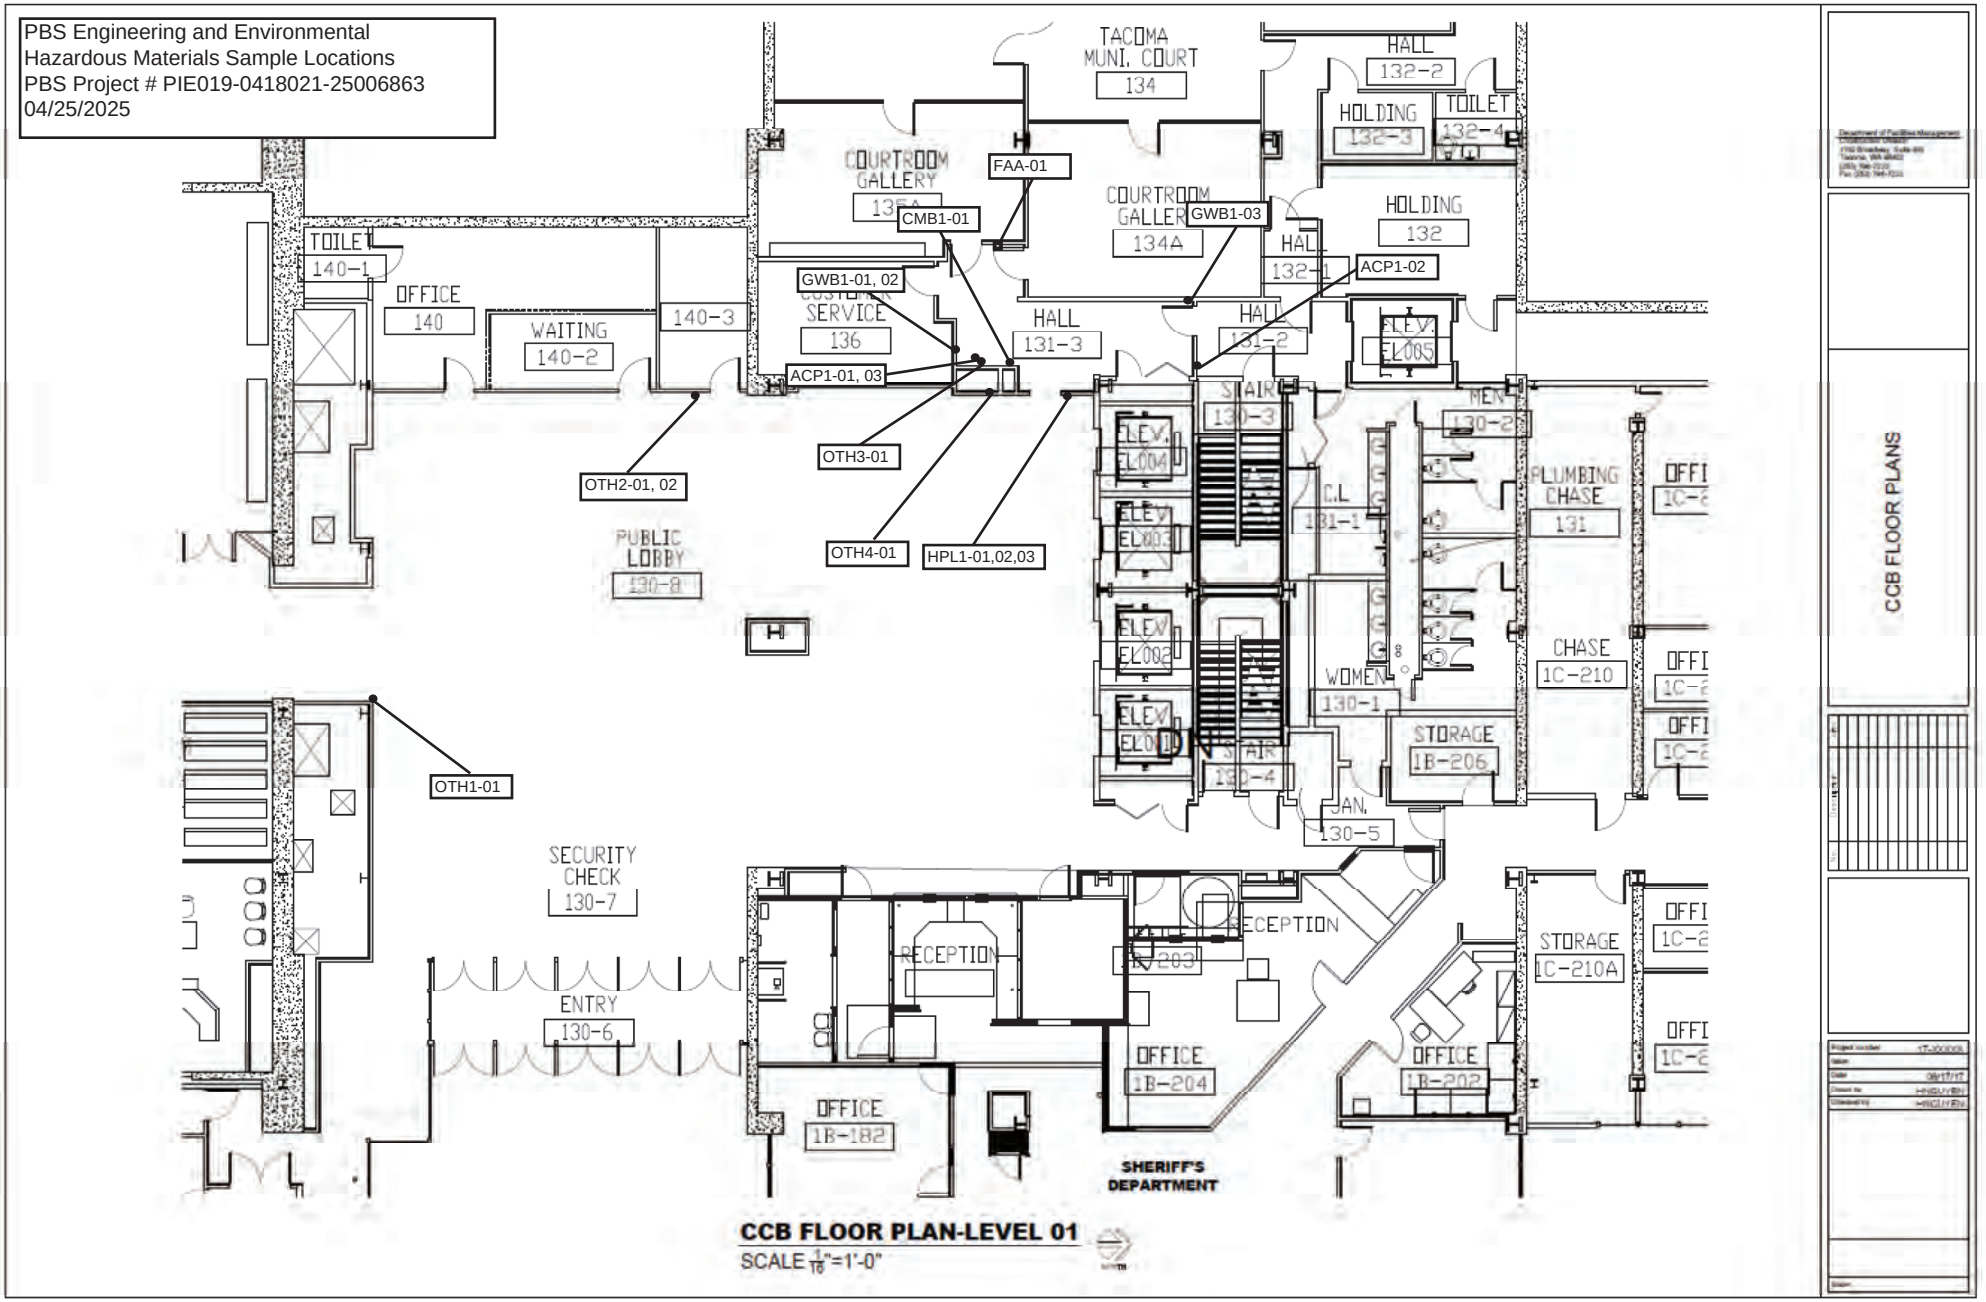

CCB FLOOR PLAN-LEVEL 01
SCALE $\frac{1}{16}$"=1'-0"

CCB FLOOR PLANS

Asbestos Samples

OTH1-01 — Drawing Reference to Bulk Sample Field Code, See Inventory of Samples

Lead Samples

FAA-01 — Drawing Reference to Bulk Sample Field Code, See Inventory of Samples

Appendix B

Photo Documentation Sheet

Asbestos-Containing Material Photos, Description, and Information



Sample Number(s): HPL1-01, HPL1-02, HPL1-03

Asbestos Content: NAD

Description: Plaster Wall

Estimated Quantity: N/A

Samples Collected: 3



Sample Number(s): GWB1-01, GWB1-02, GWB1-03

Asbestos Content: NAD

Description: Gypsum Wallboard

Estimated Quantity: N/A

Samples Collected: 3



Sample Number(s): CBM1-01

Asbestos Content: NAD


Description: 4" Black Cove Base with Tan mastic

Estimated Quantity: N/A

Samples Collected: 1

NAD – No Asbestos Detected

Asbestos-Containing Material Photos, Description, and Information

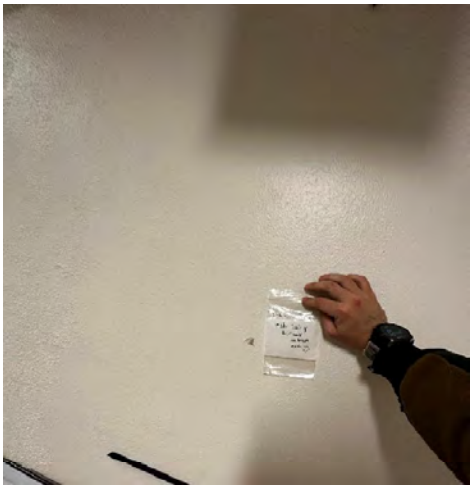

Sample Number(s): ACP1-01, ACP1-02, ACP1-03

Asbestos Content: NAD

Description: Plaster Coating Over Gypsum Wallboard

Estimated Quantity: N/A

Samples Collected: 1



Sample Number(s): OTH1-01

Asbestos Content: NAD

Description: Stone Wall Paneling with White Mastic

Estimated Quantity: N/A

Samples Collected: 1



Sample Number(s): OTH2-1, OTH2-02

Asbestos Content: NAD


Description: Terrazzo Flooring

Estimated Quantity: N/A

Samples Collected: 2

NAD – No Asbestos Detected

Asbestos-Containing Material Photos, Description, and Information

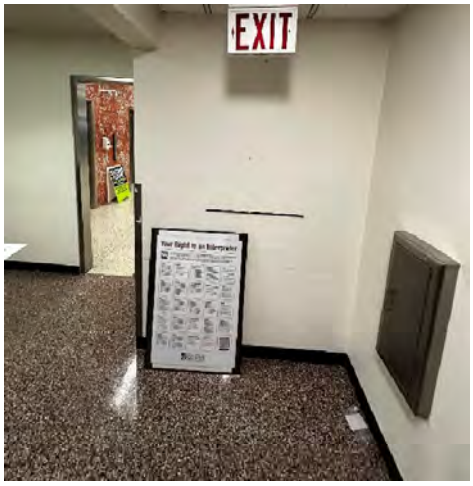


Sample Number(s): OTH3-01

Asbestos Content: NAD

Description: Red Speckled Thin Stone Tile with Grout

Estimated Quantity: N/A

Samples Collected: 1

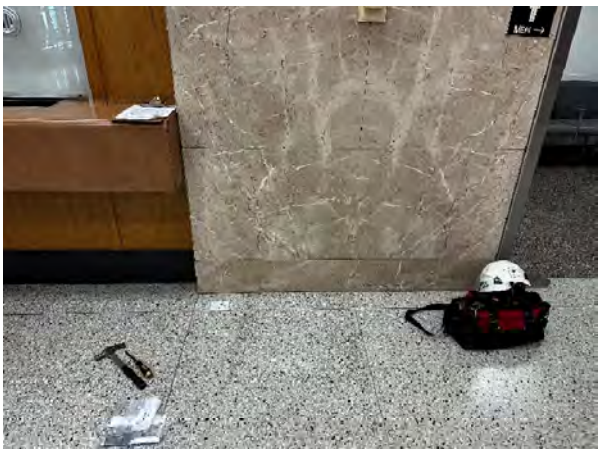

Sample Number(s): OTH4-01

Asbestos Content: NAD

Description: Tan Trim Sealant at Wall Panel-to-Floor Junction

Estimated Quantity: N/A

Samples Collected: 1

Appendix C

PLM Bulk Sampling Information

PLM Bulk Sample Inventory
PLM Bulk Sample Chain of Custody Documentation
PLM Bulk Sample Laboratory Data Sheets

PLM ASBESTOS SAMPLE INVENTORY

PBS Sample #	Material Type	Sample Location	Lab Description	Lab Result	Lab
HPL1-01	Plaster wall	Freight elevator hallway, at wall for alt. call box location	Layer 1: White crumbly/sandy material with trace brown crumbly material with paint	NAD	NVL
HPL1-02	Plaster wall	Freight elevator hallway, at wall for alt. call box location	Layer 1: White crumbly/sandy material with trace brown crumbly material with paint	NAD	NVL
HPL1-03	Plaster wall	Freight elevator hallway, at wall for alt. call box location	Layer 1: White crumbly/sandy material with brown crumbly material with paint	NAD	NVL
GWB1-01	Joint compound Gypsum wallboard	Freight elevator hallway, at wall planned for demolition (from behind cove base)	Layer 1: Yellow soft mastic Layer 2: White crumbly/sandy material with mesh and paint Layer 3: White chalky material with paper	NAD NAD NAD	NVL
GWB1-02	Joint compound Gypsum wallboard	Freight elevator hallway, at wall planned for demo	Layer 1: Yellow soft mastic Layer 2: White crumbly/sandy material with mesh and paint Layer 3: White chalky material with paper	NAD NAD NAD	NVL
GWB1-03	Joint compound Gypsum wallboard	Freight elevator hallway, at wall for window installation	Layer 1: Yellow soft mastic Layer 2: White crumbly/sandy material with mesh and paint Layer 3: White chalky material with paper	NAD NAD NAD	NVL
CBM1-01	4" black cove base with tan mastic	Freight elevator hallway, at wall planned for demo	Layer 1: Black rubbery material with debris and trace paint Layer 2: Yellow soft mastic with debris	NAD NAD	NVL
ACP1-01	Plaster coating over gypsum wallboard	Freight elevator hallway, at wall planned for demo	Layer 1: White crumbly/sandy material with paint and trace of paper Layer 2: Trace white chalky material	NAD NAD	NVL
ACP1-02	Plaster coating over gypsum wallboard	Freight elevator hallway, at wall for window installation	Layer 1: White crumbly/sandy material with paint Layer 2: Trace of white chalky material with paper	NAD NAD	NVL

PLM ASBESTOS SAMPLE INVENTORY

PBS Sample #	Material Type	Sample Location	Lab Description	Lab Result	Lab
ACP1-03	Plaster coating over gypsum wallboard	Freight elevator hallway, at wall planned for demo	Layer 1: White crumbly/sandy material with paint Layer 2: Trace of white chalky material with paper	NAD NAD	NVL
OTH1-01	Stone wall paneling with white mastic	1st floor lobby, south wall	Layer 1: Off-white brittle material Layer 2: Whie crumbly material with trace of debris	NAD NAD	NVL
OTH2-01	Terrazzo flooring	1st floor lobby, outside room 136	Layer 1: Gray brittle material Layer 2: White soft mastic	NAD NAD	NVL
OTH2-02	Terrazzo flooring	1st floor lobby, outside room 136	Layer 1: Gray and red brittle material Layer 2: White soft mastic Layer 3: Trace gray crumbly material	NAD NAD NAD	NVL
OTH3-01	1' red speckle stone floor tile with grout	Freight elevator hall at wall planned for demo	Layer 1: Multicolored brittle tile with debris Layer 2: White crumbly material	NAD NAD	NVL
OTH4-01	Tan trim sealant at wall panel-to-floor junction	Lobby at entrance to freight elevator corridor	Layer 1: Tan brittle crumbly material	NAD	NVL

April 25, 2025

Ryan Hunter
PBS Environmental - Seattle
214 E Galer St. Suite. 300
Seattle, WA 98102

RE: Bulk Asbestos Fiber Analysis; NVL Batch # 2506919.00

Client Project: PIE019-6863
Location: County-City Building 1st Floor Door Widening

Dear Mr. Hunter,

Enclosed please find test results for the 15 sample(s) submitted to our laboratory for analysis on 4/18/2025.

Examination of these samples was conducted for the presence of identifiable asbestos fibers using polarized light microscopy (PLM) with dispersion staining in accordance with **U. S. EPA 40 CFR Appendix E to Subpart E of Part 763**, Interim Method for the Determination of Asbestos in Bulk Insulation Samples and **EPA 600/R-93/116**, Method for the Determination of Asbestos in Bulk Building Materials.

For samples containing more than one separable layer of materials, the report will include findings for each layer (labeled Layer 1 and Layer 2, etc. for each individual layer). The asbestos concentration in the sample is determined by calibrated visual estimation.

For those samples with asbestos concentrations between 1 and 10 percent based on visual estimation, the EPA recommends a procedure known as point counting (NESHAPS, 40 CFR Part 61). Point counting is a statistically more accurate means of quantification for samples with low concentrations of asbestos.

The detection limit for the calibrated visual estimation is <1%, 400 point counts is 0.25% and 1000 point counts is 0.1%

Samples are archived for two weeks following analysis. Samples that are not retrieved by the client are discarded after two weeks.

Thank you for using our laboratory services. Please do not hesitate to call if there is anything further we can assist you with.

Sincerely,

Hilary Crumley, Manager Asbestos Laboratory

NVLAP Testing
Lab Code: 102063-0

Enc.: Sample Results

Bulk Asbestos Fibers Analysis

By Polarized Light Microscopy

Client: PBS Environmental - Seattle
Address: 214 E Galer St. Suite. 300
Seattle, WA 98102

Attention: Mr. Ryan Hunter
Project Location: County-City Building 1st Floor Door Widening

Batch #: 2506919.00
Client Project #: PIE019-6863
Date Received: 4/18/2025
Samples Received: 15
Samples Analyzed: 15
Method: EPA/600/R-93/116

Lab ID: 250039682 **Client Sample #: 6863-HPL1-01**

Location: County-City Building 1st Floor Door Widening

Comments: Small sample size.

Layer 1 of 1 **Description:** White crumbly/sandy material with trace brown crumbly material and paint

Non-Fibrous Materials:	Other Fibrous Materials:%	**Asbestos Type: %**
Binder/Filler, Paint, Sand	Synthetic fibers <1%	**None Detected ND**
Fine particles	Cellulose <1%	
	Wollastonite <1%	

Lab ID: 250039683 **Client Sample #: 6863-HPL1-02**

Location: County-City Building 1st Floor Door Widening

Comments: Small sample size.

Layer 1 of 1 **Description:** White crumbly/sandy material with trace brown crumbly material and paint

Non-Fibrous Materials:	Other Fibrous Materials:%	**Asbestos Type: %**
Binder/Filler, Sand, Paint	Cellulose <1%	**None Detected ND**
Mineral grains	Wollastonite <1%	

Lab ID: 250039684 **Client Sample #: 6863-HPL1-03**

Location: County-City Building 1st Floor Door Widening

Layer 1 of 1 **Description:** White crumbly/sandy material with brown crumbly material and paint

Non-Fibrous Materials:	Other Fibrous Materials:%	**Asbestos Type: %**
Binder/Filler, Sand, Paint	Synthetic fibers <1%	**None Detected ND**
Mineral grains	Wollastonite 1%	
	Talc fibers <1%	

Lab ID: 250039685 **Client Sample #: 6863-GWB1-01**

Location: County-City Building 1st Floor Door Widening

Sampled by: Client
Analyzed by: Michelle Seidl **Date:** 04/24/2025
Reviewed by: Hilary Crumley **Date:** 04/25/2025

Hilary Crumley, Manager Asbestos Laboratory

Note: If samples are not homogeneous, then subsamples of the components were analyzed separately. All bulk samples are analyzed using both EPA 600/R-93/116 and EPA 40 CFR Appendix E to Subpart E of Part 763 with the following measurement uncertainties for the reported % Asbestos (1%=0-3%, 5%=1-9%, 10%=5-15%, 20%=10-30%, 50%=40-60%). This report relates only to the items tested. If sample was not collected by NVL personnel, then the accuracy of the results is limited by the methodology and acuity of the sample collector. This report shall not be reproduced except in full, without written approval of NVL Laboratories, Inc. It shall not be used to claim product endorsement by NVLAP or any other agency of the US Government

Bulk Asbestos Fibers Analysis

By Polarized Light Microscopy

Client: PBS Environmental - Seattle
Address: 214 E Galer St. Suite. 300
Seattle, WA 98102

Attention: **Mr. Ryan Hunter**
Project Location: County-City Building 1st Floor Door Widening

Batch #: 2506919.00
Client Project #: PIE019-6863
Date Received: 4/18/2025
Samples Received: 15
Samples Analyzed: 15
Method: EPA/600/R-93/116

Layer 1 of 3	**Description:** Yellow soft mastic			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Mastic/Binder, Fine particles	None Detected	ND	**None Detected ND**
Layer 2 of 3	**Description:** White crumbly/sandy material with mesh and paint			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Binder/Filler, Mineral grains, Paint	Synthetic fibers	10%	**None Detected ND**
		Glass fibers	8%	
Layer 3 of 3	**Description:** White chalky material with paper			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Gypsum/Binder, Fine particles	Cellulose	25%	**None Detected ND**
		Glass fibers	2%	

Lab ID: 250039686 **Client Sample #: 6863-GWB1-02**

Location: County-City Building 1st Floor Door Widening

Layer 1 of 3	**Description:** Yellow soft mastic with paint			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Mastic/Binder, Fine particles, Paint	Cellulose	2%	**None Detected ND**
Layer 2 of 3	**Description:** White crumbly/sandy material with paint and mesh			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Binder/Filler, Sand, Mineral grains	Glass fibers	6%	**None Detected ND**
		Synthetic fibers	7%	
Layer 3 of 3	**Description:** White chalky material with paper			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Gypsum/Binder, Fine particles	Cellulose	31%	**None Detected ND**
		Glass fibers	3%	

Sampled by: Client
Analyzed by: Michelle Seidl **Date:** 04/24/2025
Reviewed by: Hilary Crumley **Date:** 04/25/2025

Hilary Crumley, Manager Asbestos Laboratory

Note: If samples are not homogeneous, then subsamples of the components were analyzed separately. All bulk samples are analyzed using both EPA 600/R-93/116 and EPA 40 CFR Appendix E to Subpart E of Part 763 with the following measurement uncertainties for the reported % Asbestos (1%=0-3%, 5%=1-9%, 10%=5-15%, 20%=10-30%, 50%=40-60%). This report relates only to the items tested. If sample was not collected by NVL personnel, then the accuracy of the results is limited by the methodology and acuity of the sample collector. This report shall not be reproduced except in full, without written approval of NVL Laboratories, Inc. It shall not be used to claim product endorsement by NVLAP or any other agency of the US Government

Bulk Asbestos Fibers Analysis

By Polarized Light Microscopy

Client: PBS Environmental - Seattle
Address: 214 E Galer St. Suite. 300
Seattle, WA 98102

Attention: Mr. Ryan Hunter
Project Location: County-City Building 1st Floor Door Widening

Batch #: 2506919.00
Client Project #: PIE019-6863
Date Received: 4/18/2025
Samples Received: 15
Samples Analyzed: 15
Method: EPA/600/R-93/116

Lab ID: 250039687 **Client Sample #: 6863-GWB1-03**

Location: County-City Building 1st Floor Door Widening

Layer 1 of 3	**Description:** Yellow soft mastic			
	Non-Fibrous Materials:	Other Fibrous Materials:%		**Asbestos Type: %**
	Mastic/Binder, Fine grains	Cellulose	<1%	**None Detected ND**
Layer 2 of 3	**Description:** White crumbly/sandy material with mesh and paint			
	Non-Fibrous Materials:	Other Fibrous Materials:%		**Asbestos Type: %**
	Binder/Filler, Sand, Mineral grains	Glass fibers	20%	**None Detected ND**
	Paint	Synthetic fibers	4%	
Layer 3 of 3	**Description:** White chalky material with paper			
	Non-Fibrous Materials:	Other Fibrous Materials:%		**Asbestos Type: %**
	Gypsum/Binder, Fine particles	Cellulose	29%	**None Detected ND**
		Glass fibers	2%	

Lab ID: 250039688 **Client Sample #: 6863-CBM1-01**

Location: County-City Building 1st Floor Door Widening

Layer 1 of 2	**Description:** Black rubbery material with debris and trace of paint			
	Non-Fibrous Materials:	Other Fibrous Materials:%		**Asbestos Type: %**
	Rubber/Binder, Debris, Paint	None Detected	ND	**None Detected ND**
Layer 2 of 2	**Description:** Yellow soft mastic with debris			
	Non-Fibrous Materials:	Other Fibrous Materials:%		**Asbestos Type: %**
	Mastic/Binder, Debris	Cellulose	1%	**None Detected ND**
		Synthetic fibers	1%	

Sampled by: Client
Analyzed by: Michelle Seidl **Date:** 04/24/2025
Reviewed by: Hilary Crumley **Date:** 04/25/2025

Hilary Crumley, Manager Asbestos Laboratory

Note: If samples are not homogeneous, then subsamples of the components were analyzed separately. All bulk samples are analyzed using both EPA 600/R-93/116 and EPA 40 CFR Appendix E to Subpart E of Part 763 with the following measurement uncertainties for the reported % Asbestos (1%=0-3%, 5%=1-9%, 10%=5-15%, 20%=10-30%, 50%=40-60%). This report relates only to the items tested. If sample was not collected by NVL personnel, then the accuracy of the results is limited by the methodology and acuity of the sample collector. This report shall not be reproduced except in full, without written approval of NVL Laboratories, Inc. It shall not be used to claim product endorsement by NVLAP or any other agency of the US Government

Bulk Asbestos Fibers Analysis

By Polarized Light Microscopy

Client: PBS Environmental - Seattle
Address: 214 E Galer St. Suite. 300
Seattle, WA 98102

Attention: Mr. Ryan Hunter
Project Location: County-City Building 1st Floor Door Widening

Batch #: 2506919.00
Client Project #: PIE019-6863
Date Received: 4/18/2025
Samples Received: 15
Samples Analyzed: 15
Method: EPA/600/R-93/116

Lab ID: 250039689 **Client Sample #: 6863-ACP1-01**

Location: County-City Building 1st Floor Door Widening

Comments: Small sample size.

Layer 1 of 2 **Description:** White crumbly/sandy material with paint and trace of paper

Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
Binder/Filler, Paint, Gypsum/Binder	Cellulose	6%	**None Detected ND**
	Synthetic fibers	1%	
	Glass fibers	1%	

Layer 2 of 2 **Description:** Trace white chalky material

Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
Gypsum/Binder, Fine particles	Cellulose	3%	**None Detected ND**

Lab ID: 250039690 **Client Sample #: 6863-ACP1-02**

Location: County-City Building 1st Floor Door Widening

Layer 1 of 2 **Description:** White crumbly/sandy material with paint

Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
Binder/Filler, Sand, Paint	Cellulose	1%	**None Detected ND**

Layer 2 of 2 **Description:** Trace of white chalky material with paper

Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
Gypsum/Binder, Fine particles	Cellulose	28%	**None Detected ND**
	Glass fibers	1%	

Lab ID: 250039691 **Client Sample #: 6863-ACP1-03**

Location: County-City Building 1st Floor Door Widening

Sampled by: Client
Analyzed by: Michelle Seidl **Date:** 04/24/2025
Reviewed by: Hilary Crumley **Date:** 04/25/2025

Hilary Crumley, Manager Asbestos Laboratory

Note: If samples are not homogeneous, then subsamples of the components were analyzed separately. All bulk samples are analyzed using both EPA 600/R-93/116 and EPA 40 CFR Appendix E to Subpart E of Part 763 with the following measurement uncertainties for the reported % Asbestos (1%=0-3%, 5%=1-9%, 10%=5-15%, 20%=10-30%, 50%=40-60%). This report relates only to the items tested. If sample was not collected by NVL personnel, then the accuracy of the results is limited by the methodology and acuity of the sample collector. This report shall not be reproduced except in full, without written approval of NVL Laboratories, Inc. It shall not be used to claim product endorsement by NVLAP or any other agency of the US Government

Bulk Asbestos Fibers Analysis

By Polarized Light Microscopy

Client: PBS Environmental - Seattle
Address: 214 E Galer St. Suite. 300
Seattle, WA 98102

Attention: **Mr. Ryan Hunter**
Project Location: County-City Building 1st Floor Door Widening

Batch #: 2506919.00
Client Project #: PIE019-6863
Date Received: 4/18/2025
Samples Received: 15
Samples Analyzed: 15
Method: EPA/600/R-93/116

Layer 1 of 2	**Description:** White crumbly/sandy material with paint			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Binder/Filler, Paint, Sand	Cellulose	1%	**None Detected ND**
Layer 2 of 2	**Description:** White chalky material with trace of paper			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Gypsum/Binder, Fine particles	Cellulose	11%	**None Detected ND**

Lab ID: 250039692 **Client Sample #: 6863-OTH1-01**

Location: County-City Building 1st Floor Door Widening

Layer 1 of 2	**Description:** Off-white brittle material			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Mineral grains	None Detected	ND	**None Detected ND**
Layer 2 of 2	**Description:** White crumbly material with trace of debris			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Binder/Filler, Fine particles, Debris	Cellulose	1%	**None Detected ND**

Lab ID: 250039693 **Client Sample #: 6863-OTH2-01**

Location: County-City Building 1st Floor Door Widening

Layer 1 of 2	**Description:** Gray brittle material			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Mastic/Binder, Fine grains	Cellulose	2%	**None Detected ND**
		Synthetic fibers	1%	
Layer 2 of 2	**Description:** White soft mastic			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Mastic/Binder, Fine particles	None Detected	ND	**None Detected ND**

Lab ID: 250039694 **Client Sample #: 6863-OTH2-02**

Location: County-City Building 1st Floor Door Widening

Sampled by: Client
Analyzed by: Michelle Seidl **Date:** 04/24/2025
Reviewed by: Hilary Crumley **Date:** 04/25/2025

Hilary Crumley, Manager Asbestos Laboratory

Note: If samples are not homogeneous, then subsamples of the components were analyzed separately. All bulk samples are analyzed using both EPA 600/R-93/116 and EPA 40 CFR Appendix E to Subpart E of Part 763 with the following measurement uncertainties for the reported % Asbestos (1%=0-3%, 5%=1-9%, 10%=5-15%, 20%=10-30%, 50%=40-60%). This report relates only to the items tested. If sample was not collected by NVL personnel, then the accuracy of the results is limited by the methodology and acuity of the sample collector. This report shall not be reproduced except in full, without written approval of NVL Laboratories, Inc. It shall not be used to claim product endorsement by NVLAP or any other agency of the US Government

Bulk Asbestos Fibers Analysis

By Polarized Light Microscopy

Client: PBS Environmental - Seattle
Address: 214 E Galer St. Suite. 300
Seattle, WA 98102

Attention: **Mr. Ryan Hunter**
Project Location: County-City Building 1st Floor Door Widening

Batch #: 2506919.00
Client Project #: PIE019-6863
Date Received: 4/18/2025
Samples Received: 15
Samples Analyzed: 15
Method: EPA/600/R-93/116

Layer 1 of 3	**Description:** Gray and red brittle material			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Mineral grains	None Detected	ND	**None Detected ND**
Layer 2 of 3	**Description:** White mastic			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Mastic/Binder, Fine grains	Cellulose	1%	**None Detected ND**
Layer 3 of 3	**Description:** Trace gray crumbly material			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Binder/Filler, Fine particles	None Detected	ND	**None Detected ND**

Lab ID: 250039695 **Client Sample #: 6863-OTH3-01**

Location: County-City Building 1st Floor Door Widening

Layer 1 of 2	**Description:** Multicolored brittle tile with debris			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Mineral grains, Mastic/Binder, Debris	Cellulose	1%	**None Detected ND**
Layer 2 of 2	**Description:** White crumbly material			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Binder/Filler, Fine particles	None Detected	ND	**None Detected ND**

Lab ID: 250039696 **Client Sample #: 6863-OTH4-01**

Location: County-City Building 1st Floor Door Widening

Comments: Small sample size.

Layer 1 of 1	**Description:** Tan brittle crumbly material			
	Non-Fibrous Materials:	Other Fibrous Materials:	%	**Asbestos Type: %**
	Binder/Filler, Fine grains, Fine particles	Cellulose	1%	**None Detected ND**

Sampled by: Client
Analyzed by: Michelle Seidl **Date:** 04/24/2025
Reviewed by: Hilary Crumley **Date:** 04/25/2025

Hilary Crumley, Manager Asbestos Laboratory

Note: If samples are not homogeneous, then subsamples of the components were analyzed separately. All bulk samples are analyzed using both EPA 600/R-93/116 and EPA 40 CFR Appendix E to Subpart E of Part 763 with the following measurement uncertainties for the reported % Asbestos (1%=0-3%, 5%=1-9%, 10%=5-15%, 20%=10-30%, 50%=40-60%). This report relates only to the items tested. If sample was not collected by NVL personnel, then the accuracy of the results is limited by the methodology and acuity of the sample collector. This report shall not be reproduced except in full, without written approval of NVL Laboratories, Inc. It shall not be used to claim product endorsement by NVLAP or any other agency of the US Government

ASBESTOS LABORATORY SERVICES

Company	PBS Environmental - Seattle	**NVL Batch Number**	**2506919.00**
Address	214 E Galer St. Suite. 300 Seattle, WA 98102	**TAT** 5 Days **Rush TAT**	**AH** No
Project Manager	Mr. Ryan Hunter	**Due Date** 4/25/2025	**Time** 11:15 AM
Phone	(206) 233-9639	**Email**	ryan.hunter@pbsusa.com
Cell	(484) 269-2138	**Fax**	(866) 727-0140

Project Name/Number: PIE019-6863 **Project Location:** County-City Building 1st Floor Door Widening

Subcategory PLM Bulk

Item Code ASB-02 EPA 600/R-93-116 Asbestos by PLM <bulk>

Total Number of Samples 15 Rush Samples

	Lab ID	Sample ID	Description	A/R
1	250039682	6863-HPL1-01		A
2	250039683	6863-HPL1-02		A
3	250039684	6863-HPL1-03		A
4	250039685	6863-GWB1-01	Composite	A
5	250039686	6863-GWB1-02	Composite	A
6	250039687	6863-GWB1-03	Composite	A
7	250039688	6863-CBM1-01		A
8	250039689	6863-ACP1-01		A
9	250039690	6863-ACP1-02		A
10	250039691	6863-ACP1-03		A
11	250039692	6863-OTH1-01		A
12	250039693	6863-OTH2-01		A
13	250039694	6863-OTH2-02		A
14	250039695	6863-OTH3-01		A
15	250039696	6863-OTH4-01		A

	Print Name	Signature	Company	Date	Time
Sampled by	Client				
Relinquished by	Client				

Office Use Only	Print Name	Signature	Company	Date	Time
Received by	Laura Carcone		NVL	4/18/25	1115
Analyzed by	Michelle Seidl		NVL	4/24/25	
Results Called by					
☐ **Faxed** ☐ **Emailed**					

Special Instructions:

Date: 4/18/2025
Time: 11:38 AM
Entered By: Laura Carcone

PBS
AN APEX COMPANY

2506919

ORATORY CHAIN OF CUSTODY

Project: County-City Building 1st Floor Door Widening

Project #: PIE019-6863 Page 1 of 2

Analysis requested: PLM

Date: 4/17/25

Relinq'd by/Signature:

Date/Time: 4/17/25

Received by/Signature: LAURA C

Date/Time: 4/17/25 1115

Email ALL INVOICES to: seattleap@pbsusa.com

E-mail results to:

- ☐ Willem Mager
- ☐ Gregg Middaugh
- ☒ Ryan Hunter
- ☐ Janet Murphy
- ☐ Toan Nguyen
- ☐ Peter Stensland
- ☐ Kunga Woser
- ☐ Ferman Fletcher
- ☒ Cameron Budnick
- ☐ Katie King
- ☐ Nick San
- ☐ James Haven
- ☐ Kameron DeMonnin
- ☐ _____

TURN AROUND TIME:

- ☐ 1 Hour
- ☐ 2 Hours
- ☐ 4 Hours
- ☐ 24 Hours
- ☐ 48 Hours
- ☐ 3 Days
- ☒ 5 Days
- ☐ Other_____

If positive, send samples with "***" for composite analysis

SAMPLE DATA FORM

Sample #	Material	Location	Lab
HPL1-01	Plaster wall	Freight elevator hallway, at wall for alt. call box location	NVL
HPL1-02	Plaster wall	Freight elevator hallway, at wall for alt. call box location	NVL
HPL1-03	Plaster wall	Freight elevator hallway, at wall for alt. call box location	NVL
GWB1-01	***Gypsum wallboard with joint compound	Freight elevator hallway, at wall planned for demo	NVL
GWB1-02	***Gypsum wallboard with joint compound	Freight elevator hallway, at wall planned for demo	NVL
GWB1-03	***Gypsum wallboard with joint compound	Freight elevator hallway, at wall for window installation	NVL
CBM1-01	4" black cove base with tan mastic	Freight elevator hallway, at wall planned for demo	NVL
ACP1-01	Plaster coating over gypsum wallboard	Freight elevator hallway, at wall planned for demo	NVL
ACP1-02	Plaster coating over gypsum wallboard	Freight elevator hallway, at wall for window installation	NVL
ACP1-03	Plaster coating over gypsum wallboard	Freight elevator hallway, at wall planned for demo	NVL
OTH1-01	Stone wall paneling with white mastic	1st floor lobby, south wall	NVL
OTH2-01	Terrazzo flooring	1st floor lobby, outside room 136	NVL
OTH2-02	Terrazzo flooring	1st floor lobby, outside room 136	NVL

214 EAST GALER STREET, SUITE 300, SEATTLE, WA 98102 ▪ 206.233.9639 MAIN ▪ 866.727.0140 FAX ▪ PBSUSA.COM

PBS
AN APEX COMPANY

2506919 'ORY CHAIN OF CUSTODY

Project: County-City Building 1st Floor Door Widening **Project #:** PIE019-6863 Page **2** of **2**

SAMPLE DATA FORM			
Sample #	**Material**	**Location**	**Lab**
OTH3-01	12" red speckle stone floor tile with grout	Freight elevator hall at wall planned for demo	NVL
OTH4-01	Tan trim sealant at wall panel-to-floor	Lobby at entrance to freight elevator corridor	NVL

214 EAST GALER STREET, SUITE 300, SEATTLE, WA 98102 ▪ 206.233.9639 MAIN ▪ 866.727.0140 FAX ▪ PBSUSA.COM

Appendix D

AA Lead Paint Chip Sampling Information

AA Lead Paint Chip Sample Inventory
AA Lead Paint Chip Chain of Custody Documentation
AA Lead Paint Chip Laboratory Data Sheets

AA LEAD PAINT CHIP SAMPLE INVENTORY

PBS Sample #	Paint Color / Substrate / Component	Sample Location	Results (mg/kg)	Results (%)	Lab
FAA-01	White / Plaster / Wall	Freight elevator hallway at room 135	47	<0.0047	NVL

mg/kg = Milligrams per kilogram
< = Less than the Limit of Detection

April 21, 2025

Ryan Hunter
PBS Environmental - Seattle
214 E Galer St. Suite. 300
Seattle, WA 98102

NVL Batch # 2506921.00

RE: Total Metal Analysis
Method: EPA 7000B Lead by FAA <paint>
Item Code: FAA-02

Client Project: PIE019-6863
Location: County-City Building 1st Floor Door Widening

Dear Mr. Hunter,

NVL Labs received 1 sample(s) for the said project on 4/18/2025. Preparation of these samples was conducted following protocol outlined in EPA 3051/7000B , unless stated otherwise. Analysis of these samples was performed using analytical instruments in accordance with EPA 7000B Lead by FAA <paint>. The results are usually expressed in mg/Kg and percentage (%). Test results are not blank corrected.

For recent regulation updates pertaining to current regulatory levels or permissible exposure levels, please call your local regulatory agencies for more detail.

At NVL Labs all analyses are performed under strict guidelines of the Quality Assurance Program. If samples were collected by the customer, then the reported test results apply only to the samples as received by NVL Labs. This report is considered highly confidential and will not be released without your approval. Samples are archived after two weeks from the analysis date. Please feel free to contact us at 206-547-0100, in case you have any questions or concerns.

Sincerely,

Shalini Patel, Manager Metals/Org Laboratory

Enc.: Sample results

Analysis Report

Total Lead (Pb)

Client: PBS Environmental - Seattle
Address: 214 E Galer St. Suite. 300
Seattle, WA 98102

Attention: **Mr. Ryan Hunter**
Project Location: County-City Building 1st Floor Door Widening

Batch #: 2506921.00
Matrix: Paint
Method: EPA 3051/7000B
Client Project #: PIE019-6863
Date Received: 4/18/2025
Samples Received: 1
Samples Analyzed: 1

Lab ID	Client Sample #	Sample Weight (g)	RL in mg/Kg	Results in mg/Kg	Results in percent
250039701	FAA-01	0.2107	47	< 47	< 0.0047

Sampled by: Client
Analyzed by: Yasuyuki Hida
Reviewed by: Shalini Patel

Date Analyzed: 04/21/2025
Date Issued: 04/21/2025

Shalini Patel, Manager Metals/Org Laboratory

mg/ Kg =Milligrams per kilogram
Percent = Milligrams per kilogram / 10000
Note : Method QC results are acceptable unless stated otherwise.
Unless otherwise indicated, the condition of all samples was acceptable at time of receipt.

RL = Reporting Limit
'<' = Below the reporting Limit

Bench Run No: 2025-0421-04

LEAD LABORATORY SERVICES

Company	PBS Environmental - Seattle	**NVL Batch Number**	**2506921.00**
Address	214 E Galer St. Suite. 300 Seattle, WA 98102	**TAT** 5 Days **AH** No **Rush TAT**	
Project Manager	Mr. Ryan Hunter	**Due Date** 4/25/2025 **Time**	11:15 AM
Phone	(206) 233-9639	**Email**	ryan.hunter@pbsusa.com
Cell	(484) 269-2138	**Fax**	(866) 727-0140

Project Name/Number: PIE019-6863 **Project Location:** County-City Building 1st Floor Door Widening

Subcategory Flame AA (FAA)

Item Code FAA-02 EPA 7000B Lead by FAA <paint>

Total Number of Samples 1 Rush Samples

	Lab ID	Sample ID	Description	A/R
1	250039701	FAA-01		A

	Print Name	Signature	Company	Date	Time
Sampled by	Client				
Relinquished by	Client				

Office Use Only	Print Name	Signature	Company	Date	Time
Received by	Laura Carcone		NVL	4/18/25	1115
Analyzed by	Yasuyuki Hida		NVL	4/21/25	
Results Called by					
☐ **Faxed** ☐ **Emailed**					

Special Instructions:

Date: 4/18/2025
Time: 11:48 AM
Entered By: Laura Carcone

PBS
AN APEX COMPANY

ORATORY CHAIN OF CUSTODY

2506921

Project: County-City Building 1st Floor Door Widening **Project #:** PIE019-6863 Page 1 of 1

Analysis requested: FAA **Date:** 4/17/2025

Relinq'd by/Signature: **Date/Time:** 4/17/2025

Received by/Signature: LAURA C **Date/Time:** 4/18/25 1115

Email ALL INVOICES to: seattleap@pbsusa.com

E-mail results to:

- ☐ Willem Mager
- ☐ Gregg Middaugh
- ☒ Ryan Hunter
- ☐ Janet Murphy
- ☐ Toan Nguyen
- ☐ Peter Stensland
- ☐ Kunga Woser
- ☐ Ferman Fletcher
- ☒ Cameron Budnick
- ☐ Katie King
- ☐ Nick San
- ☐ James Haven
- ☐ Kameron DeMonnin
- ☐ _____

TURN AROUND TIME:

- ☐ 1 Hour
- ☐ 2 Hours
- ☐ 4 Hours
- ☐ 24 Hours
- ☐ 48 Hours
- ☐ 3 Days
- ☒ 5 Days
- ☐ Other_____

SAMPLE DATA FORM			
Sample #	**Material**	**Location**	**Lab**
FAA-01	White / Plaster / Wall	Freight elevator hallway at room 135	NVL

Appendix E
Certifications

THIS IS TO CERTIFY THAT

CAMERON BUDNICK

HAS SUCCESSFULLY COMPLETED THE TRAINING COURSE

for

ONLINE AHERA ASBESTOS INSPECTOR REFRESHER

In accordance with TSCA Title II, Part 763, Subpart E, Appendix C of 40 CFR

Course Date: 09/24/2024

Course Location: Online

Certificate: IRO-24-9630B

For verification of the authenticity of this certificate contact:
PBS Engineering and Environmental Inc.
4412 S Corbett Avenue
Portland, OR 97239
503.248.1939

PBS
AN APEX COMPANY

CCB #SRA0615 4-Hr Training

4-Hour Online AHERA Inspector Refresher Training; AHERA is the Asbestos Hazard Emergency Response Act enacting Title II of Toxic Substance Control Act (TSCA)

Expiration Date: 09/24/2025

Andy Fridley, Instructor