


IF SWITCH

P_JN: 100mW----Att: 20dB ----> R4: 270R
P_JN: 1W ----Att: 30dB ----> R4: 820R


Install R4 is TRX has a Positive Tension on Antenna Coax when Tx (FT290 / FT790)

All Capacitors 0603
All Inductors 0603 or 0805
All Resistors 0805 except R1, R3 and R5 that must be 1206

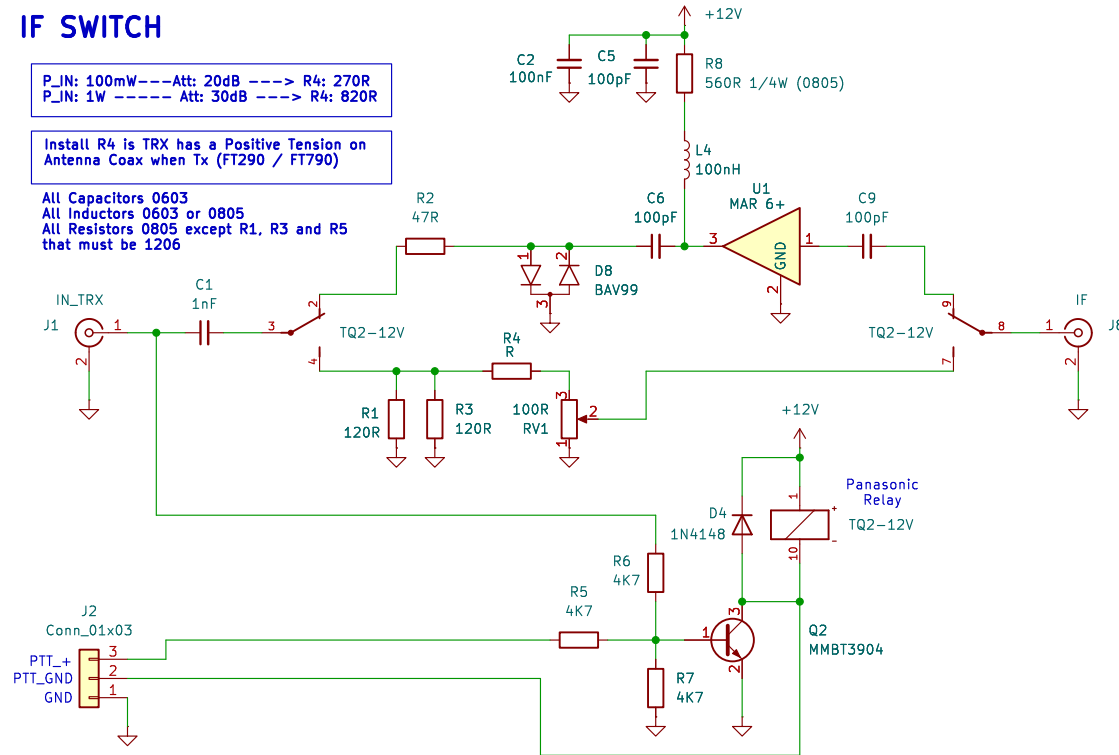

MIXER & ANTENNA

All Capacitors 0603
All Inductors 0603

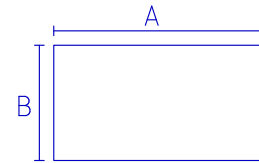


WAVE GUIDE


HARMONIC MIXER
x2
 $10.368 - (2 \times 5.112) = 144 \text{ MHz}$

IF f=144MHz

LO= fx2= 5.112GHz J10

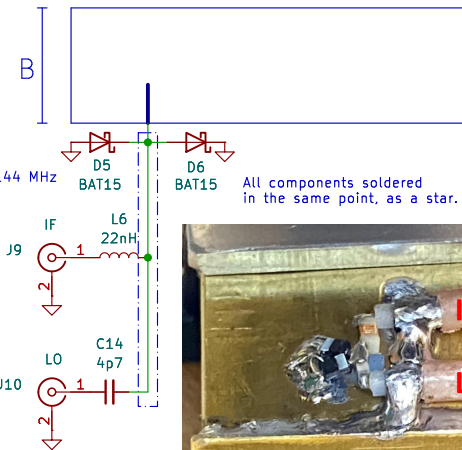


All components soldered in the same point, as a star.

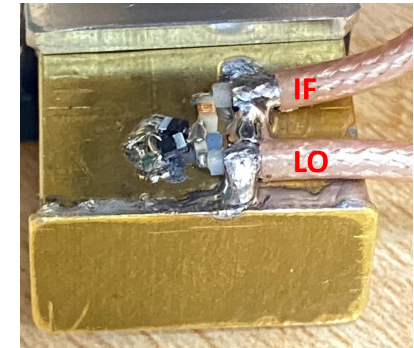

LO DOUBLER


All Capacitors 0603
All Inductors 0603

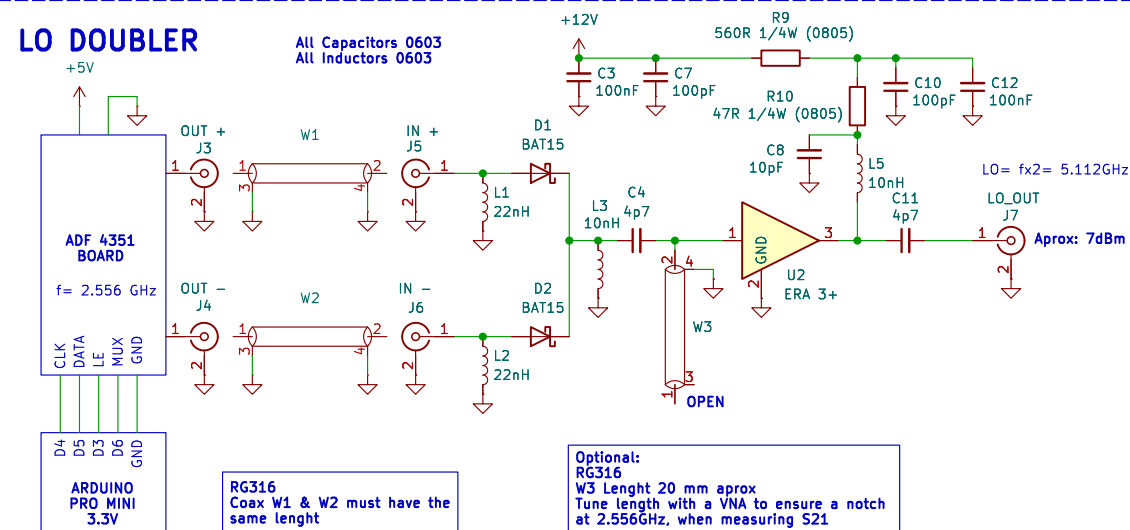

RG316
Coax W1 & W2 must have the same lenght

Optional:
RG316
W3 Lenght 20 mm aprox
Tune length with a VNA to ensure a notch at 2.556GHz, when measuring S21

POWER SUPPLY

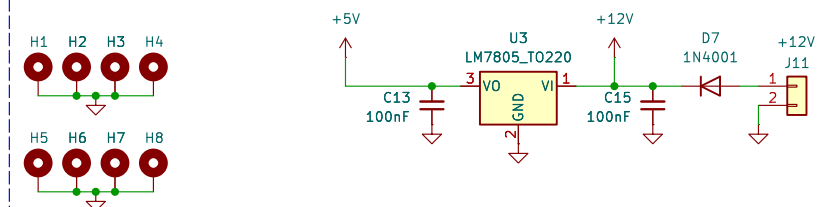

10 GHz NESTRANSVERTER
CT1DMK

Schematic by EA4BFK

Sheet: /
File: NESTRANSVERTER_LC.kicad_sch

Title: NESTRANSVERTER 10 GHz

Size: A4
KiCad E.D.A. 8.0.9

Rev: 1.1
Id: 1/1