


E-006 PLC OUTPUTS

Conv\_Simple / CV-101 (garage conveyor) — O-00..O-06 · pilots, contactor coil, button lamp · GS10 control = Modbus (E-007), NO GS10 DI wiring

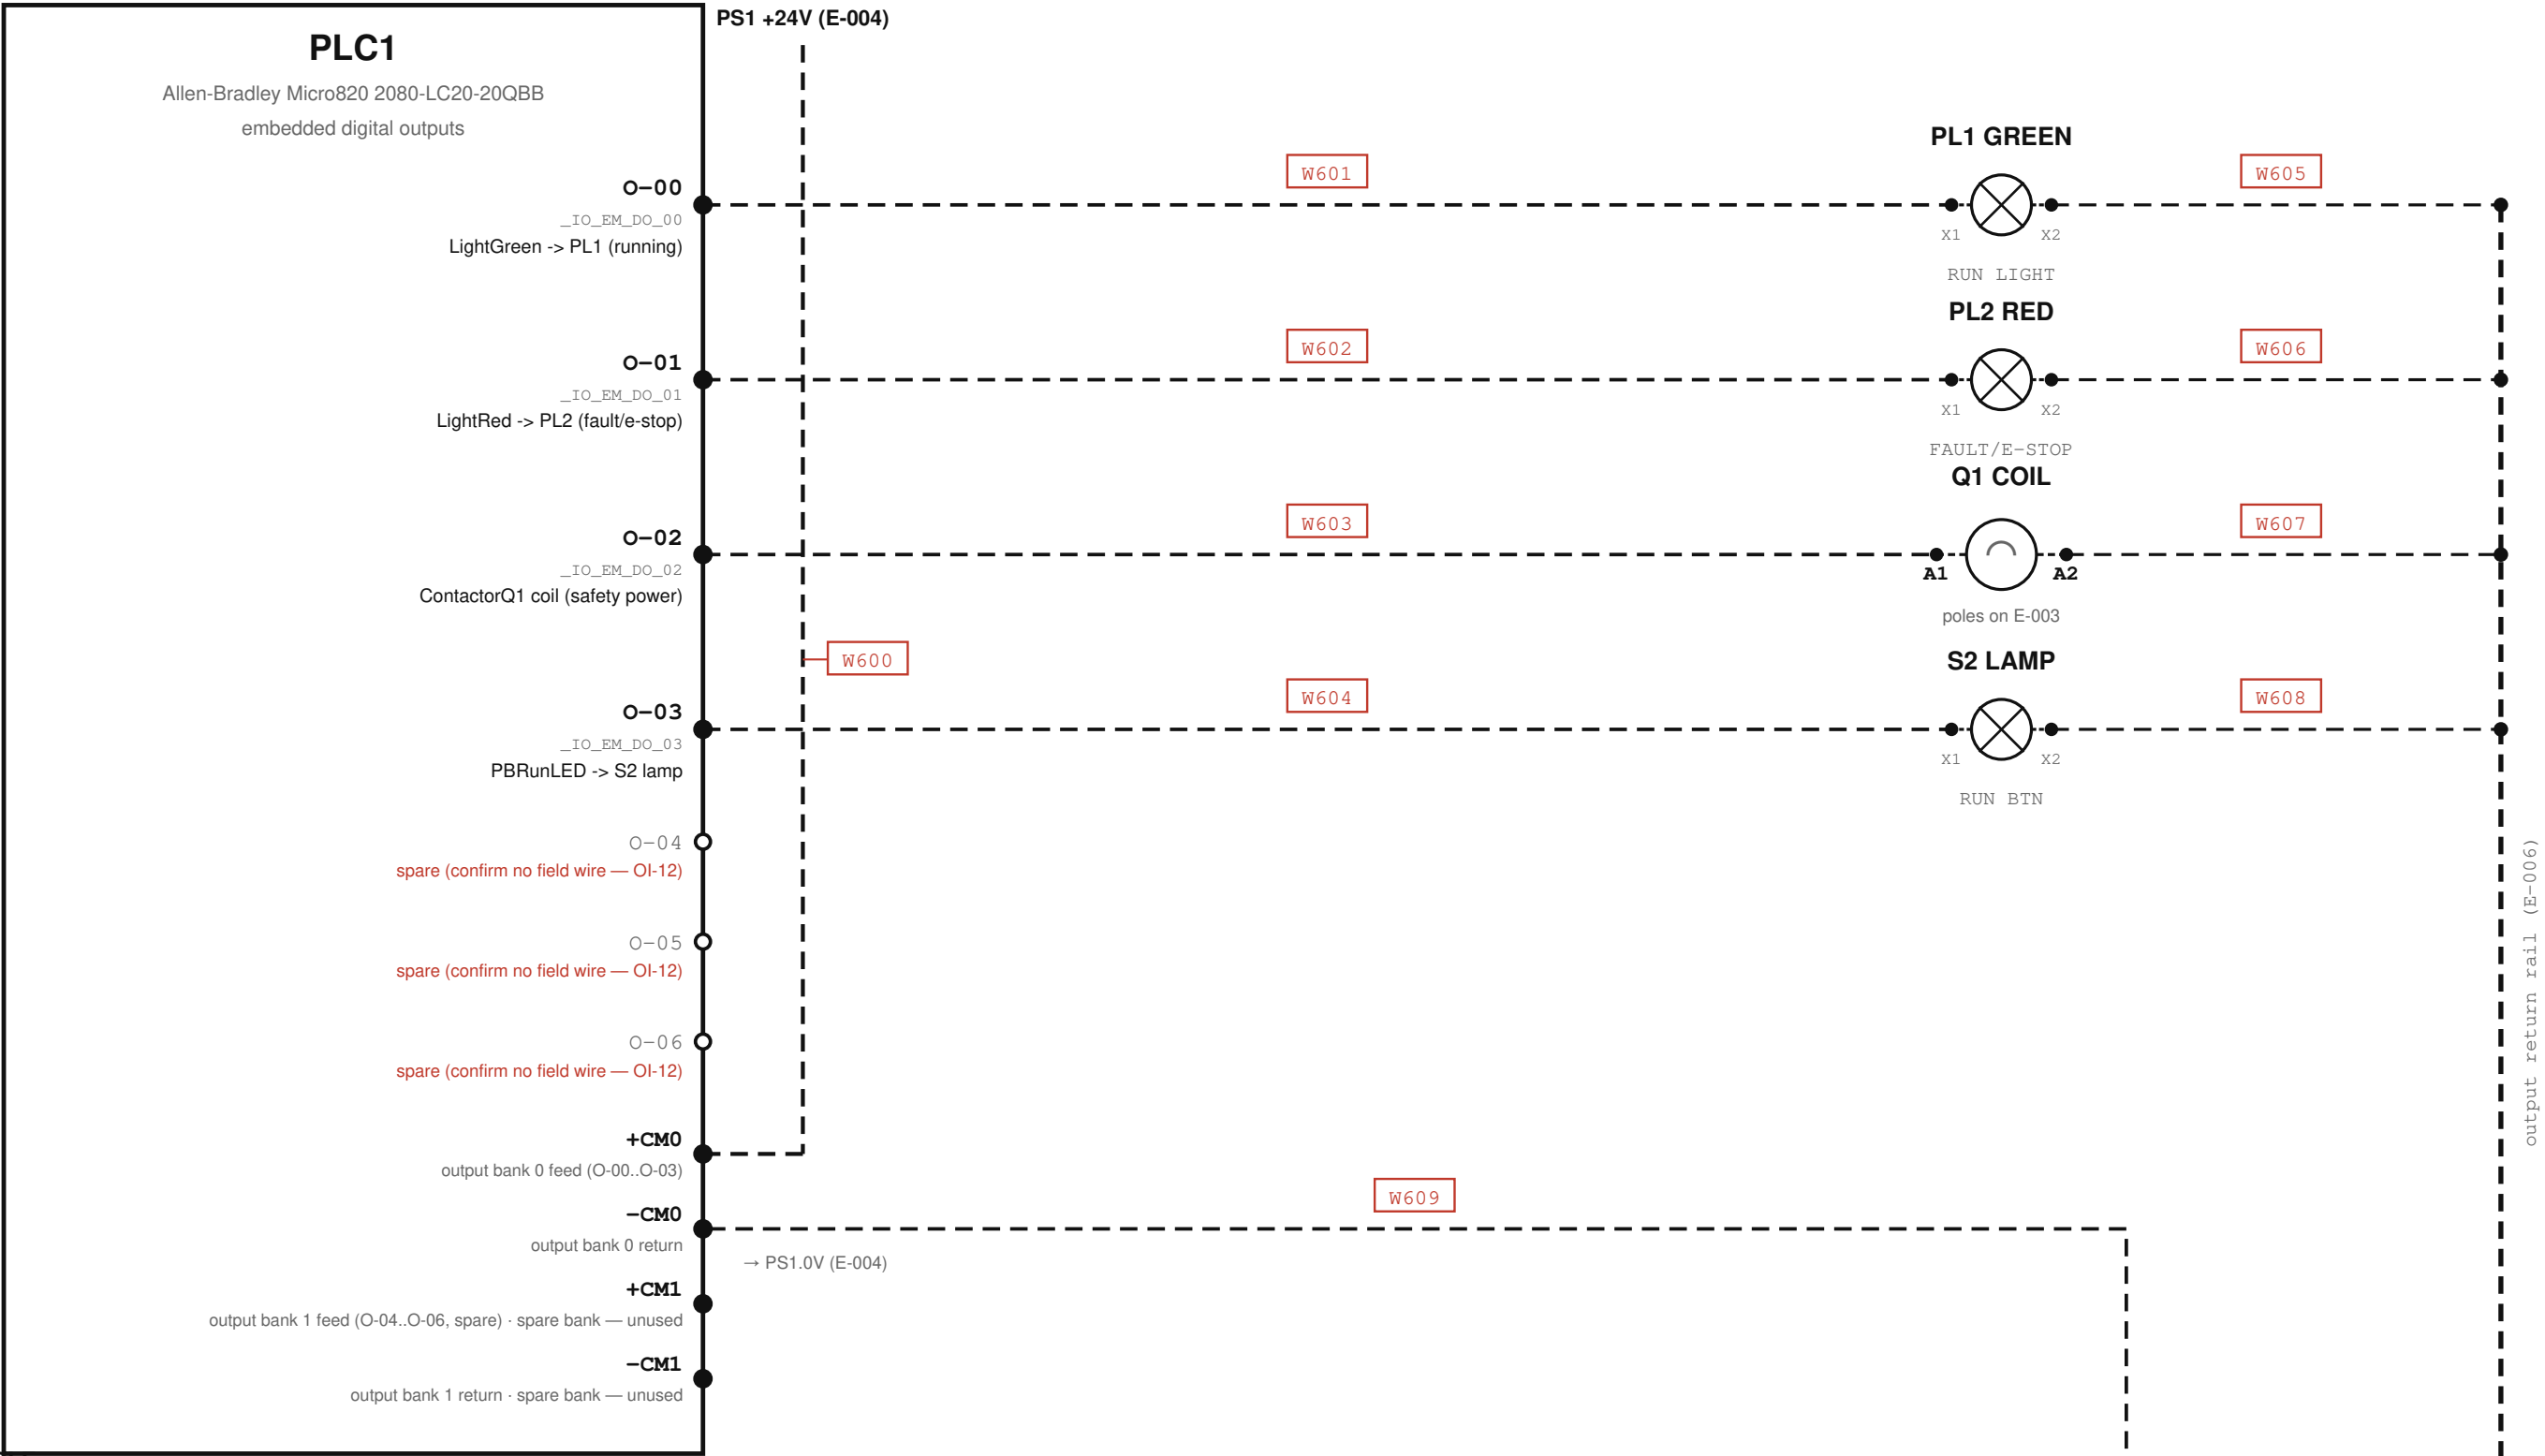

Hardwired fallback documented in MIRA-WI-001 v3 §3 Fig 1 (DO\_03..DO\_07 → GS10 DI1..DI5 + DCM) — NOT ACTIVE and NOT drawn: P02.0x at factory default per the 2026-05-20 parameter export; DO\_07 does not exist on the 2080-LC20-20QBB (O-00..O-06); DO\_03 collides with PBRunLED in the live I/O map. Bench presence of any such wiring = FIELD VERIFY (OI-18).

- SAFETY**
- Monitored outputs are NOT a safety function.
  - E-stop must remove power per NFPA 79.
  - Q1 drop path is the power-removal; verify it works.

- NOTES**
- GS10 run/dir/freq = Modbus — see E-007 (P00.20=1, P00.21=2 per 2026-05-20 parameter export)
  - No as-built: O-00/O-01/O-03 from CCW v4.0; O-02 corroborated by live Prog\_init v2.1.

**SOURCES:**  
CCW\_VARIABLES\_v4.0.txt  
Prog\_init\_ConvSimple\_v2.1.st  
MIRA\_PLC\_WorkInstruction\_v3.pdf  
GS10\_actual\_parameters\_5.20.26.xlsx  
GS10\_UM.txt

- LEGEND**
- VERIFIED (solid)
  - FIELD VERIFY (dashed)
  - Wxxx proposed wire number (red = unverified)

CONNECTION TABLE

| Wire | From      | To                         | Signal                          | Type           | Status       | Notes |
|------|-----------|----------------------------|---------------------------------|----------------|--------------|-------|
| W600 | PS1.+24V  | PLC1.+CM0                  | output bank 0 feed              | power_24vdc    | field_verify |       |
| W601 | PLC1.O-00 | PL1.X1                     | LightGreen (run light)          | control_output | field_verify |       |
| W602 | PLC1.O-01 | PL2.X1                     | LightRed (fault/e-stop light)   | control_output | field_verify |       |
| W603 | PLC1.O-02 | Q1.A1                      | ContactorQ1 coil (safety power) | control_output | field_verify |       |
| W604 | PLC1.O-03 | S2.X1                      | PBRunLED (run button lamp)      | control_output | field_verify |       |
| W605 | PL1.X2    | output return rail (E-006) | run light return                | control_return | field_verify |       |
| W606 | PL2.X2    | output return rail (E-006) | fault light return              | control_return | field_verify |       |
| W607 | Q1.A2     | output return rail (E-006) | contactor coil return           | control_return | field_verify |       |
| W608 | S2.X2     | output return rail (E-006) | PB lamp return                  | control_return | field_verify |       |
| W609 | PLC1.-CM0 | PS1.0V                     | output bank 0 return            | power_0v       | field_verify |       |

PLC OUTPUTS

Conv\_Simple / CV-101 (garage conveyor)

MIRA / FactoryLM  
output map CCW v4.0 + live Prog\_init; O-02 do-not-reuse (WI-001 p.4)

SHEET  
E-006

REV A  
2026-07-10

6 of 9