


E-003 VFD POWER

Conv_Simple / CV-101 (garage conveyor) — supply → CB1 → Q1 (MC) → VFD1 (GS10) → M1 · every conductor FIELD VERIFY

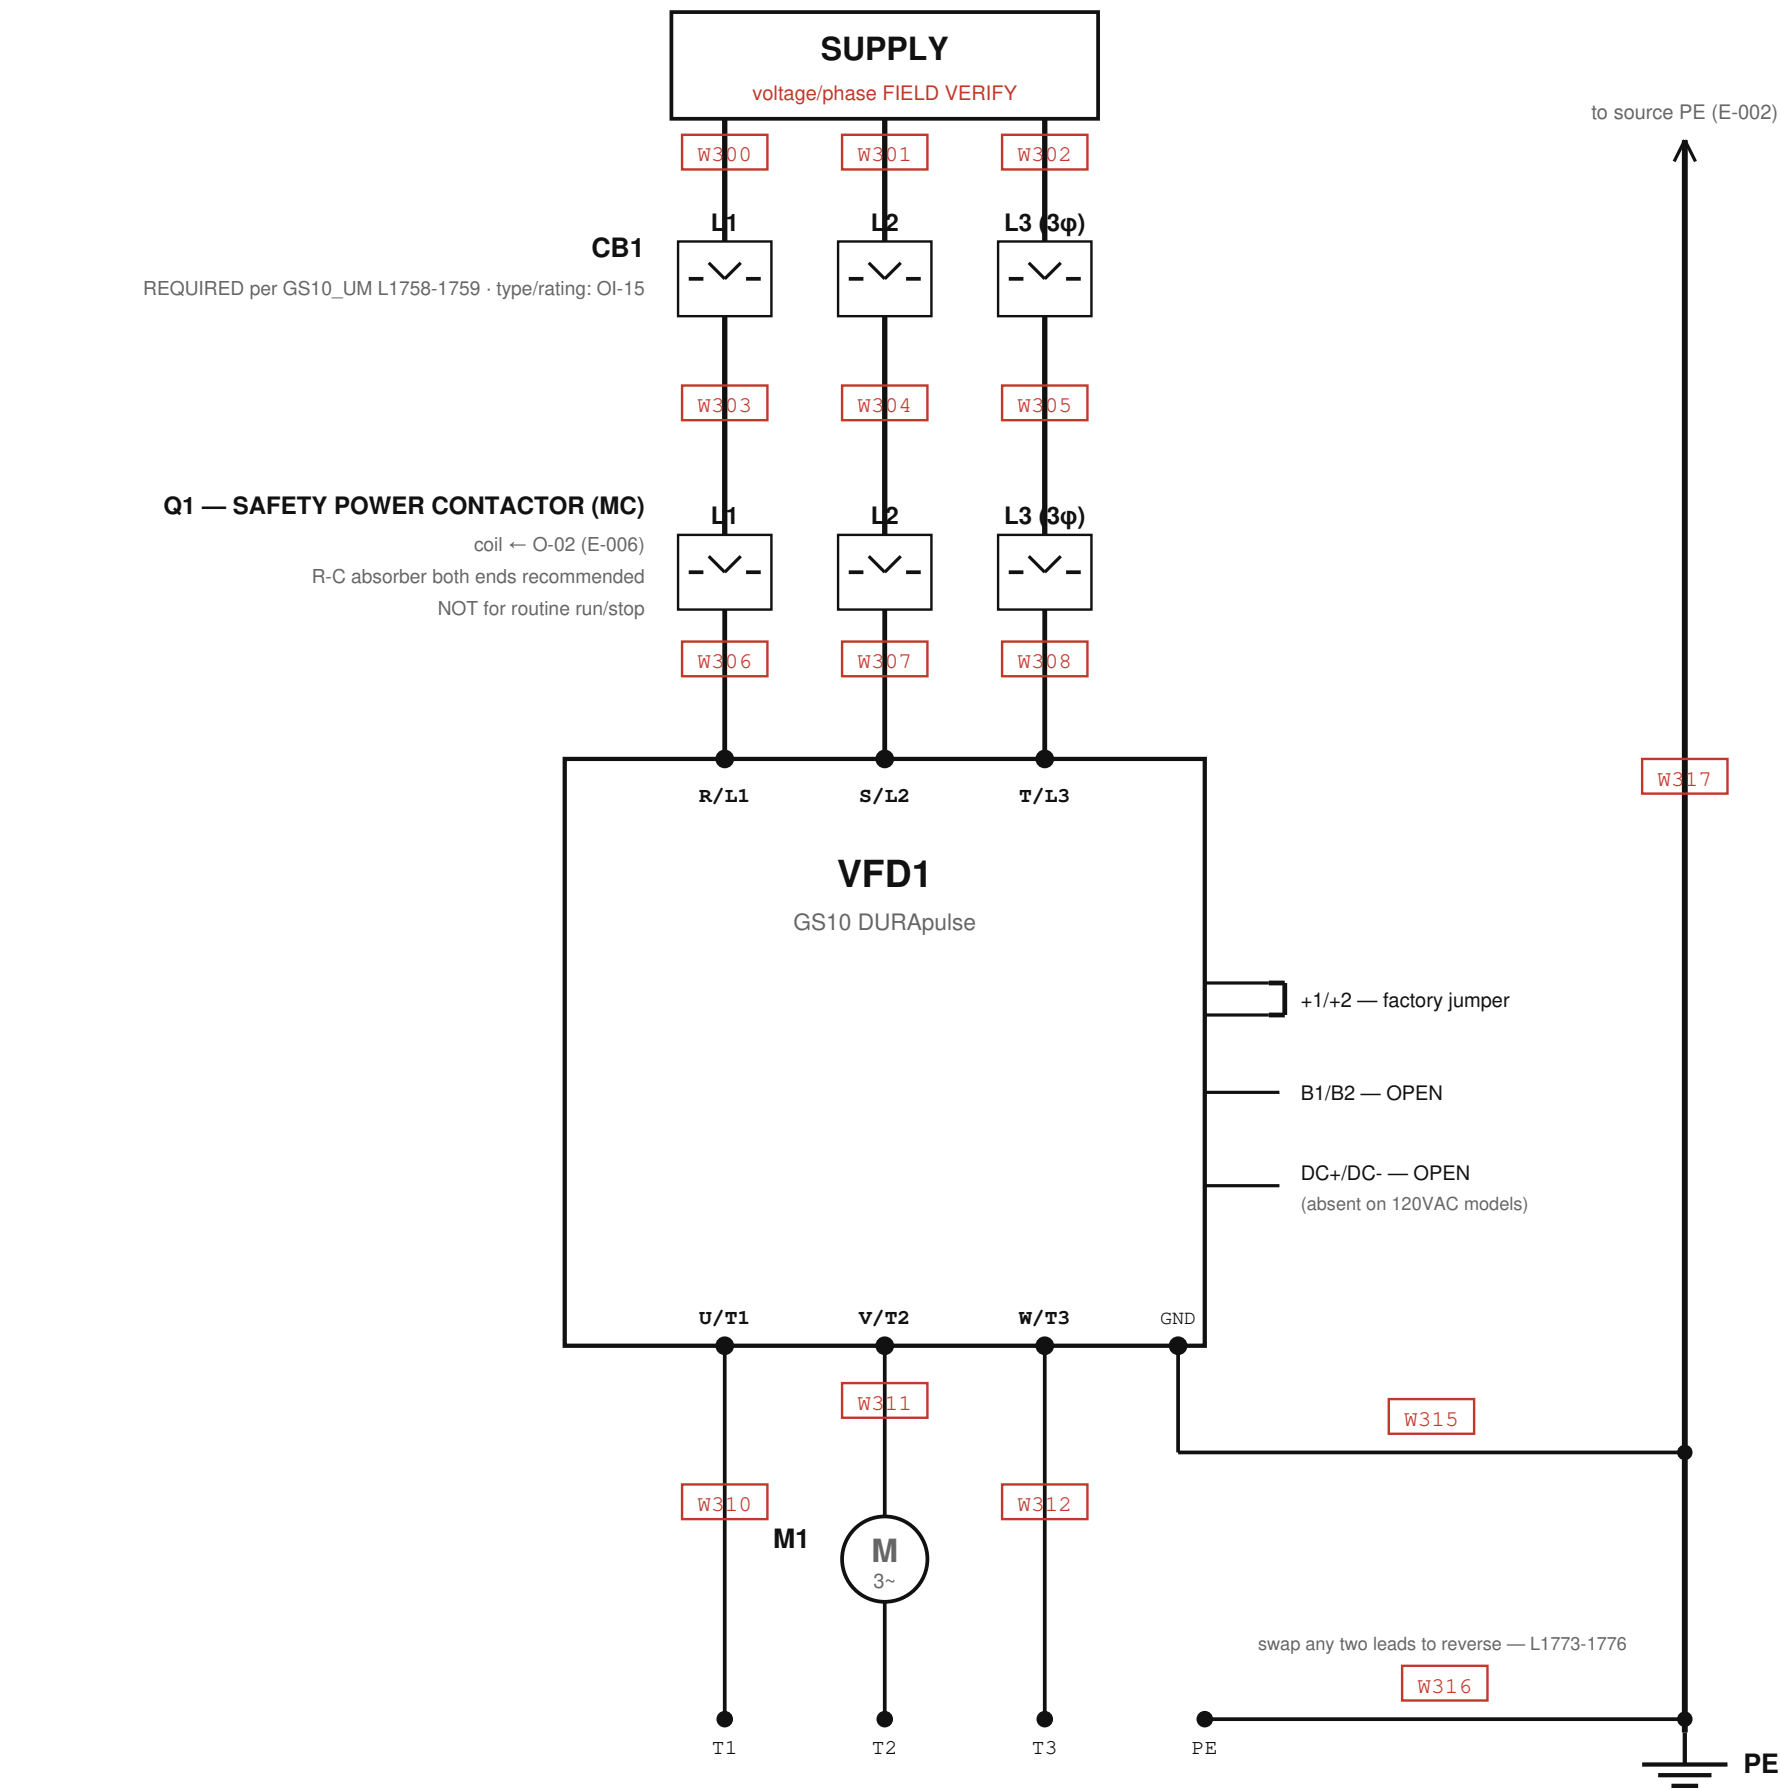

CONNECTION TABLE

Wire	From	To	Signal	Type	Status	Notes
W300	SUPPLY (E-002)	CB1.1	L1 supply	power_line	field_verify	
W301	SUPPLY (E-002)	CB1.3	L2/N supply	power_line	field_verify	
W302	SUPPLY (E-002)	CB1.5	L3 supply (if 3φ)	power_line	field_verify	phase count unknown
W303	CB1.2	Q1.1	L1 protected	power_line	field_verify	
W304	CB1.4	Q1.3	L2 protected	power_line	field_verify	
W305	CB1.6	Q1.5	L3 protected (if 3φ)	power_line	field_verify	phase count unknown
W306	Q1.2	VFD1.R/L1	L1 switched	power_line	field_verify	power ⊥ control — L1787
W307	Q1.4	VFD1.S/L2	L2 switched	power_line	field_verify	
W308	Q1.6	VFD1.T/L3	L3 switched (if 3φ)	power_line	field_verify	phase count unknown
W310	VFD1.U/T1	M1.T1	motor phase U	motor_lead	field_verify	
W311	VFD1.V/T2	M1.T2	motor phase V	motor_lead	field_verify	
W312	VFD1.W/T3	M1.T3	motor phase W	motor_lead	field_verify	
W315	VFD1.GND	PE bus	drive PE (≤0.1Ω)	ground	field_verify	
W316	M1.PE	PE bus	motor frame PE	ground	field_verify	
W317	PE bus	SUPPLY (E-002)	PE to source	ground	field_verify	

SAFETY NOTES

- Never start/stop via input power (L1811-1813); the MC (Q1) is emergency/safety switching only (L1754-1757).
- LOTO + wait ≥5 min for DC-bus discharge before touching (WI p.2 §2).
- Monitored e-stop is NOT a safety stop — hardwire S0 to remove drive power per NFPA 79 / EN 60204-1.
- PE resistance ≤0.1Ω (L1760-61); shield/conduit bonded both ends (L1792-95); RFI jumper in/out FIELD VERIFY (L1693-1718, OI-17).

- VERIFIED — solid (no E-003 conductor qualifies yet; terminal names verified via table sources)
- FIELD VERIFY — dashed + red wire flag (all E-003 conductors; wire numbers PROPOSED — OI-19)

SOURCES: plc/GS10_UM.txt (terminals L1971-1986; topology L1750-1813) · plc/GS10_Integration_Guide.md (Q1 phase-5 test)
plc/Prog_init_ConvSimple_v2.1.st (vfd_run_permit) · plc/MIRA_PL_C_WorkInstruction_v3.pdf (LOTO §2)

VFD POWER

Conv_Simple / CV-101 (garage conveyor)

MIRA / FactoryLM

terminals per GS10 UM 1st Ed Rev B;
MC placement per manual recommendation; as-built UNVERIFIED

SHEET

E-003

REV A

2026-07-10

3 of 9