


Design Title : TABLE 5.scene
Revision Level :
Approved by :
Designer :
Company :
Address :
E-Mail :
Phone :
Date : 2025-06-19

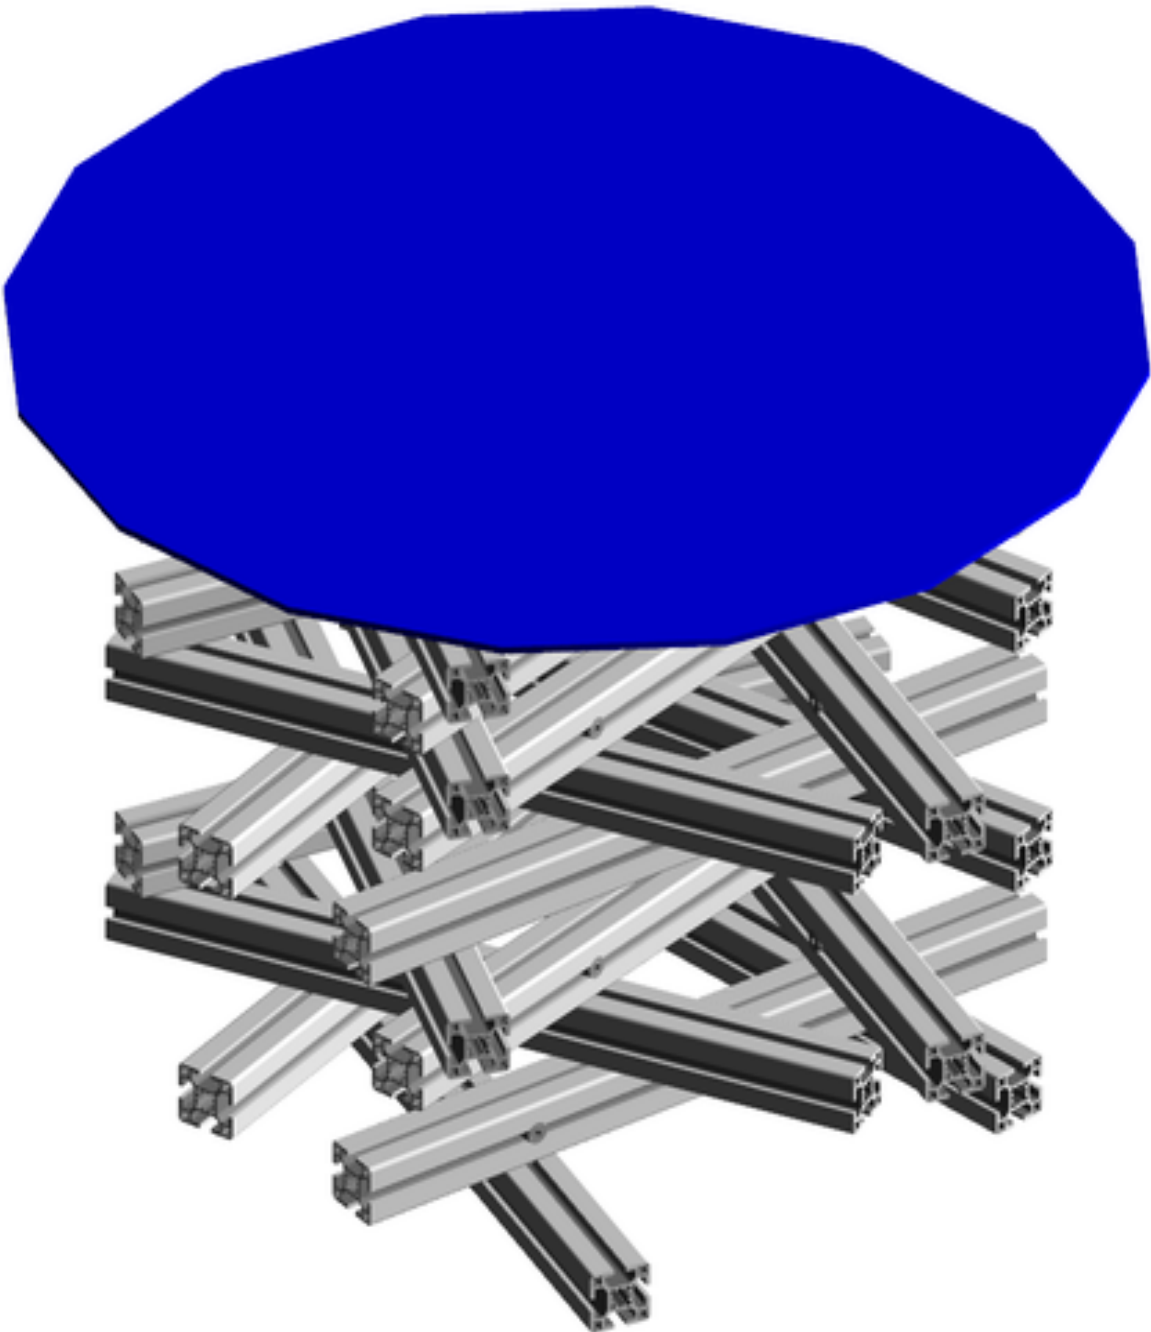


Bill of materials (Number of kits: 1)


Pos	Article-No	Description	Units	Qty
1	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain **PER DRAWING 1**	MM	1
1.A	ZA3/123.4	Parallel-connector distance left: 123.4 mm, anchor on side: 2	EA	1
1.B	ZA3/404.3	Parallel-connector distance left: 404.3 mm, anchor on side: 2	EA	1
2	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain **PER DRAWING 2**	MM	1
2.A	ZA3/95.7	Parallel-connector distance left: 95.7 mm, anchor on side: 2	EA	1
2.B	ZA3/310.2	Parallel-connector distance left: 310.2 mm, anchor on side: 2	EA	1
3	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain **PER DRAWING 3**	MM	1
3.A	ZA3/46.6	Parallel-connector distance left: 46.6 mm, anchor on side: 2	EA	1
4	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain **PER DRAWING 4**	MM	1
4.A	ZA3/191.7	Parallel-connector distance left: 191.7 mm, anchor on side: 2	EA	1
5	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain **PER DRAWING 5**	MM	2
5.A	ZA3/53.6	Parallel-connector distance left: 53.6 mm, anchor on side: 2	EA	2
5.B	ZA3/339.4	Parallel-connector distance left: 339.4 mm, anchor on side: 2	EA	2
6	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain **PER DRAWING 6**	MM	2
6.A	ZA3/171.6	Parallel-connector distance left: 171.6 mm, anchor on side: 2	EA	2
6.B	ZA3/363.3	Parallel-connector distance left: 363.3 mm, anchor on side: 2	EA	2
7	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain **PER DRAWING 7**	MM	2
7.A	ZA3/164.2	Parallel-connector distance left: 164.2 mm, anchor on side: 2	EA	2
7.B	ZA3/369.3	Parallel-connector distance left: 369.3 mm, anchor on side: 2	EA	2
8	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain **PER DRAWING 8**	MM	2
8.A	ZA3/117.0	Parallel-connector distance left: 117.0 mm, anchor on side: 2	EA	2
8.B	ZA3/481.0	Parallel-connector distance left: 481.0 mm, anchor on side: 2	EA	2
9	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain **PER DRAWING 9**	MM	3
9.A	ZA3/73.6	Parallel-connector distance left: 73.6 mm, anchor on side: 2	EA	3
9.B	ZA3/339.4	Parallel-connector distance left: 339.4 mm, anchor on side: 2	EA	3
10	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain **PER DRAWING 10**	MM	3
10.A	ZA3/171.6	Parallel-connector distance left: 171.6 mm, anchor on side: 2	EA	3
10.B	ZA3/317.4	Parallel-connector distance left: 317.4 mm, anchor on side: 2	EA	3
11	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain	MM	6
12	1.21.4E5	Connector, parallel-square	EA	34

Total Weight: 20.04 kg (44.18 lbs)

Isometric view
Some accessories may not be shown

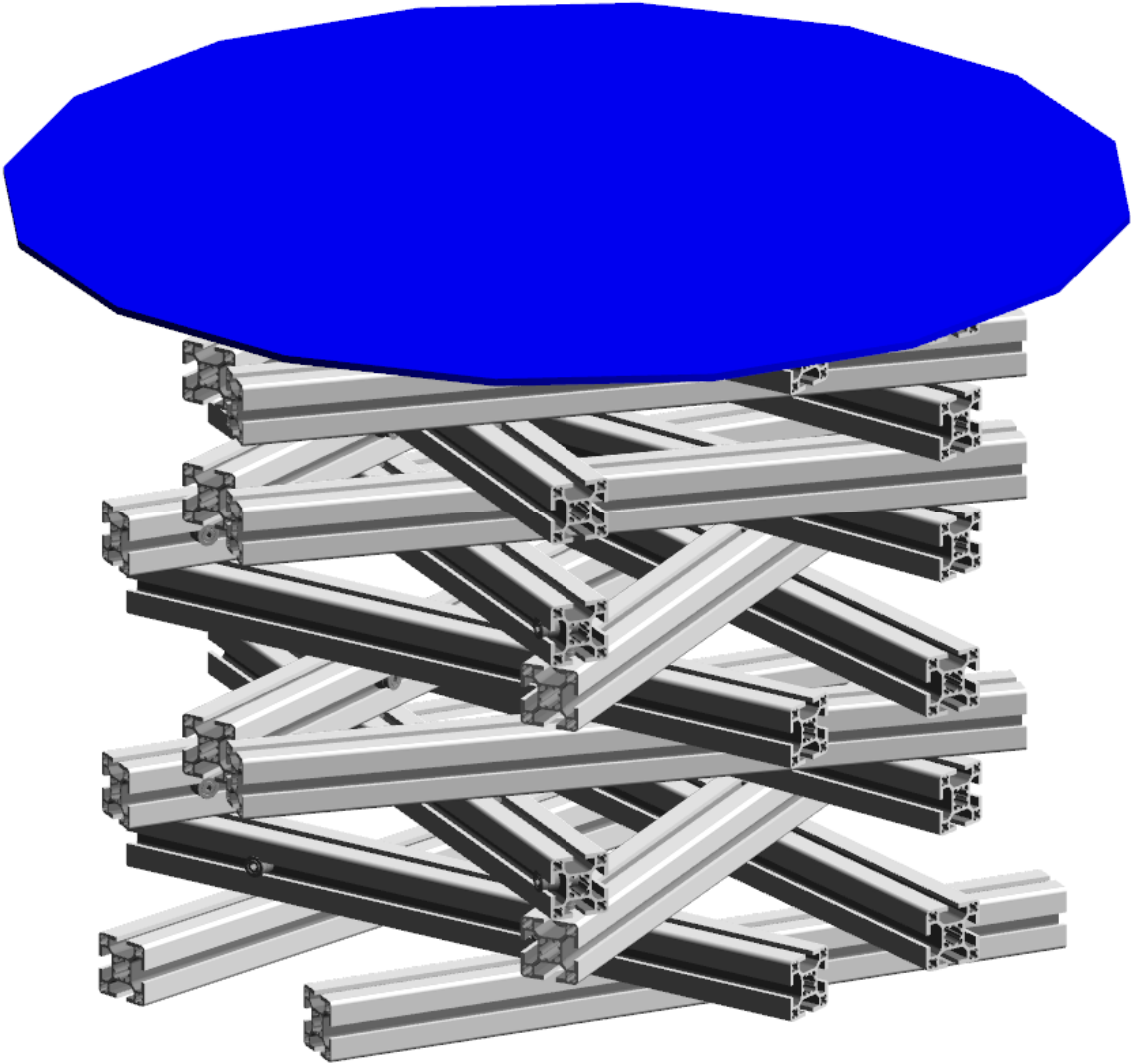


Multiview

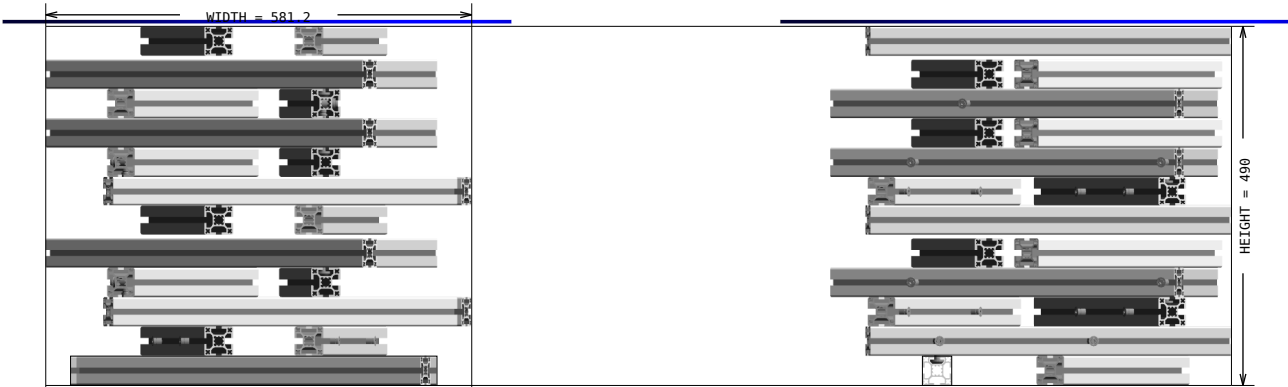


FRONT


LEFT

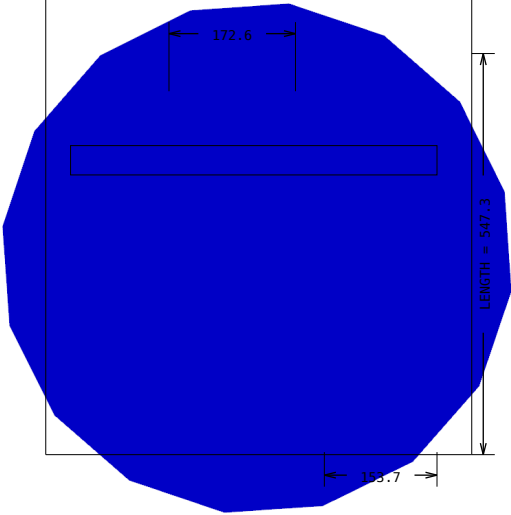



TOP

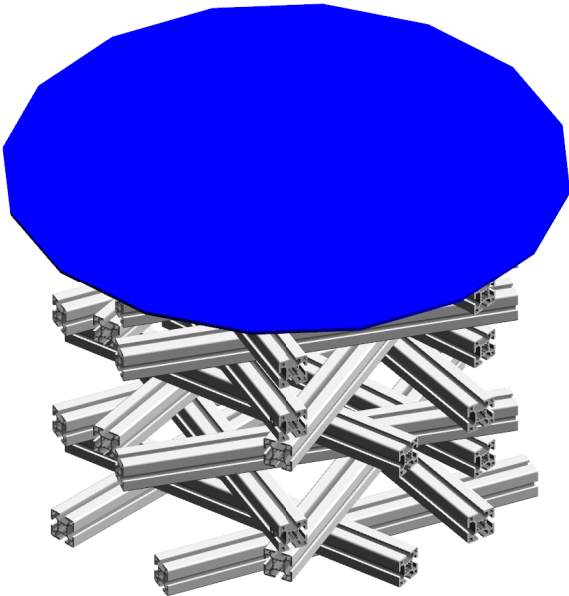


ISOMETRIC

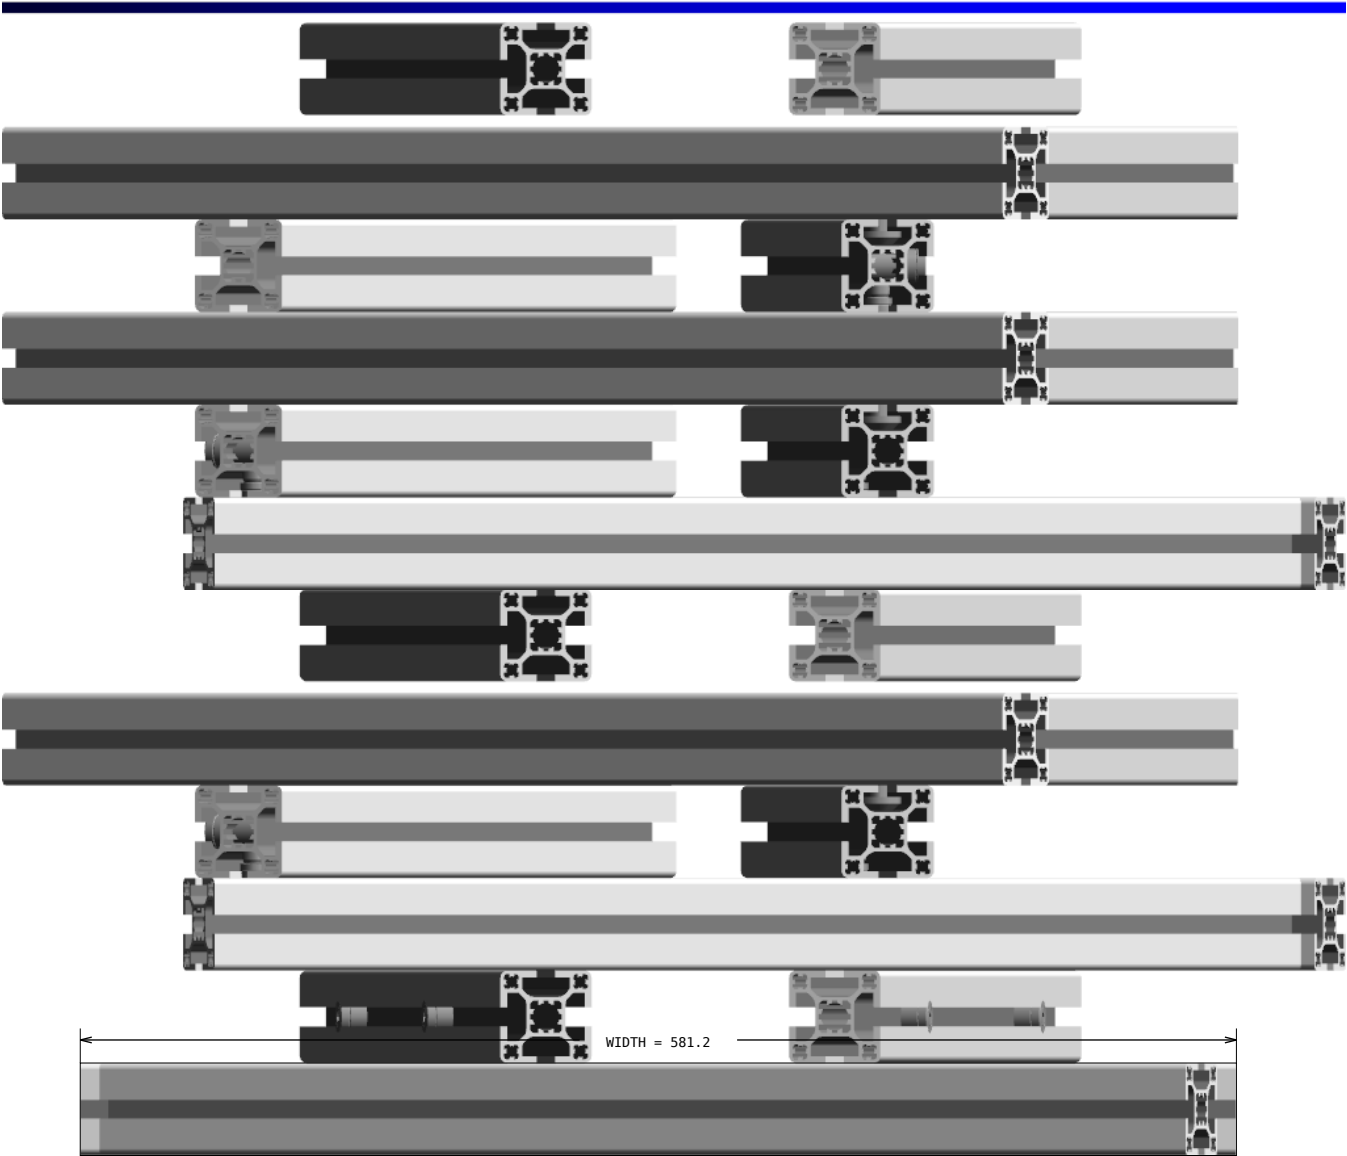

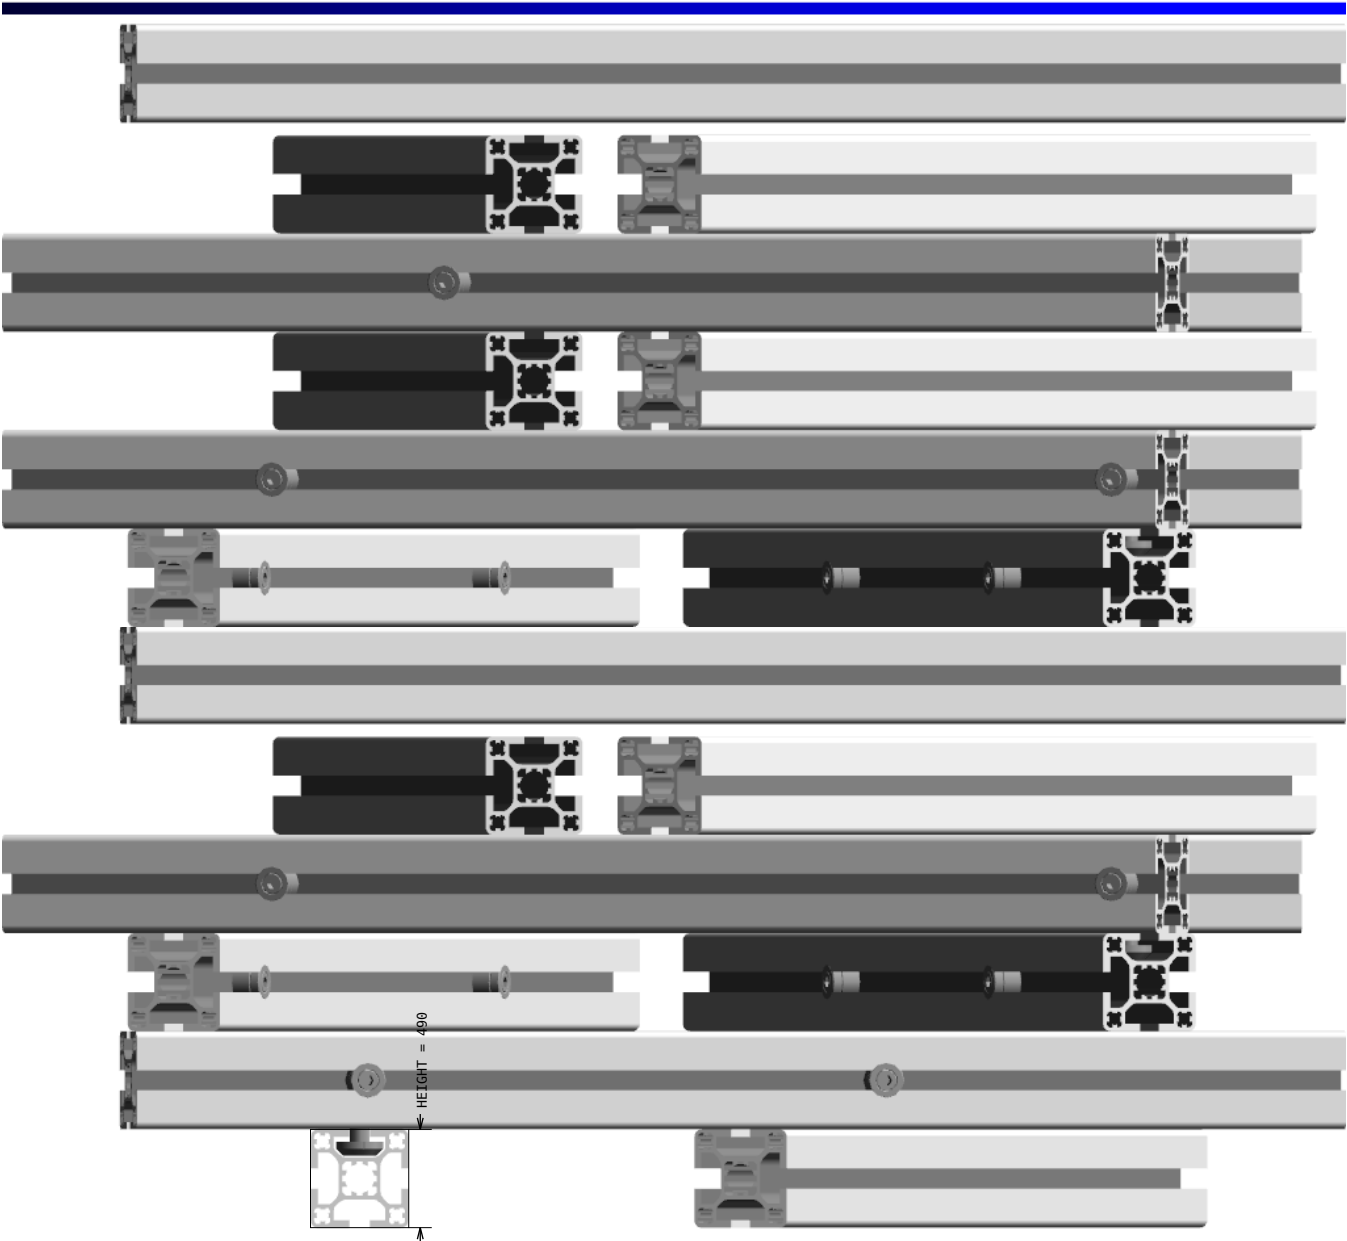

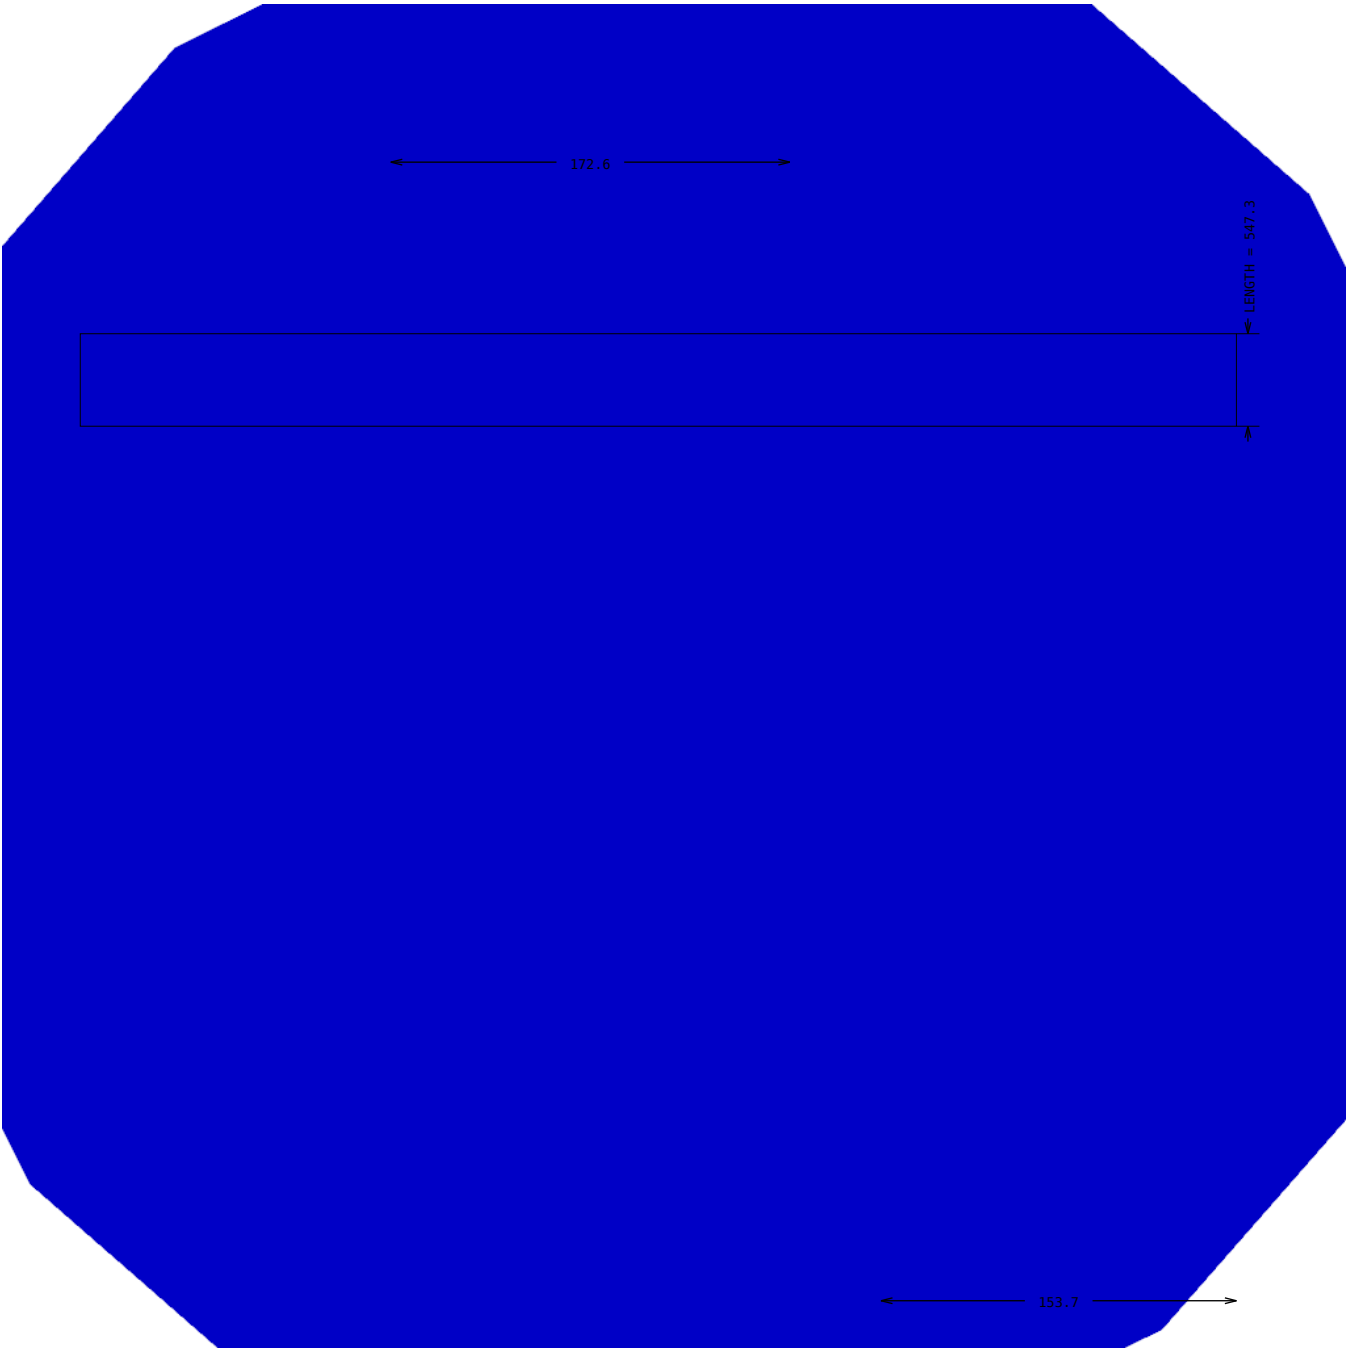

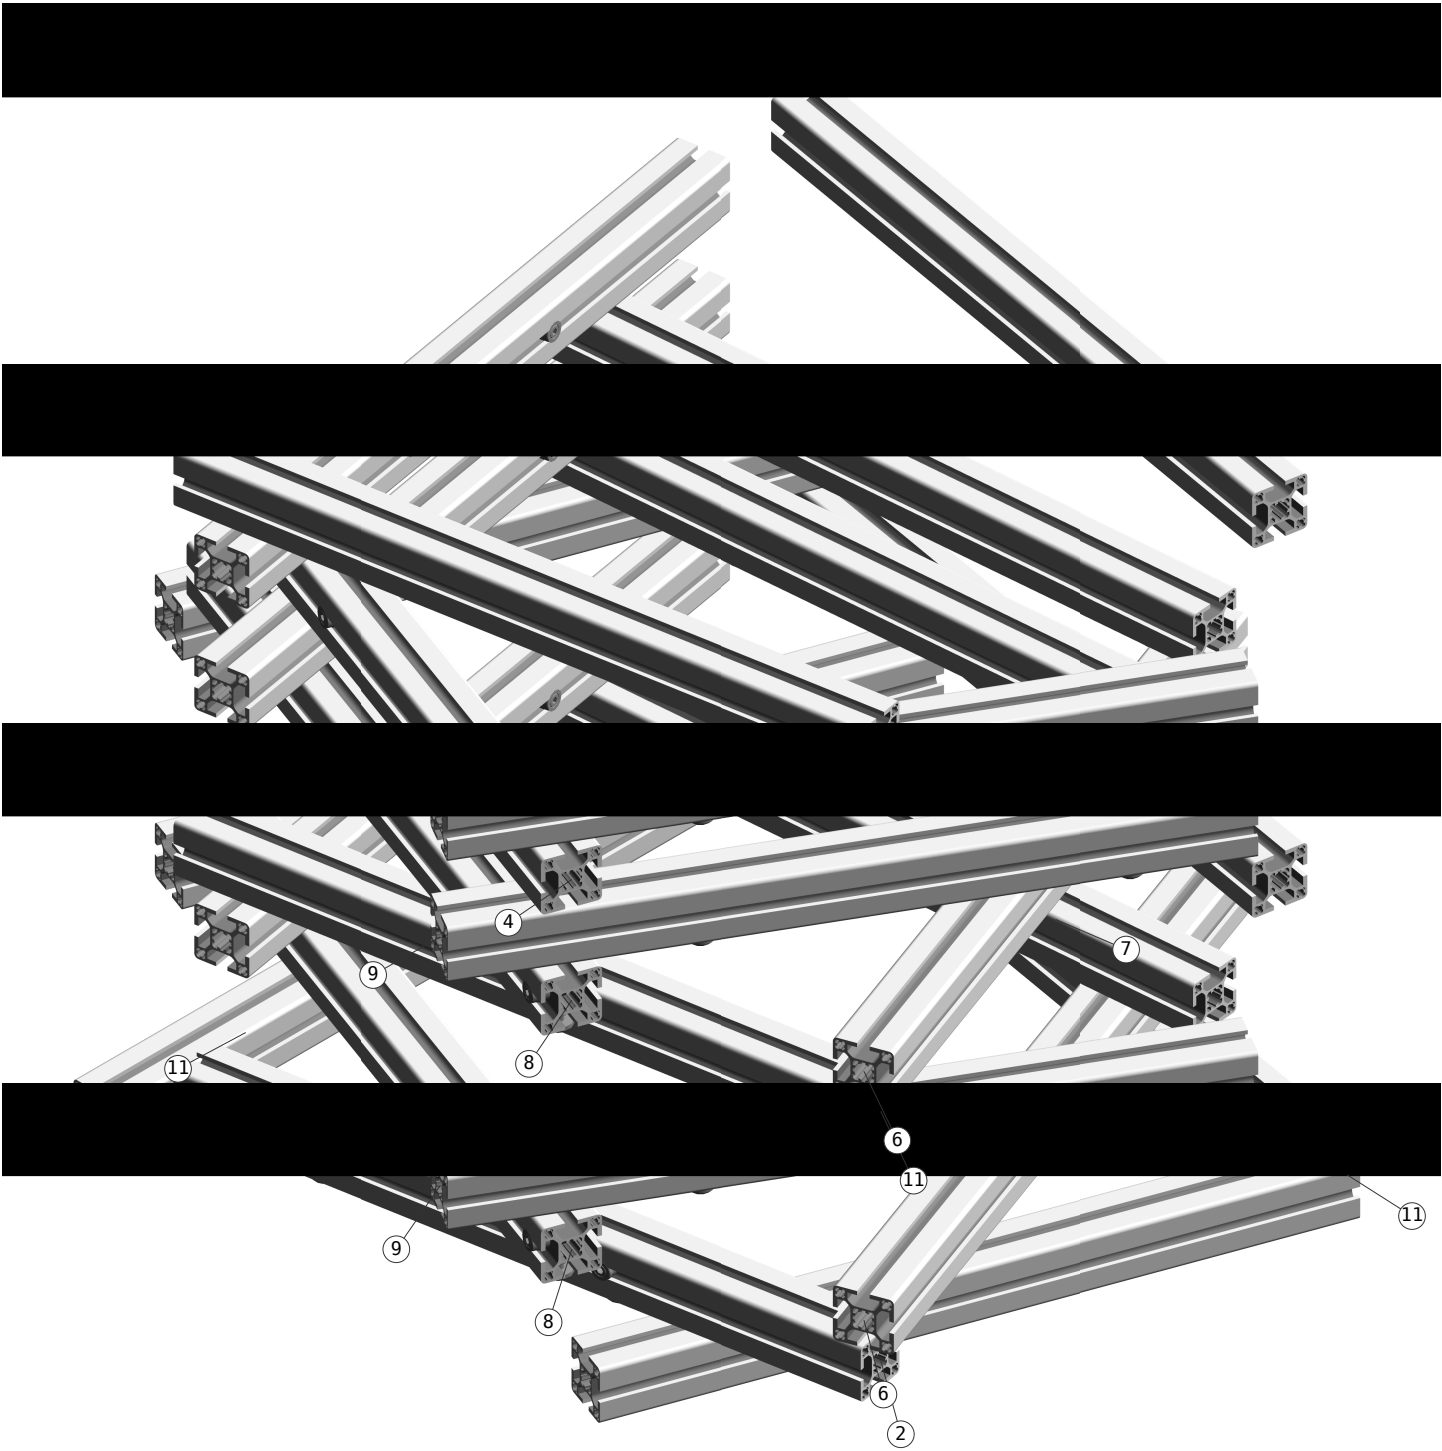

Assembly List


Pos	Article-No	Description	Related parts	Qty
1	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain	1.21.4E5, Connector, parallel-square	2
2	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain	1.21.4E5, Connector, parallel-square	2
3	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain	1.21.4E5, Connector, parallel-square	1
4	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain	1.21.4E5, Connector, parallel-square	1
5	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain	1.21.4E5, Connector, parallel-square	4
6	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain	1.21.4E5, Connector, parallel-square	4
7	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain	1.21.4E5, Connector, parallel-square	4
8	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain	1.21.4E5, Connector, parallel-square	4
9	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain	1.21.4E5, Connector, parallel-square	6
10	1.11.040040.43LP-A00A00/500	Profile 40x40, 4E, light, plain	1.21.4E5, Connector, parallel-square	6

Sliced profile details


Profile machining details




DRAWING 1, Pos 1
SIDE 1, bar length: 500.0 mm

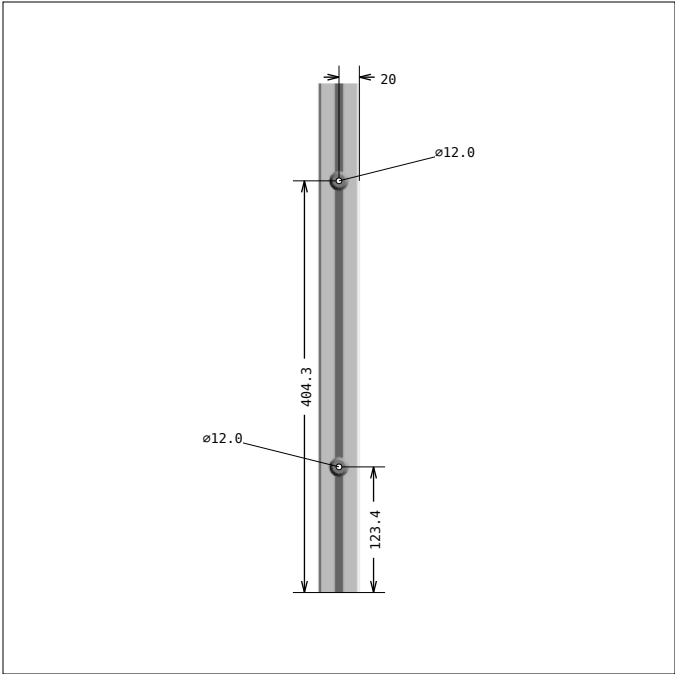

DRAWING 1, Pos 1
SIDE 2

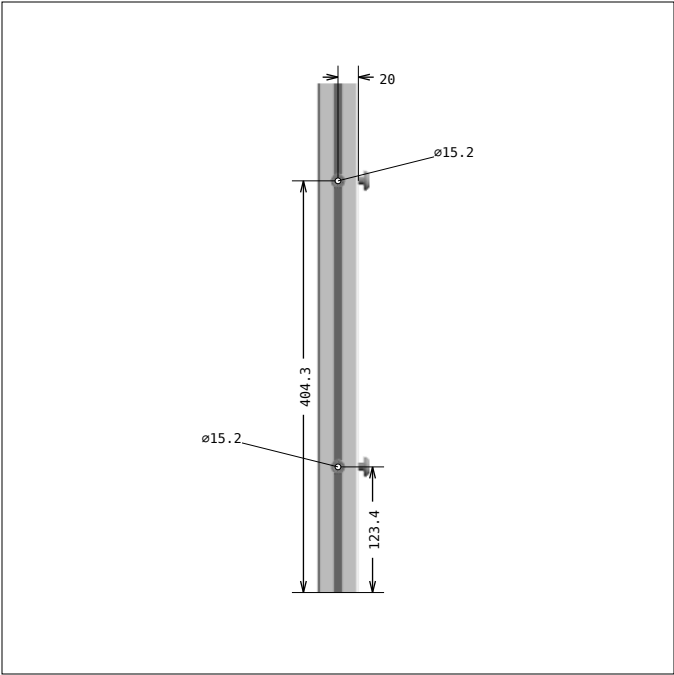

DRAWING 1, Pos 1
SIDE 3




DRAWING 1, Pos 1
SIDE 4

← Profile "left end" is always at the bottom of the drawing. All dimensions are from "left".


Profile machining details




DRAWING 2, Pos 2
SIDE 1, bar length: 500.0 mm

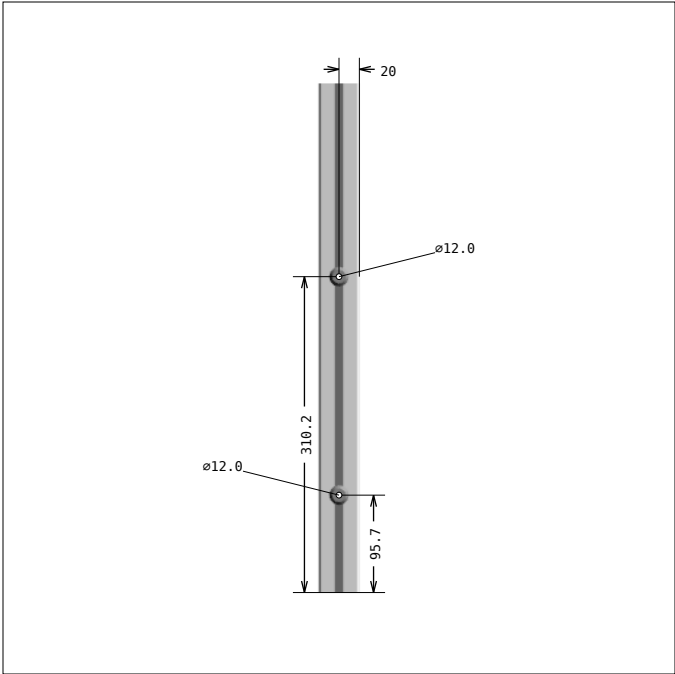

DRAWING 2, Pos 2
SIDE 2

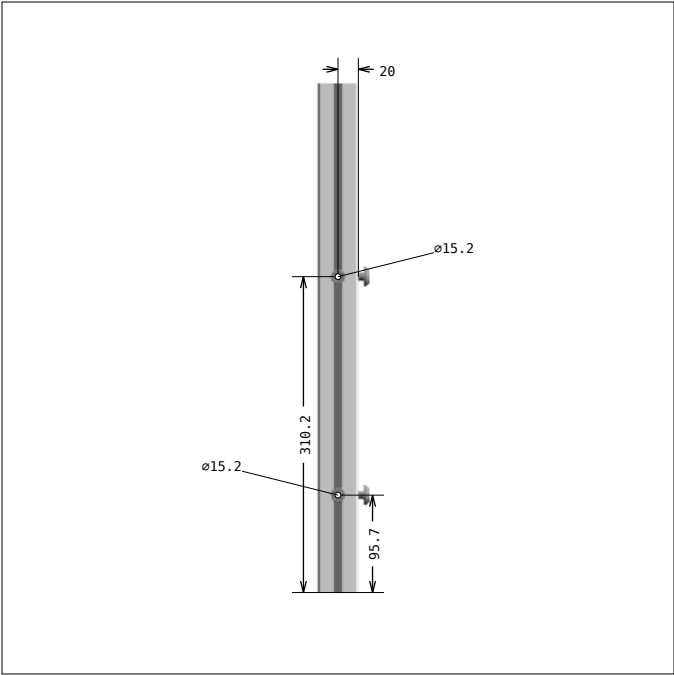

DRAWING 2, Pos 2
SIDE 3




DRAWING 2, Pos 2
SIDE 4

← Profile "left end" is always at the bottom of the drawing. All dimensions are from "left".


Profile machining details




DRAWING 3, Pos 3
SIDE 1, bar length: 500.0 mm

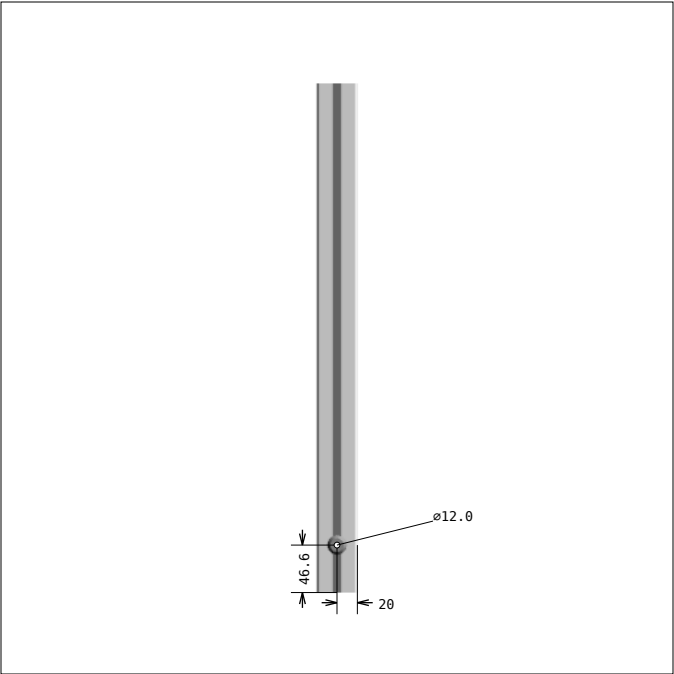

DRAWING 3, Pos 3
SIDE 2

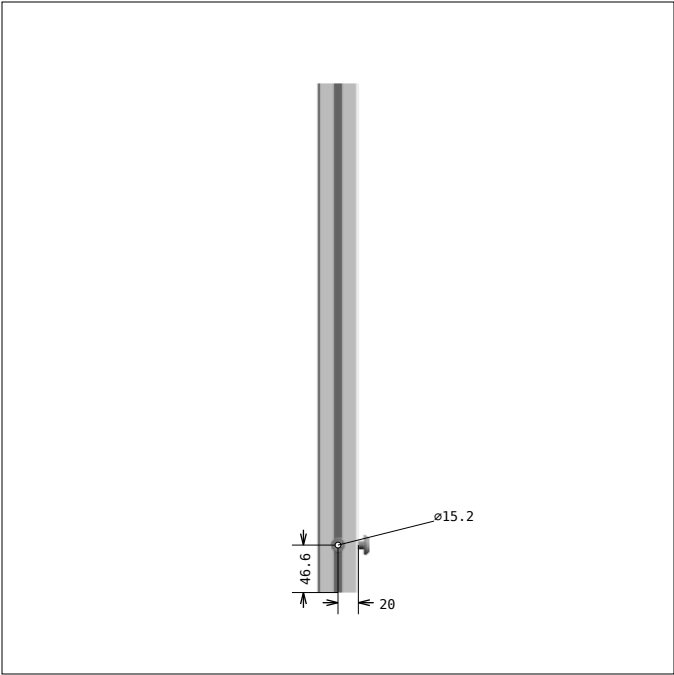

DRAWING 3, Pos 3
SIDE 3




DRAWING 3, Pos 3
SIDE 4

← Profile "left end" is always at the bottom of the drawing. All dimensions are from "left".


Profile machining details




**DRAWING 4, Pos 4
SIDE 1, bar length: 500.0 mm**

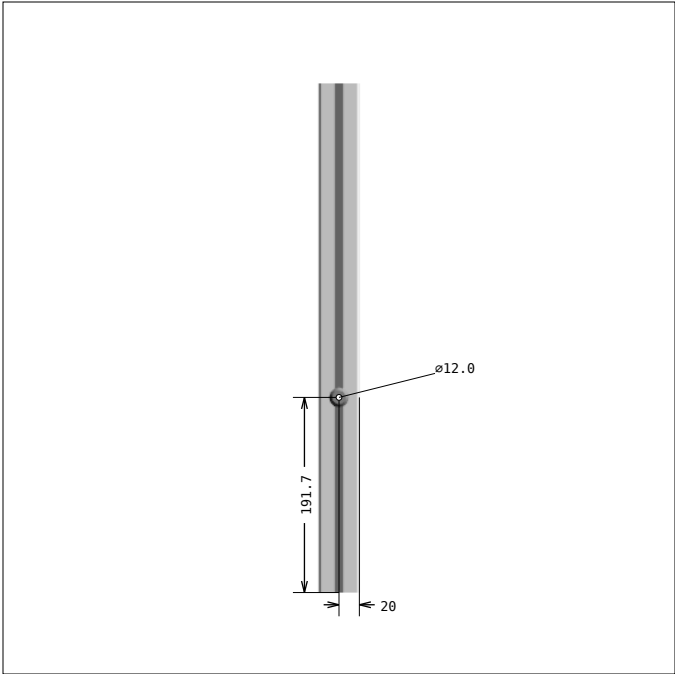

**DRAWING 4, Pos 4
SIDE 2**

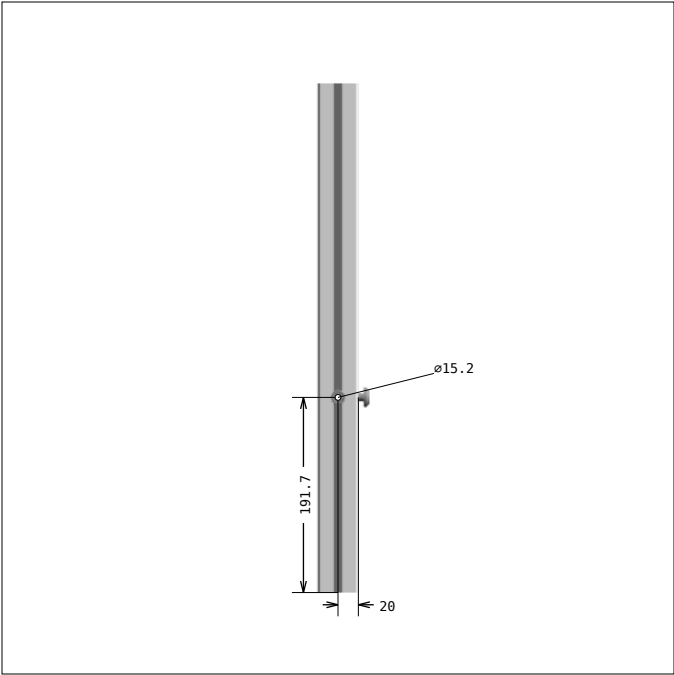

**DRAWING 4, Pos 4
SIDE 3**




**DRAWING 4, Pos 4
SIDE 4**

← Profile "left end" is always at the bottom of the drawing. All dimensions are from "left".


Profile machining details




DRAWING 5, Pos 5
SIDE 1, bar length: 500.0 mm

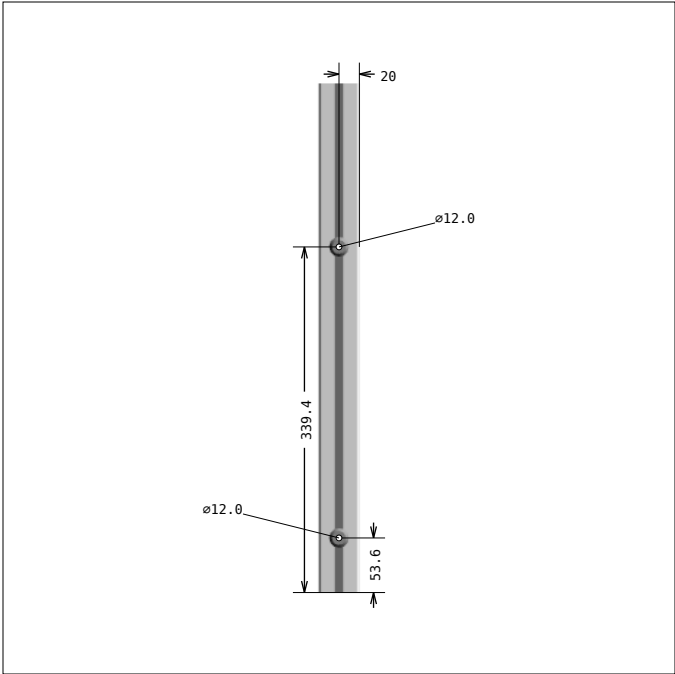

DRAWING 5, Pos 5
SIDE 2

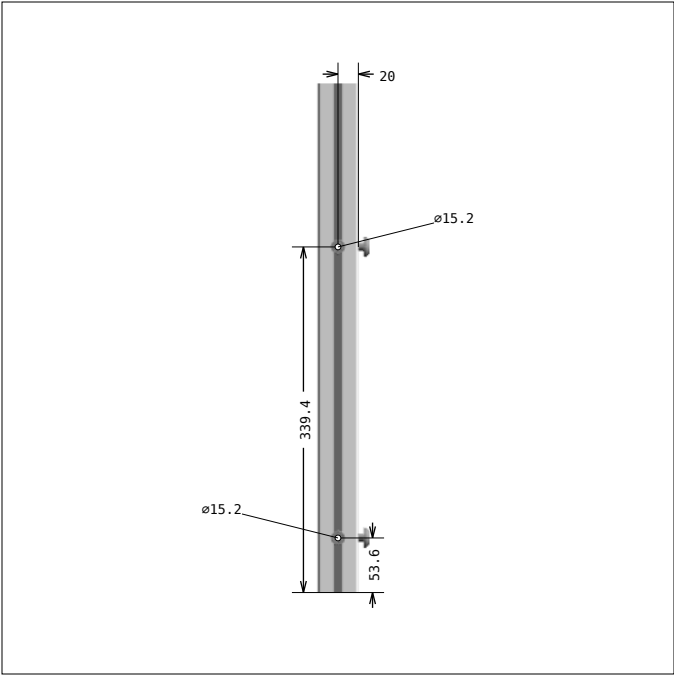


DRAWING 5, Pos 5
SIDE 3




DRAWING 5, Pos 5
SIDE 4

← Profile "left end" is always at the bottom of the drawing. All dimensions are from "left".


Profile machining details

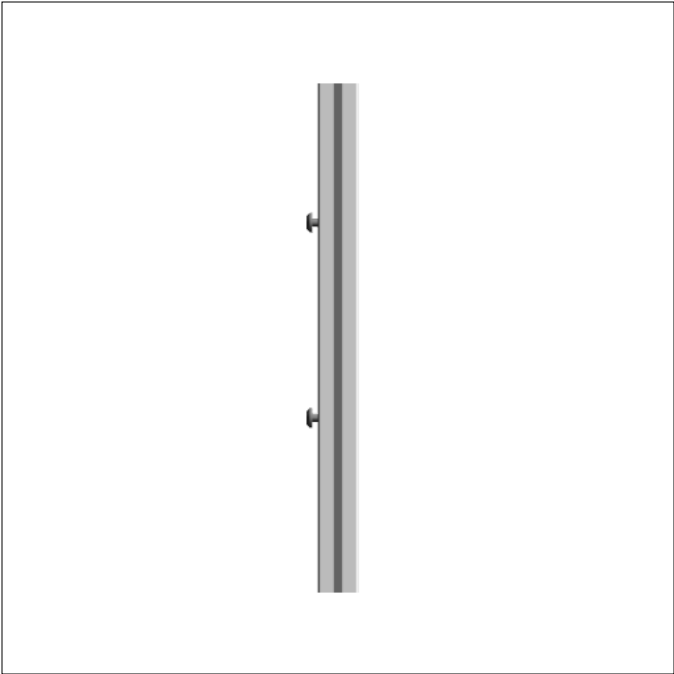


DRAWING 6, Pos 6
SIDE 1, bar length: 500.0 mm

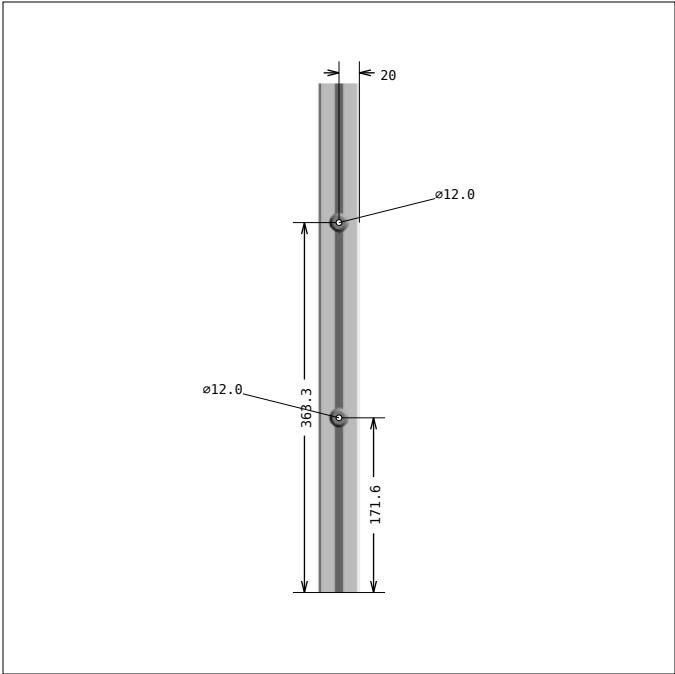

DRAWING 6, Pos 6
SIDE 2

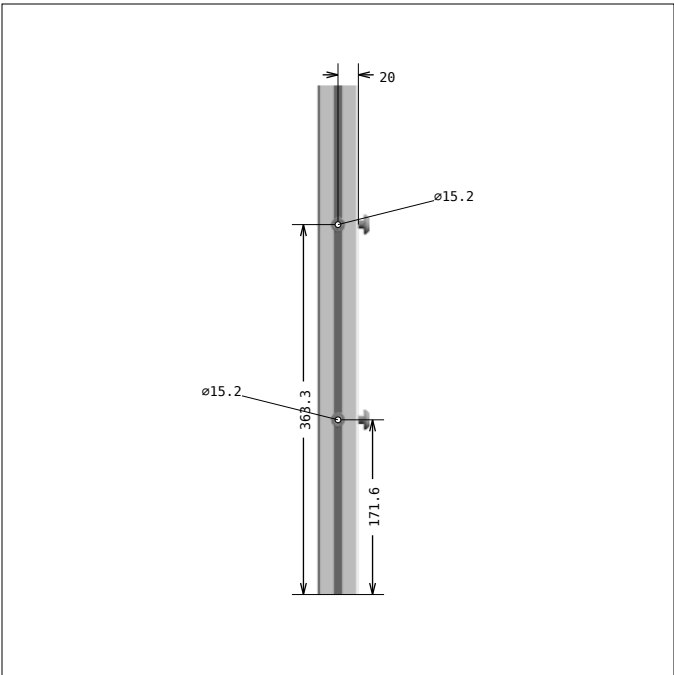


DRAWING 6, Pos 6
SIDE 3




DRAWING 6, Pos 6
SIDE 4

← Profile "left end" is always at the bottom of the drawing. All dimensions are from "left".


Profile machining details

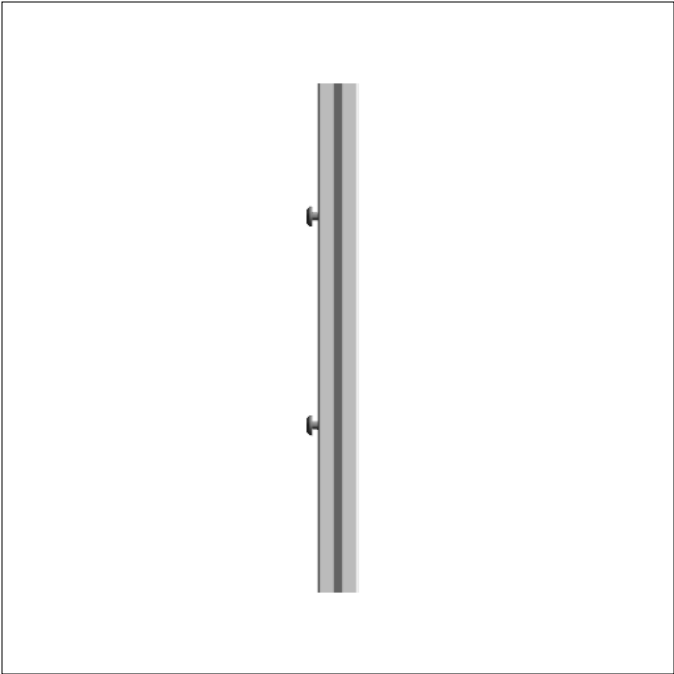


**DRAWING 7, Pos 7
SIDE 1, bar length: 500.0 mm**

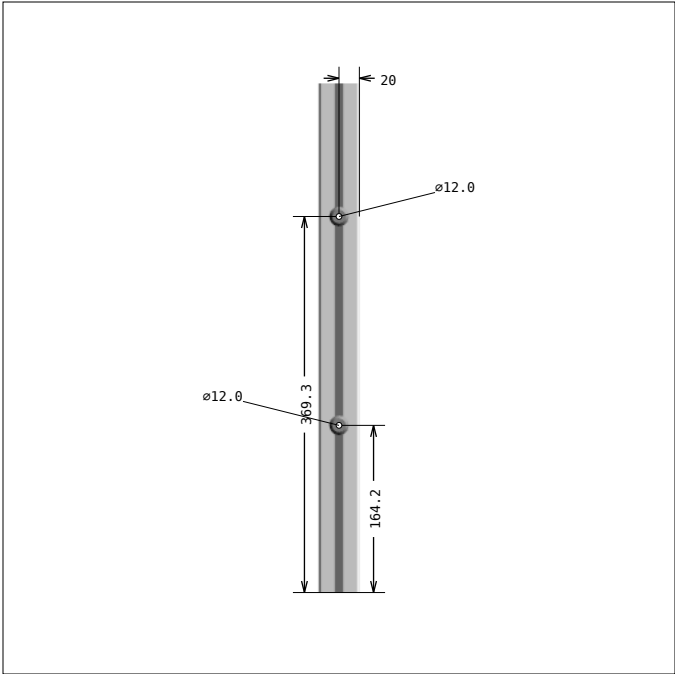

**DRAWING 7, Pos 7
SIDE 2**

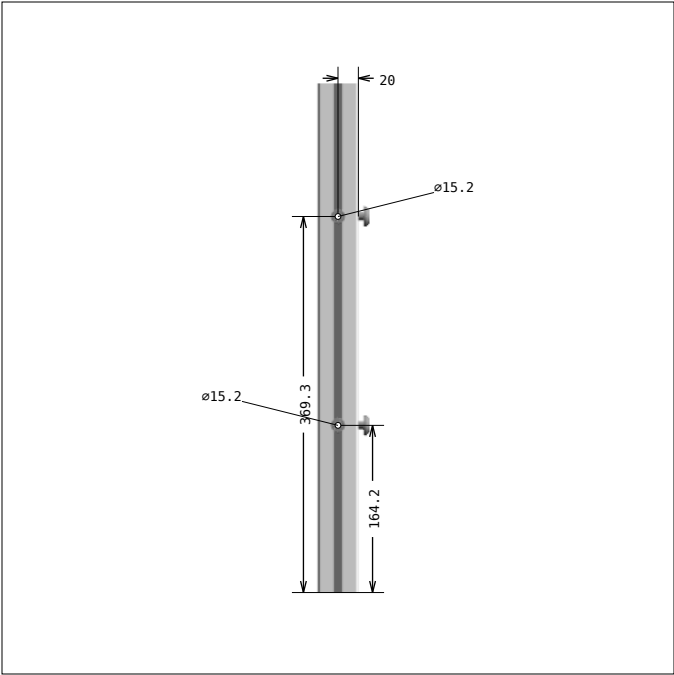

**DRAWING 7, Pos 7
SIDE 3**




**DRAWING 7, Pos 7
SIDE 4**

← Profile "left end" is always at the bottom of the drawing. All dimensions are from "left".


Profile machining details




DRAWING 8, Pos 8
SIDE 1, bar length: 500.0 mm

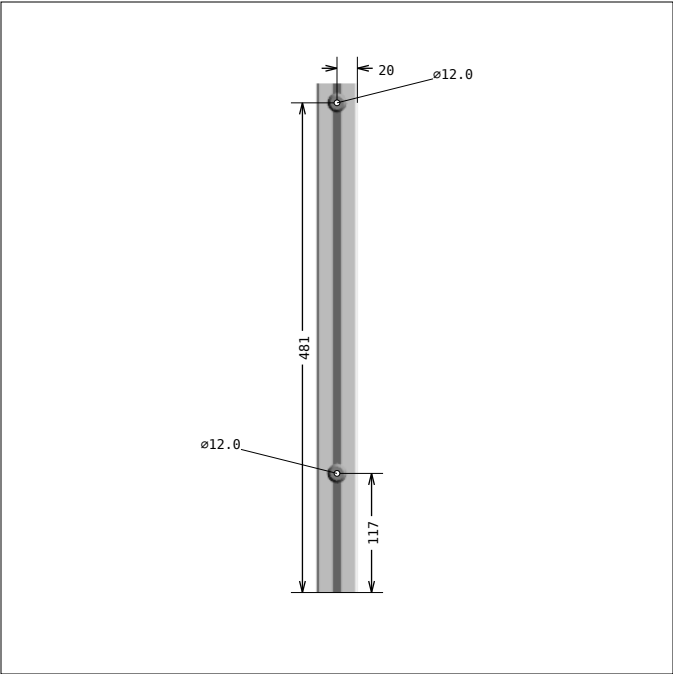

DRAWING 8, Pos 8
SIDE 2

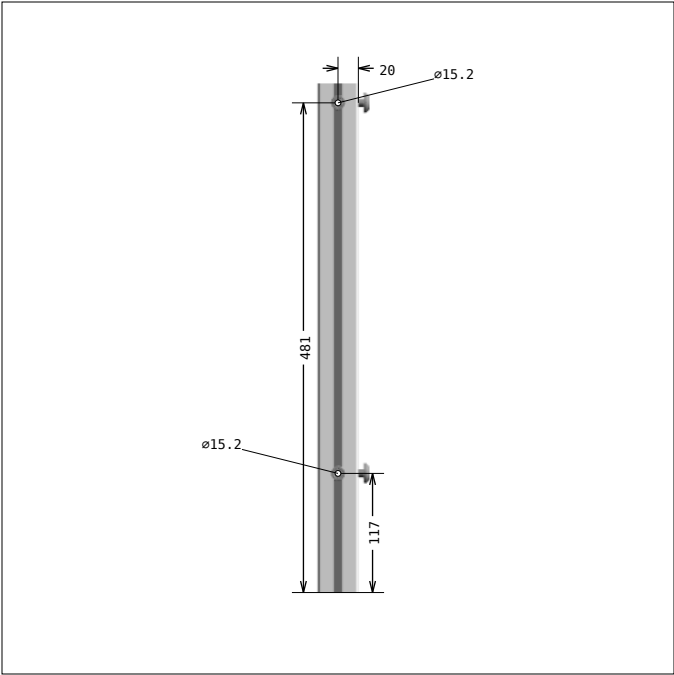

DRAWING 8, Pos 8
SIDE 3




DRAWING 8, Pos 8
SIDE 4

← Profile "left end" is always at the bottom of the drawing. All dimensions are from "left".


Profile machining details




DRAWING 9, Pos 9
SIDE 1, bar length: 500.0 mm

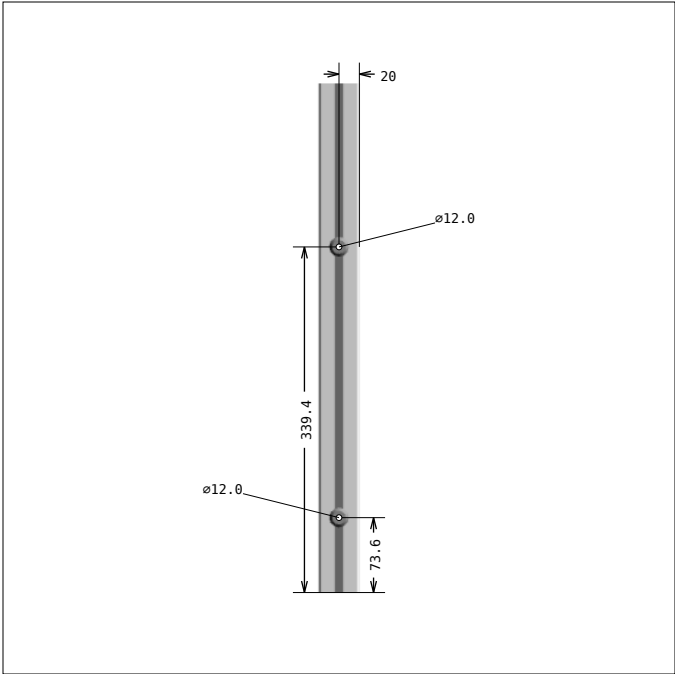

DRAWING 9, Pos 9
SIDE 2

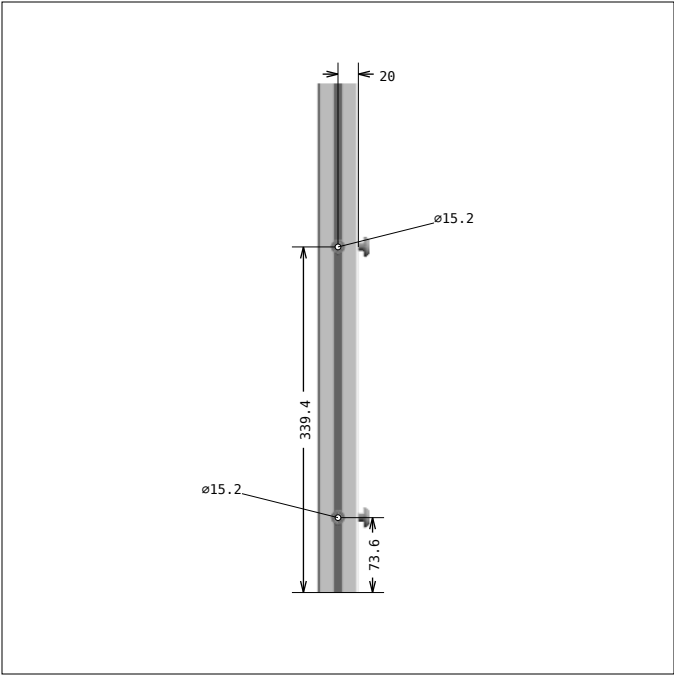


DRAWING 9, Pos 9
SIDE 3




DRAWING 9, Pos 9
SIDE 4

← Profile "left end" is always at the bottom of the drawing. All dimensions are from "left".


Profile machining details

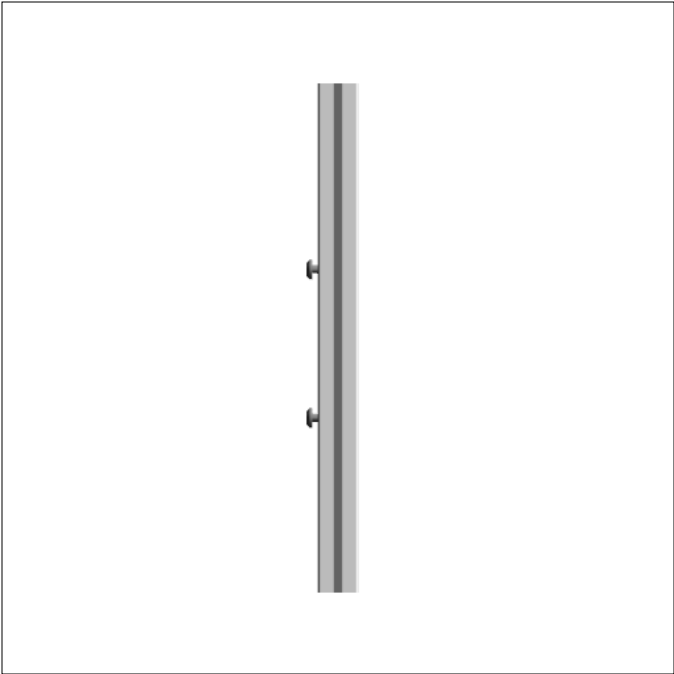


DRAWING 10, Pos 10
SIDE 1, bar length: 500.0 mm

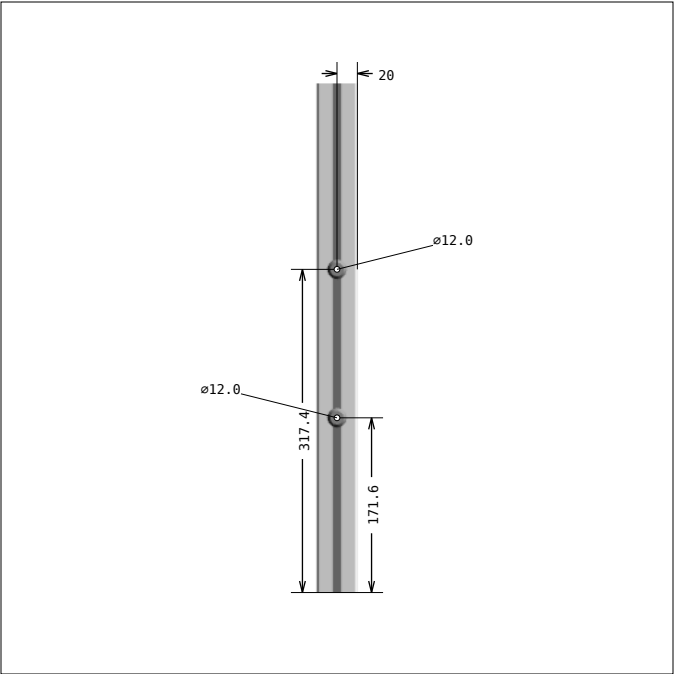

DRAWING 10, Pos 10
SIDE 2

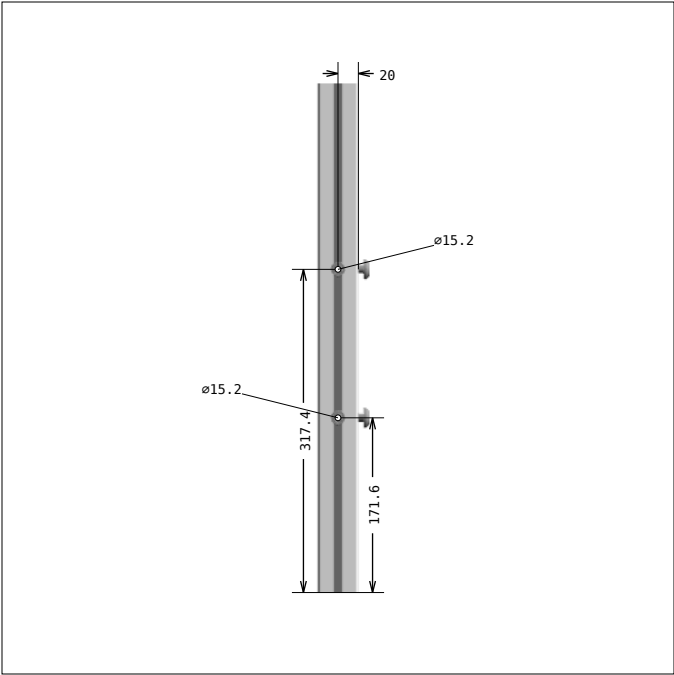

DRAWING 10, Pos 10
SIDE 3







DRAWING 10, Pos 10
SIDE 4

← Profile "left end" is always at the bottom of the drawing. All dimensions are from "left".

Suggested profile cuts (incl. kerf: 3.5 mm)

Article-No	Cuts	Waste (mm)
1.11.040040.43LP		
11 10 8 9 7 6 5 2 1 11 11 500.0500.0500.0500.0500.0500.0500.0500.0500.0500.0		
		461.5 mm
10 4 9 3 10 8 9 7 6 5 11 500.0500.0500.0500.0500.0500.0500.0500.0500.0		
		461.5 mm
11 11 500.0500.0		
		4993.0 mm

Assembly hints

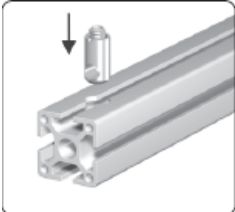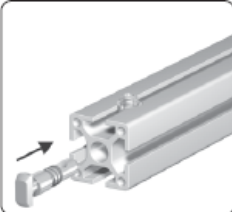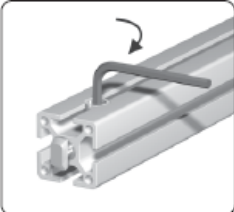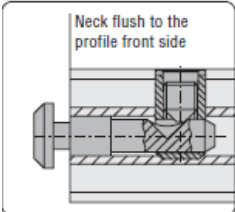ACCESSORY	1.21.4E5	Connector, parallel-square	
 Insert the cross bushing  Push in the anchor  Pretension the anchor  Neck flush to the profile front side Comments For the optimal assembly of the profiles the connector is to be installed in such a way that the neck is flush to the profile front side <td> Most MayTec connectors follow these assembly steps. Tightening torque is: 5-15 Nm for 20mm profiles, 30 Nm for 30mm group, 35 Nm for 40mm and larger profiles. </td>			Most MayTec connectors follow these assembly steps. Tightening torque is: 5-15 Nm for 20mm profiles, 30 Nm for 30mm group, 35 Nm for 40mm and larger profiles.