Inspection Report

PART PASSES — 1 of 1 hole(s) passed · 0 of 12 points outside ±0.5 mm

Rule: a hole fails if any one of its points is outside the tolerance.

STEP model	taper test .STEP
View / work zero	Back
Probe log	5-11-taper_2026-11-05_14-23-35.log
Expected points	5-11-taper_schema.json
Tolerance	±0.5 mm
Tip compensation	r X 0.519 / Y 0.164 mm
Pretravel model	along the probing direction (sloped walls)
Report created	2026-11-10 10:15
Z offset estimate	+1.027 mm (only if the hole is CAD size)

⚠ X / Y tip: calibration date unknown — re-run Set up if the probe was remounted

⚠ Tilt / Z lean / rotation NOT corrected — not measured in Set up since the app started

Hole	Result	Points failed	Max |dev| (mm)	Layers	Roundness max	Deepest point (mm)
1	**PASS**	0 / 12	0.491	3	0.012 (98%)	≥ 16.26 (CAD 20.00)

Roundness = max − min radius about the least-squares circle (mm). Margin = 100 × (1 − roundness / tolerance), worst layer. Deepest point: sphere fit of the measured wall (spherical holes) or the floor touch; '≥' = deepest probed layer when the floor cannot be reached from the walls.

Hole 1 — points

PASS — 12 of 12 points within ±0.5 mm · max |dev| 0.491 mm


Layer	#	Dir	CAD point x, y, z (mm)	Measured x, y, z (mm)	Dev (mm)	Result
1	0	Y−	0.000, -9.591, -6.259	0.003, -9.331, -6.259	-0.251	PASS
1	1	X−	-9.591, 0.000, -6.259	-9.214, 0.000, -6.259	-0.364	PASS
1	2	Y+	0.000, 9.591, -6.259	0.003, 9.343, -6.259	-0.239	PASS
1	3	X+	9.591, 0.000, -6.259	9.470, -0.000, -6.259	-0.117	PASS
2	0	Y−	0.000, -8.251, -11.259	0.003, -7.950, -11.259	-0.290	PASS
2	1	X−	-8.251, 0.000, -11.259	-7.815, 0.000, -11.259	-0.421	PASS
2	2	Y+	0.000, 8.251, -11.259	0.003, 7.993, -11.259	-0.249	PASS
2	3	X+	8.251, 0.000, -11.259	8.108, -0.000, -11.259	-0.138	PASS
3	0	Y−	0.000, -6.911, -16.259	0.003, -6.599, -16.259	-0.301	PASS
3	1	X−	-6.911, 0.000, -16.259	-6.403, 0.000, -16.259	-0.491	PASS
3	2	Y+	0.000, 6.911, -16.259	0.003, 6.636, -16.259	-0.266	PASS
3	3	X+	6.911, 0.000, -16.259	6.847, -0.000, -16.259	-0.062	PASS

Dev = signed distance along the surface normal: − = material where the hole should be (hole small), + = material missing (hole large).


Hole 1 — top-down section of each layer

Grey = CAD section at the layer depth · dotted = CAD wall circle · small grey dot = CAD point
big dot = measured point, arrow = its offset from the CAD point in this plane × 5 (green pass / red fail)
dashed = measured circle × 5 · label = point #: dev along the surface normal (mm)

Hole 1 · Layer 1 · z -6.26 · PASS
roundness 0.004 mm · margin 99%

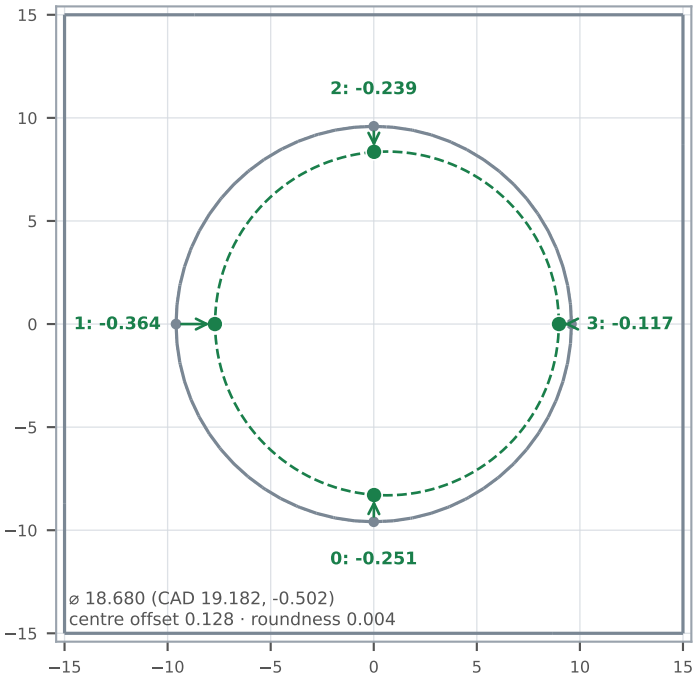

Hole 1 · Layer 2 · z -11.26 · PASS
roundness 0.012 mm · margin 98%

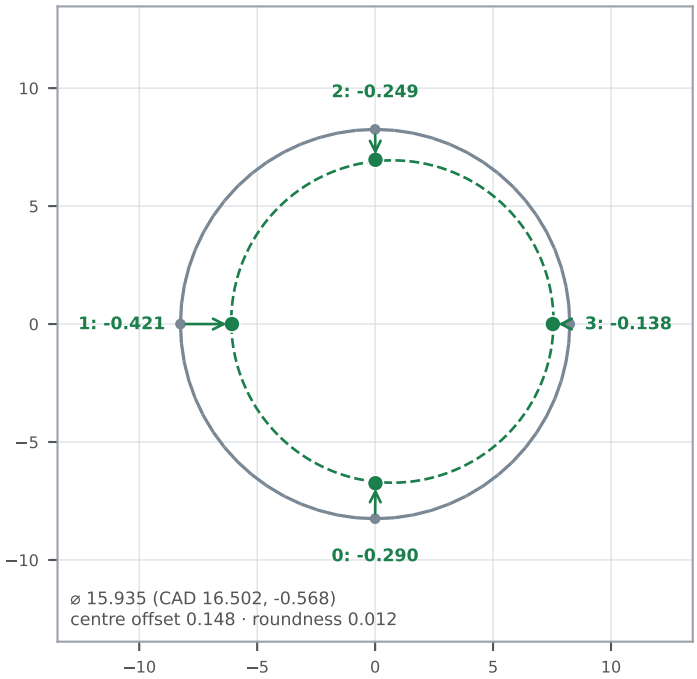

Hole 1 · Layer 3 · z -16.26 · PASS
roundness 0.003 mm · margin 99%

